

plandescil
consulting engineers
Telephone: (01953) 452001 / Fax: (01953) 456955

APPENDIX 1

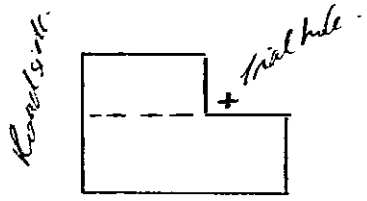

location plan.

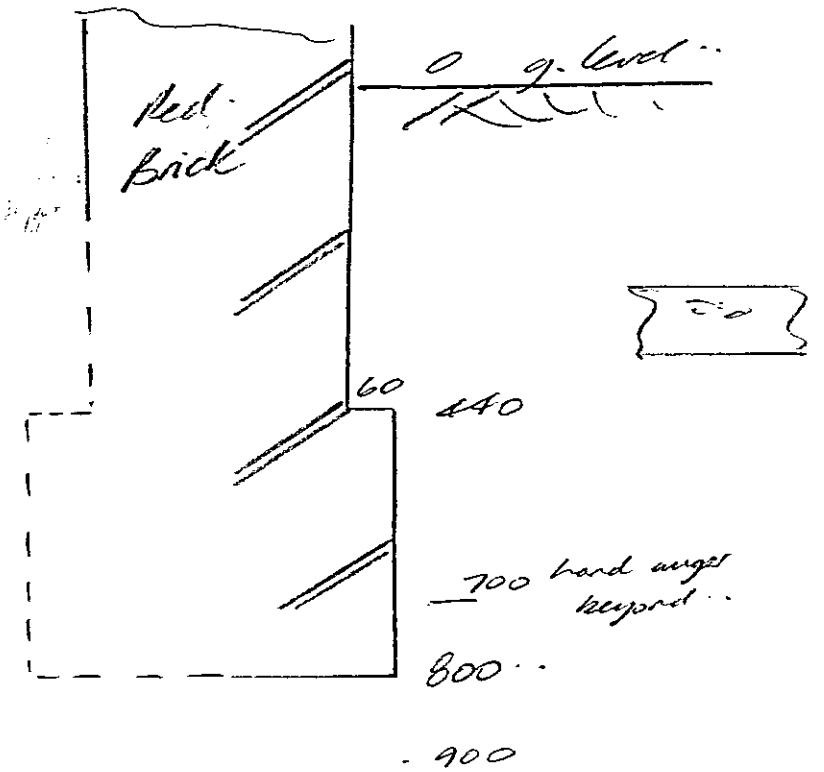

Gravel

Concrete slab. (broken thru)

Brown silt with brick fragment

Beyond wall base brown silts with stone content. Unable to retrieve core as fell through auger.

TRIAL HOLE on WALL BASE.

Note:

Gravel at high level over concrete slab. Tended to fall into hole as excavation proceeded. Augering tended to 'catch' side of brick footing and obviates infill at higher level. Entirely 'clean' virgin subsoil was not noted prior to core retrieval proving impossible. SLC borehole 3 just to north showed natural clayey silt beyond 550mm.

Job No: 10242