GeoShield Verification Report 24

PROJECT REFERENCE: GEO102862

PROJECT: Persimmon Homes Site

PROJECT ADDRESS: 150-158 High Road

Weston, Spalding

PE12 6WA

SPECIFICATION: Verified in accordance CIRIA 735.

Design in accordance with BS8485 2015 + 2019 for Methane and Carbon Dioxide.

Substrate prepared in-accordance with manufactures instructions

Visqueen Standard Gas Barrier

Visqueen GRSAM

Visqueen Preformed Top Hats.

GeoShield Verification Report

NAME OF SURVEYOR: Lee Adams

VERIFICATION COMPANY: GeoShield Limited

Icon Business Centre

4100 Park Approach

Thorpe Park

Leeds

CONTACT NUMBER: 07795 994117

EMAIL ADDRESS: ladams@geoshield.co.uk

ORDER NUMBER: To be confirmed

PER VISIT:	YES:	✔	NO:		PROJECT:	YES:	✔	NO:	

GeoShield Verification Report

CLIENT DETAILS

CLIENT CONTACT:	Andy Collins
CONTACTS ROLE:	Prestige Air Director
MOBILE PHONE:	07780 223116
EMAIL ADDRESS:	Andy@prestigeair.com

CLIENT CONTACT:	
CONTACTS ROLE:	
MOBILE PHONE:	
EMAIL ADDRESS	
NOTES:	

GeoShield Verification Report

APPLICATOR'S DETAILS

APPLICATOR NAME:	Ben
COMPANY:	Prestige Air Technology Ltd
APPLICATOR TEL:	
APPLICATOR EMAIL:	

APPLICATOR NAME:	
COMPANY:	Prestige Air Technology Ltd
APPLICATOR TEL:	
APPLICATOR EMAIL:	

NOTES: The installers from Prestige Air are competent & experienced installers in the installation of ground gas and waterproofing systems. At least 1 person holds the NVQ level 2 qualifications in the installation of gas membranes.

GeoShield Verification Report

AREA SURVEYED:

Plots 76, 77, 78 & 79
Outstanding Remediations Completed on Plot 80

SITE CONDITIONS:

WEATHER:

Cloudy

TEMPERATURE:

11ºc

RELATIVE HUMIDITY:

N/A

MEMBRANE TEMPERATURE:

N/A

TIME: 12:30 - 13:30

DATE: 06.11.2024

REPORT NUMBER: 024

ACCOMPANIED BY:

GeoShield Verification Report

Verification Layout



The photograph above shows a plan layout of the site. The area highlighted in blue shows plots 76, 77, 78, 79 and 80 (outstanding remediations were completed) where the verification inspection took place on site today.

GeoShield Verification Report


OVERVIEW



The photograph above displays an overview of plots 76 & 77 where today's verification inspection took place on site.

GeoShield Verification Report

OVERVIEW

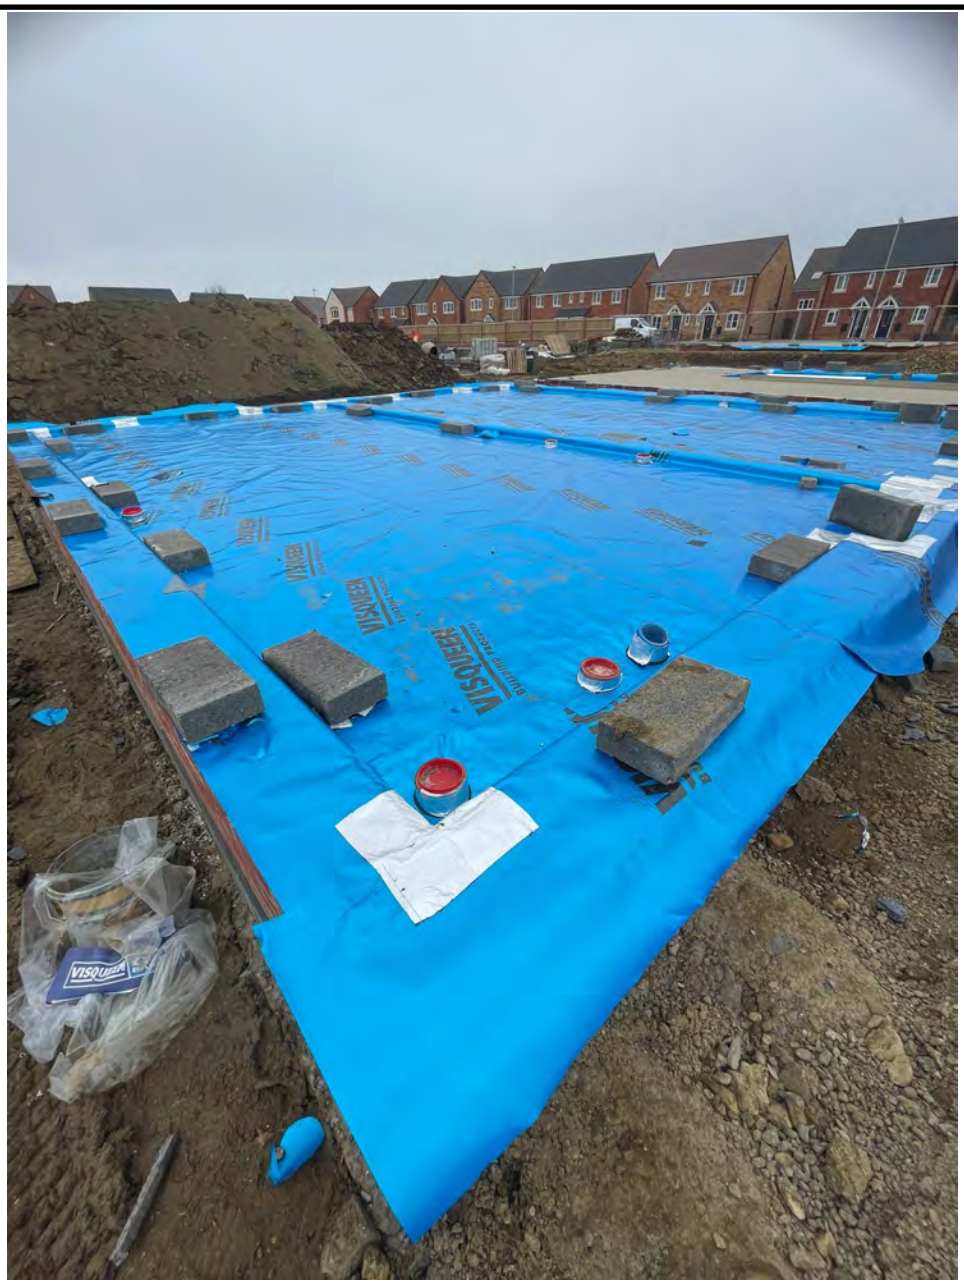

The photograph above displays an overview of plots 78 & 79 where today's verification inspection took place on site.

GeoShield Verification Report

OVERVIEW



The photograph above displays an overview of plot 80 where today's verification inspection took place on site.

GeoShield Verification Report

VERIFICATION ITEM ONE

LOCATION/GRID LINE: Plot 80

Outstanding Remediations





NOTES:

Within plot 80 there was an outstanding remediation on the garage area which hadn't been sealed on the previous visit. This was due to the builders not having enough insulation for the garage cavity walls.

NOTES:

This has then been sealed and verified during today's visit. No faults or defects were identified during today's testing procedures. Installed in accordance with manufacturer's specifications and design guidelines.


GeoShield Verification Report

VERIFICATION ITEM TWO

LOCATION/GRID LINE: Plots 76, 77, 78 & 79

Installation of Visqueen Standard Gas Barrier



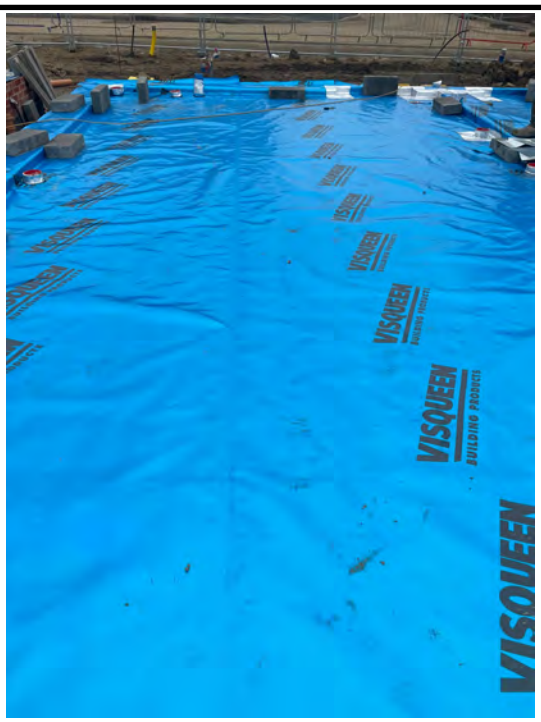

NOTES:

A complete line out of the Visqueen Standard Gas Barrier has been installed across the footprint of Plots Plots 76, 77, 78 & 79. The Visqueen Standard Gas Barrier has been lined out across the entirety of the house plots, taken over the internal party walls and external cavities to

NOTES:

ensure continuity throughout. All lap joints between the adjacent sheets of Visqueen Standard Gas Barrier have been heat welded using a hot air leister and a silicone roller with adequate pressure applied to ensure a continuous weld is achieved.

GeoShield Verification Report

VERIFICATION ITEM TWO




The above photograph displays a mechanical point stress test, also known as a pick and probe test, being conducted upon a welded lap joint of the Visqueen Standard Gas Barrier. All lap joints were subjected to thorough mechanical point stress testing and non destructive air lance integrity testing throughout the installation. One miswelded lap joint was identified at the time of the inspection, this was successfully remediated.

VERIFICATION ITEM ONE

REMEDIATIONS:

Fault Identified

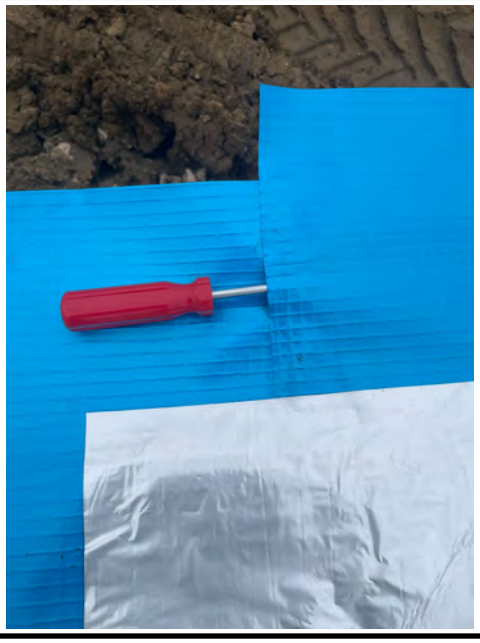

NOTES:

As mentioned, one miswelded lap joint was identified during the testing procedures conducted today. The fault was brought to the attention of the installers and remediated on site in the presence of GeoShield.



NOTES:

The fault was remediated by applying 150mm patches of Visqueen GR SAM over the affected areas with heat and rolled pressure applied to activate the bitumen backing. No further faults or defects were identified during the testing of the lap joints.

GeoShield Verification Report

VERIFICATION ITEM THREE

LOCATION/GRID LINE: Plots 76, 77, 78 & 79

Pipe Penetrations



NOTES:

Throughout the complete line out installation of the Visqueen Standard Gas Barrier to the referenced plots, there were a number of pipe penetrations that have been sealed in accordance with manufacturer's specifications and design guidelines. This has been achieved using preformed top hats as well as strips of



NOTES:

Visqueen GR SAM. The installers have first cut the Visqueen Standard Gas Barrier tight around the base of each pipe penetration to minimise voided areas. Next, the preformed top hat is placed over the pipe penetration and welded to the existing Visqueen Standard Gas Barrier. Strips of Visqueen GRSAM are then

GeoShield Verification Report

VERIFICATION ITEM THREE



adhered to the cloak of the pipe using heat and firm rolled pressure to aid in the adhesion, creating a secure bond between the pipe penetration and the Visqueen Standard Gas Barrier. Thorough non destructive air lance integrity tested was conducted upon the welded joints around the preformed top hat, along with mechanical point stress testing being conducted upon the cloak of the pipes. No faults or defects were identified.

GeoShield Verification Report

VERIFICATION ITEM FOUR

LOCATION/GRID LINE: Plots 76, 77, 78 & 79

Corners and Thresholds





NOTES:

A number of corners and thresholds throughout the referenced plots have also been sealed correctly using Visqueen GRSAM. Where the Visqueen Standard Gas Barrier has been cut to minimise voided areas and gaps across the footprint of the plot, each corner and threshold junction has been

NOTES:

reinforced by heating strips of Visqueen GRSAM and placed into position around each corner and threshold, onto the Visqueen Standard Gas Barrier. Firm rolled pressure is applied with a silicone roller to aid in the adhesion ensuring the Visqueen GRSAM has fully bonded.

GeoShield Verification Report

VERIFICATION ITEM FOUR



A probe was run along all edges of the Visqueen GRSAM within the corner & threshold detailing to validate that a gas tight seal had been achieved throughout. No faults or defects were identified with the corners and thresholds during the testing procedures. Tested and verified in accordance with CIRIA 735.

ADDITIONAL PHOTOGRAPHS



Sealed corner and pipe penetrations.



A pick and probe test being conducted upon a welded lap joint.



Visqueen Standard Gas Barrier was used on today's visit.



A pick and probe test being conducted upon a sealed corner details.

ADDITIONAL PHOTOGRAPHS



An installer using a patch of Visqueen GR SAM to seal the one fault identified.



A sealed corner and pipe penetration.



A sealed corner detail.



Sealed corner details.

AIR LANCE INTEGRITY TESTING

AIR LANCE TEST: ASTM D4437-08:2013 Inspects all seams for unbonded areas using a 4.8mm air nozzle held not more than 51mm away from the seam. 50 Psi is the minimum requirement. The air nozzle is directed on the upper edge seam, riffles indicate a unbonded seam. Each seam is numbered and failure marked with a F/1 F/2 classification and a description given



Air lance test on a pipe penetration.



Air lance test on a welded lap joint.



Air lance test on a welded lap joint.



Air lance test on a welded lap joint.

GEOSHIELD Verification Report

REMEDIATION LOG

Date	Nr	Remediation Description	Y/N
23/07/2022	001	No faults or defects identified during today's verification inspection.	✔
03/08/2022	002	Two punctures to plot 12 - remediated during verification visit.	✔
		One small mis-weld to lap joint at plot 9 - remediated during	✔
		verification visit	✔
02/09/2022	003	No faults or defects identified	✔
21/09/2022	004	No faults or defects identified during today's verification inspection.	✔
04/10/2022	005	Several holes identified. Remediated on-site.	✔
26/10/2922	006	No faults identified during this verification visit.	✔
01/11/2022	007	No faults identified during this verification visit.	✔
12/12/2022	008	One fault located to a welded lap, this was remediated on site.	✔
07/02/2023	009	X3 faults identified. Remediated on-site.	✔
24/04/2023	010	Two punctures/damage identified and remediated during the	✔
		verification visit.	✔
		Two mis-welded Lap Joints identified but remediated during the	✔
		verification visit.	✔

GEOSHIELD Verification Report

REMEDIATION LOG

Date	Nr	Remediation Description	Y/N
17/05/2023	011	No faults were identified during the verification process.	✔
15/09/2023	012	Seven miswelded lap joints identified and remediated on-site	✔
05/10/2023	013	No faults or defects identified during this visit.	✔
17/10/2023	014	A total of nine miswelded lap joints were identified, all were	✔
		successfully remediated on site.	✔
29/11/2023	015	There were no issues identified during the verification process	✔
12/12/2023	016	One small misweld identified which was remediated on site.	✔
25/01/2024	017	There were no issues identified during the verification process	✔
04/03/2023	018	There was one mis-welded Visqueen Gas Barrier lap joint which	✔
		was remediated during the verification process.	✔
24/04/2024	019	There were no issues identified during the verification process	✔
15/05/2024	020	Four miswelded lap joints were identified, all were remediated.	✔
20/06/2024	021	Three faults were identified, all were remediated.	✔
08/07/2024	022	No faults or defects were identified during the visit.	✔
30/10/2024	023	1. One fault was identified and remediated on site.	✔

GEOSHIELD Verification Report

REMEDIATION LOG

Date	Nr	Remediation Description	Y/N
		2. Housing plot 80 has an internal garage which is left outstanding	✔
		as the site had ran out of materials. This will be verified at a later	✔
		date.	✔
06/11/2024	024	One fault was identified and remediated on site.	✔

GEOSHIELD Verification Report

GAS MEMBRANE TESTING

VISUAL:	YES	✔	NO		SMOKE TEST:	YES		NO	✔
COMPRESSED AIR:	YES		NO	✔	DILECTIC	YES		NO	✔
DESTRUCTIVE:	YES		NO	✔	OTHER:	YES	✔	NO	
Testing checklist attached:				YES	✔	NO			

Gridline/Plot Sign off

Gridline/Plot Sign off	Full line outs to Plots: 2-3-4-5-6.	✔
Gridline/Plot Sign off	Plots 7,8,9,10,11,12 &13	✔
Gridline/Plot Sign off	Full line outs to Plots: 14,15,16 and 17.	✔
Gridline/Plot Sign off	Full line outs to Plots: 18-19-20-21-22-23.	✔
Gridline/Plot Sign off	Full line out to Plot 24	✔
Gridline/Plot Sign off	Plot 24 integral garage	✔
Gridline/Plot Sign off	Plots 25, 26, 27, 28 & 29.	✔
Gridline/Plot Sign off	Plots 30 &. 31	✔
Gridline/Plot Sign off	Plots 48, 49, 50, 51, 52 & 53.	✔
Gridline/Plot Sign off	Full line outs to Plots: 32,33,42,43,44 & 45.	✔
Gridline/Plot Sign off	Plots: 34,35,36,37,38 & 39 full line outs	✔
Gridline/Plot Sign off	Plots: 40, 41, 46 & 47 full line outs	✔

GeoShield Verification Report

GAS MEMBRANE TESTING

VISUAL /PICK & PROBE:	✔	SMOKE TEST:	
AIR LANCING:		DILECTIC:	
DESTRUCTIVE:		OTHER:	
INERT GAS TEST:		SPECIFY:	

Testing checklist attached: YES ✔ NO

Gridline/Plot Sign off

Gridline/Plot Sign off	Plots 125, 126, 127, 128, 129 & 130 Full Line Out	✔
Gridline/Plot Sign off	Plots 89, 90, 91, 92, 99, 100, 101 & 102 Full Line Out	✔
Gridline/Plot Sign off	Plots 103, 104, 105 & 106 Full Line Out	✔
Gridline/Plot Sign off	Plots - 95,96,97 & 98 Full Line Out	✔
Gridline/Plot Sign off	Plots 93 & 94 Full Line Out	✔
Gridline/Plot Sign off	Plots 88, 107 & 108 Full Line Out	✔
Gridline/Plot Sign off	Plots 84, 85, 86 & 87 Full Line Out	✔
Gridline/Plot Sign off	Plots 109, 110 & 111 Full Line Out	✔
Gridline/Plot Sign off	Plots 112, 116, 117 & 118 - Full Line Out	✔
Gridline/Plot Sign off	Plots 119, 120, 121, 122, 123 & 124 - Full Line Out	✔
Gridline/Plot Sign off	Plots 113, 114 & 115 - Fulll Line Out	✔

GeoShield Verification Report

GAS MEMBRANE TESTING

VISUAL /PICK & PROBE:	✔	SMOKE TEST:	
AIR LANCING:	✔	DILECTIC:	
DESTRUCTIVE:		OTHER:	
INERT GAS TEST:		SPECIFY:	

Testing checklist attached: YES ✔ NO

Gridline/Plot Sign off

Gridline/Plot Sign off	Plots 80, 81, 82 & 83 - Full Line Out	✔
Gridline/Plot Sign off	Plots 76, 77, 78 & 79 - Full Line Out	✔
Gridline/Plot Sign off		
Gridline/Plot Sign off		
Gridline/Plot Sign off		
Gridline/Plot Sign off		
Gridline/Plot Sign off		
Gridline/Plot Sign off		
Gridline/Plot Sign off		
Gridline/Plot Sign off		
Gridline/Plot Sign off		

GeoShield Verification Report

VERIFICATION SUMMARY

This was the 24th visit to the site where verification was required for the complete line out installation of the Visqueen Standard Gas Barrier to Plots 76, 77, 78 & 79.

All overlaps between the adjacent sheets of Visqueen Standard Gas Barrier have been successfully welded using a hot air leister and silicone roller creating continuous welded joints throughout.

All details throughout the installation, such as pipe penetrations, internal and external corners and thresholds have been successfully sealed using Visqueen GRSAM, a self adhesive membrane which has been heated down to aid in the adherence.

Thorough mechanical point stress testing, as well as non destructive air lance integrity testing were conducted throughout the inspection today.
One fault was identified and remediated on site.
The outstanding remediation from plot 80 has now been remediated.
The installation has been conducted to a good NVQ standard and in accordance with manufacturer's specifications.

This was passed and verified in accordance with CIRIA 735 and installed to BS8485:2015+2019.

GEOSHIELD SIGNATURE:



DATE: 06-Nov-2024