






02 ELEVATION A

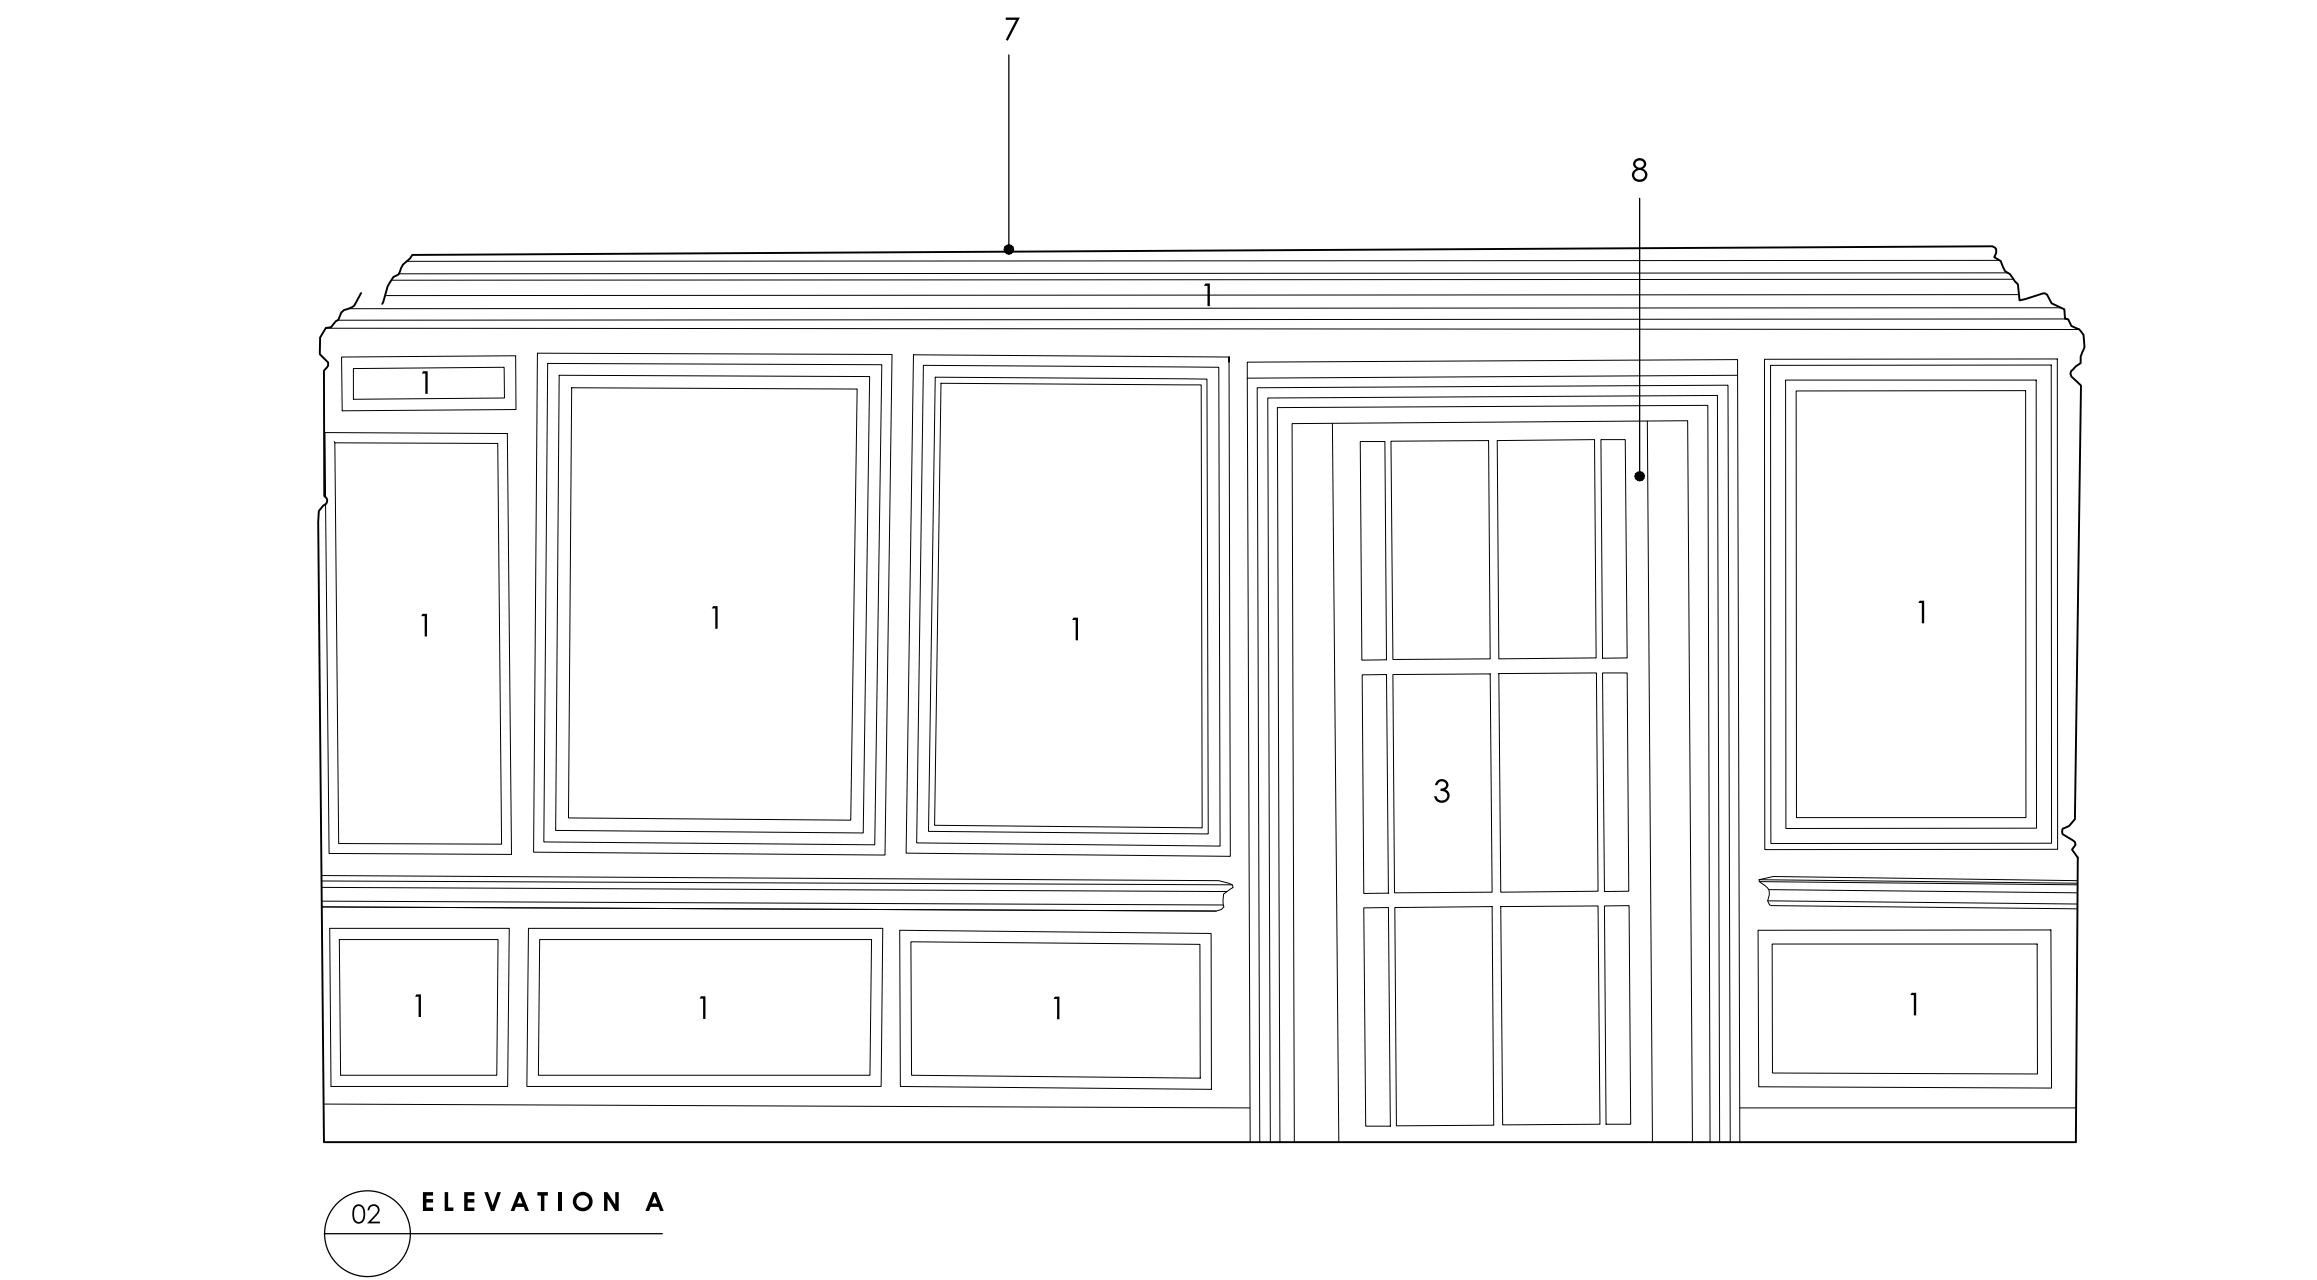


03 ELEVATION B

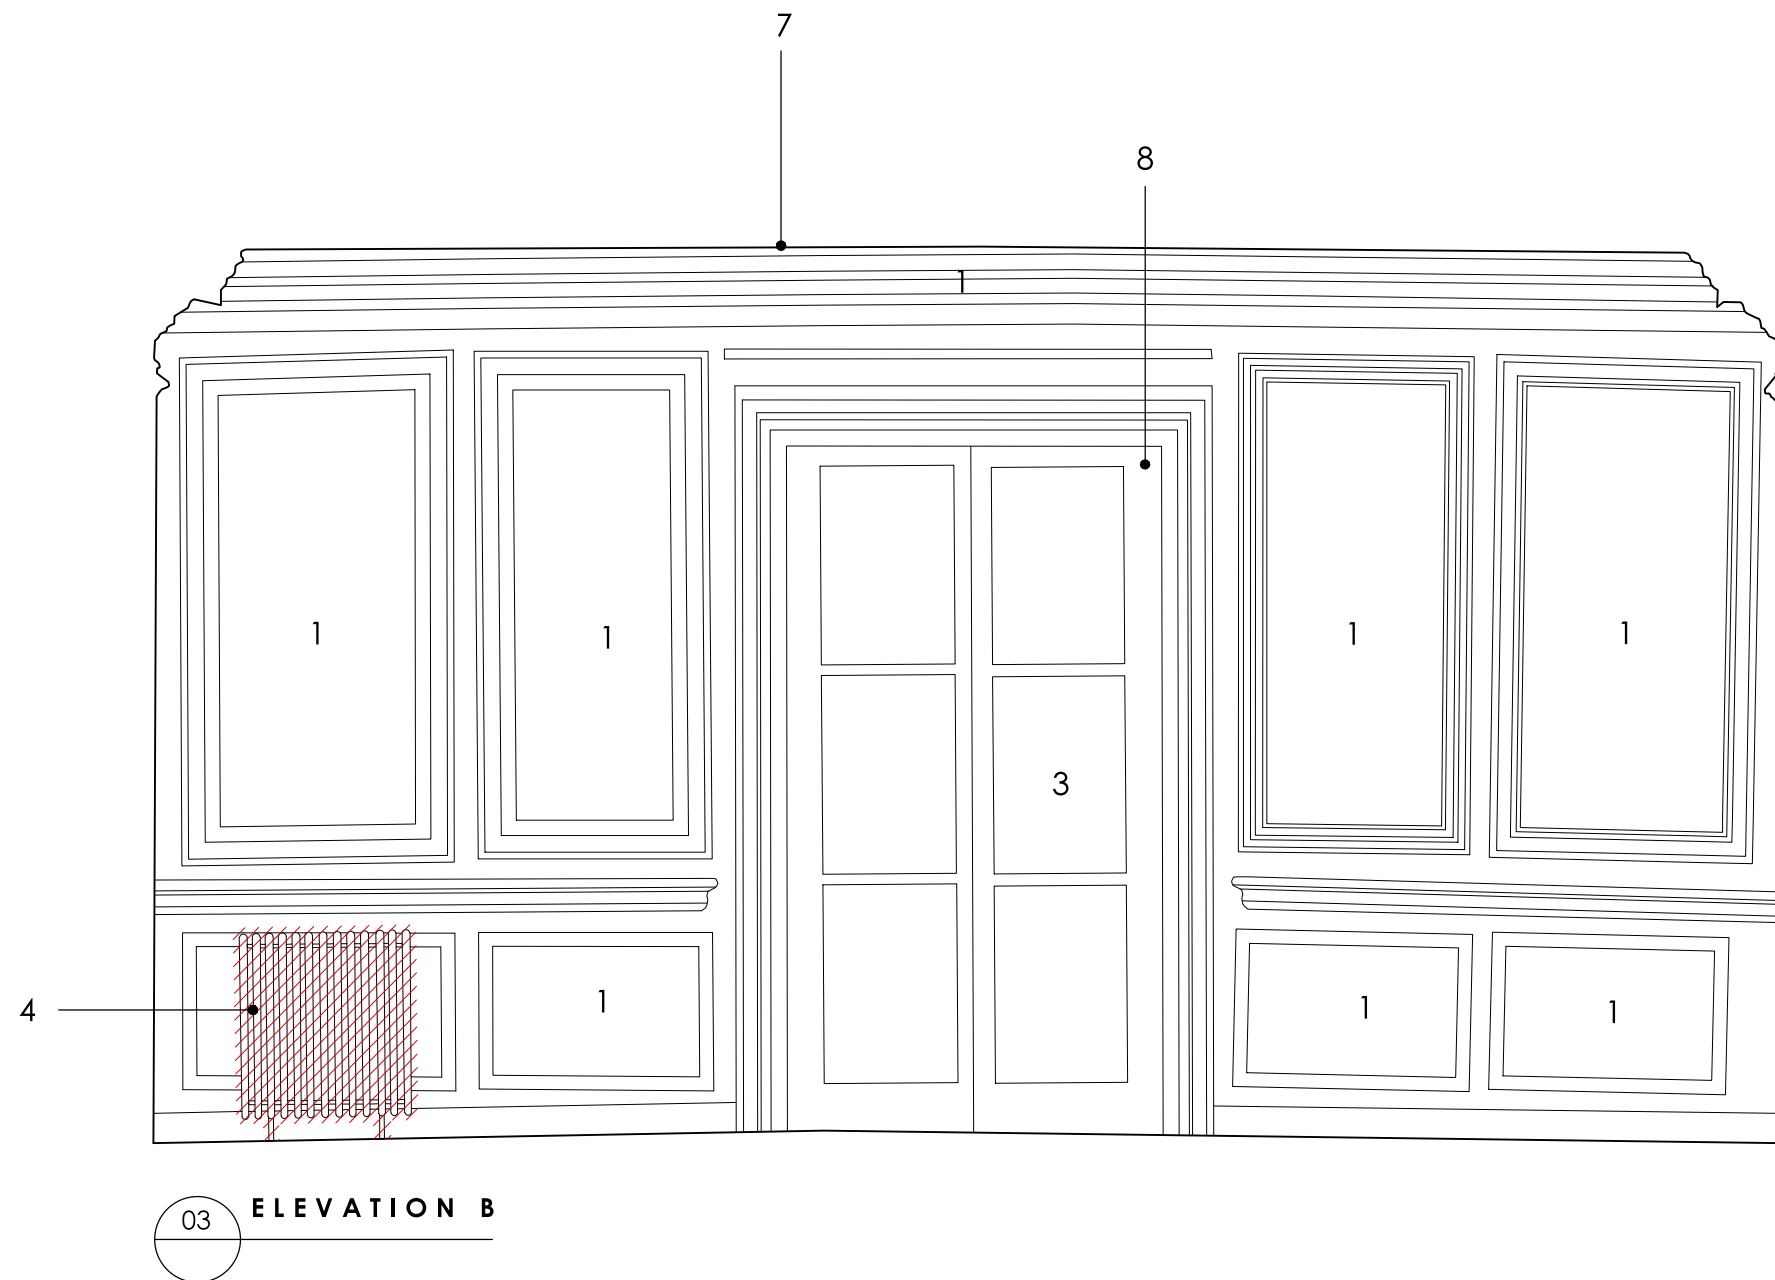

01 P L A N

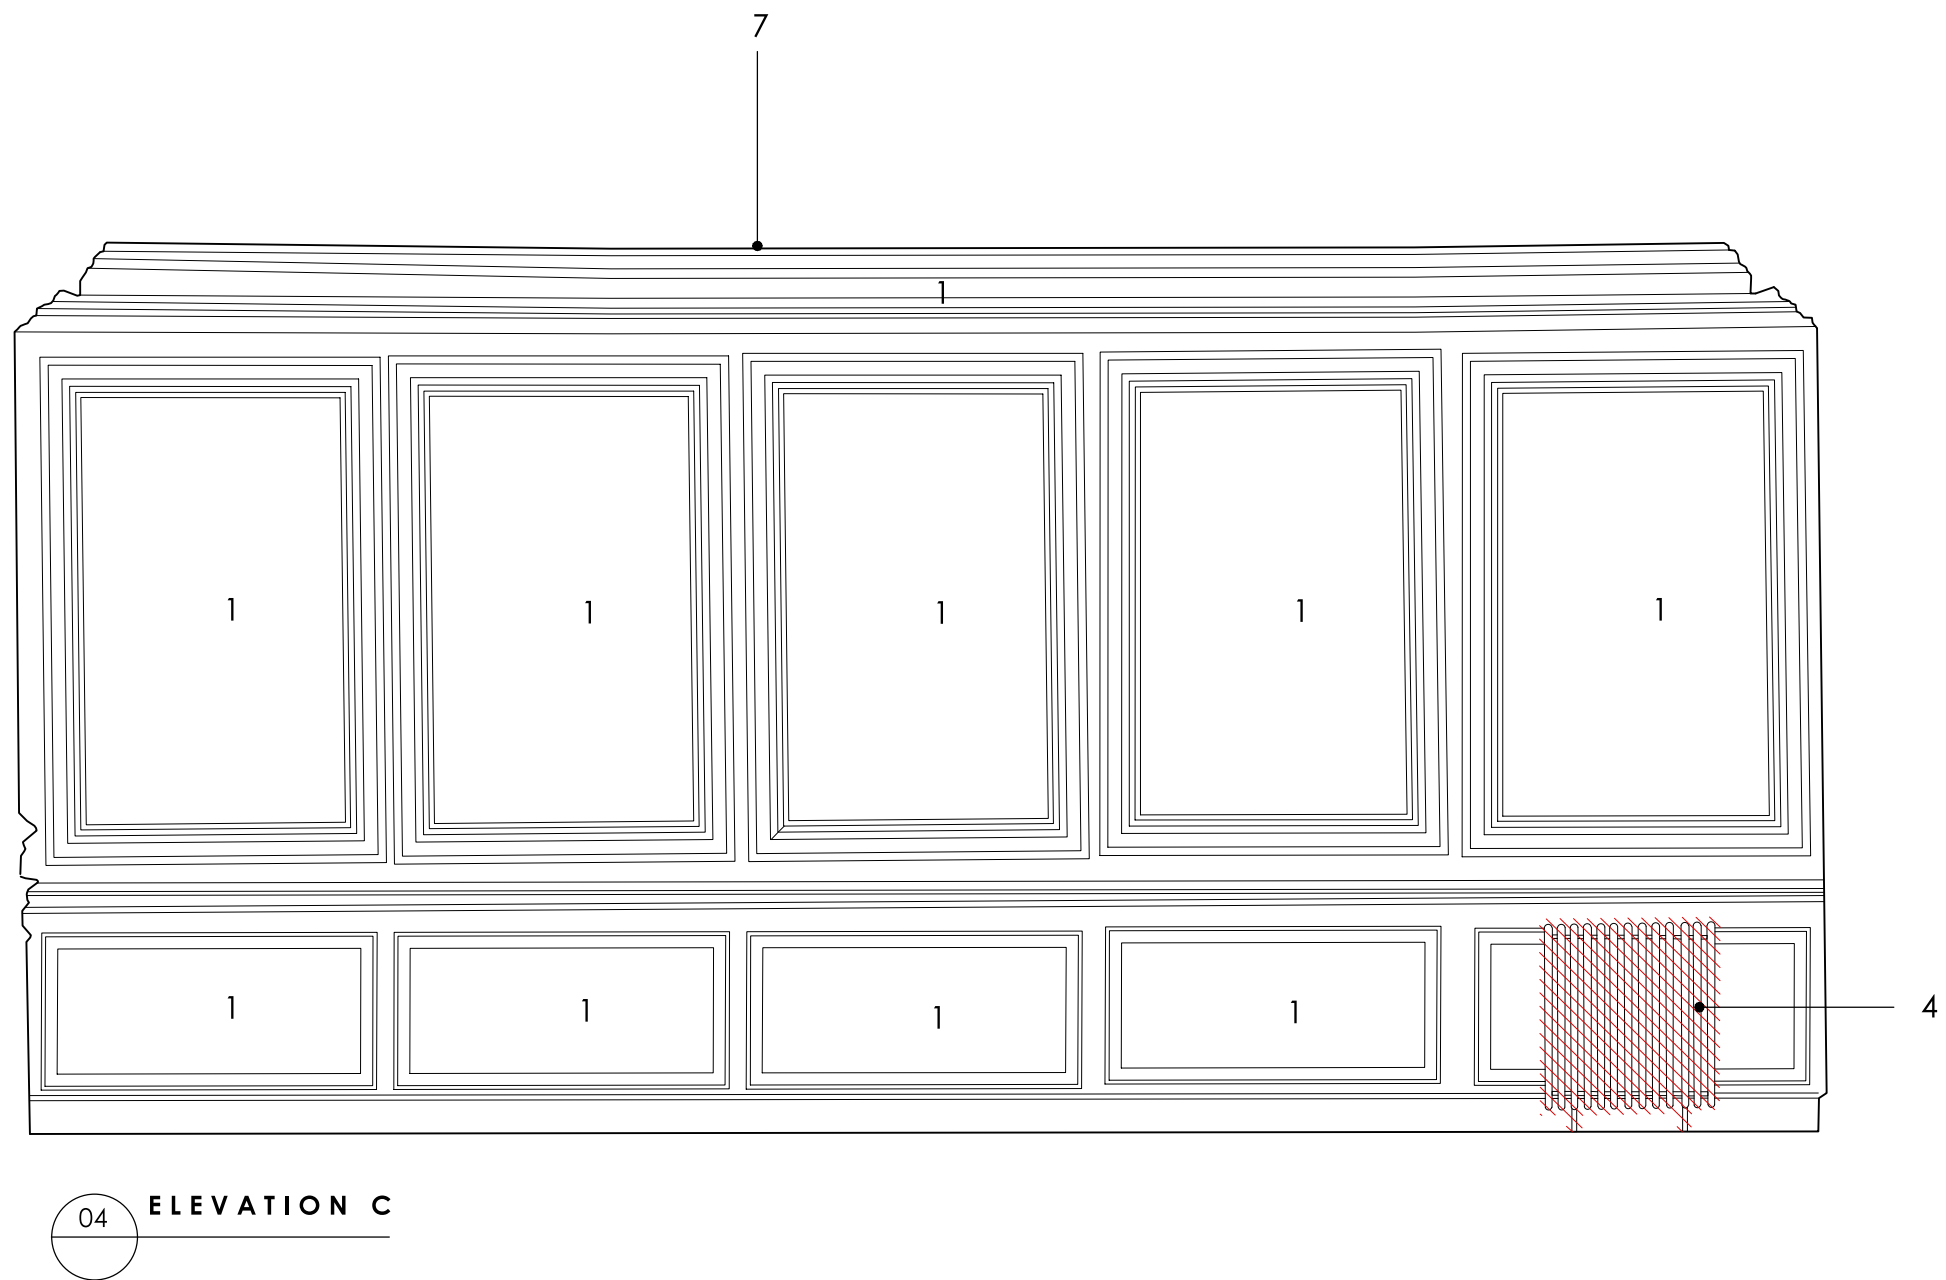

04 ELEVATION C

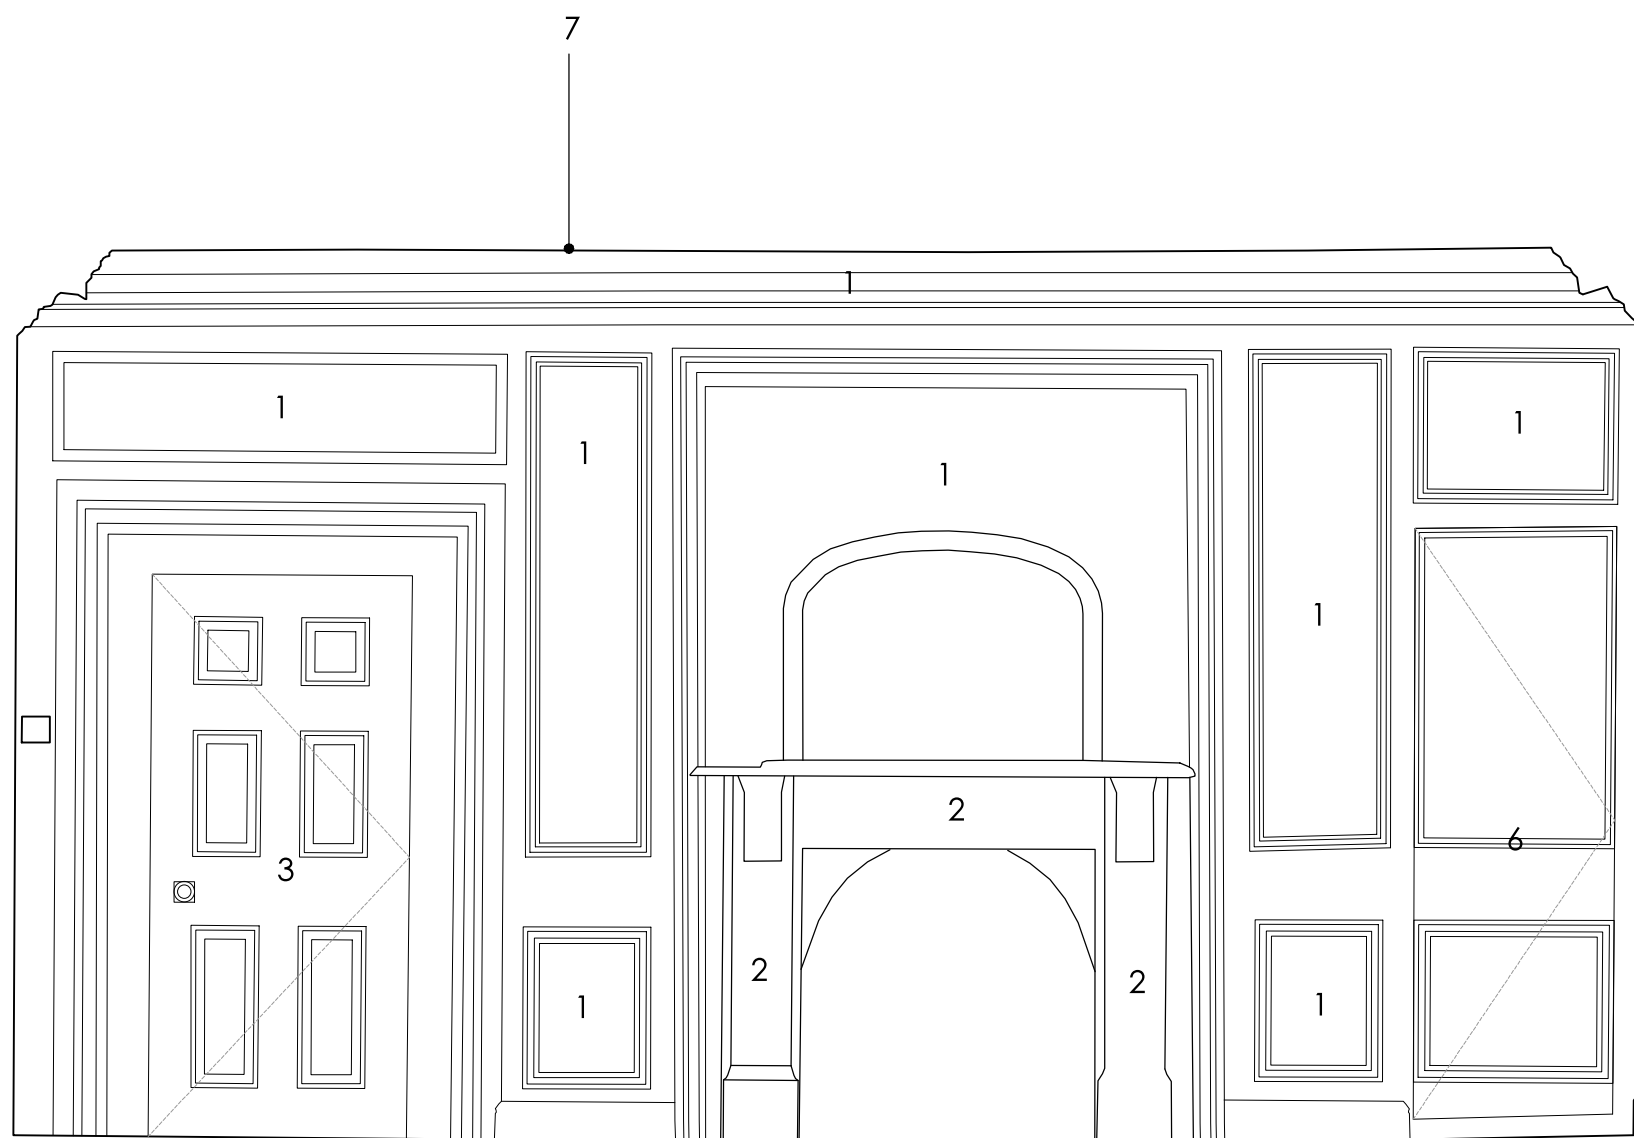

05 ELEVATION D

- Carefully remove existing point repair and make good existing paneling, point finish.
- Existing painted fire surround to be carefully removed, made good and replace with a new stone surround.
- Existing windows and doors to be stripped, repaired and repainted.
- Ironmongery and sliding sash gear to be replaced if damaged.
- Existing radiator to be carefully removed, repaired if salvageable and to be re-used in another room of the house.
- Location to be confirmed.
- Existing carpet to be carefully removed.
Existing timber flooring to be stripped, repaired and refurbished. Under floor heating system to be implemented as per manufacturers instructions. Timber Floor to be re-laid. See CARE Engineers details.
- Existing cupboard to be refurbished, lined with MDF and made good. Paint finish to match paneling.
- Carefully remove existing lining paper on the ceiling, repair and make good existing plaster - using appropriate lime plaster mix, point finish.
- Secondary glazing to be fitted internally for thermal efficiency.

Note: Remedial works as per CARE Engineers drawings.

Issued for Planning	11.01.2023	01
Issued for Information	16.11.2022	01
Issued for Information	30.09.2021	00
Issue - Amendment	Date	Rev

Project Wykes Manor, Wykes Ln, Donington, Spalding, PE11 4SD

JONATHAN HENDRY ARCHITECTS LTD
10 Nickerson Way
Peasefields Business Park
Hullunder Clay
Uncolnshire
DN33 3J5

T: 01522458100
W: www.jonathanhendryarchitects.com

Subject Proposed Internal Elevations - RM.01

Scale 1:25 Date 30.09.2021

Original Size A1

Drawing No. GA_RM.01.01