



- Carefully remove existing wallpaper and dado, repair wall using appropriate lime plaster mix, paint finish.
- Existing skirting board to be carefully removed, stripped, repaired and re-laid.
- Existing doors and windows above to be stripped, repaired and repainted.
- Ironmongery to be replaced if damaged and unsalvageable.
- Proposed door with glass pane and 2 panel. Architrave to match style of existing. Paint finish.
- Proposed window pane above new door similar to existing doors. Frame, paint finish.
- Existing radiator to be carefully removed and replaced. Wall to be repaired.
- Carefully strip wall to widen opening by 400mm, re-plaster and make good of opening. Paint finish. See CARE Engineers details.
- Existing tiled floor to be carefully, cleaned and repaired.
- Existing door to be carefully removed door to be stripped, repaired, repainted and retained. To be re-used within new stud wall. Ref. RM_06.
- Stone step leading into RM_03 to be retained.
- Ceiling to be carefully repaired and re-painted.

Note: Remedial works as per CARE Engineers drawings.


7. Doorway to be widened by 400mm on both sides to open up the hallway accessing the stairway - timber joinery to be removed and made good.
- See CARE Engineers details.

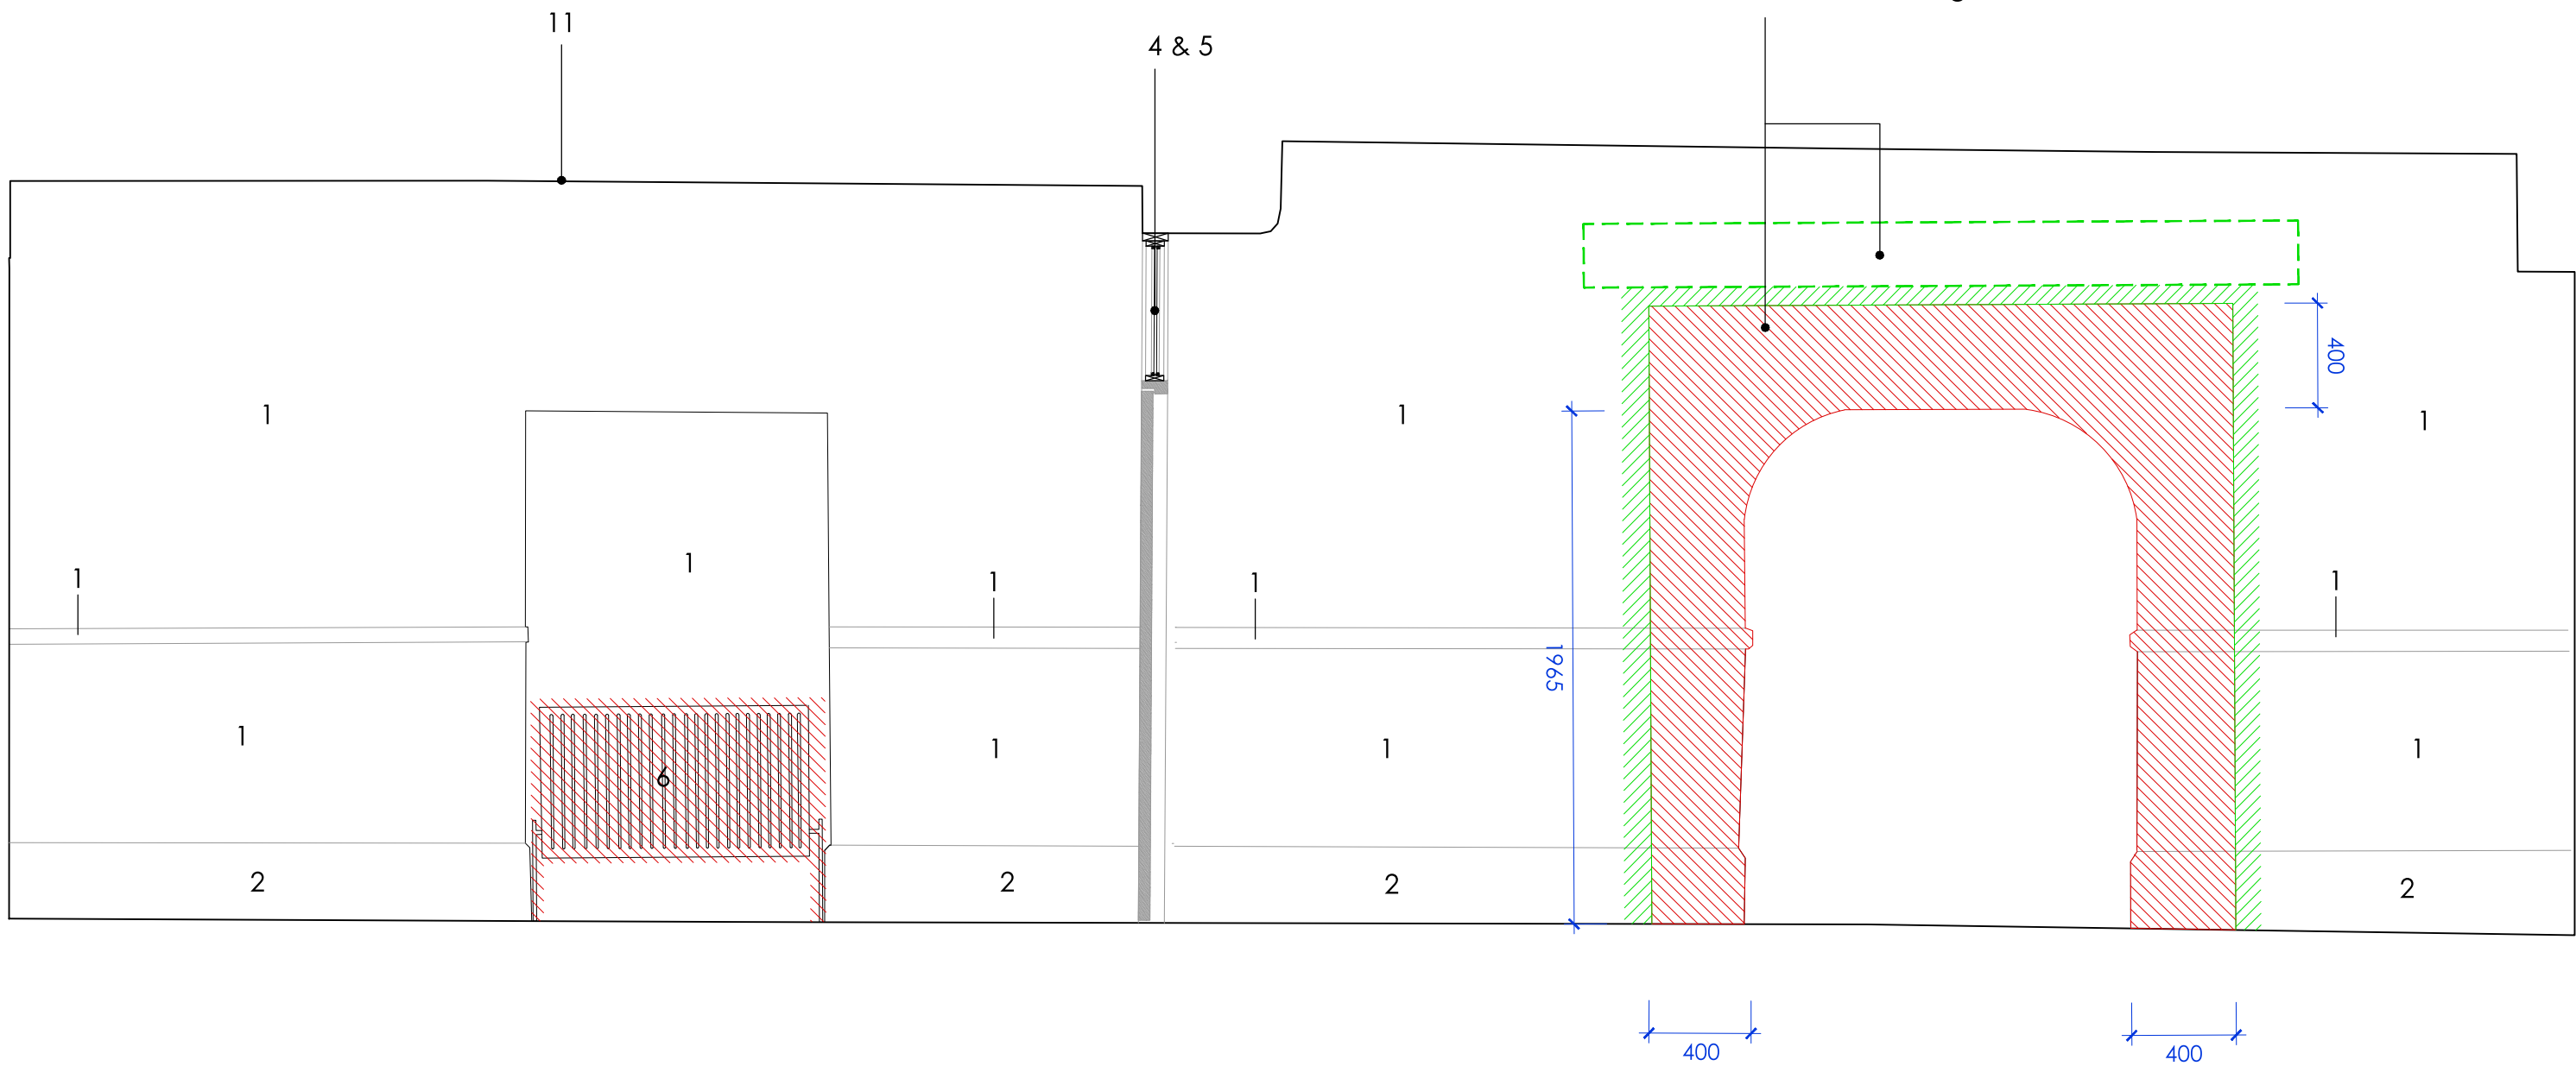


02 ELEVATION A

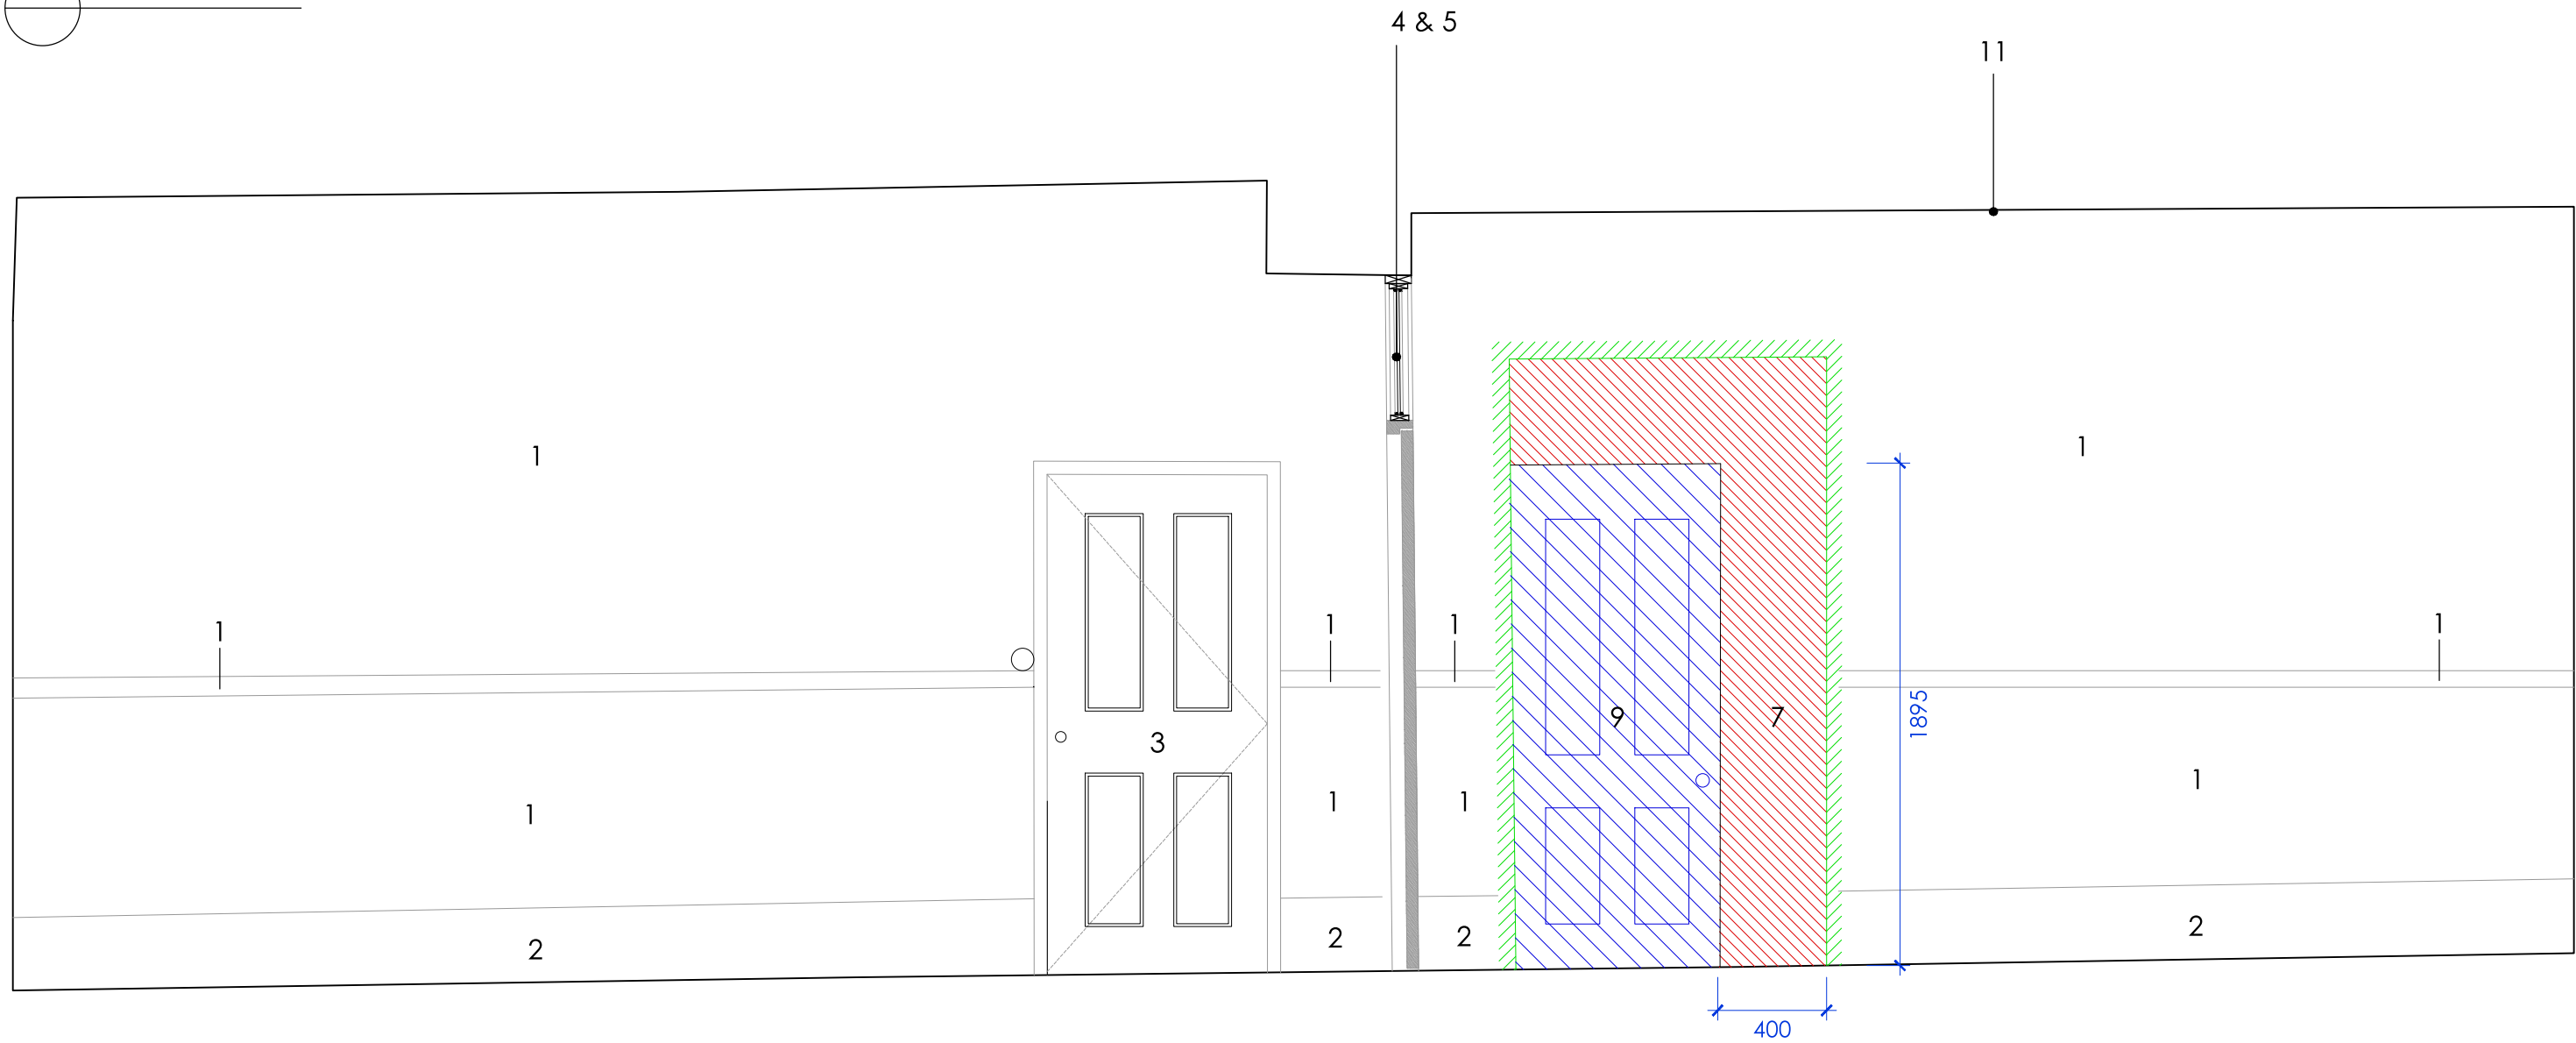

03 ELEVATION B

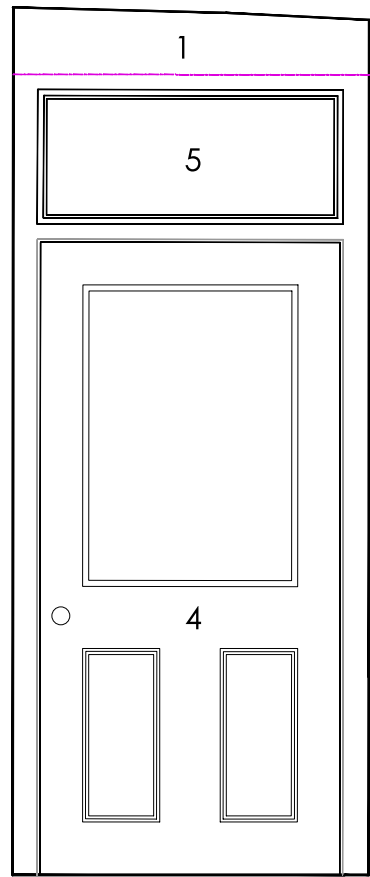


04 ELEVATION C

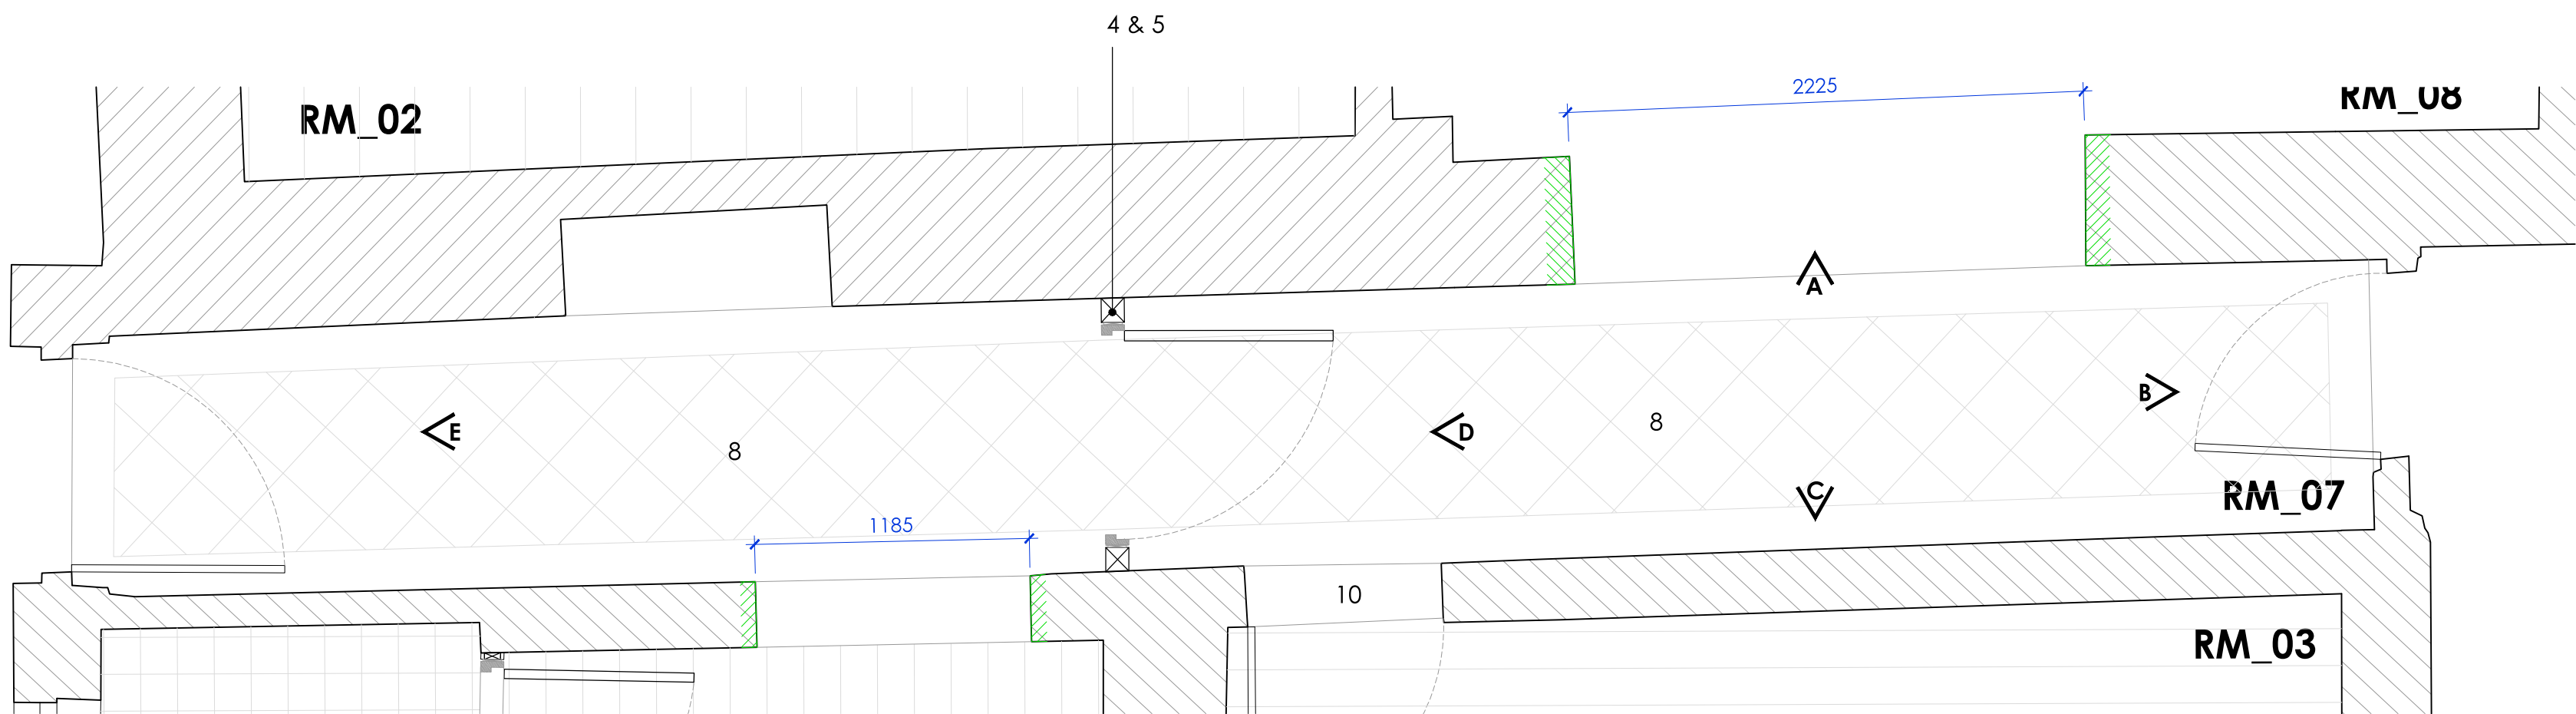

01 P L A N

05 ELEVATION D

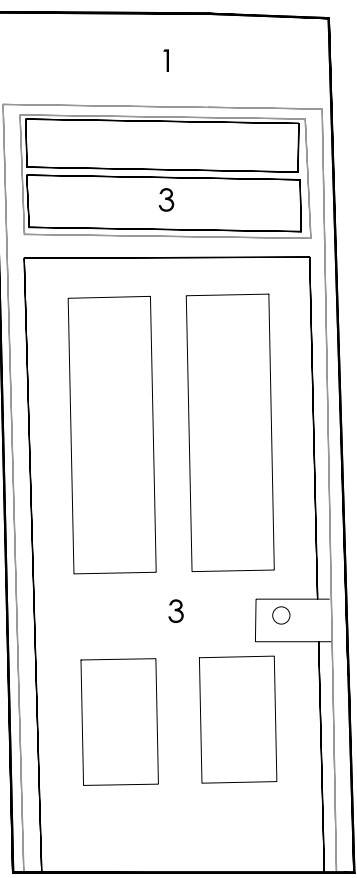

06 ELEVATION E