

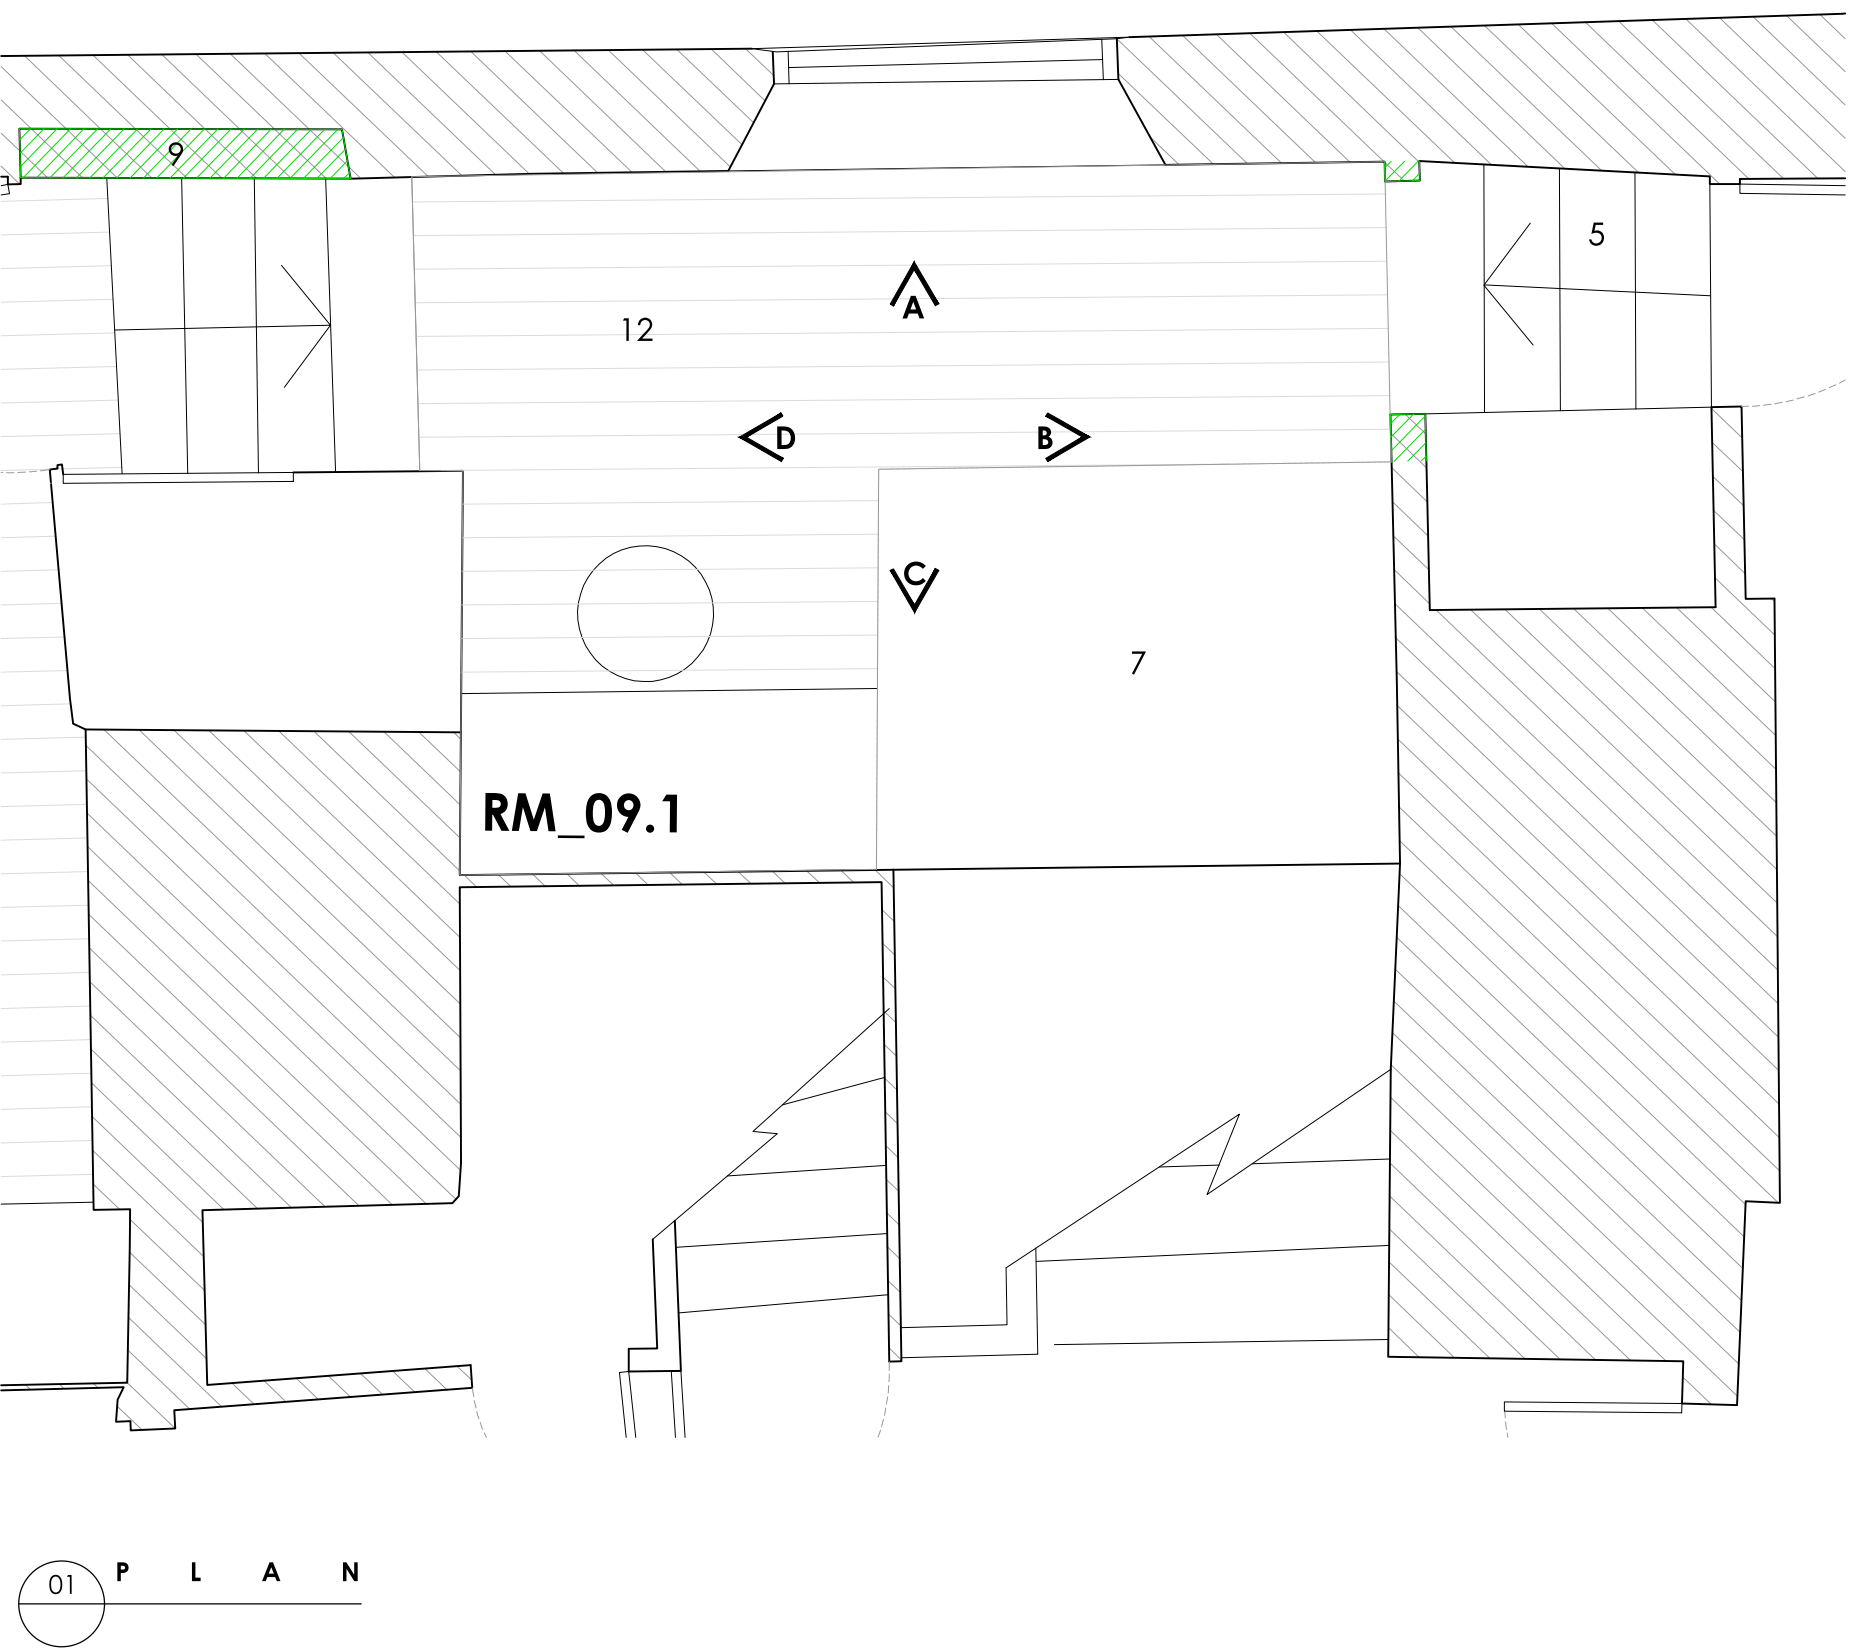
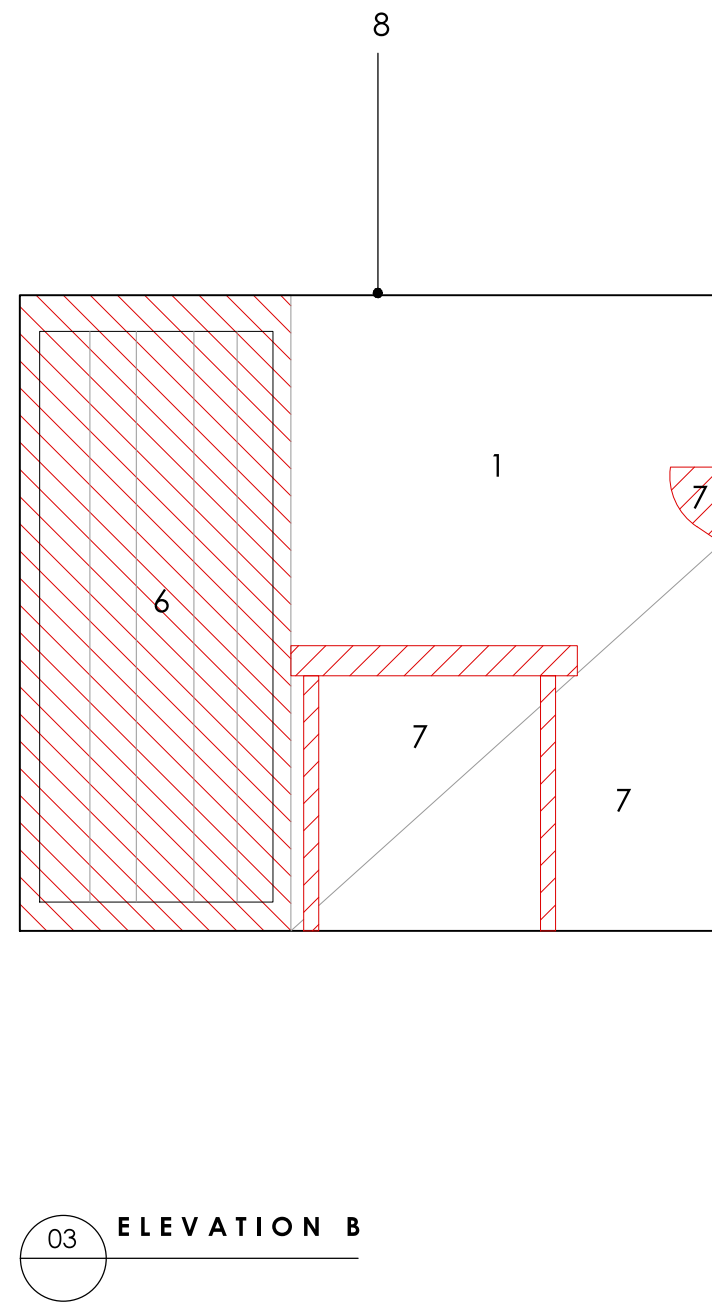
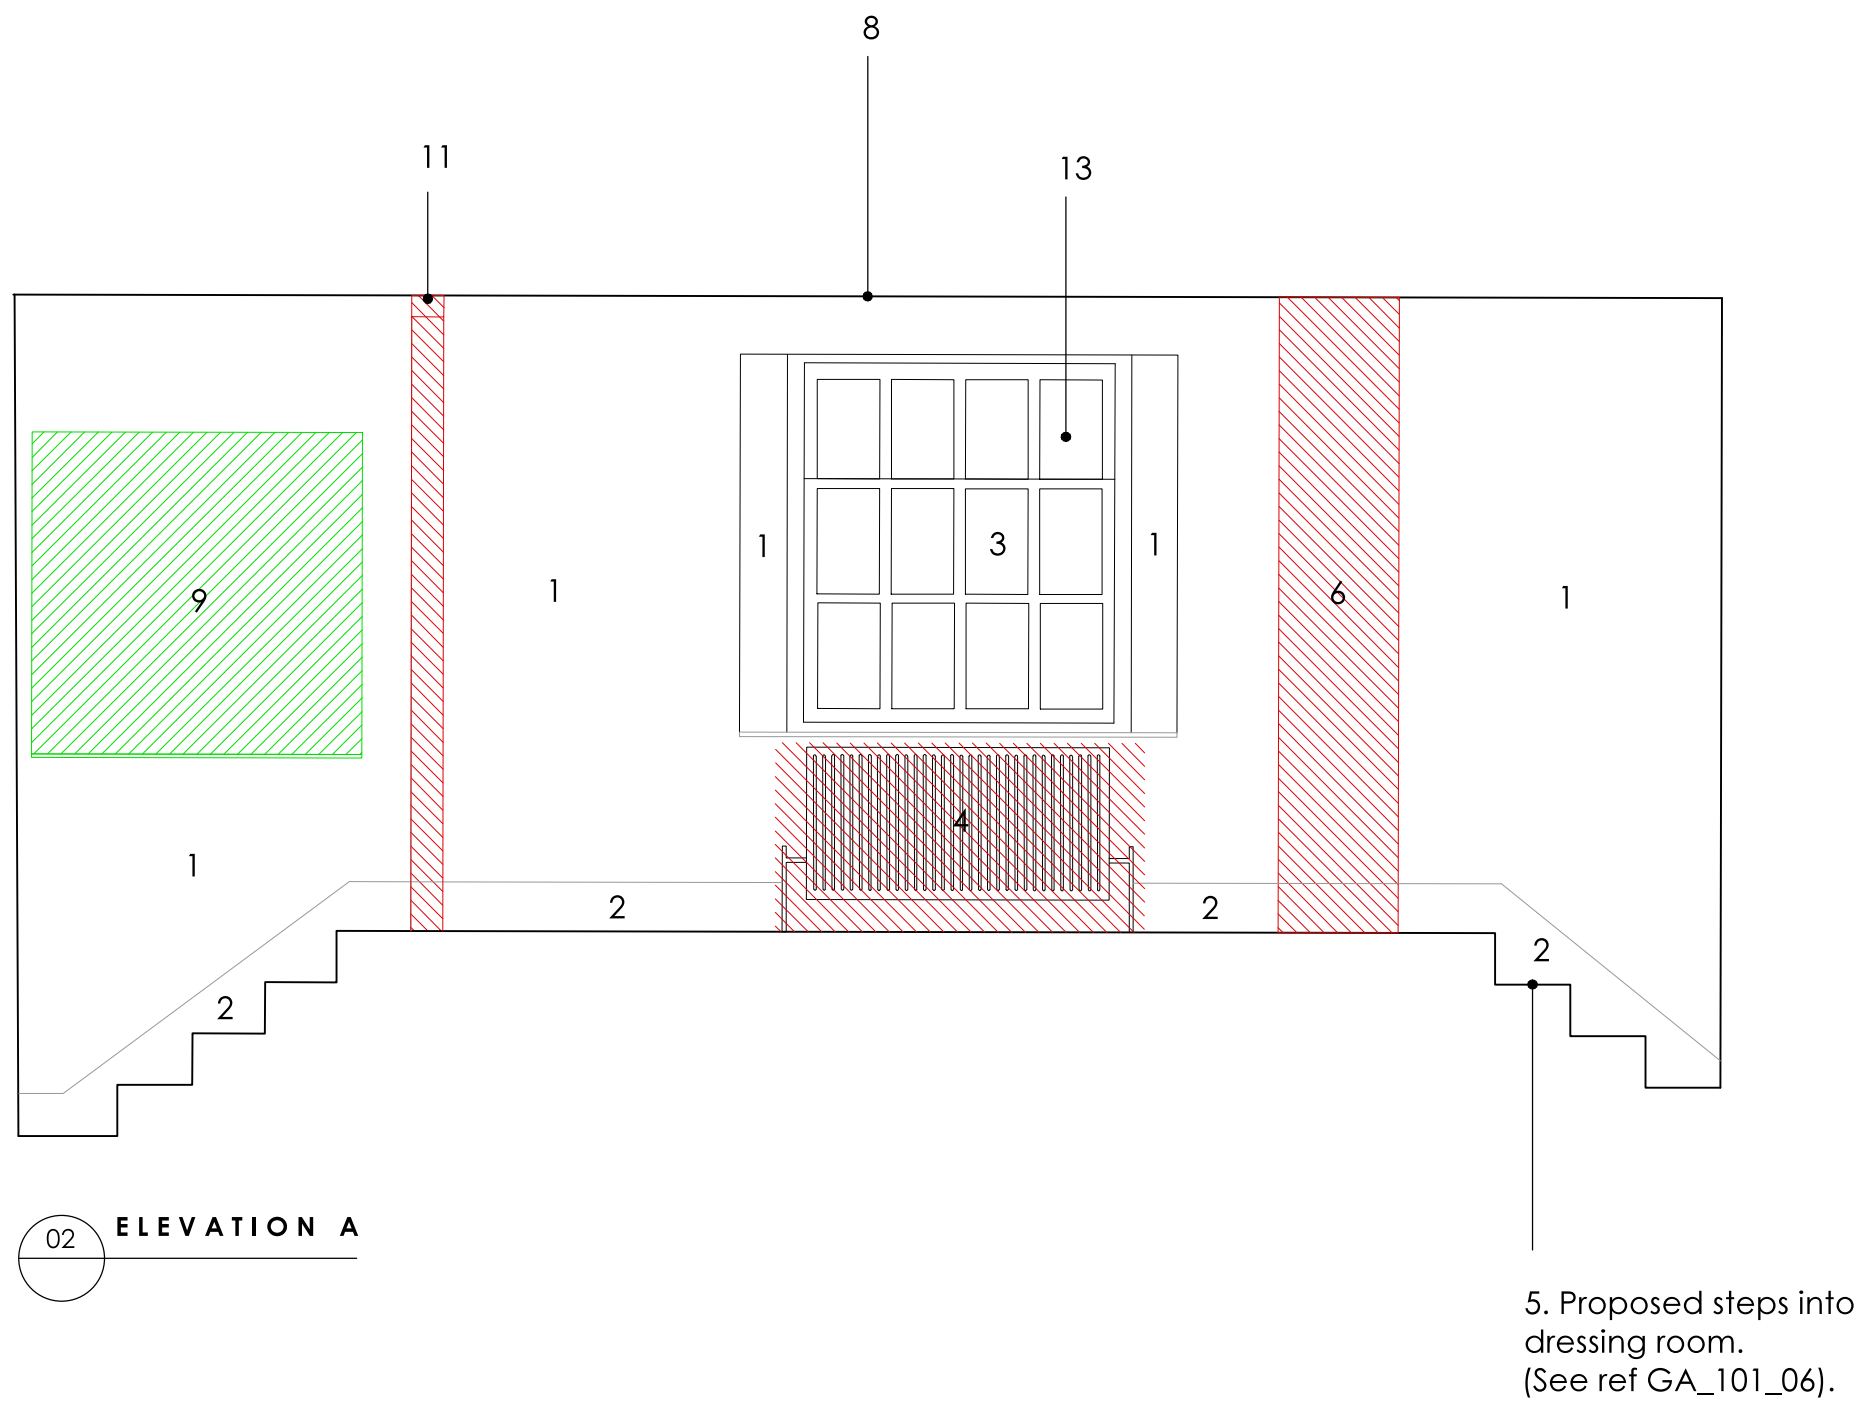


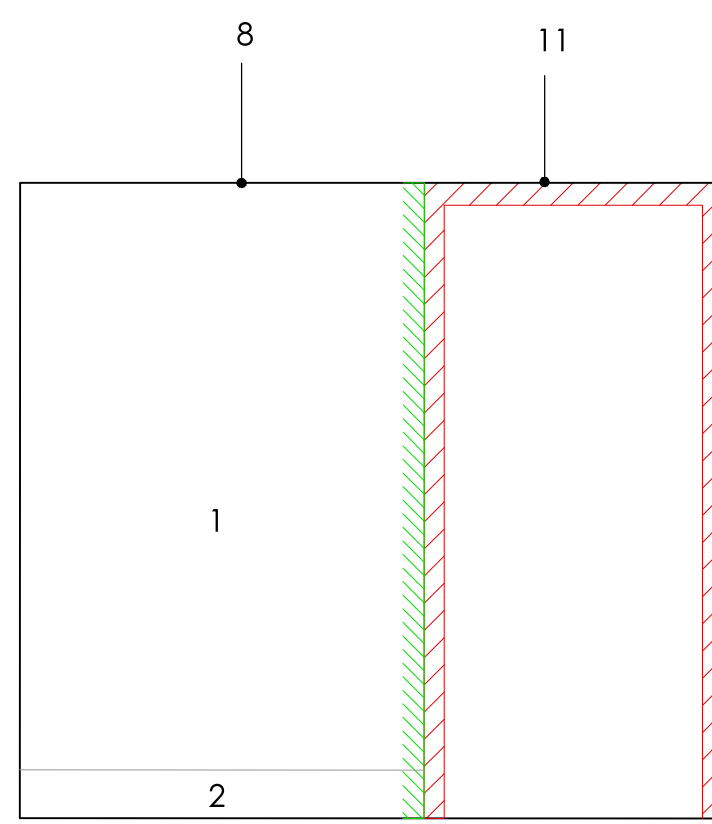

7. Carefully remove and replace, if condition is poor.

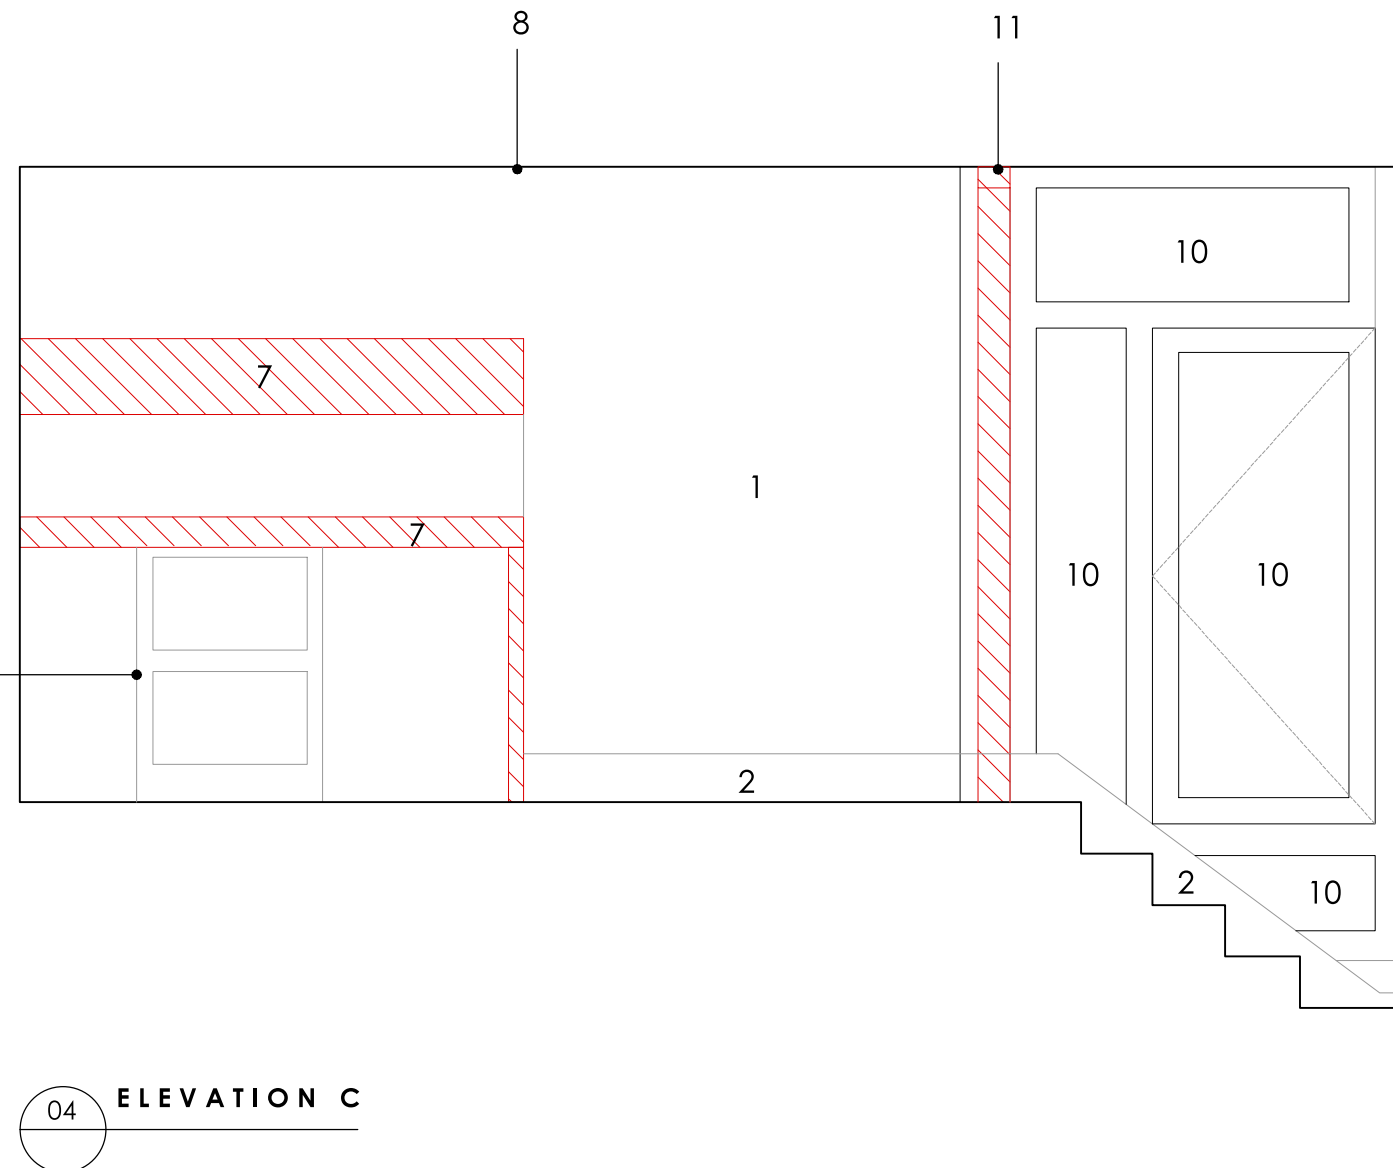

- Carefully remove existing wallpaper and repair existing plaster to be made good - using appropriate lime plaster mix, paint finish.
- Existing skirting board to be carefully stripped, repaired and proposed.
- Existing windows to be carefully to be stripped, repaired and repainted. - Ironmongery and sliding sash gear to be replaced if damaged.
- Existing radiator to be carefully removed and replaced. Wall to be repaired.
- Proposed timber steps.
- Existing cupboard door and wall panels to be carefully removed, wall to be carefully demolished to provide access through to the RM.09.
- Existing joinery to be carefully removed. Diagonal wall paneling to be repaired and made good, paint finish.
- Carefully remove existing lining paper on the ceiling, repair and make good existing plaster - using appropriate lime plaster mix, paint finish.
- Existing wall recess to be infill and made flush with existing wall. Plastered - using appropriate lime plaster mix, paint finish.
- Existing cupboard door and paneling to be carefully stripped, and repaired, paint finish.
- Existing door and surround to be carefully removed, wall to be repaired.
- Existing timber floor to be carefully stripped, repaired and re-laid. Timber floors to be exposed.
- Secondary glazing to be fitted internally for thermal efficiency.

Note: Remedial works as per CARE Engineers drawings.

Issued for Planning 11.01.2023 00
Issued for Information 16.11.2022 00
Issue - Amendment Date Rev

Project Wykes Manor, Wykes Ln, Donington, Spalding, PE11 4SD

JONATHAN HENDRY ARCHITECTS LTD
10 Nickerson Way
Peascliffe Business Park
Hullcliffe-Cray
Unstated
DN16 5HS

T: 01522 458100
W: www.jonathanhendryarchitects.com

Subject Proposed Internal Elevations - RM.09.1

Scale 1:25 Date 11.03.2022

Original Size A1

Drawing No. GA_RM.09.1 Revision 00