

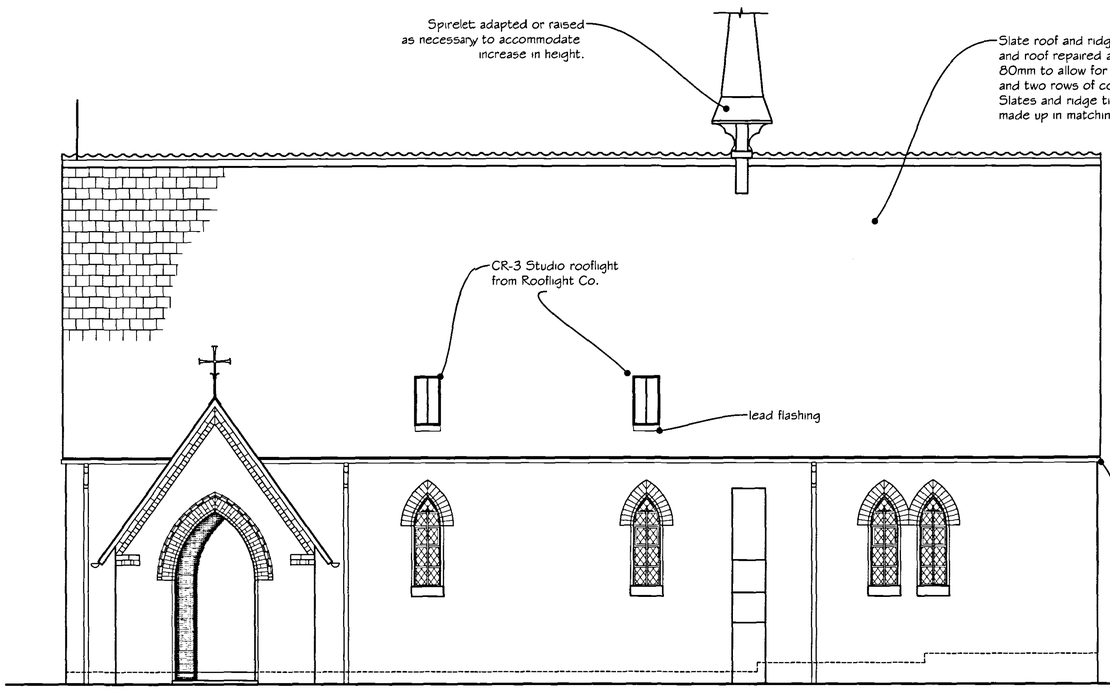



South Elevation

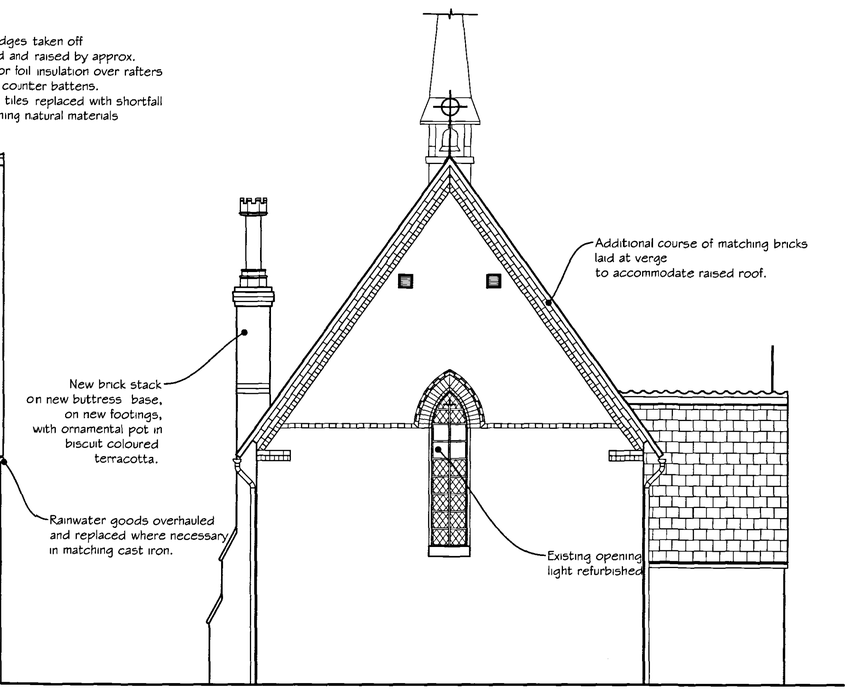

West Elevation

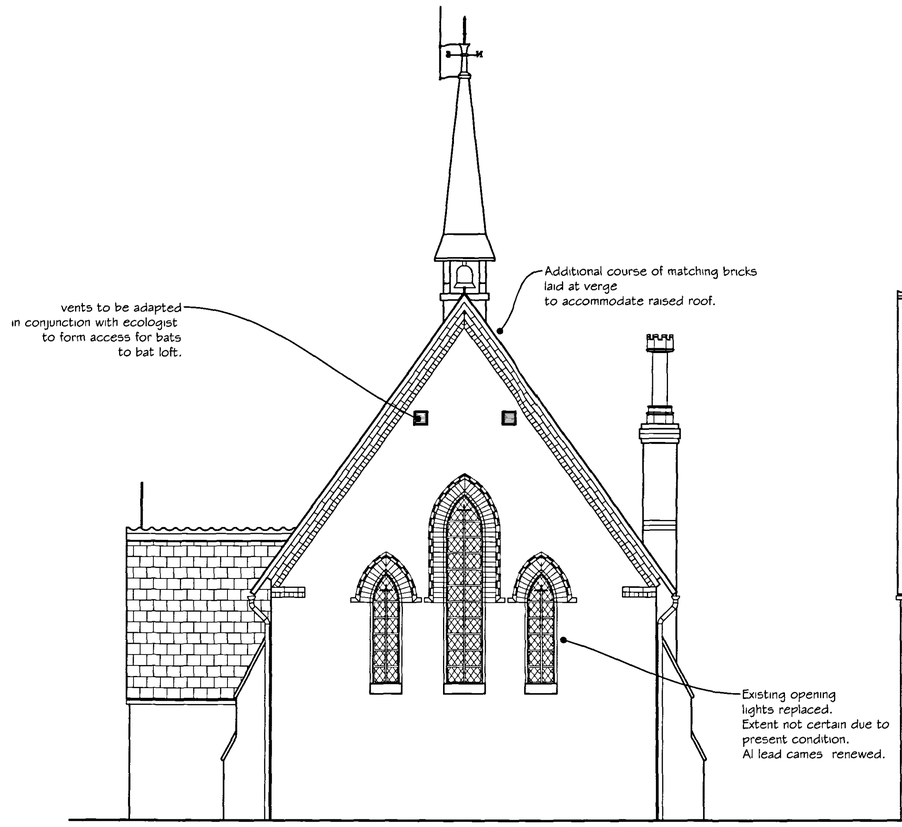

East Elevation

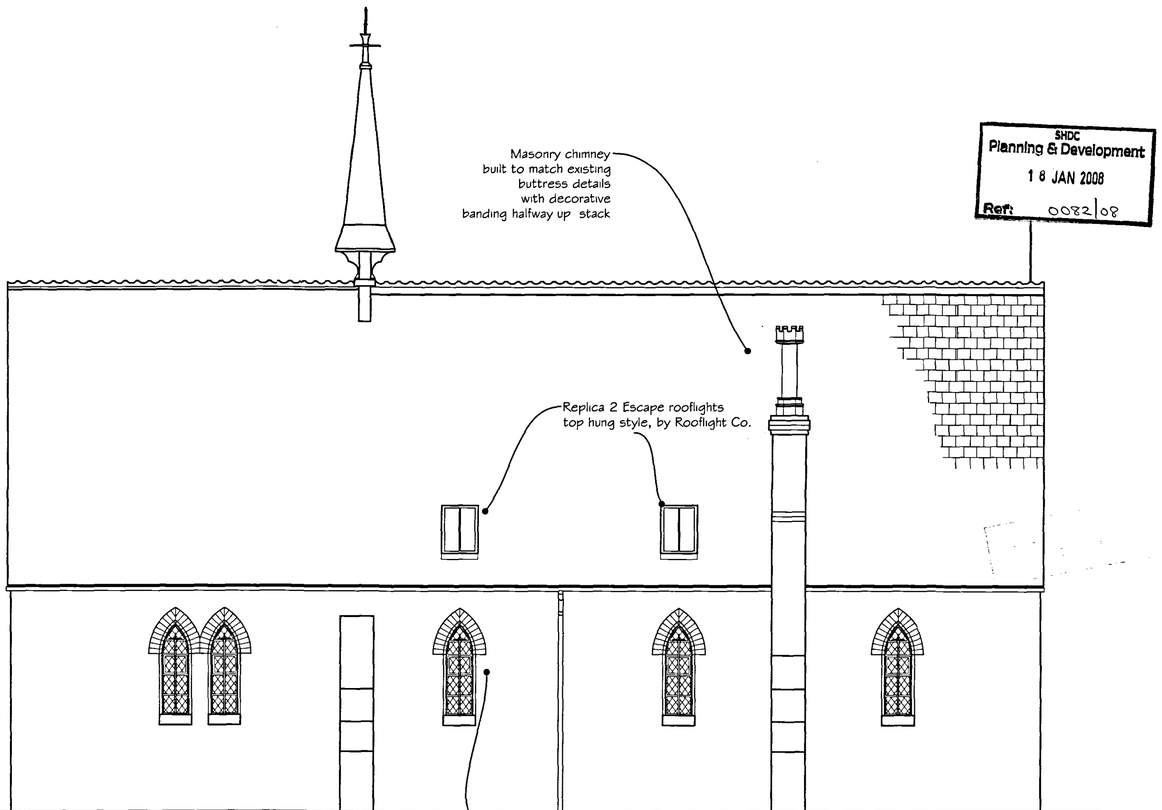

North Elevation

SHDC
Planning & Development
18 JAN 2008
Ref: 0082/08

NOTES :

All dimensions must be checked on site and any discrepancies reported to architect. Do not scale from this drawing. If in doubt ask.

Repointing:
Any repointing is only to be carried out where existing mortar is defective. It must be raked out by hand. No machine tools allowed.

New mortar is to match existing as closely as possible and generally to be 1 : 3 non hydraulic lime putty: well graded sharp sand. It is to be finished flush and at initial set stippled back to raise the aggregate.

Brickwork :
Replacement bricks to approved sample, to be multi coloured facing bricks, with light orange base to match existing in colour, size and texture as closely as possible.

Dressing bricks to be darker red facings, shaped where necessary to match existing form.

Any piecing in must match existing bonding and have the mortar raked back to allow pointing in with adjacent repointing work.

	Date	Revisions

© Copyright

Anderson and Glenn
Architectural and Landscape Consultancy
Yew Tree Nurseries
Frampton West
BOSTON PE20 1RQ

Tel : 01205 724047
Fax : 01205 723792
www.andersonandglenn.com

Client
Redundant Churches Dept.
Diocese of Lincoln

Job Title
Church of St Matthew
Redundant Church
Holbeach St Matthews

Drawing Title
Poposed
External Elevations

Scale
1:50 @ A1

Date
Aug. 2007

Drawn by
M. Anderson

Drg. No.
A-097-53

Rev.