


DOUBLE-HUNG WINDOW FIXED IN OUTER THICK-NESS OF REVEAL - WITH AND WITHOUT REBATE

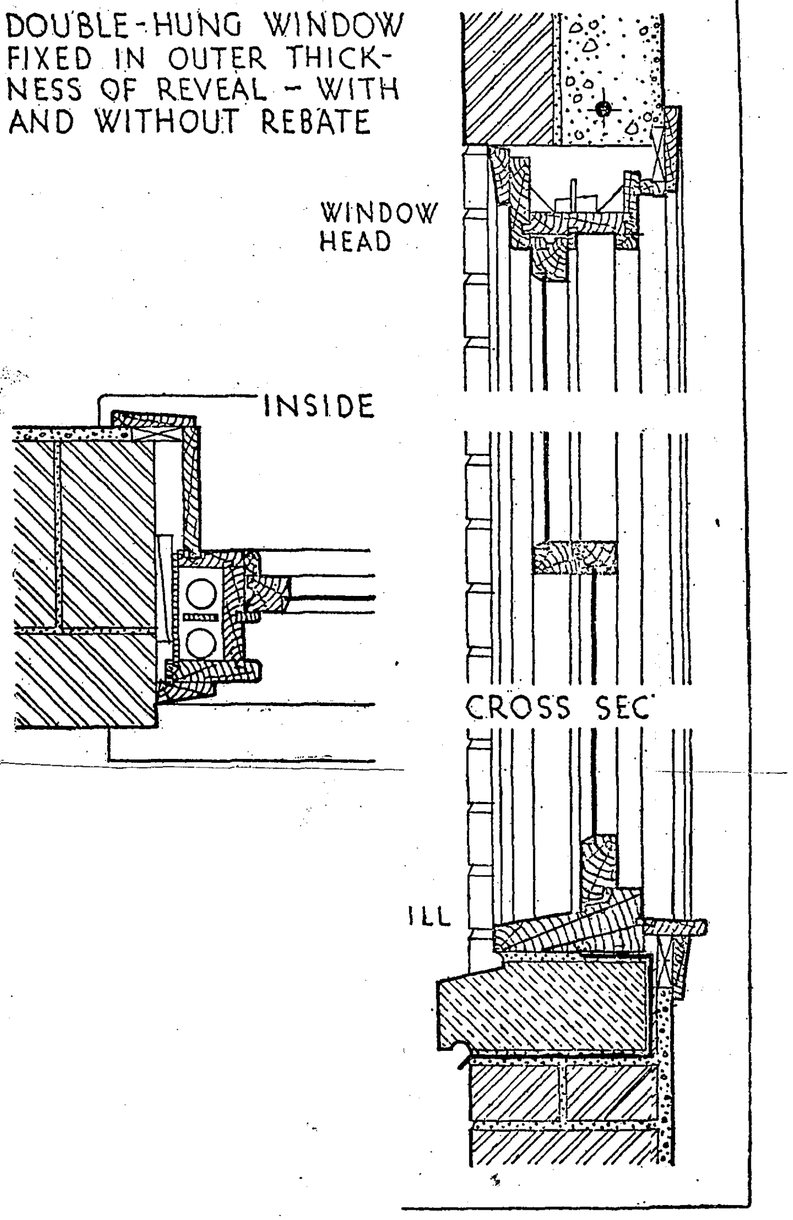

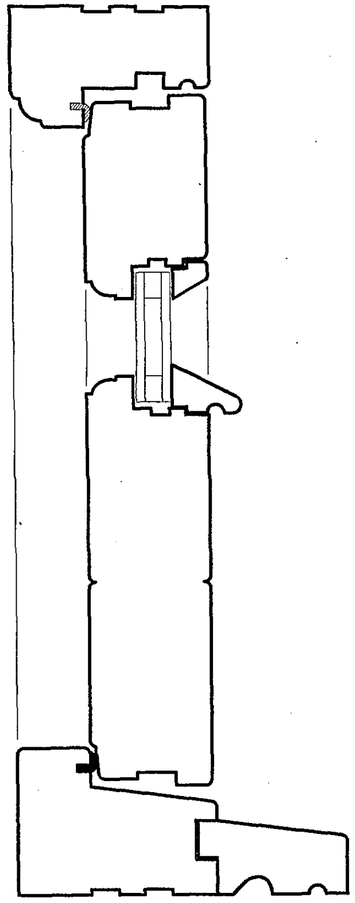

Section thru' french doors

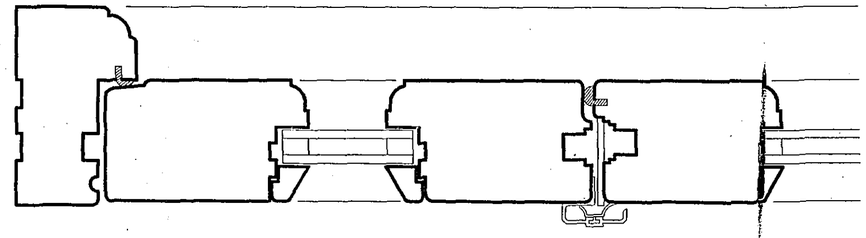

Plan detail of french doors

All new timber widows are to be purpose made joinery manufactured using selected European Redwood sourced from Northern Europe. All windows and doors are to have hardwood sills.

Timber window an are to be constructed as shown and of the Conservation type to match existing windows and manufactured from European Redwood and shall comply with CP 112: Part 2. Timber and manufactured components are not to be delivered to site until they can be put into suitable dry storage conditions.
The moisture content of all external joinery work must not exceed 16% at the time of fixing.
All Joinery work is to be pressure impregnated with preservative and a certificate of treatment from the supplier will be required.
All joinery work is to be manufactured and assembled in accordance with BS 1186 Part 2, properly morticed, tennoned and wedged and with the joints glued under pressure.
All external joinery components are to be primed on site after assembly and prepared to receive paint finish.
All conservation windows and doors are to be single glazed with 4mm Annealed glass units incorporating Fine Lambs.Tongue glazing bars. Glass is to be traditional putty glazed into rebates and left to cure before decoration.

SHDC
Planning & Development
12 NOV 2007
Ref: 0880/07

JOHN D LYNCH
partnership
CHARTERED ARCHITECTS

Client
Mr A Elwine

Project
Listed Building Application

Drawing
Working Details & Spec.

Date	Drawn
Nov. 2007	JDL

Job No.	Drawing No.
1673	WD/3

Scale	Revision
1:2, 1:4	