

DO NOT SCALE THIS DRAWING. THE CONTRACTOR IS DEEMED TO HAVE CHECKED ALL DIMENSIONS ON SITE AND REPORT ANY DISCREPANCIES TO OGLESBY & LIMB LTD.
THE CONTENTS OF THIS DRAWING ARE COVERED BY COPYRIGHT AND REMAIN THE PROPERTY OF OGLESBY & LIMB LTD. WRITTEN APPROVAL MUST BE OBTAINED FROM OGLESBY & LIMB LTD PRIOR TO DUPLICATION OR REPRODUCTION OF THIS DRAWING OR ITS CONTENTS.
ANY DIMENSIONS NOT SHOWN ARE TO BE CHECKED AND AGREED WITH OGLESBY & LIMB LTD.

Required works

General Works

All works to skirting, wall render, stone string courses, corbels, ceiling vaulting, eaves and roof as described elsewhere.

Memorial Panels:
Memorial Panels 1 (P1.1 to 1.15 inclusive), Memorial Panel 2 (P2.1 to P2.15 inclusive) and Memorial Panel 3 (P3.1 to P3.15 inclusive).

Memorial Panel 1
Complete panel (all sections) to be thoroughly DOFF cleaned.
Areas of suspected cementitious pointing to panels 1.7, 1.15 etc to be carefully removed and repointed in a suitable lime mix (unless removal causes damage to surrounding stone).
Minor cracks to stone panels (1.6, 1.10 and 1.14 etc) to be repaired.
Works to lettering to be undertaken as specified including repainting in black.

Memorial Panel 2
Complete panel (all sections) to be thoroughly DOFF cleaned.
Areas of suspected cementitious pointing to panels 2.2, 2.4, 2.7, 2.10, 2.11 etc to be carefully removed and repointed in a suitable lime mix (unless removal causes damage to surrounding stone).
Minor cracks to stone panels (2.2, 2.9, 2.10, 2.11 etc) to be repaired.
The word SPALDING on panel 2.11 is to be recaved (potential cut out and piece in new with lettering carved).
Works to lettering to be undertaken as specified including repainting in black.

Memorial Panel 3
Complete panel (all sections) to be thoroughly DOFF cleaned.
Areas of suspected cementitious pointing to panels to be carefully removed and repointed in a suitable lime mix (unless removal causes damage to surrounding stone).
Minor cracks to stone panels (3.10 and 3.14 etc) to be repaired.
Works to lettering to be undertaken as specified including repainting in black.

Flags

Flag 1 plinth is badly cracked and eroded and is to be removed and replaced with new to match.

Flag 1 is to have paint sampling and analysis undertaken by Lincoln Conservation and the flag is then to be carefully rubbed down, any minor cracks are to be repaired, and the flag is then to be repainted with suitable paint as specified by Lincolnshire Conservation.

The existing flagpole is to be rubbed down and repainted, again with suitable paint as specified by Lincolnshire Conservation.

Flag 1 wreath and head detail is to be carefully cleaned, minor repairs implemented and both are then to be repainted with suitable paint as specified by Lincolnshire Conservation.


Flag 2 plinth is generally in reasonable condition and is therefore only to be DOFF cleaned.

Flag 2 is to have paint sampling and analysis undertaken by Lincoln Conservation and the flag is then to be carefully rubbed down, any minor cracks are to be repaired, and the flag is then to be repainted with suitable paint as specified by Lincolnshire Conservation.

The existing flagpole is to be rubbed down and repainted, again with suitable paint as specified by Lincolnshire Conservation.

Flag 2 wreath (damaged) is to be carefully removed and is to be replaced with new to match, if possible cast from the remaining wreath on Flag 2. The head detail is to be carefully cleaned, minor repairs implemented as required and is to be repainted again with suitable paint as specified by Lincolnshire Conservation.

Frieze
Complete frieze (all sections SF1 to SF7 inclusive) to be thoroughly DOFF cleaned.
Joints between frieze panel stones are to be repointed using suitable lime mortar.
Works to lettering to be undertaken as specified including repainting in black.

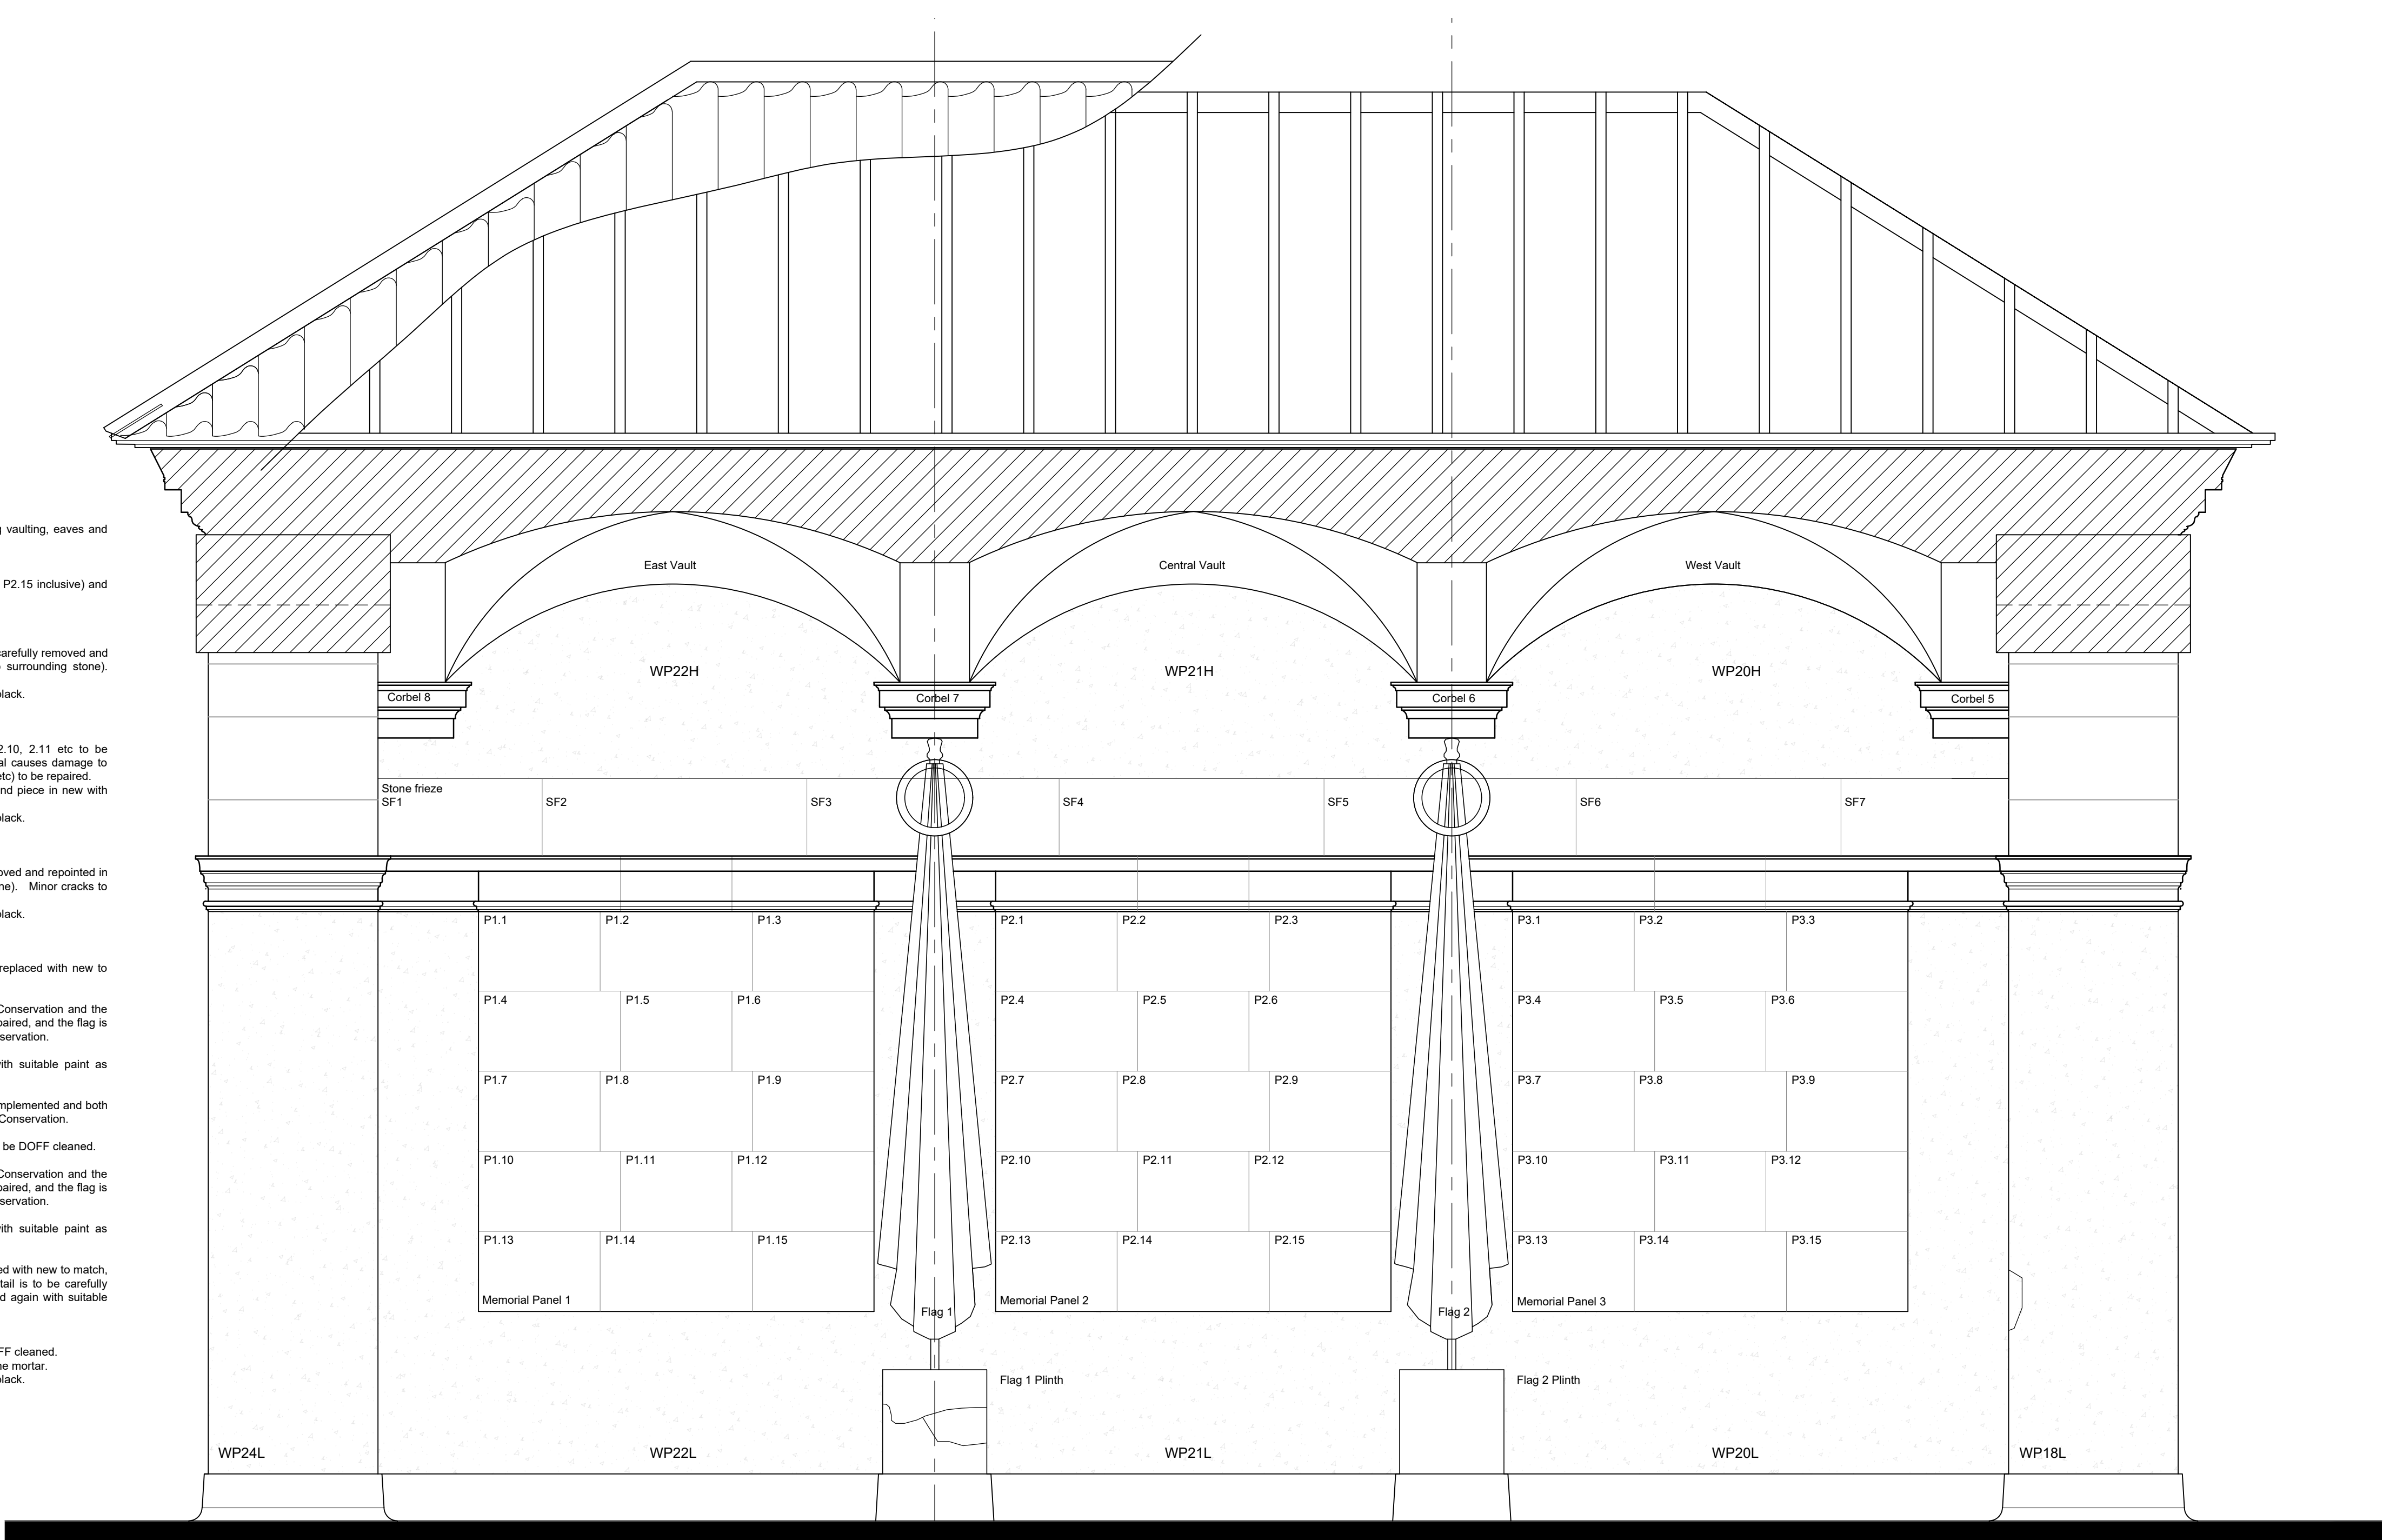

Longitudinal Section looking South as existing


Scale 1:20

SCALE 1 : 20


SCALE 1 : 1




Image of Memorial Panels

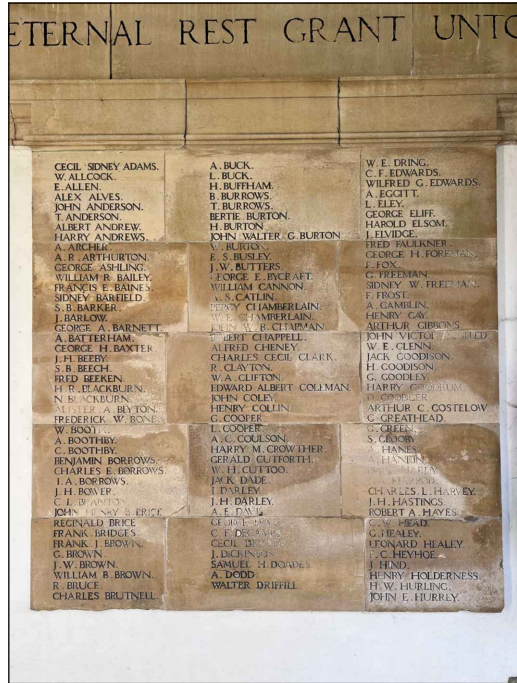

Memorial Panel 1

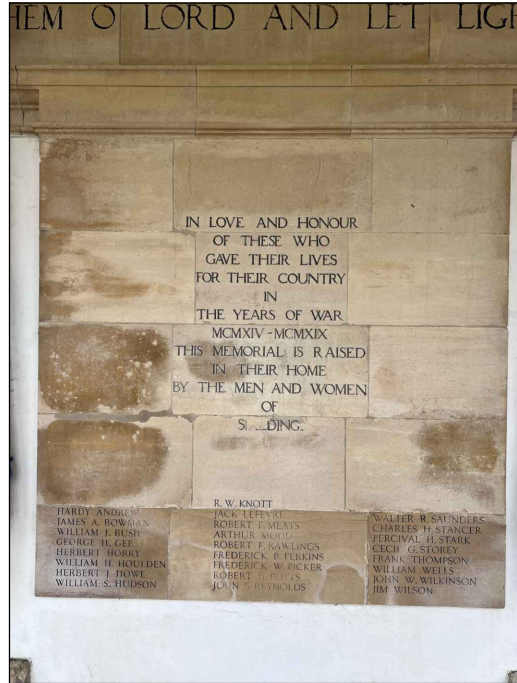


Memorial Panel 2

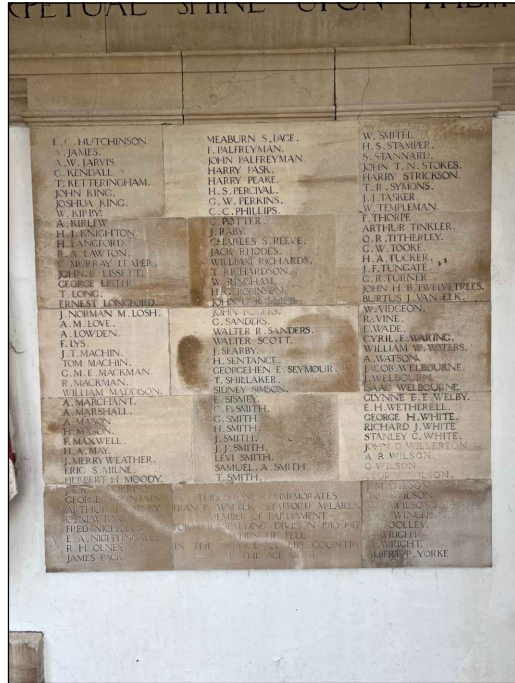


Memorial Panel 3



Flag 1

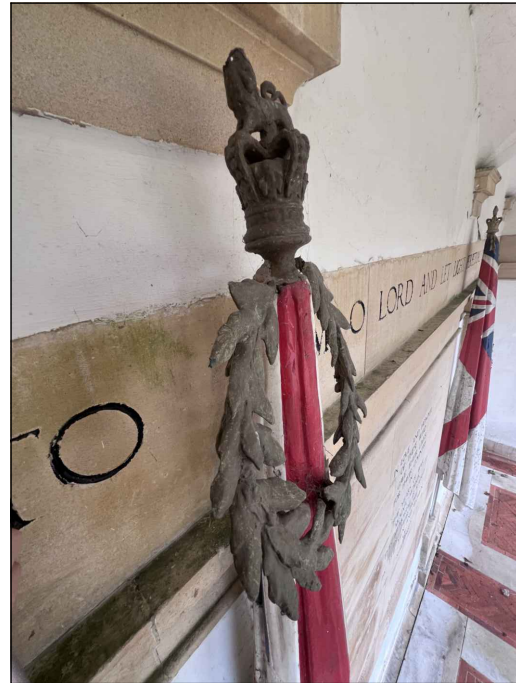

Flag 1 wreath detail

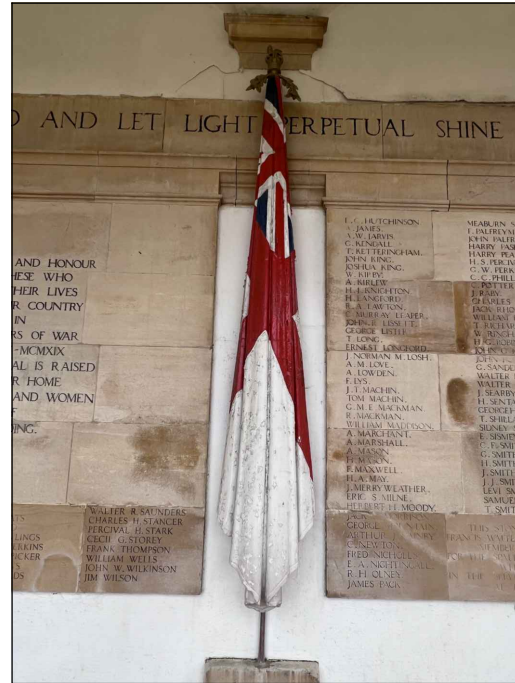

Flag 2



Flag 2 wreath detail

Drawing Title:

**Longitudinal Section 1 as existing
identifying works required**

LBC APPLICATION ISSUE

Date:	Dec 2024	Scale:	as shown @ A1
Drawn by:	ajo	Checked by:	ap

Drawing Number:	Rev:
A1660-15	T1