




TOP SASH TO BE RESTORED.
AND GLASS CLEANED AND REPLACED.

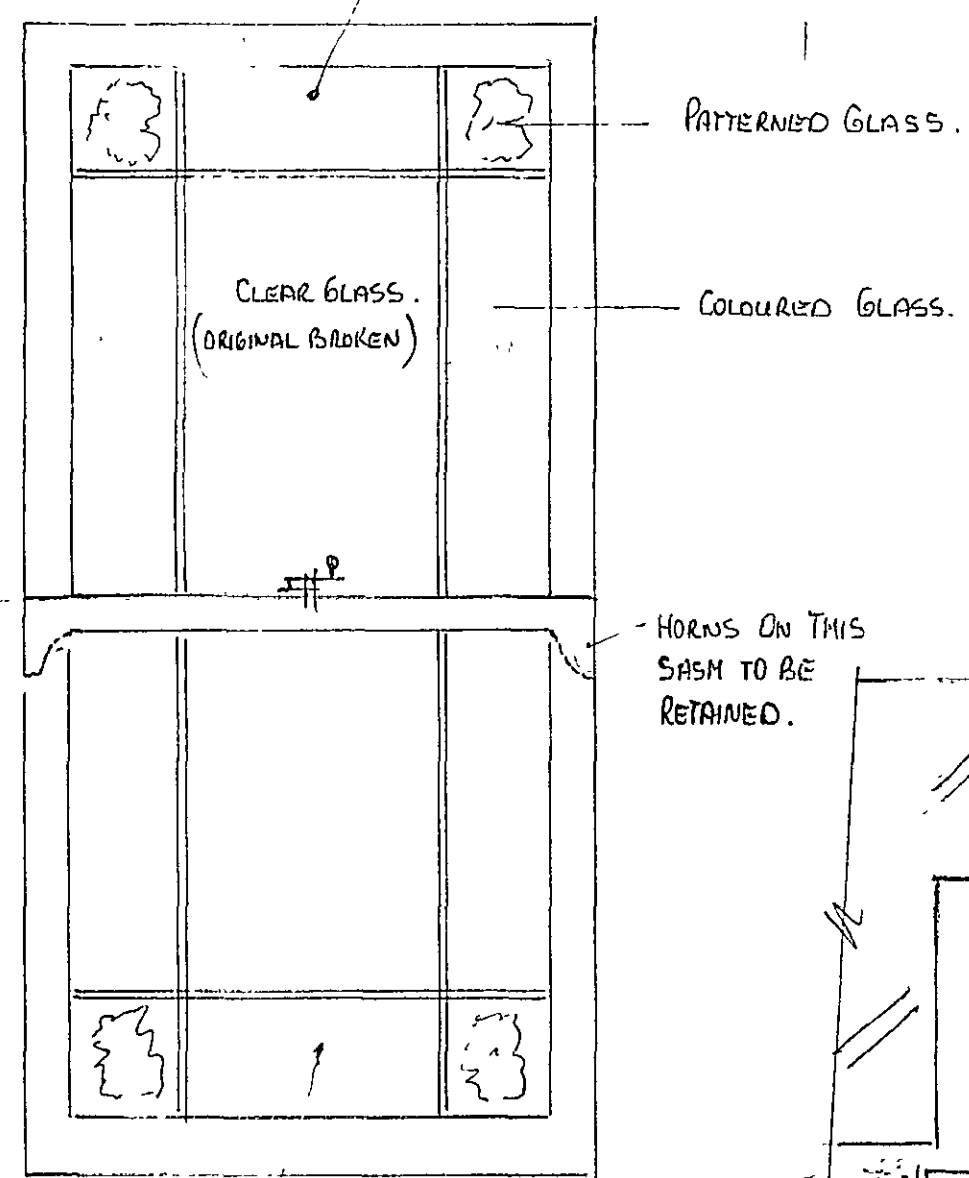




HARDWOOD HEAD
& CILL SECTIONS.
(N.B. NOT ALL WINDOWS HAD
SOLID HEADS.)

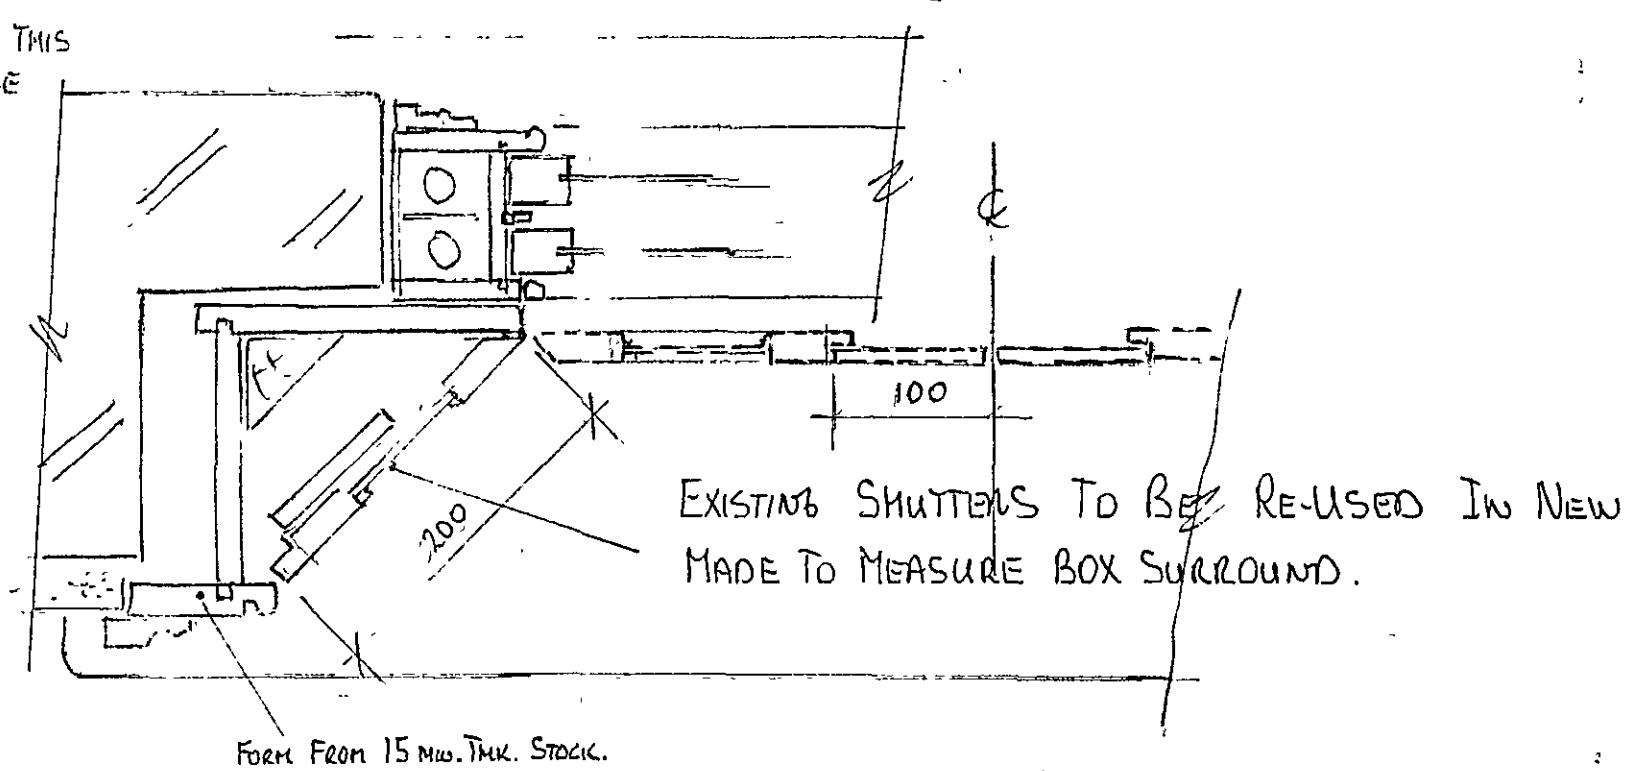

NEW BTH. SASH TO BE MADE USING
TOP AS PATTERN. GLAZING TO BE
PROVIDED TO MATCH TOP.




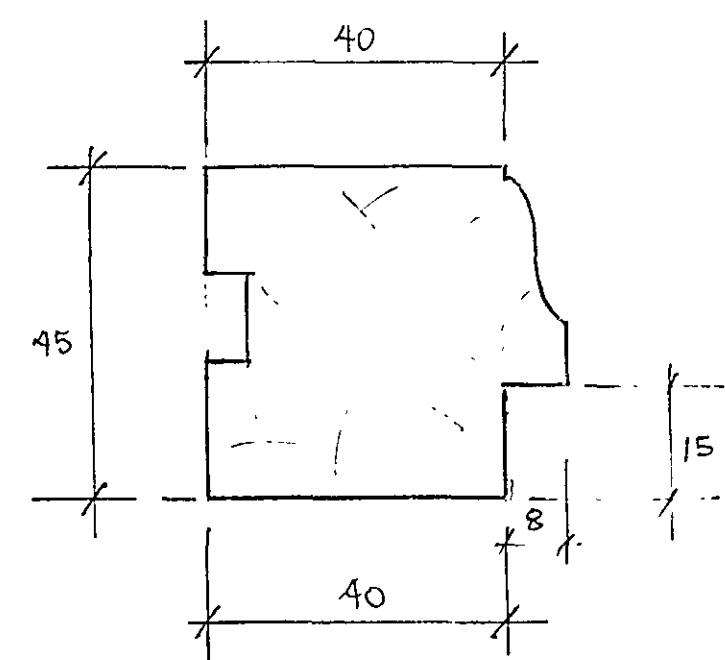


W 8



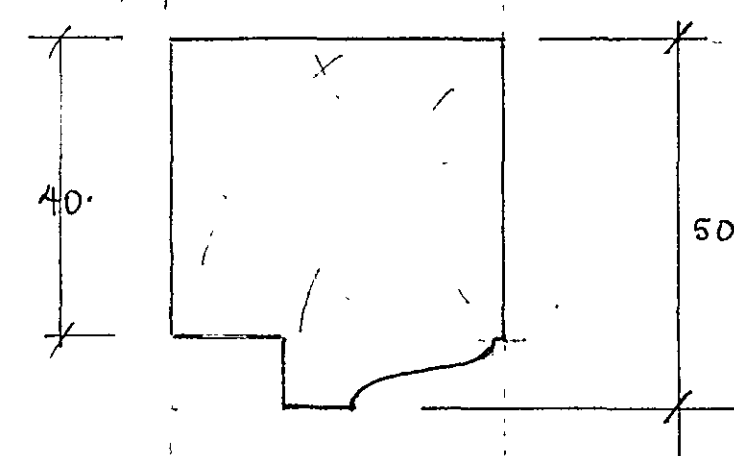
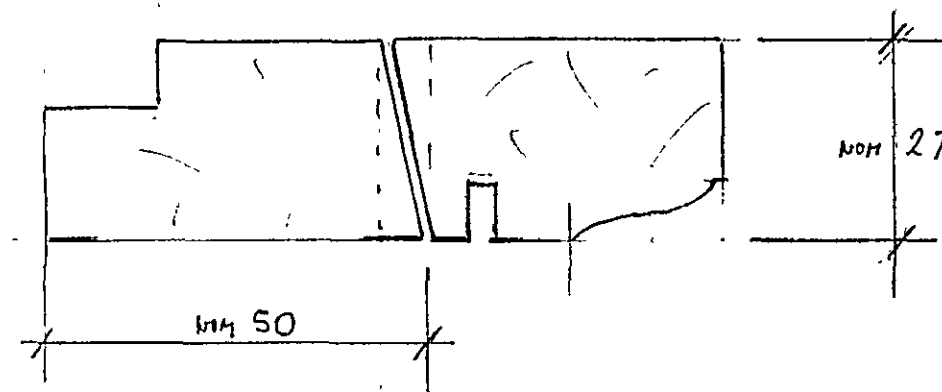
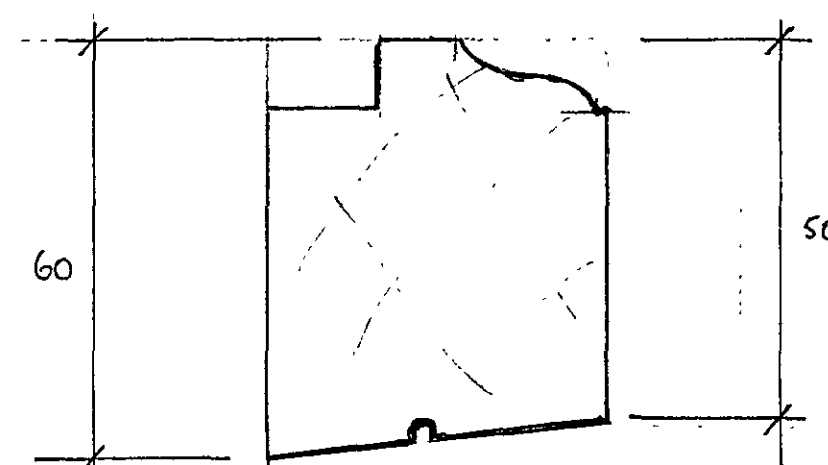


LARGER BOXES FOR
W. 9.10.15 & 16.


N.B. SOME EXISTING WEIGHTS MAY REQUIRE
REDUCING FOR W. 9.10.15 & 16 AFTER
SUBSTITUTION OF 3mm GLASS FOR
HEAVY PLATE GLASS.

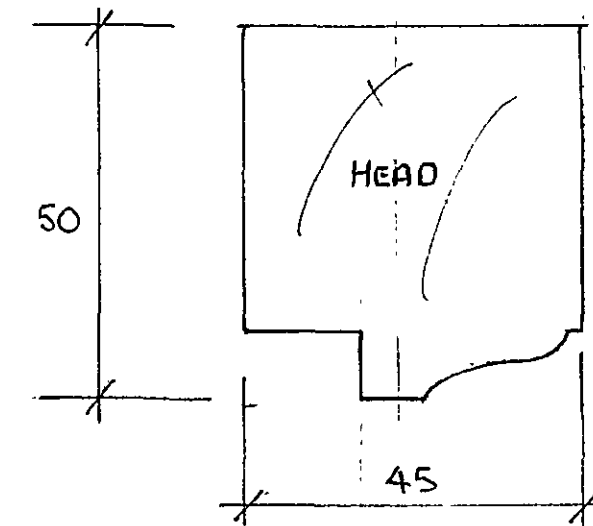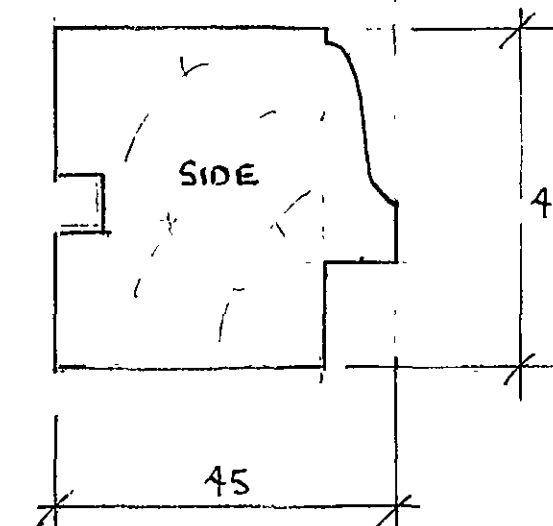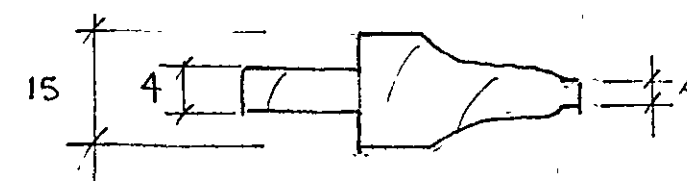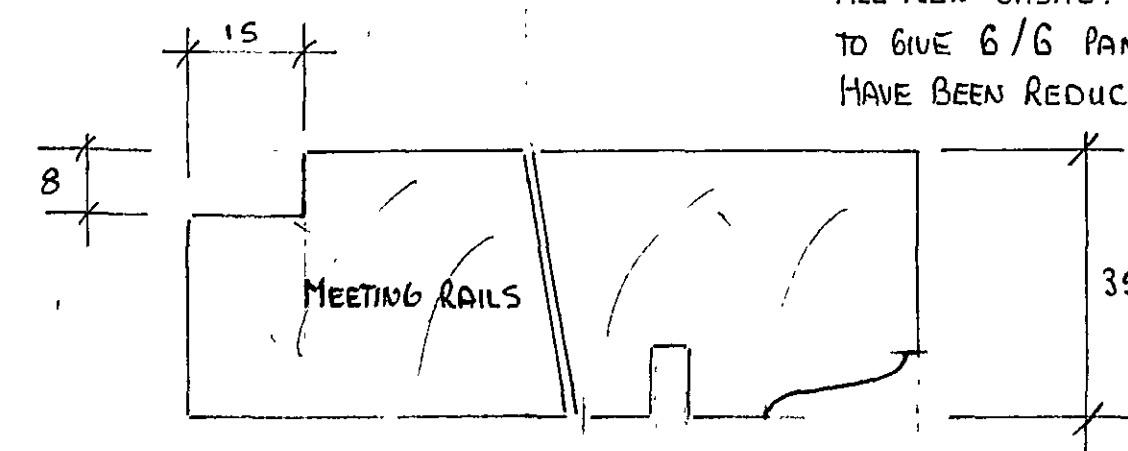


ALL NEW SASHES. NOW TO HAVE GLAZING BARS
TO GIVE 6/6 PANES. DEPTH OF REBATES
HAVE BEEN REDUCED FROM ORIGINALS AS GLASS
WILL NOW BE 3mm.

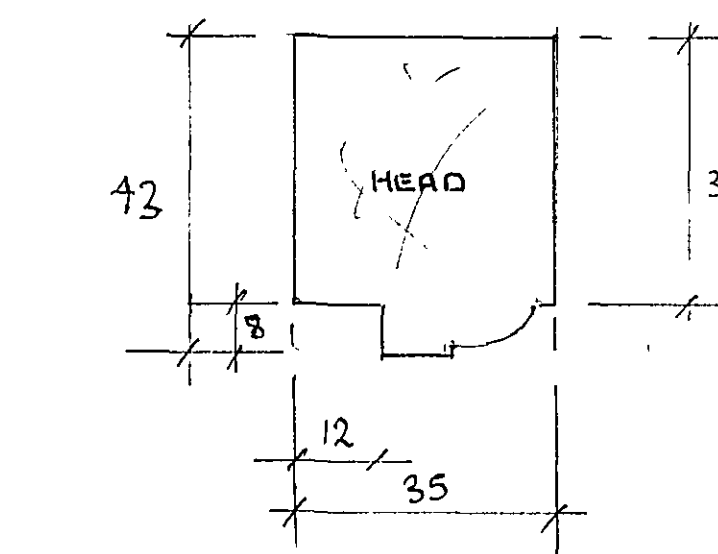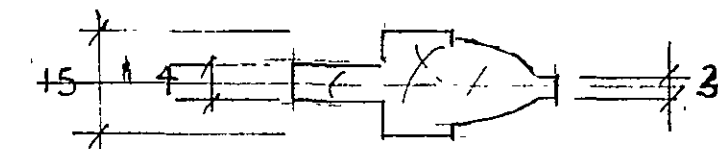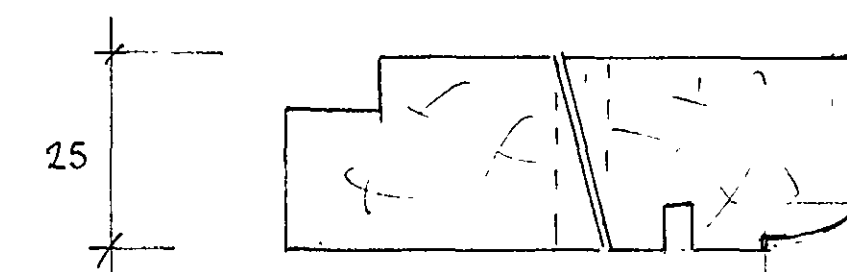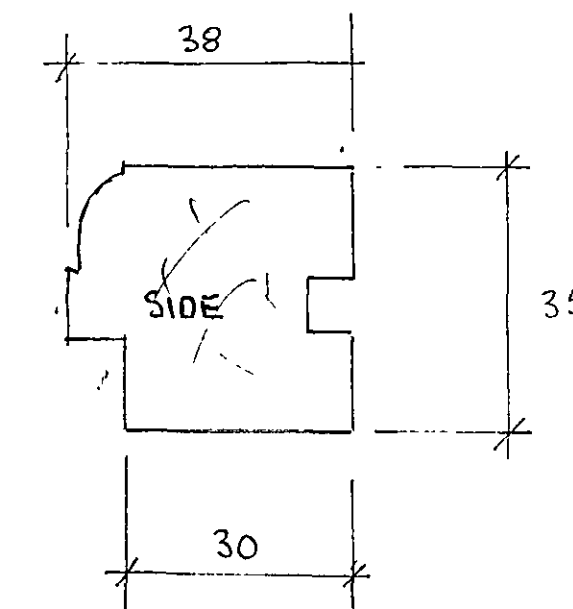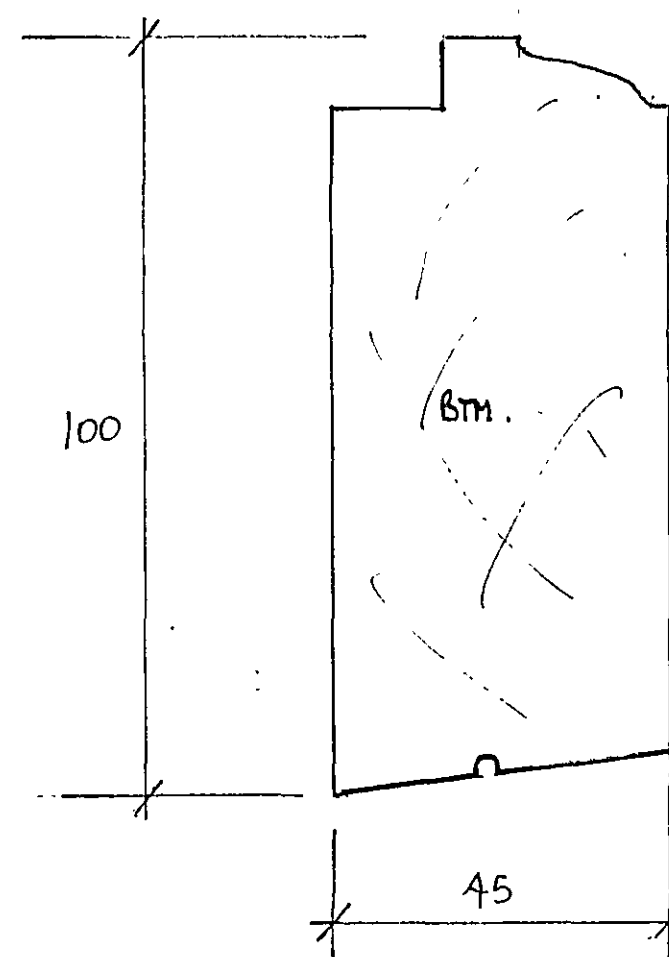

W. 9.10.15 & 16

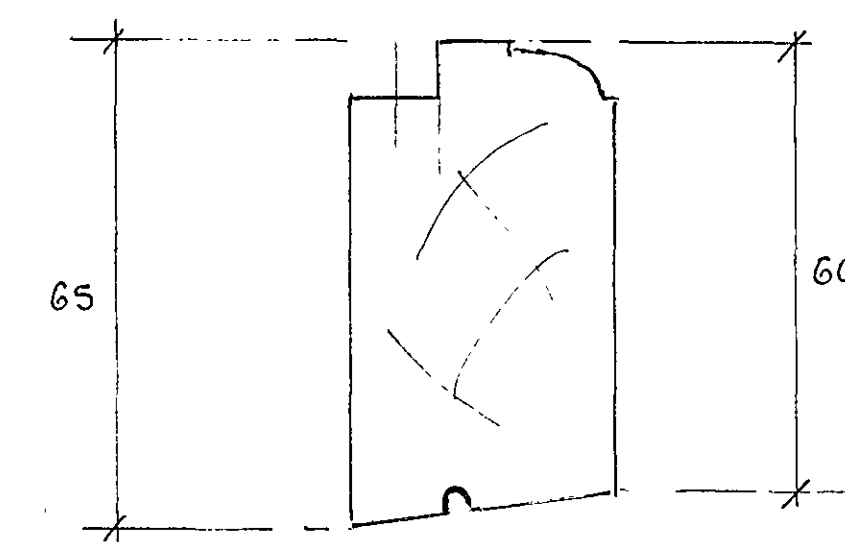

W 7.14.

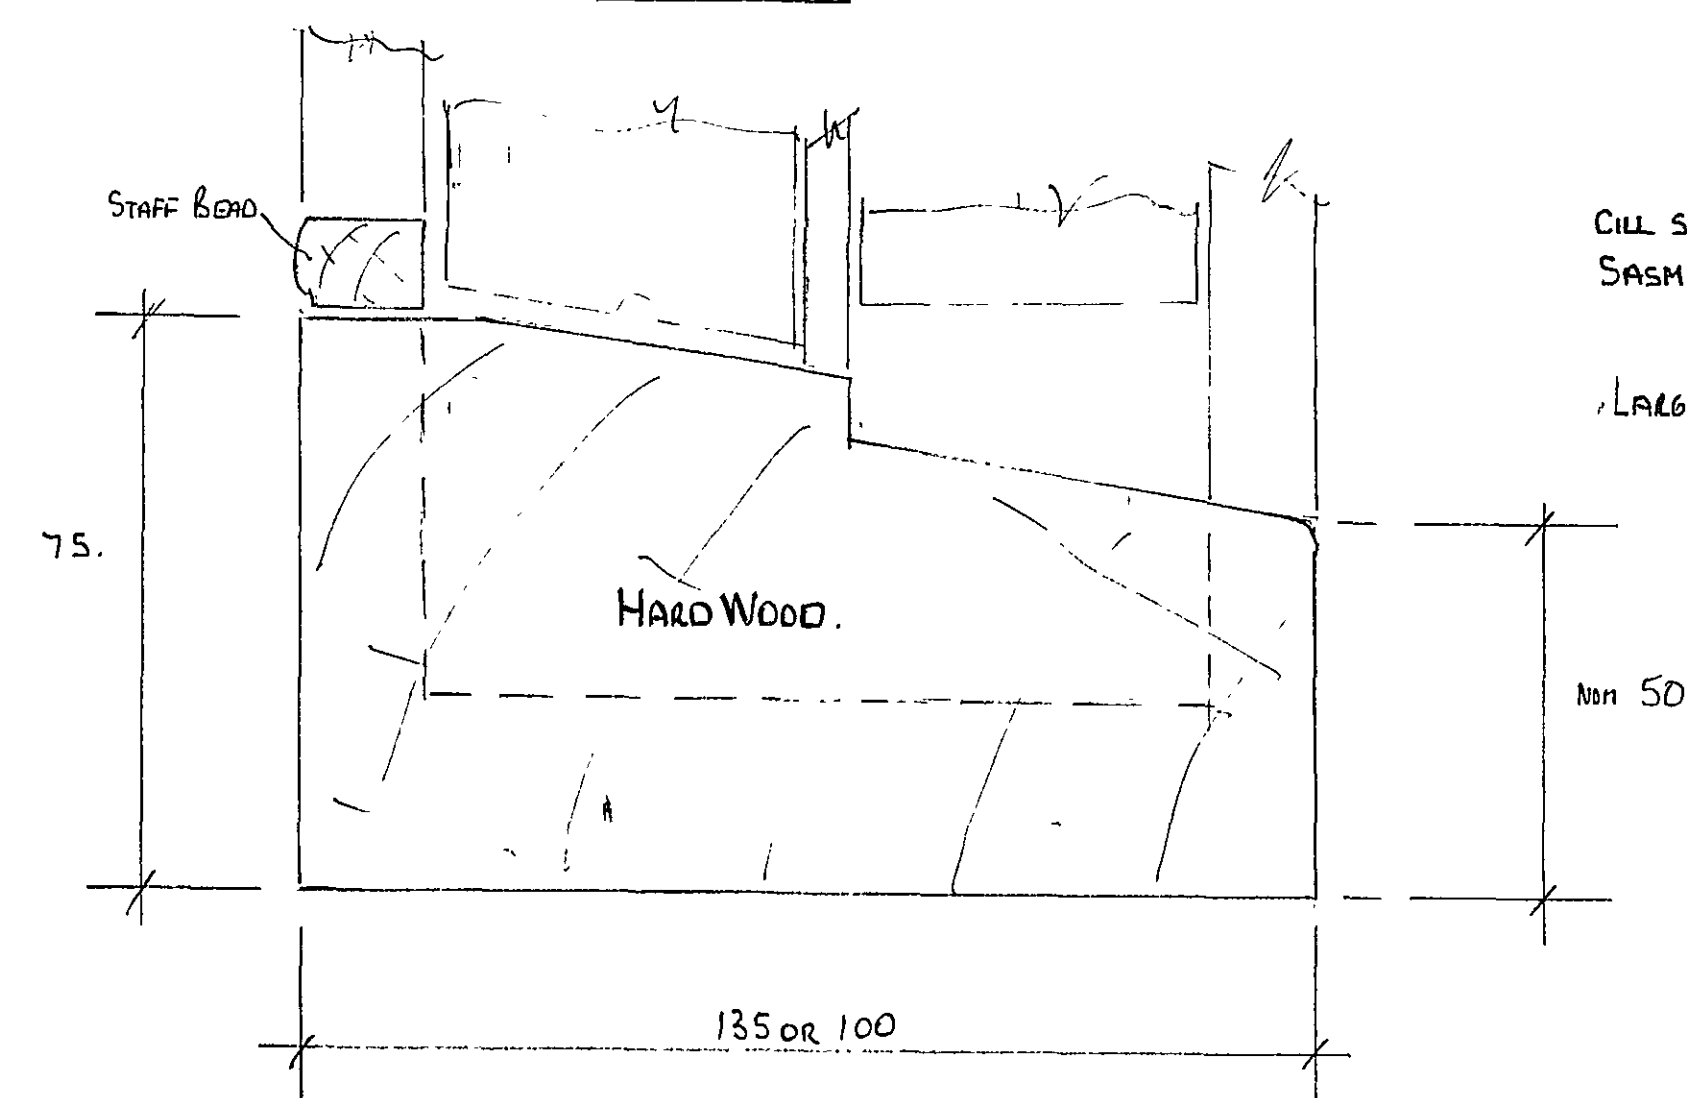

CILL SECTIONS TO SUIT WIDTH OF
SASH RAILS.

LARGER SIZE FOR W 9.10.15 & 16.

refer to drg. P.C.7 for schedule.

SHDC
Planning & Development
11 JUL 2007
Ref: 376/07