SI-492292

Monitoring Details:

Provider Name: CET

Instruction Date: 25/07/2022

Reading Date:

Date of Issue: 08/08/2023

Monitoring Interval: Every 8 weeks

Number of Visits: 7

Visits Completed: 6

Visits Outstanding: 1

Client Details:

Client: Sedgwick

Job Reference: 9581093

Engineer / Handler: Eloise Seale

Monitored Address:


Occupier: Mr. Christopher Longstaff

Address: Westbourne Lodge, Summerhouse & Coal House, 13 Cowbit Road, Spalding, PE11 2RD

Telephone: [redacted]

Email: -

Site Plan

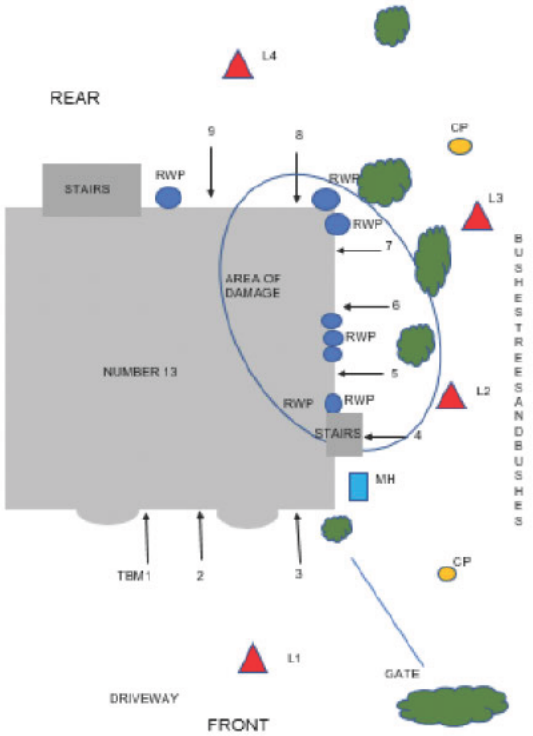
L4
REAR
9
8
CP
STAIRS
RWP
RWP
RWP
L3
7
AREA OF DAMAGE
6
RWP
NUMBER 13
5
RWP
RWP
L2
STAIRS
4
MH
BUSHES TREES AND BUSHES
TBM 1
2
3
CP
L1
GATE
DRIVEWAY
FRONT

Visit Notes

Visit	Surveyors Note
Visit 1	
Visit 2	
Visit 3	
Visit 4	
Visit 5	
Visit 6	
Visit 7	
Visit 8	
Visit 9	
Visit 10	

Level Readings


	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/10/22	05/12/22	31/01/23	05/04/23	15/06/23	08/08/23				
TBM1	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000				
2	9.9159	9.9152	9.9141	9.9157	9.9145	9.9161				
3	9.9551	9.9544	9.9535	9.9539	9.9542	9.9545				
4	8.5385	8.5403	8.5380	8.5340	8.5341	8.5401				
5	8.3129	8.3115	8.3111	8.3139	8.3150	8.3144				
6	8.1677	8.1689	8.1695	8.1676	8.1678	8.1680				
7	8.1608	8.1623	8.1585	8.1609	8.1607	8.1612				
8	8.0905	8.0912	8.0890	8.0903	8.0912	8.0913				
9	8.0349	8.0367	8.0334	8.0352	8.0365	8.0358				

SI-492292

Level Movement (Displayed in Millimeters)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/10/22	05/12/22	31/01/23	05/04/23	15/06/23	08/08/23				
TBM 1	0	0	0	0	0	0				
2	0	-0.7	-1.8	-0.2	-1.4	+0.2				
3	0	-0.7	-1.6	-1.2	-0.9	-0.6				
4	0	+1.8	-0.5	-4.5	-4.4	+1.6				
5	0	-1.4	-1.8	+1	+2.1	+1.5				
6	0	+1.2	+1.8	-0.1	+0.1	+0.3				
7	0	+1.5	-2.3	+0.1	-0.1	+0.4				
8	0	+0.7	-1.5	-0.2	+0.7	+0.8				
9	0	+1.8	-1.5	+0.3	+1.6	+0.9				

Level Readings Chart (Points TBM 1 - 9)

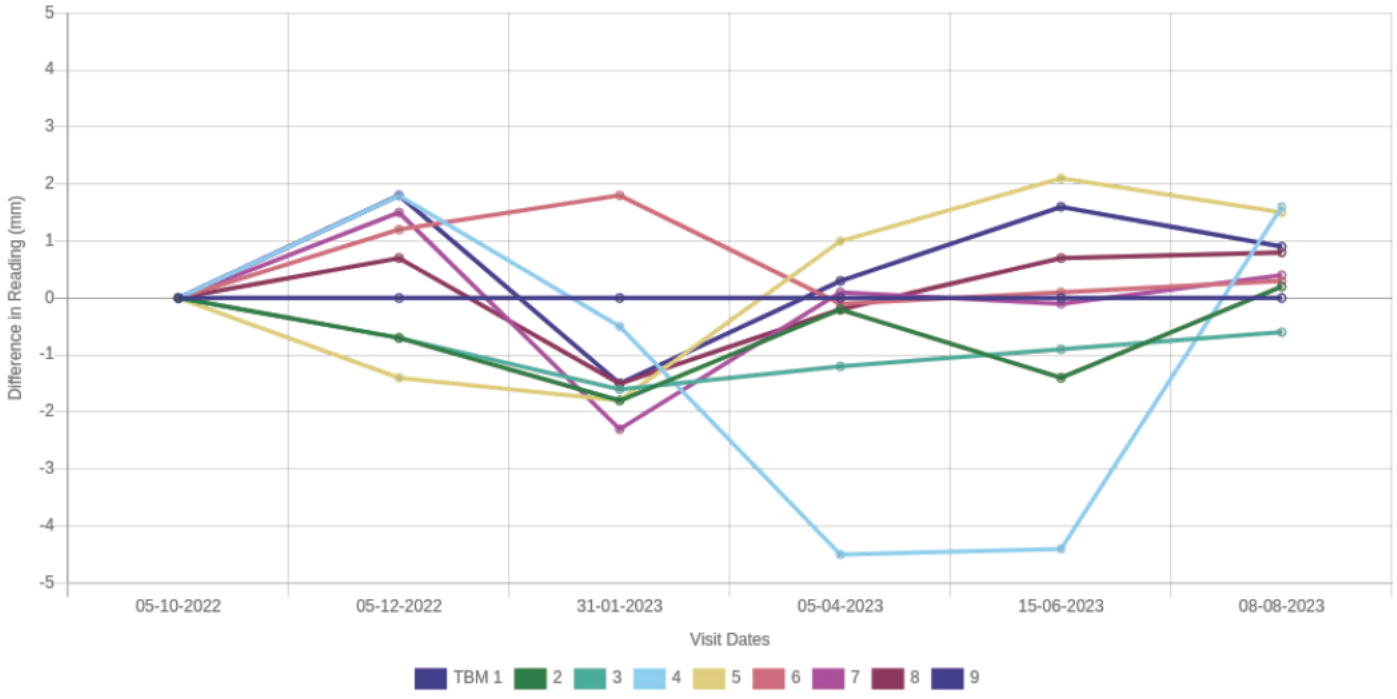

SI-492292


Crack Monitoring

EXT RHS by RWP low level

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	18/08/22	05/10/22	05/12/22	31/01/23	05/04/23	15/06/23	08/08/23			
H	76.36	76.52	76.66	76.48	76.43	76.7	76.61			
V	85.27	85.5	85.55	85.45	85.26	85.5	85.53			
C	84.11	84.11	84.24	84.12	83.99	84.08	84.09			

EXT RHS by RWP low level - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	18/08/22	05/10/22	05/12/22	31/01/23	05/04/23	15/06/23	08/08/23			
H	-0.16	0	0.14	-0.04	-0.09	0.18	0.09			
V	-0.23	0	0.05	-0.05	-0.24	0	0.03			
C	0	0	0.13	0.01	-0.12	-0.03	-0.02			

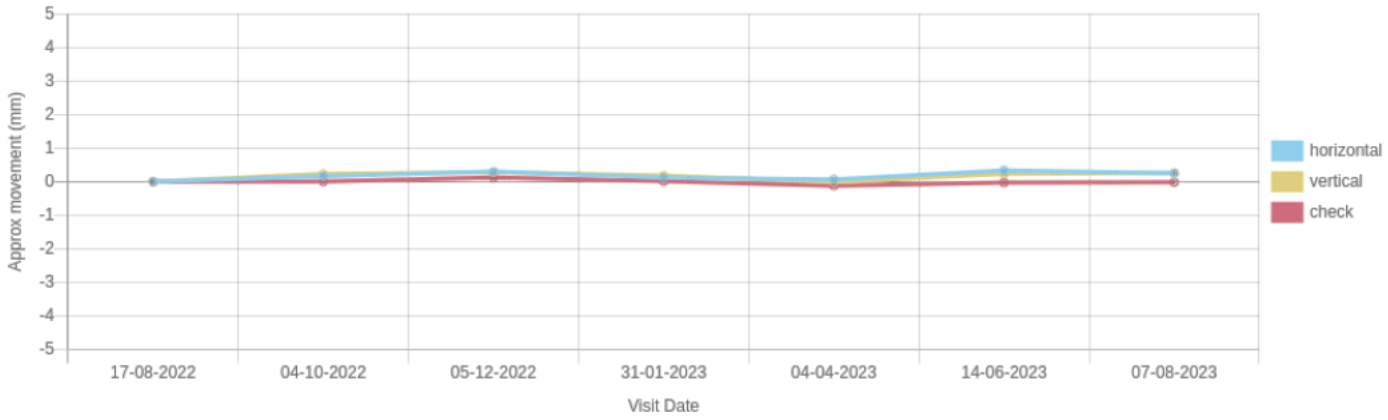

SI-492292


Crack Monitoring

INT airing cupboard window

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	18/08/22	05/10/22	05/12/22	31/01/23	05/04/23	15/06/23	08/08/23			
H	71.89	72.22	72.65	72.48	72.33	72.02	72.13			

INT airing cupboard window - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	18/08/22	05/10/22	05/12/22	31/01/23	05/04/23	15/06/23	08/08/23			
H	-0.33	0	0.43	0.26	0.11	-0.2	-0.09			

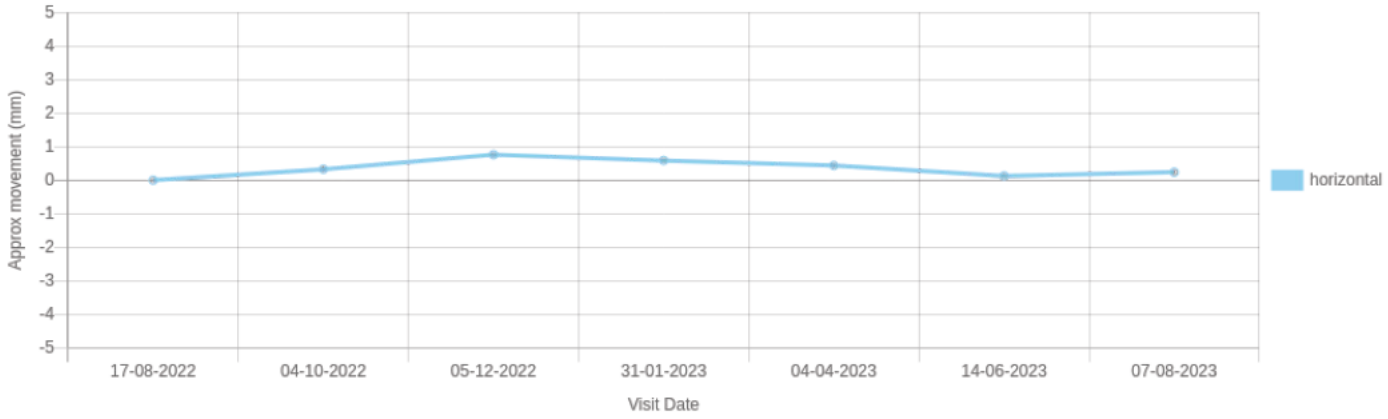

SI-492292

Crack Monitoring

INT RHS bedroom above window

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	18/08/22	05/10/22	05/12/22	31/01/23	05/04/23	15/06/23	08/08/23			
H	85.03	85.2	85.3	84.89	84.89	84.98	85.17			

INT RHS bedroom above window - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	18/08/22	05/10/22	05/12/22	31/01/23	05/04/23	15/06/23	08/08/23			
H	-0.17	0	0.1	-0.31	-0.31	-0.22	-0.03			

