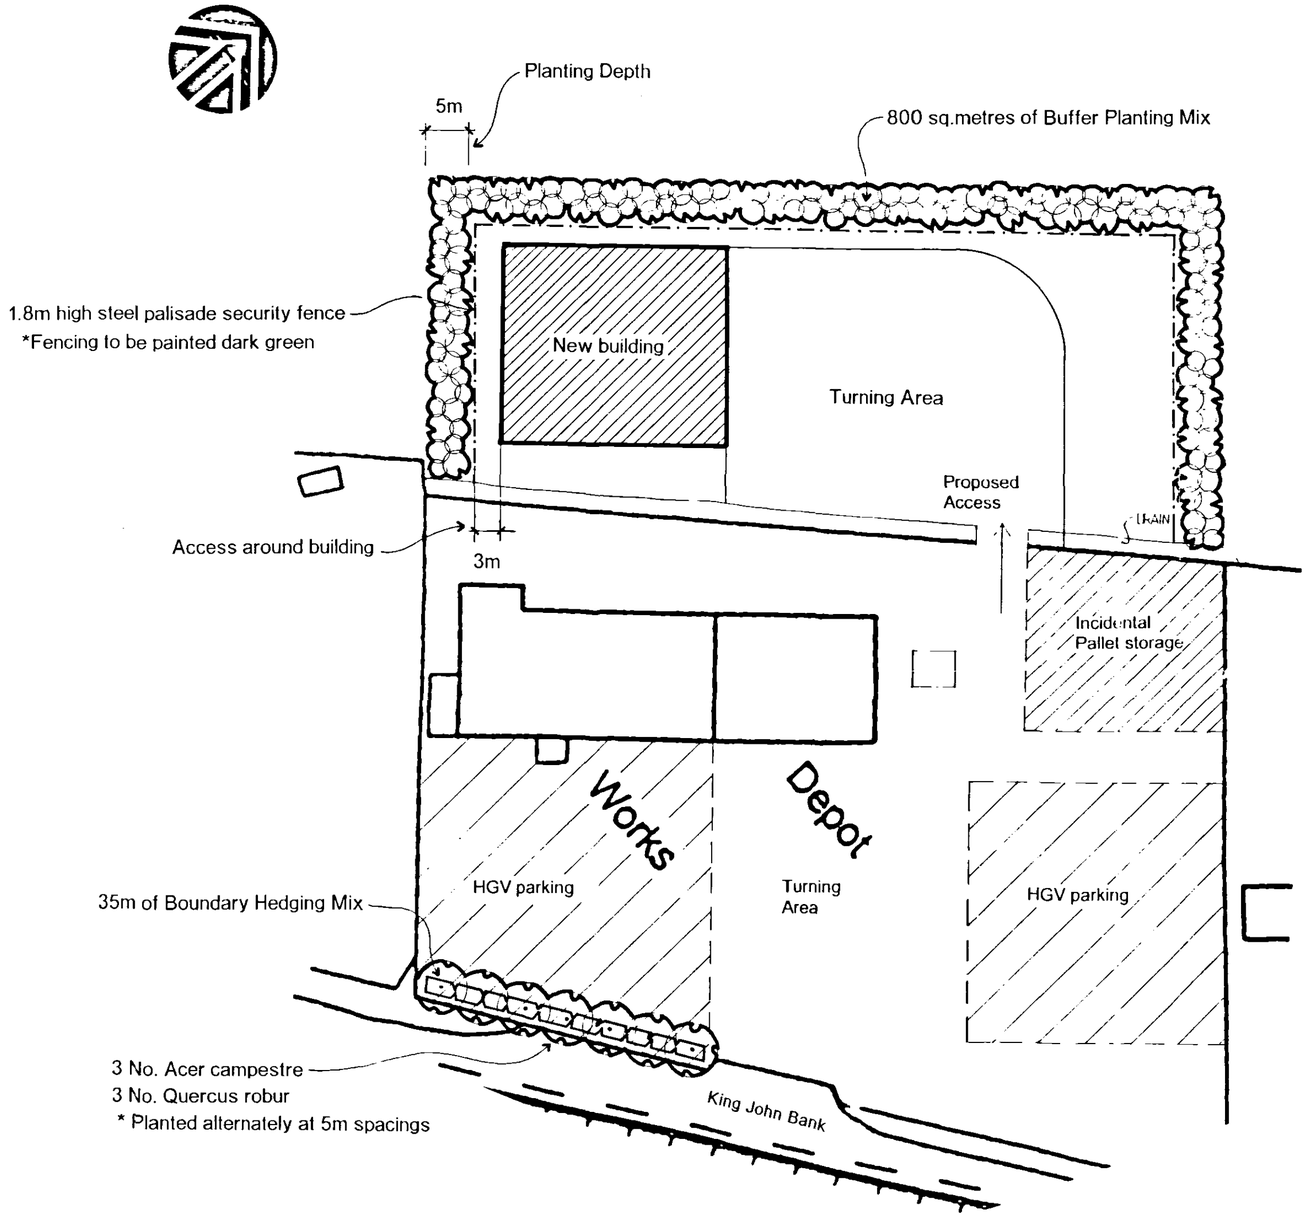


PLANTING SCHEDULE

BUFFER PLANTING MIX

FEATHERED TREES

Qty	Species	Form	Height (cm)	Root Condition	Min. No. of Breaks	No. of Transplants	% in Mix
9	Acer campestre	Feathered	200-250	Bare Root	5	2x	10
5	Populus tremula	Feathered	200-250	Bare Root	5	2x	5
5	Prunus avium	Feathered	175-200	Bare Root	5	2x	5
13	Quercus robur	Feathered	175-200	Root Ball	5	2x	15
SHRUB UNDERSTOREY							
120	Cornus sanguinea	Transplant	40-60	Bare Root	2	1 + 1	15
200	Crataegus monogyna	Transplant	60-80	Bare Root	-	1 + 1	25
40	Ilex aquifolium	Leader & laterals	60-80	3L Pot	-	-	5
120	Prunus spinosa	Transplant	60-80	Bare Root	2	1 + 1	15
40	Sambucus nigra	Transplant	60-80	Bare Root	3	1 + 1	5

Note: Trees to be planted at 3.0m ctrs in groups of 2-3 per species. Understorey at 1 per m^2 in groups of 5-10 per species.

BOUNDARY HEDGING MIX

Qty	Species	Form	Height (cm)	Root Condition	No. of Transplants	% in Mix
21	Acer campestre	Transplant	60-80	Bare Root	1 + 1	15
105	Crataegus monogyna	Pre-formed	60-80	Bare Root	1 + 1	75
7	Ilex aquifolium	Leader & laterals	60-80	3L Pot	-	5
7	Prunus spinosa	Transplant	60-80	Bare Root	1 + 1	5

Note: To be planted as a double staggered hedge with 500mm between plants and 500mm between rows.

STANDARD TREES

Qty	Species	Form	Height (cm)	Min no. of breaks	Root Condition
3	Acer Campestre	Heavy Standard	350-425	5	Root Ball
3	Quercus robur	Heavy Standard	250-425	5	Root Ball

AMENDED PLAN
Ref. A1

DRAWING
05 MAY 2005
ISSUED

08 MAY 2005
0423/05

DETERMINED PLAN

Rev A KTC Palisade Fence moved to inside of Planting. 05-05

THE ROBERT DOUGHTY CONSULTANCY LIMITED
TOWN AND COUNTRY PLANNING-LANDSCAPE ARCHITECTURE
32 High Street, Helpringham, Sleaford, Lincolnshire, NG34 0RA
Tel: (01529) 421646 Fax: (01529) 421358
Website: www.rdc-landplan.co.uk
E mail: admin@rdc-landplan.co.uk

Client: M C Salter & Sons

Project: Erection of HGV Repair Building, King John Bank

Drawing title: Landscape Detailing Plan

Job No.	Drawing No.	Rev.	Drawn
685	LD01		JC

Scale	Date	Checked
1:500	March 2005	

DO NOT SCALE from this drawing. All measurements should be checked against on site conditions and any discrepancies should be brought to the attention of the Robert Doughty Consultancy.