DRAINS 'R' US

C.C.T.V. SURVEY

SITE: Marsh Road
Holbeach Hurn

Please Note:
The measurements generated from the survey are only to be used as a guide / approximation of distance. Additional measurements should be taken before excavations etc. are carried out and we therefore accept no liability for any inaccuracies found.

NOTES:
Gully 2 & 4 are full of debris (silt etc.) & outlet is under water. Unable to survey.

Main run section SW1 U/S SW2 is 50%+ full of debris (silt etc.) & was unable to survey.

SW1 appears to be discharging towards field but again large amounts of debris in pipework. Unable to survey.


More investigation requiredto determine where outfall is.

PLAN VIEW

NOT TO SCALE

GUIDE ONLY

MARSH ROAD
HOLBEACH HURN

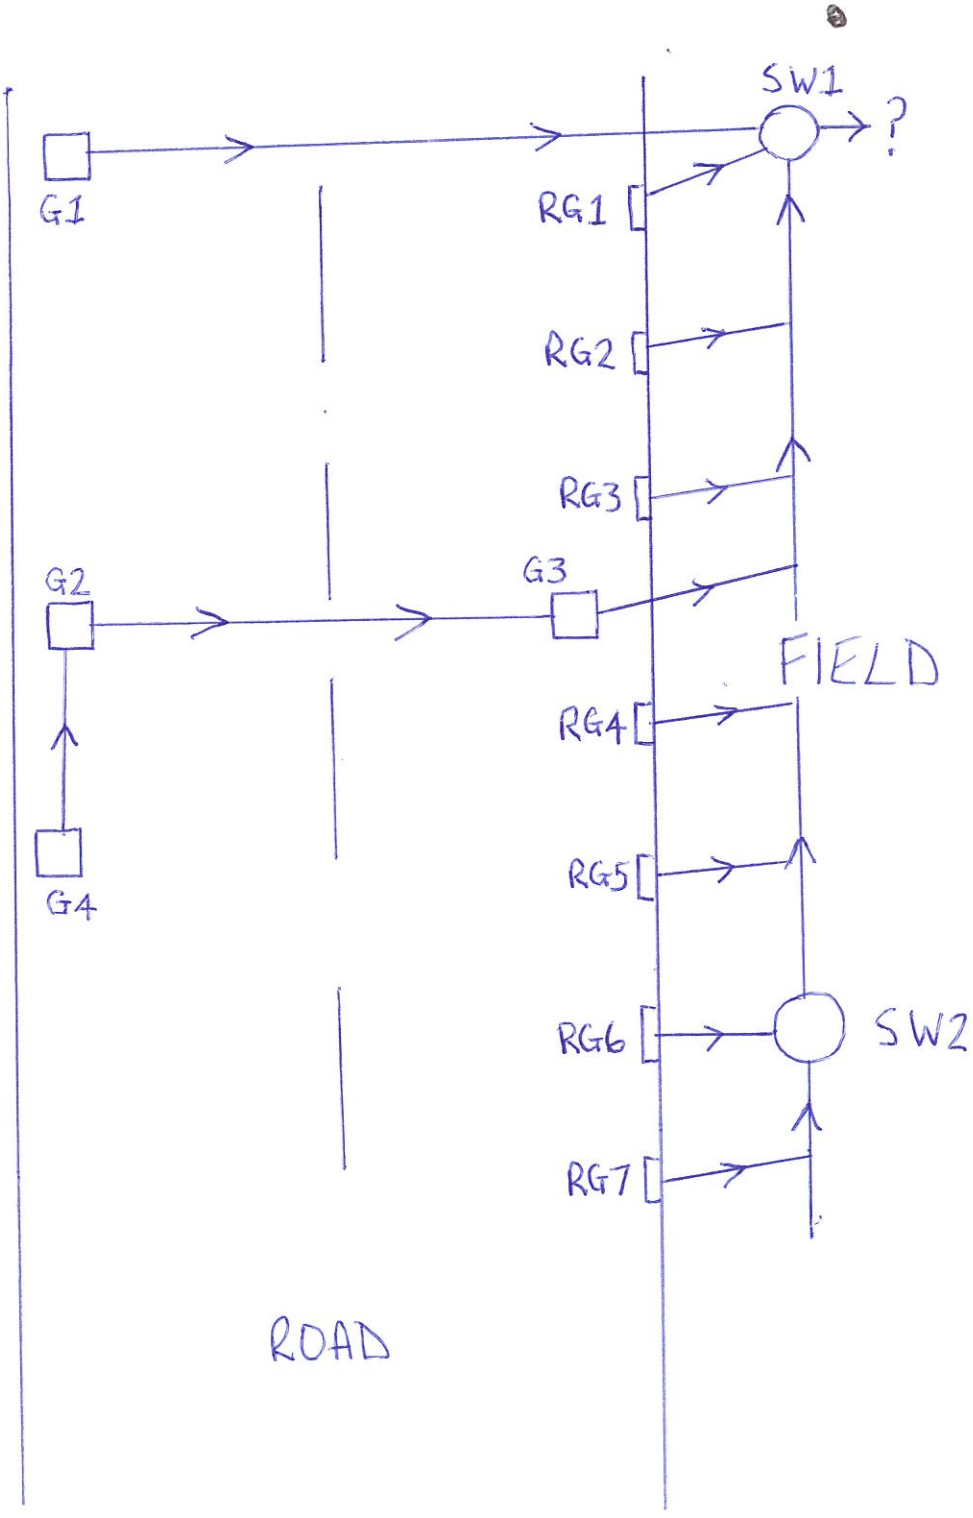


FIELD VIEW

HURN COTTAGE


DRAINS 'R' US (EASTERN) LTD INSPECTION REPORT			DRAINS 'R' US (EASTERN) LTD ROSE LODGE, WHAPLODE SPALDING, LINCS PE12 6WH TEL: 01406-423629 FAX: 01406-423628		
Date: 13.11.17	Job No: 1	Weather: Fine	Operator: T.Coote	Title: 1	PLR:
Present:	Vehicle: Van 2	Camera: Push Rod	Preset:	Cleaned: No	Grade:
Road: Marsh Road Town: Holbeach Hurn Location: Highway		Map No 1: Map No 2: Map No:		Start MH: SW1 End MH: G1 Length:	
Reason for Inspection: Survey Section Use: Storm Catchment:			Size/Shape: 6" Material: Plastic Lining:		
Remarks:					

Position:	Observation:
0.0 Metres	Start of survey
0.0 Metres	Debris in pipework (silt) 20% area loss
5.4 Metres	Roots in pipework 5 o'clock 5% area loss
6.5 Metres	Gully

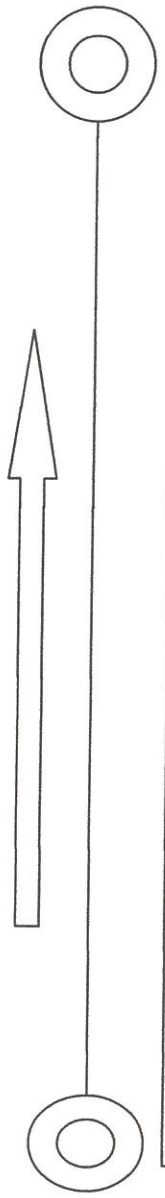


DRAINS 'R' US (EASTERN) LTD INSPECTION REPORT			DRAINS 'R' US (EASTERN) LTD ROSE LODGE, WHAPLODE SPALDING, LINCS PE12 6WH TEL: 01406-423629 FAX: 01406-423628		
Date: 13.11.17	Job No: 1	Weather: Fine	Operator: T.Coote	Title: 2	PLR:
Present:	Vehicle: Van 2	Camera: Push Rod	Preset:	Cleaned: No	Grade:
Road: Marsh Road Town: Holbeach Hurn Location: Highway		Map No 1: Map No 2: Map No:		Start MH: SW1 End MH: RG1 Length:	
Reason for Inspection: Survey Section Use: Storm Catchment:			Size/Shape: 6" Material: Saltglaze Lining:		
Remarks:					

Position:	Observation:
0.0 Metres	Start of survey
0.0 Metres	Pipe work broken & missing
0.1 Metres	Pipe work collapsed

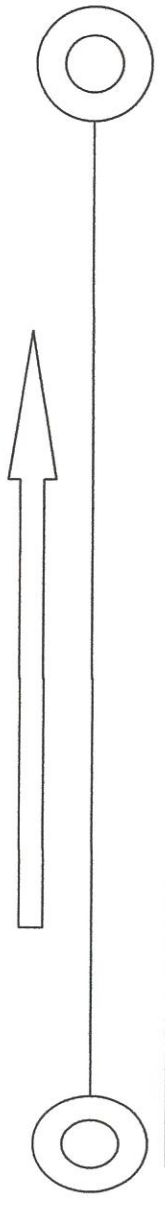

DRAINS 'R' US (EASTERN) LTD INSPECTION REPORT			DRAINS 'R' US (EASTERN) LTD ROSE LODGE, WHAPLODE SPALDING, LINCS PE12 6WH TEL: 01406-423629 FAX: 01406-423628		
Date: 13.11.17	Job No: 1	Weather: Fine	Operator: T.Coote	Title: 3	Invert:
Present:	Vehicle: Van 2	Camera: Push Rod	Preset:	Cleaned: No	Grade:
Road: Marsh Road Town: Holbeach Hurn Location: Highway		Map No 1: Map No 2: Map No:		Start MH: RG2 End MH: SW1 (main run) Length:	
Reason for Inspection: Survey Section Use: Storm Catchment:			Size/Shape: 4" Material: Saltglaze Lining:		
Remarks:					


Position: **Observation:**

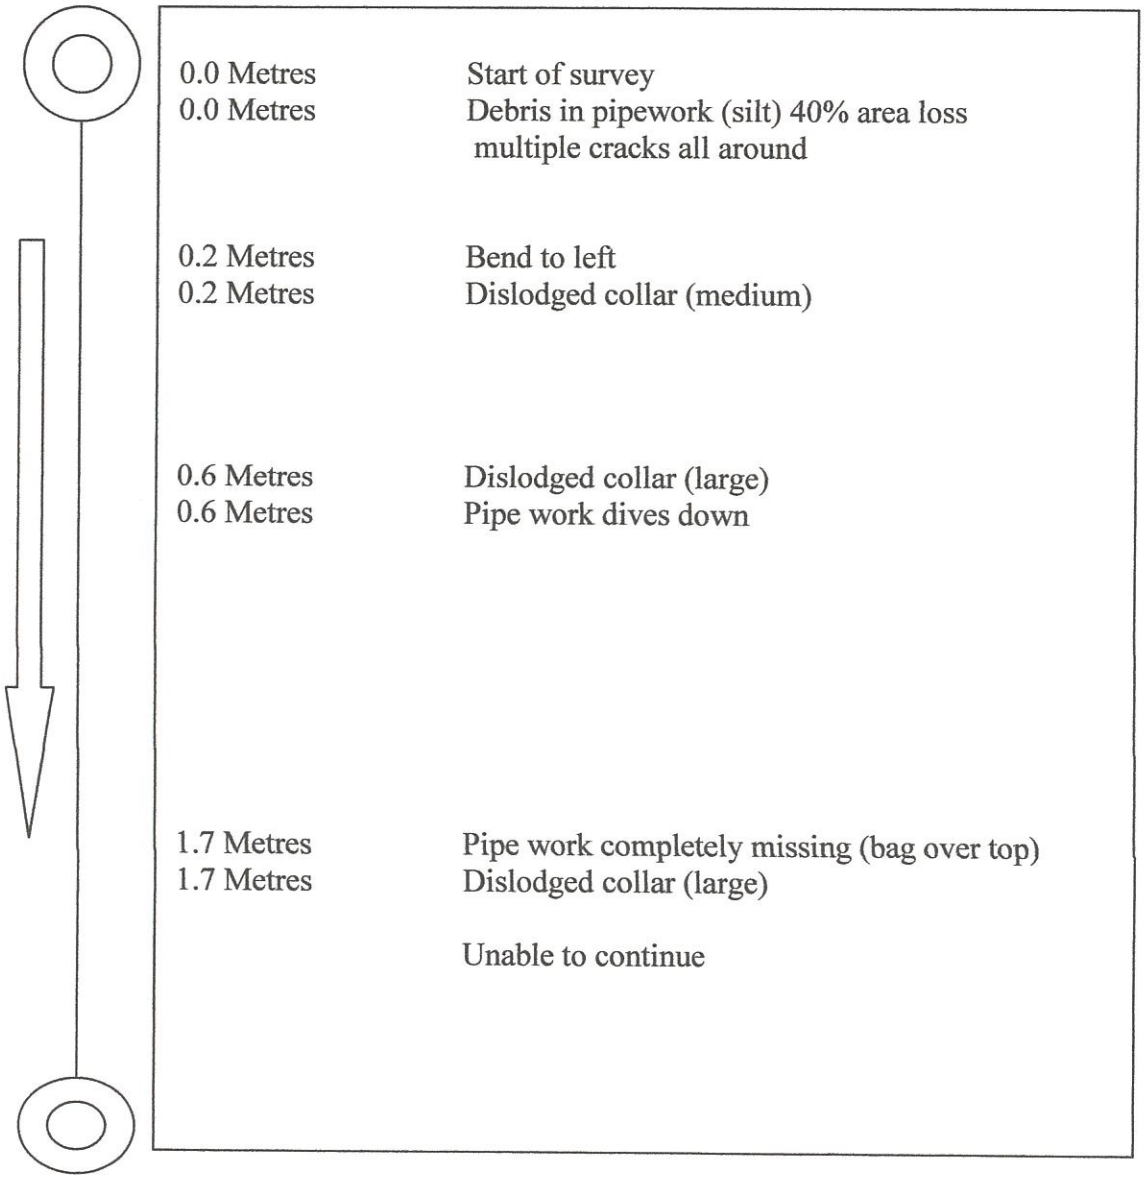

0.0 Metres	Start of survey
0.0 Metres	Debris in pipework (silt) 40% area loss multiple cracks all around
0.2 Metres	Bend to left
0.2 Metres	Dislodged collar (medium)
0.6 Metres	Dislodged collar (large)
0.6 Metres	Pipe work dives down
1.7 Metres	Pipe work completely missing (bag over top)
1.7 Metres	Dislodged collar (large)
	Unable to continue

DRAINS 'R' US (EASTERN) LTD INSPECTION REPORT			DRAINS 'R' US (EASTERN) LTD ROSE LODGE, WHAPLODE SPALDING, LINCS PE12 6WH TEL: 01406-423629 FAX: 01406-423628		
Date: 13.11.17	Job No: 1	Weather: Fine	Operator: T.Coote	Title: 4	Invert:
Present:	Vehicle: Van 2	Camera: Push Rod	Preset:	Cleaned: No	Grade:
Road: Marsh Road Town: Holbeach Hurn Location: Highway		Map No 1: Map No 2: Map No:		Start MH: RG3 End MH: SW1 (main run) Length:	
Reason for Inspection: Survey Section Use: Storm Catchment:			Size/Shape: 4" Material: Saltglaze Lining:		
Remarks:					


Position: **Observation:**

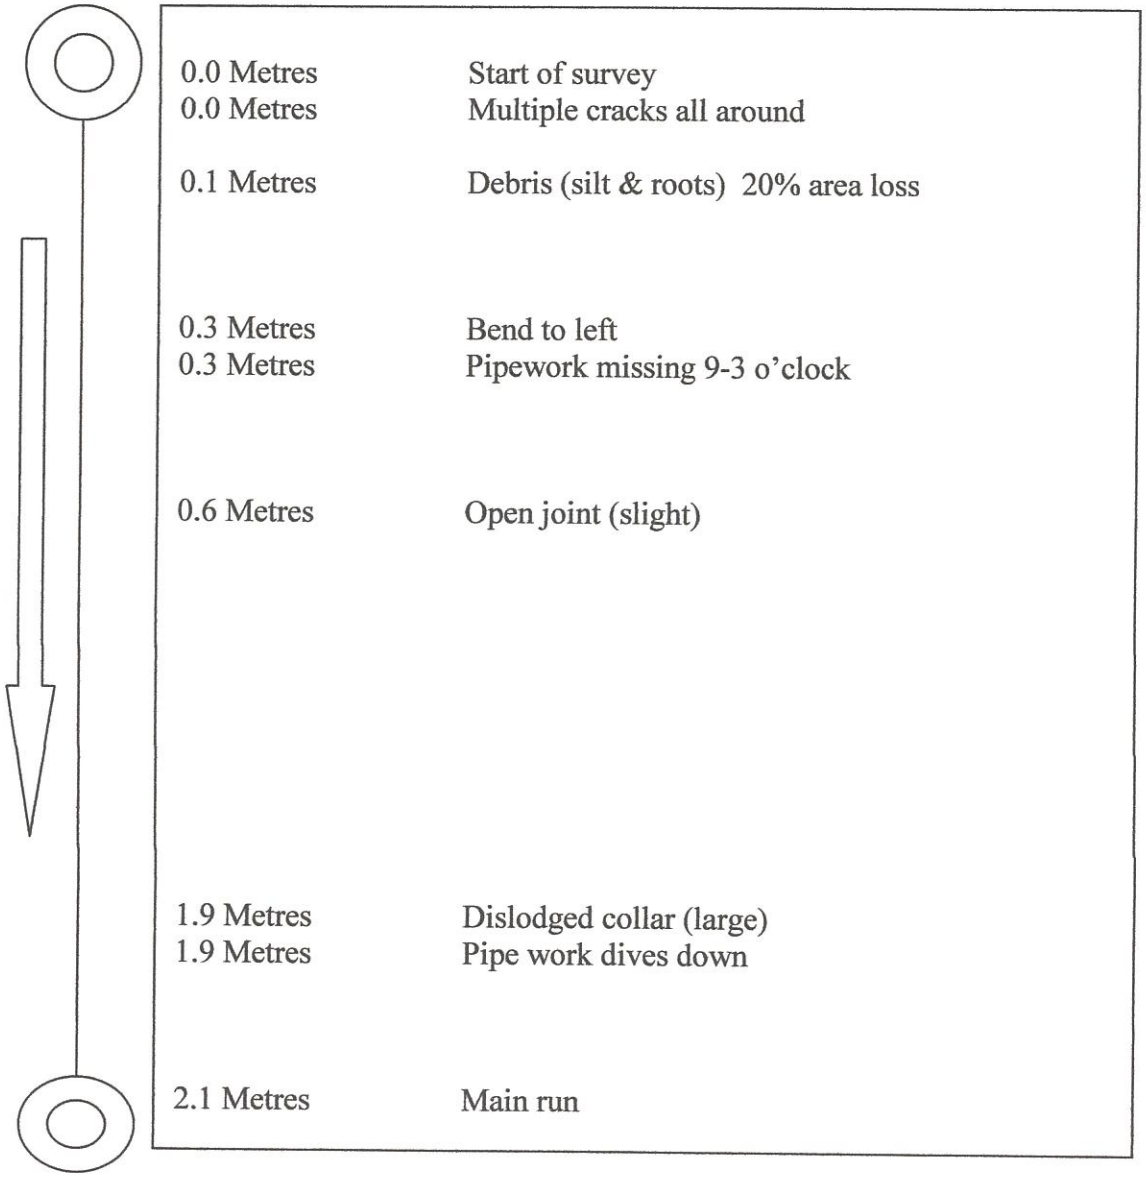

0.0 Metres	Start of survey
0.0 Metres	Multiple cracks all around
0.1 Metres	Debris (silt & roots) 20% area loss
0.3 Metres	Bend to left
0.3 Metres	Pipework missing 9-3 o'clock
0.6 Metres	Open joint (slight)
1.9 Metres	Dislodged collar (large)
1.9 Metres	Pipe work dives down
2.1 Metres	Main run

DRAINS 'R' US (EASTERN) LTD INSPECTION REPORT			DRAINS 'R' US (EASTERN) LTD ROSE LODGE, WHAPLODE SPALDING, LINCS PE12 6WH TEL: 01406-423629 FAX: 01406-423628		
Date: 13.11.17	Job No: 1	Weather: Fine	Operator: T.Coote	Title: 5	Invert:
Present:	Vehicle: Van 2	Camera: Push Rod	Preset:	Cleaned: No	Grade:
Road: Marsh Road Town: Holbeach Hurn Location: Highway		Map No 1: Map No 2: Map No:		Start MH: RG4 End MH: SW1 (main run) Length:	
Reason for Inspection: Survey Section Use: Storm Catchment:			Size/Shape: 4" Material: Saltglaze Lining:		
Remarks:					


Position: **Observation:**

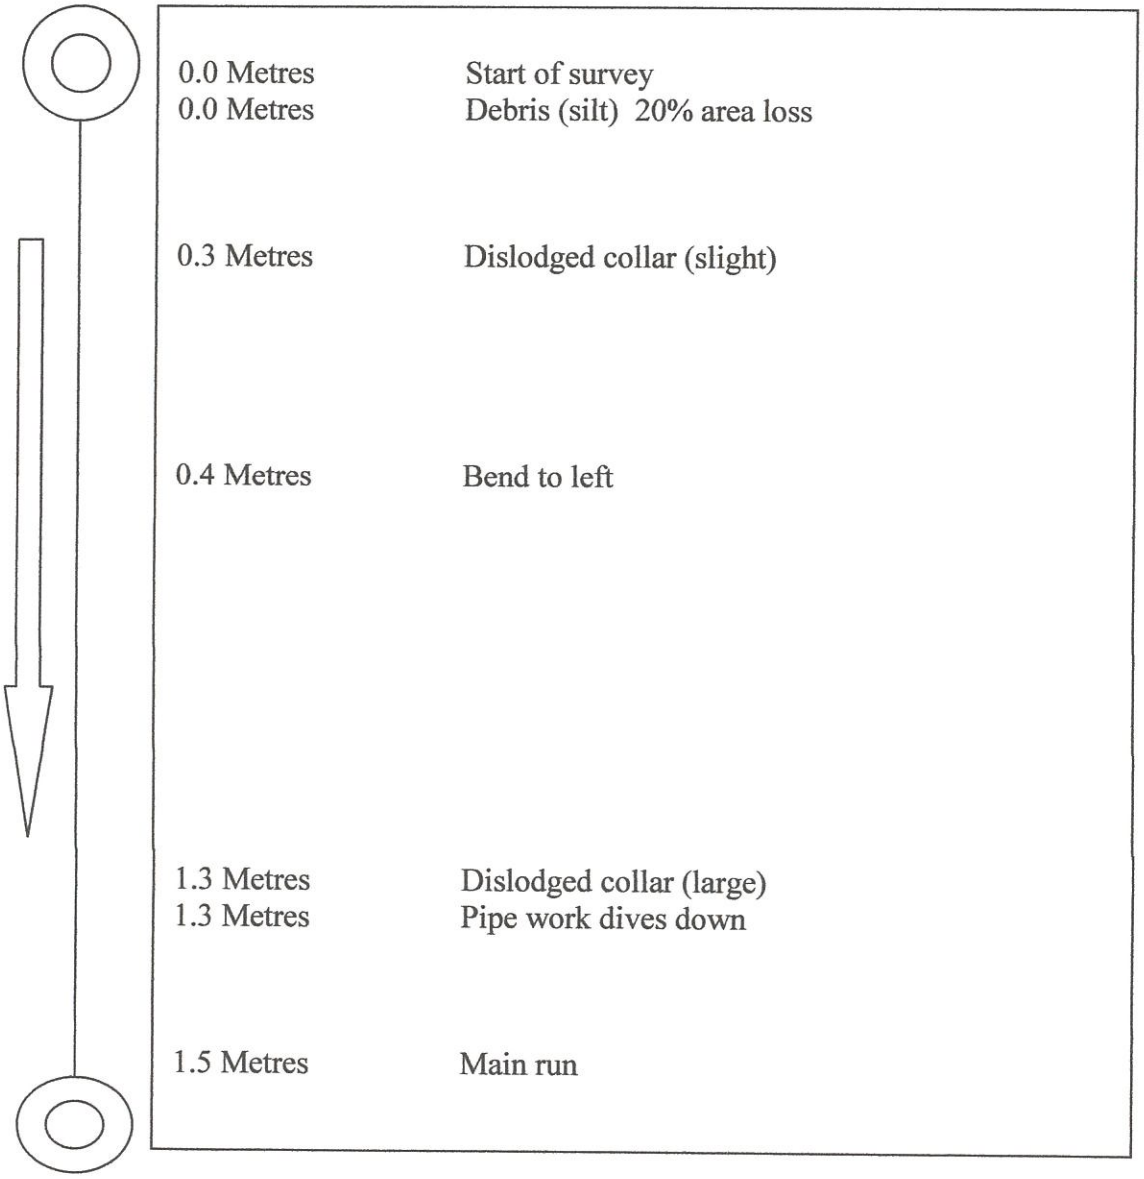

0.0 Metres	Start of survey
0.0 Metres	Debris (silt) 20% area loss
0.3 Metres	Dislodged collar (slight)
0.4 Metres	Bend to left
1.3 Metres	Dislodged collar (large)
1.3 Metres	Pipe work dives down
1.5 Metres	Main run

DRAINS 'R' US (EASTERN) LTD INSPECTION REPORT			DRAINS 'R' US (EASTERN) LTD ROSE LODGE, WHAPLODE SPALDING, LINCS PE12 6WH TEL: 01406-423629 FAX: 01406-423628		
Date: 13.11.17	Job No: 1	Weather: Fine	Operator: T.Coote	Title: 6	Invert:
Present:	Vehicle: Van 2	Camera: Push Rod	Preset:	Cleaned: No	Grade:
Road: Marsh Road Town: Holbeach Hurn Location: Highway		Map No 1: Map No 2: Map No:		Start MH: RG5 End MH: SW1 (main run) Length:	
Reason for Inspection: Survey Section Use: Storm Catchment:			Size/Shape: 4" Material: Saltglaze Lining:		
Remarks:					


Position: **Observation:**

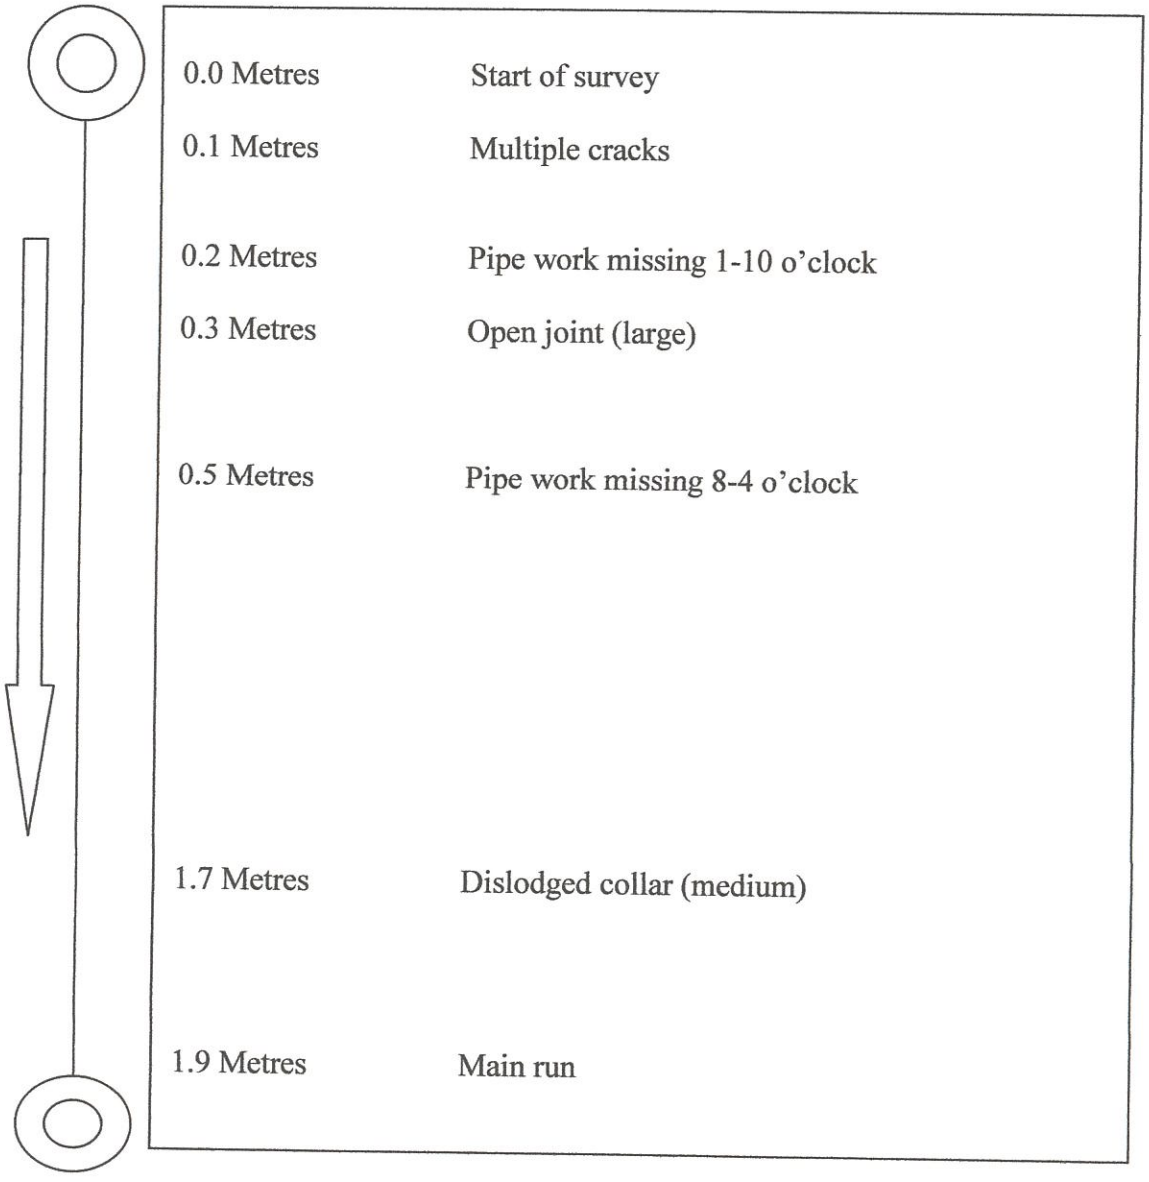

0.0 Metres	Start of survey
0.1 Metres	Multiple cracks
0.2 Metres	Pipe work missing 1-10 o'clock
0.3 Metres	Open joint (large)
0.5 Metres	Pipe work missing 8-4 o'clock
1.7 Metres	Dislodged collar (medium)
1.9 Metres	Main run

DRAINS 'R' US (EASTERN) LTD INSPECTION REPORT			DRAINS 'R' US (EASTERN) LTD ROSE LODGE, WHAPLODE SPALDING, LINCS PE12 6WH TEL: 01406-423629 FAX: 01406-423628		
Date: 13.11.17	Job No: 1	Weather: Fine	Operator: T.Coote	Title: 7	Invert:
Present:	Vehicle: Van 2	Camera: Push Rod	Preset:	Cleaned: No	Grade:
Road: Marsh Road Town: Holbeach Hurn Location: Highway		Map No 1: Map No 2: Map No:		Start MH: RG6 End MH: SW2 Length:	
Reason for Inspection: Survey Section Use: Storm Catchment:			Size/Shape: 6" Material: Saltglaze Lining:		
Remarks:					


Position: **Observation:**

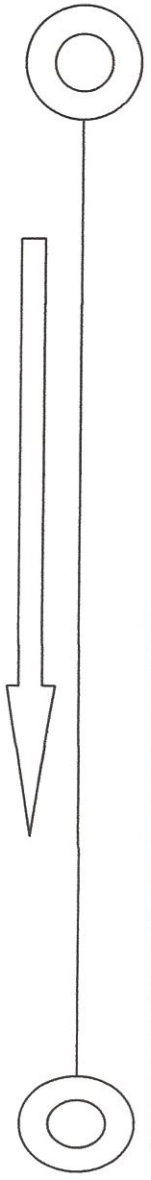

0.0 Metres	Start of survey
0.0 Metres	Tree roots in pipework 30% area loss
0.5 Metres	Dislodged collar (large)
1.1 Metres	Manhole

DRAINS 'R' US (EASTERN) LTD INSPECTION REPORT			DRAINS 'R' US (EASTERN) LTD ROSE LODGE, WHAPLODE SPALDING, LINCS PE12 6WH TEL: 01406-423629 FAX: 01406-423628		
Date: 13.11.17	Job No: 1	Weather: Fine	Operator: T.Coote	Title: 8	Invert:
Present:	Vehicle: Van 2	Camera: Push Rod	Preset:	Cleaned: No	Grade:
Road: Marsh Road Town: Holbeach Hurn Location: Highway		Map No 1: Map No 2: Map No:		Start MH: RG7 End MH: 2 (main run) Length:	
Reason for Inspection: Survey Section Use: Storm Catchment:			Size/Shape: 6" Material: Plastic/ribbed Lining:		
Remarks:					


Position: **Observation:**

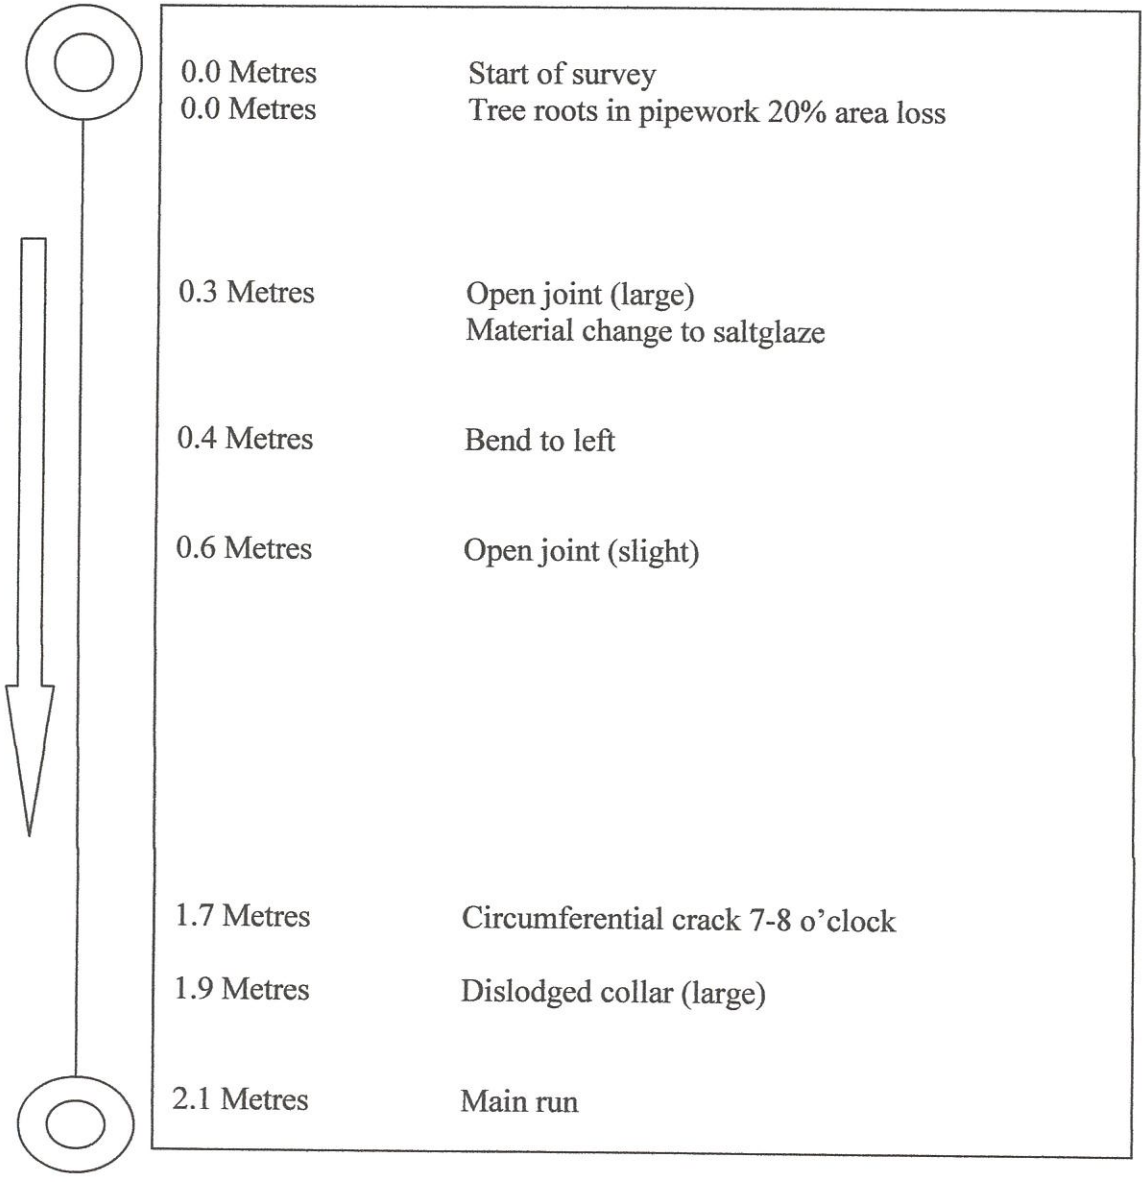

0.0 Metres	Start of survey
0.0 Metres	Tree roots in pipework 20% area loss
0.3 Metres	Open joint (large) Material change to saltglaze
0.4 Metres	Bend to left
0.6 Metres	Open joint (slight)
1.7 Metres	Circumferential crack 7-8 o'clock
1.9 Metres	Dislodged collar (large)
2.1 Metres	Main run

DRAINS 'R' US (EASTERN) LTD INSPECTION REPORT			DRAINS 'R' US (EASTERN) LTD ROSE LODGE, WHAPLODE SPALDING, LINCS PE12 6WH TEL: 01406-423629 FAX: 01406-423628		
Date: 13.11.17	Job No: 1	Weather: Fine	Operator: T.Coote	Ti9le: 8	Invert:
Present:	Vehicle: Van 2	Camera: Push Rod	Preset:	Cleaned: No	Grade:
Road: Marsh Road Town: Holbeach Hurn Location: Highway		Map No 1: Map No 2: Map No:		Start MH: G3 End MH: SW1 (main run) Length:	
Reason for Inspection: Survey Section Use: Storm Catchment:			Size/Shape: 6" Material: Saltglazed Lining:		
Remarks:					

Position: **Observation:**

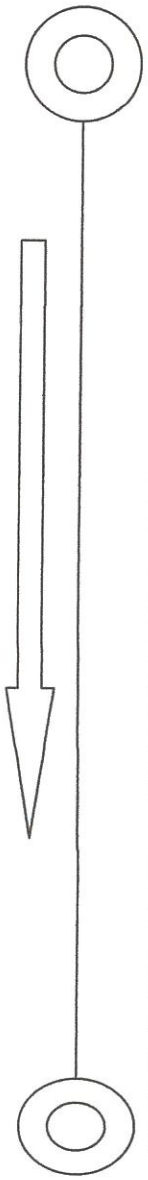

0.0 Metres	Start of survey
0.0 Metres	Water level 40% height/diameter
0.1 Metres	Debris (silt & roots) 90% area loss
	Unable to continue