

## Health and Safety Notes:

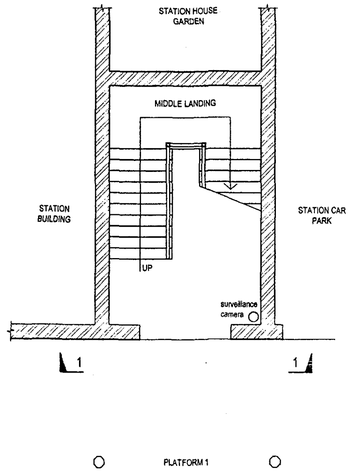



PLAN AT PLATFORM 1 LEVEL

SCALE 1:75

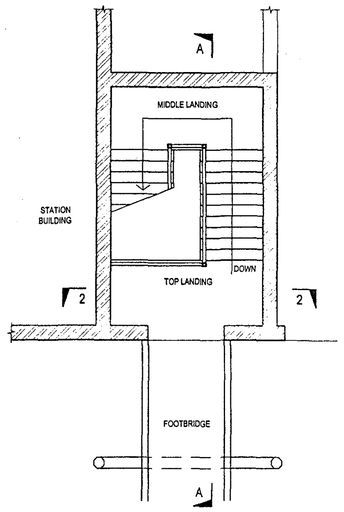


PLAN AT BRIDGE LEVEL


SCALE 1:75

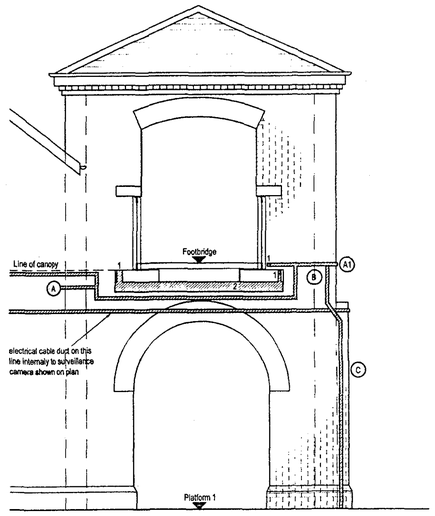


Position of services
A Surveillance camera
A1 Surveillance camera to side wall
B Station anouncement speaker
C Light to side wall
1 Point at which services run along walkway girders
2 Point at which services enter building

ELEVATION 1-1
LOCATION OF SERVICES


SCALE 1:50

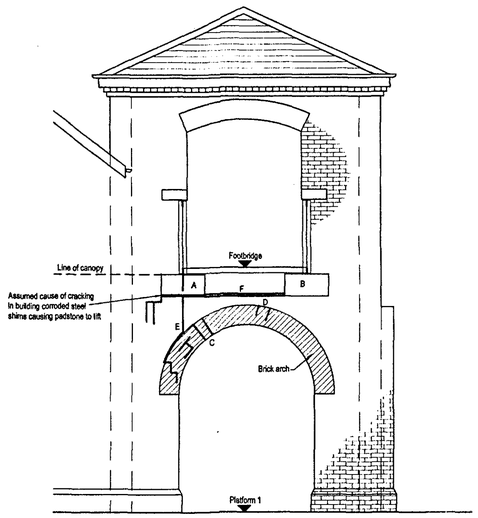


Location of cracks in wall
A Padstone 700x370 deep 40mm gap under
B Padstone 700x360 deep
C Cracks in arch wider at bottom
D Radial cracks wider at top
E 3mm Crack through joints and bricks
F Brickwork between padstones lifted up

ELEVATION 1-1
DEFECTS AT PLATFORM LEVEL


SCALE 1:50

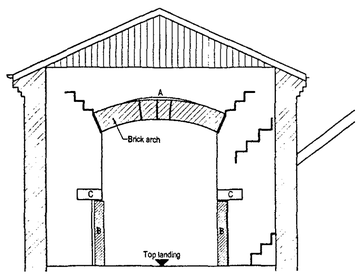


Location of cracks in wall
A 3mm gap above arch
B Footbridge girders supported on padstones below
C Corbel stones being lifted by footbridge girders

ELEVATION 2-1
DEFECTS AT FOOTBRIDGE LEVEL

SCALE 1:50

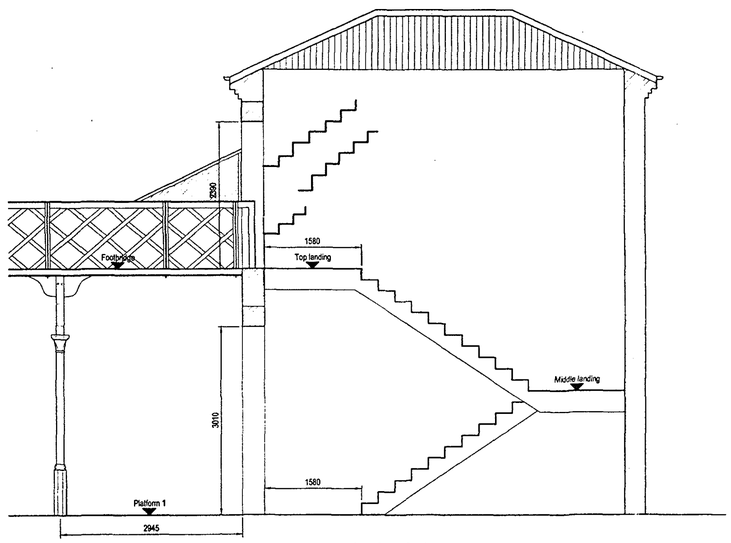


Location of cracks in wall

SECTION A-A
DEFECTS TO SIDE WALL AT FOOTBRIDGE LEVEL

SCALE 1:50

SHDC
Planning & Development
25 OCT 2004
Ref: 1435/04

Notes:

1. All working dimensions to be checked on site.
2. Do not scale.
3. Any discrepancies between drawings of different scales, and between drawings and specification where appropriate to be notified to The Engineer for decision.
4. Copyright reserved. This drawing may only be used for The Client and location specified in the title block. It may not be copied or disclosed to any third party without the prior written consent of John Newton and Partners.
5. Prior to any work being commenced on site, The Engineer should be contacted regarding the current status or regulatory technical approval of this drawing.

| Rev. | Date | Amendment | By | Chk. |
|---|---|---|---|---|
| | | | | |

Status: FORM B


**John Newton & Partners**
*Consulting Civil, Structural & Environmental Engineers*
Woodvale House
Woodvale Road
Brighouse
West Yorkshire HD6 4AB
Tel: (01484) 400691
Fax: (01484) 400696
brighouse@jnpgroup.co.uk
Amersham • Brighouse • Leamington Spa • Sheffield
www.jnpgroup.co.uk
Residential Industrial Commercial Retail Leisure Waste
Education & Health Sewerage Highways Contaminated Land


| | |
|---|---|
| Client | C. SPENCER LTD |
| Job | SPALDING STATION<br>PLATFORM REFURBISHMENT |
| Title | EXISTING DEFECTS TO STAIR TOWER<br>TO FOOTBRIDGE ON PLATFORM 1 |
| Drawn By | DG |
| Date | 09.08.04 |
| Eng. Check | MJW |
| Tech. Check | |
| Scale | As Shown at A1 |

BM TRADA CERTIFICATION ISO 9001:2000 UKAS QUALITY MANAGEMENT 012

| Drawing No. | Rev. |
|---|---|
| NG6096/SPA-05 | |

DETERMINED