



EARTH ENVIRONMENTAL
& GEOTECHNICAL



PHASE I DESK TOP STUDY

MULBERRY BARN

TORRINGTON LANE

REPORT REF: R0160/19

FEBRUARY 2019



Earth Environmental & Geotechnical
(Southern) Ltd
9 Greyfriars Road,
Reading,
Berkshire
RG1 1NU

Tel : 0118370730

Email info@earthenvironmental.co.uk
www.earthenvironmental.co.uk

PHASE 1 DESK TOP STUDY

MULBERRY BARN

TORRINGTON LANE

Report Ref: R0160/19

FEBRUARY 2019

Prepared on Behalf of:

Jamie Simmons

By:

Earth Environmental & Geotechnical (Southern) Ltd
9 Greyfriars road
Reading
Berkshire
RG1 1NU

DISTRIBUTION:

1 Electronic copy **Jamie Simmons**

Phase 1 Desk Top Study

MULBERRY BARN, TORRINGTON LANE

Report Reference: R0160/19

Version B.0

Date: 10th February 2019

Prepared for: Jamie Simmons

Prepared by: Earth Environmental & Geotechnical (Southern) Ltd
9 Greyfriars road
Reading
Berkshire
RG11NU

Definition of Version Code:

- D. Applied during initial drafting of the report before it has been reviewed.
- C. Applied after the report has been reviewed but before it has been approved by the Project Manager.
- B. Applied after the Project Manager has approved the report ready for issue to the client.
- A. Applied to reports after external/internal review.

The version number starts at "0" and is raised by "1" at each re-type.

Written by:



Ruta Praneviciute
Geo-Environmental Consultant

Approved by:



John Grace
Regional Director

CONTENTS

1.0	INTRODUCTION	4
	Background	4
	Terms of Reference	4
	Sources of Information	4
	Limitations of the Study	4
2.0	THE SITE	6
	Site Location and Description	6
	Site Utility Services	9
	Proposed Development	9
3.0	ENVIRONMENTAL SETTING	10
	Geology	10
	Ground Workings	10
	Mining and Other Underground Workings	10
	Radon Potential	10
	Hydrogeology and Hydrology	11
	Landfill and Waste Management Activity	11
	Environmental Permits, Incidents and Registers	11
	Industrial Land Use Information	11
	Environmentally Sensitive Sites	12
	Archaeology	12
	Potential Flood Risks	12
	Previous Site Investigations	12
4.0	SITE HISTORY	13
5.0	PRELIMINARY RISK ASSESSMENT AND CONCEPTUAL SITE MODEL	14
	Introduction	14
	Potential Sources	15
	Potential Receptors	15
	Potential Pathways	15
6.0	PRELIMINARY RISK ASSESSMENT	17
7.0	CONCLUSIONS AND RECOMMENDATIONS	18

APPENDICES

Appendix 1	Geo Insight Report
Appendix 2	Enviro Insight Report
Appendix 3	Report Limitations

TABLES

Table 1	Environmental Permits, Incidents and Registers
Table 2	Summary of Site History
Table 3	Consequence, Probability and Risk
Table 4	Estimation of Level of Risk by Comparison of Consequence and Probability
Table 5	Preliminary Conceptual model

FIGURES

- | | |
|----------|---|
| Figure 1 | Aerial Photograph Showing Site Location |
| Figure 2 | View from the East of Site Looking West Towards the Barn |
| Figure 3 | Photograph Showing the Current Barn Present on Site |
| Figure 4 | View from the Centre of Site Looking South |
| Figure 5 | Photograph Showing the Eastern Area of Site with the Pond and Ditch Running South |

1.0 INTRODUCTION

Background

- 1.1 Earth Environmental & Geotechnical was commissioned by Jamie Simmons (the Client) to undertake a Phase 1 Geo-Environmental Desk Study for the site known as Mulberry Barn, Torrington Lane, Fleet, Spalding.
- 1.2 It is understood the site is to be subject to redevelopment works with a proposed new residential end use.

Terms of Reference

- 1.3 EEGSL were commissioned by Jamie Simmons to undertake a Phase I Geo-Environmental Desk Study at the site in accordance with email correspondence on the 23rd January 2019.
- 1.4 The objectives of this assessment are:
- *Undertake a desk-based review of the underlying geology and hydrology, current and historical site uses, potential contamination sources, radon potential, natural cavities and mining risks. And*
 - *Assess the implications of any potential environmental risks, liabilities and development constraints associated with the site in relation to the future use and in relation to off-site receptors.*

Sources of Information

- 1.5 The Phase 1 Desk Study comprises of a review of the following information sources:
- British Geological Survey online maps.
 - Google Earth imagery.
 - Environment Agency online data.
 - Historical Ordnance Survey maps.
 - The site and surrounding areas environmental, geological and mining data presented in the site-specific Groundsure Reports (Appendix 1 & 2).

Limitations of the Study

- 1.6 The report is written in the context of an agreed scope of work and budget and should not be used in a different context. New information, improved practices or changes in legislation may require a reinterpretation of the report in whole or in part. EEGSL reserve the right to amend either conclusions or recommendations in light of any further information that may become available. This report is provided for the sole use by the client and is confidential to them.
- 1.7 Recommendations within this report are also based on records produced by others. It is assumed this information is accurate and no liability can be accepted for the accuracy of this

information.

2.0 THE SITE

Site Location and Description

- 2.1 The site is located along Torrington Lane in Fleet, Spalding. The approximate National Grid Reference for the centre of site is 538804,322856.
- 2.2 The site location is shown in Figure 1 below.

Figure 1: Aerial Photograph Showing Site Location



- 2.3 The site covers an area of approximately 0.41ha and is generally flat. A pond occupies the eastern extent of site and leads into a field drain which extends further to the south. The site is occupied by several small outbuildings and a dilapidated brick barn with a sheet metal roof.
- 2.4 The property is bordered on the north, west and south by open fields and to the east by Poplar Farm and Maisdyke House. The wider area is dominated by agricultural fields with few developments present.
- 2.5 Photographs showing the general layout of the assessment site are provided within figures 2 to 5.

Figure 2: View from the East of Site Looking West Towards the Barn



Figure 3: Photograph Showing the Current Barn Present on Site



Figure 4: View from the Centre of Site Looking South



Figure 5: Photograph Showing the Eastern Area of Site with the Pond and Ditch Running South



Site Utility Services

- 2.6 A site service plan has been not provided by the client. The status of all services should be checked with the statutory providers prior to any development (including site investigation) commencing.

Proposed Development

- 2.7 The proposed development consists of the conversion of the current barn into a residential property with associated access, parking and garden areas.

3.0 ENVIRONMENTAL SETTING

3.1 The geology of the site is covered by British Geological Survey (BGS) online data and the site-specific Groundsure Geo-Insight report (Appendix 1).

3.2 Environmental conditions are covered by Environment Agency (EA) and British Geological Survey (BGS) online data, and the site-specific Groundsure Enviro-Insight report (Appendix 2).

Geology

3.3 The BGS states that the site is directly underlain by the Tidal Flats Deposits (comprising Clay and Silt) which in turn are underlain by the Ampthill Clay Formation (Mudstone).

3.4 There are no records of linear geological features within 500m of the site.

3.5 There are no records of any landslip activity within 500m of the site boundary.

3.6 There are no BGS public borehole records available within 250m of the site.

3.7 The site is in an area where the hazard rating is negligible, very low or Low with regard to landslides, shrink swell clays, ground dissolution of soluble rocks and collapsible deposits.

3.8 The site is in an area where the hazard rating is Moderate with regard to compressible deposits and running sands.

3.9 There is one estimated background soil chemistry record for the site, recording levels of arsenic = 15-25mg/kg, cadmium = <1.8mg/kg, chromium = 60-90mg/kg, nickel = 15-30mg/kg and lead = <100mg/kg.

Ground Workings

3.10 There are no records of historical surface ground working, historical underground working or current ground workings within 250m of the site.

3.11 There are no underground railway lines or railway tunnels within 250m of the site.

Mining and Other Underground Workings

3.12 There are no historical or current mining records, coal mining records, non-coal mining cavities, or natural cavities within 1km of the site.

3.13 There are no areas of brine extraction, gypsum extraction, tin mining or clay mining within 1km of the site.

Radon Potential

3.14 The property is not in a Radon Affected Area, as less than 1% of properties are above the Action Level. Radon protection measures are therefore not expected to be required as part of any new development on site.

Hydrogeology and Hydrology

- 3.15 The underlying superficial deposits and Ampthill Clay Formation are both classified by the Environment Agency (EA) as Unproductive Strata, and hence are not classified as aquifers due to their cohesive and impermeable nature.
- 3.16 There are no recorded groundwater abstractions, or potable water abstraction licence records within 1km of the site. The site is also not situated within a groundwater Source Protection Zone.

Landfill and Waste Management Activity

- 3.17 There are no recorded historical or current Landfills or Waste Treatment Facilities located within 1km of the assessment site.

Environmental Permits, Incidents and Registers

- 3.18 The Groundsure report includes records of environmental permits, incidents and registers within 250m of the site, which are summarised in Table 1.

Table 1: Environmental Permits, Incidents and Registers

Historic IPC Authorisations	None	
Part A (1) and IPPC Authorised Activities	None	
Red List Discharge Consents	None	
List 1 Dangerous Substances Inventory Sites	None	
List 2 Dangerous Substances Inventory Sites	None	
Part A (2) and Part B Activities and Enforcements	None	
Category 3 or 4 Radioactive Substance Authorisations	None	
Licensed Discharge Consents	None	
Water Industry Referrals	None	
Planning Hazardous Substance Consents and Enforcements	None	
Dangerous or Hazardous (COMAH and NIHHS) Sites	None	
National Incidents Recording System (Pollution Incidents), List 2	None	
National Incidents Recording System (Pollution Incidents), List 1	None	
Sites Determined as Contaminated Land under Part 2A EPA1990	None	

Industrial Land Use Information

- 3.19 There is one record of a historical potentially contaminative land use identified within 250m of the assessment site. The record is attributed to an unspecified Pit located 136m to the north west present in 1887.

- 3.20 According to the Groundsure report, there are no records of historical tanks, historical energy features, historical garages and motor vehicle repair sites, historical petrol or fuel sites, or military sites within 250m of the site.
- 3.21 There are five records of historical potentially infilled land within 250m of the site. Four of the five records are located on site and are associated with the current day pond and drainage ditch. It would appear that, from review of historical maps, the Groundsure report has assumed this area has been infilled. However, as this area is still present on site as a depression, and there would not appear to have been any infilling, these four records are considered to be inaccurate in this instance.
- 3.22 There is one record of an unspecified pit located 136m north west of the site, recorded 1887.
- 3.23 According to the Groundsure report, there are no records of current potentially contaminative land uses identified within 250m of the assessment site.
- 3.24 There are no National Grid high voltage underground electricity transmission cables, or high-pressure gas transmission pipelines within 500m of the site.

Environmentally Sensitive Sites

- 3.25 There are no significant environmentally sensitive sites within 1km of the site.

Archaeology

- 3.26 An archaeological assessment falls outside the brief of this report. Where considered necessary, advice should be sought from an archaeological specialist.

Potential Flood Risks

- 3.27 Detailed assessment of flood risk is outside the scope of this report. However, it is highlighted that the site is in an Environment Agency Flood Zone 2, and therefore there is a Low (1 in 1000 to 1 in 100) chance of flooding in any given year.

Previous Site Investigations

- 3.28 EEGSL are not aware of any previous ground investigation works which have been undertaken on or in the vicinity of site.

4.0 SITE HISTORY

4.1 The historical development of the site has been determined by reference to historical plans and Google Earth imagery. The reviewed historical plans comprise only readily available records and may be limited; however, the information available to date indicates that additional searches are unlikely to add to our understanding of the site. The earliest available historical mapping covering the site dates back to 1887.

4.2 The site history of site is summarised in Table 2.

Table 2: Summary of Site History

Date	Site	Surrounding Land Use
1887	Site is positioned within the north eastern corner of an open field. A pond is located within the north eastern corner of the site and appears to be fed by a field drain running in a southerly direction along the field's boundary.	The site is bound on three side by open fields. Poplar Farm and Maisdike House can be seen directly to the east of site.
1888	A small out building can be seen located on site directly west of the pond.	No significant change.
1904	No significant change.	No significant change.
1931	The pond on site is marked as a marsh. The building formally on site has been removed, and a new building of similar size can be seen located within the eastern area of site.	No significant change.
1967	The barn can now be seen developed on site in its current day location. The pond is once again labelled as such on site.	No significant change.
1969	No significant change.	No significant change.
1995	No significant change.	No significant change.
2002	No significant change.	No significant change.
2010	No significant change.	No significant change.
2014	No significant change.	No significant change.
2014-2019	The site and surrounding area have not seen any significant development since the late 1960s. The barn is still present on site along with several much smaller wood and brick outbuildings.	No significant change.

5.0 PRELIMINARY RISK ASSESSMENT AND CONCEPTUAL SITE MODEL

Introduction

- 5.1 The following paragraphs outline a Preliminary Risk Assessment (PRA) for the site based on the above desk study information as defined by DEFRA and the EA Model Procedures for the Management of Land Contamination, CLR11(2004).
- 5.2 Table 5 provides a Preliminary Conceptual Model (PCM) which considers the source-pathway-receptor linkages present alongside the likelihood, severity and risk level as defined within Table 3 and Table 4 below. The assessment of probability, a modified risk table, and certain consequence definitions are based on CIRIA C552 and CLR11.
- 5.3 Table 5 considers whether a pollution linkage is potentially present and provides a preliminary qualitative assessment of risk based on the information currently available. Where a possible linkage is identified, it does not necessarily mean that a significant risk exists but indicates that further information is required through appropriate site investigation to substantiate the conceptual model.
- 5.4 The PRA/PCM is based on a proposed residential end use.

Table 3: Consequence, Probability and Risk

Probability	Consequence,	Risk
High Likelihood- There is a pollution linkage and an event either appears very likely in the short term and almost inevitable over the long term, or there is evidence at the receptor of harm or pollution	Very High – acute risk to the human health likely to result in significant harm. Risk of severe or irreversible effect on ground/surface water quality. Catastrophic damage to buildings / property.	Very High – there is a high potential that the source-pathway-receptor scenarios may give rise to harm to human health or the environment and remedial action is likely to be required.
Likely – there is a pollution linkage and all the elements are present, which means that it is probable an event will occur. Circumstances are such that an event is not inevitable, but possible in the short term and likely over the long term.	High – Severe or irreversible effect on human health. Temporary severe or irreversible effect on ground/surface water quality. Reduction of water quality rendering groundwater or surface water unfit to drink and/or substantial adverse impact on groundwater dependant environmental receptors.	High – it is likely that the source-pathway-receptor scenarios may give rise to an impact on human health or the environment, which may require remediation and/or control measures to mitigate risks
Low likelihood– there is a pollutant linkage and circumstances are possible for an event could occur. However, it is by no means certain that even over a longer period such event would take place, and is less likely in the shorter term	Moderate – Long term or short term moderate effect on human health. Moderate effect on ground/surface water quality, reversible with time. Reduced reliability of a supply at a groundwater or surface water abstraction source	Moderate – it is possible that the source-pathway-receptor scenarios may give rise to an impact on human health or the environment, however it is either relatively unlikely that such are would be severe, or if any harm were to occur it is more likely that harm would be mild.
Unlikely – there is a pollution linkage, but circumstances are such that it is doubtful that an event would occur even in the very long term.	Low – Non-permanent health effects to human health (easily prevented by means such as personal protective clothing etc.) Slight effect on ground/surface water quality, reversible with time. Marginal reduced reliability of a supply at a groundwater or surface water abstraction source.	Low – it is possible that harm could arise at the source, however it is likely that they would at worst be mild.
		Very Low – it is unlikely that the source-pathway-receptor scenarios will give rise to an impact on human health or the environment.

Table 4: Estimation of Level of Risk by Comparison of Consequence and Probability

		Consequence			
		High	Moderate	Low	Very low
Probability	High Likelihood	Very High	High risk	Moderate risk	Moderate to low risk
	Likely	High risk	Moderate risk	Moderate to low risk	Low risk
	Low Likelihood	Moderate risk	Moderate to low risk	Low risk	Very low risk
	Unlikely	Moderate to low risk	Low risk	Very low risk	Very low risk

Potential Sources

- 5.5 From review of historical maps and environmental data collected for the assessment site, it has been identified that the site itself has seen very little historical use. Since 1888 site has been used only by several small outbuilding and the current barn. The pond located on site would appear to be seasonal or sometimes run dry, and hence on some maps has been labelled as a marsh. However, from during this review there has been no evidence identified that would suggest it has ever been infilled. From reviewing the construction of the buildings on site, it would appear that they are either of a wooden or brick construction, and no evidence of the use of asbestos was noted.
- 5.6 Taking into account the above, a lack of significant on-site contamination sources have been identified.
- 5.7 Limited Off-site sources of contamination have also been identified, with only an unspecified pit being recorded 136m to the south west in 1886. Taking into account the distance of this feature from site and the cohesive nature of the underlying strata, it is not expected that this potential source of ground gas is likely to have impacted the assessment site.
- 5.8 Taking into account the above, a lack of significant off-site sources have also been identified.

Potential Receptors

- 5.9 The following receptors have been considered as part of this assessment.
- Current site users
 - Future land users;
 - Construction workers during site development works; and

Potential Pathways

- 5.10 The following pathways have been considered as part of this assessment.
- Direct / dermal contact, ingestion, inhalation pathways of potentially contaminated soils;

Table 5: Preliminary Conceptual Model

Source	Pathway	Receptor	Probability	Consequence	Risk	Comment
No significant sources of contamination have been identified	Dermal contact, ingestion and inhalation of soils dust	Current Site users	Unlikely	Low	Low	Given the lack of significant sources of contamination being identified, the risk to current site users from potential contamination within the shallow soils beneath site is considered to be LOW.
		Future Site users	Unlikely	Low	Low	Given the lack of significant sources of contamination being identified, the risk to future site users from potential contamination within the shallow soils beneath site is considered to be LOW.
		Construction Workers	Unlikely	Low	Low	Given the lack of significant sources of contamination being identified, the risk to construction workers from potential contamination within the shallow soils beneath site is considered to be LOW.

6.0 PRELIMINARY RISK ASSESSMENT

- 6.1 From review of historical and current day information, it has been identified that the assessment site has seen little development, with only a small number of small outbuildings and one barn being present on site since the 1880s.
- 6.2 A pond has been identified on site, which historically has also been marked on maps as a marsh. It has been considered that this pond is likely to be seasonal and hence sometimes will be void of water. It is assumed that due to the lack of water, this area has been recorded in the Groundsure report as potentially being infilled. However, from review of current day mapping it has been proven that this pond / depression is still present and is not thought to have ever seen any significant infilling.
- 6.3 One off site source of contamination has been identified. The infilling of an unspecified pit located 136m to the south west was highlighted within the Groundsure report. However, considering the distance between site, the cohesive nature of the underlying strata and the time since this pit was infilled, it is considered unlikely to pose a significant risk to the assessment site in this instance.
- 6.4 Give the lack of significant sources of contamination identified, the risk to site has been deemed as Low.

7.0 CONCLUSIONS AND RECOMMENDATIONS

- 7.1 The PRA and CSM have highlighted a lack of significant sources and potential pollution linkages associated with contamination at the assessment site. A Low risk has therefore been assigned.
- 7.2 Given the above conclusions, it is recommended that no further works are required with regards to the investigation of contamination at the assessment site.
- 7.3 It should be noted however, that due diligence is required during every project, and should any new evidence of contamination be found, appropriate investigation and / or remediation should be undertaken. The significance of any contamination not discovered by this investigation is outside the scope of this report.

APPENDIX 1

GEO-INSIGHT REPORT

Earth Environmental & Geotechnical Southern Ltd	Groundsure Reference:	GS-5777359
KINGSBURY HOUSE, KINGSBURY SQUARE, MELKSHAM, SN12 6HL	Your Reference:	R0160
	Report Date	25 Jan 2019
	Report Delivery Method:	Email - pdf

Geo Insight

Address: Mulberry Barn, TORRINGTON LANE, FLEET, SPALDING,

Dear Sir/ Madam,

Thank you for placing your order with Groundsure. Please find enclosed the **Groundsure Geo Insight** as requested.

If you need any further assistance, please do not hesitate to contact our helpline on 08444 159000 quoting the above Groundsure reference number.

Yours faithfully,



Managing Director
Groundsure Limited

Enc.
Groundsure Geo Insight

Address: Mulberry Barn, TORRINGTON LANE, FLEET, SPALDING,
Date: 25 Jan 2019
Reference: GS-5777359
Client: Earth Environmental & Geotechnical Southern Ltd



Aerial Photograph Capture date: 06-Apr-2015
Grid Reference: 538804,322856
Site Size: 0.41ha

Contents Page

Contents Page.....	3
Overview of Findings.....	5
1:10,000 Scale Availability.....	8
Availability of 1:10,000 Scale Geology Mapping.....	9
1 Geology (1:10,000 scale).....	10
1.1 Artificial Ground map (1:10,000 scale).....	10
1. Geology 1:10,000 scale.....	11
1.1 Artificial Ground.....	11
1.2 Superficial Deposits and Landslips map (1:10,000 scale).....	12
1.2 Superficial Deposits and Landslips.....	13
1.2.1 Superficial Deposits/ Drift Geology.....	13
1.2.2 Landslip.....	13
1.3 Bedrock and linear features map (1:10,000 scale).....	14
1.3 Bedrock and linear features.....	15
1.3.1 Bedrock/ Solid Geology.....	15
1.3.2 Linear features.....	15
2 Geology 1:50,000 Scale.....	16
2.1 Artificial Ground map.....	16
2. Geology 1:50,000 scale.....	17
2.1 Artificial Ground.....	17
2.1.1 Artificial/ Made Ground	17
2.1.2 Permeability of Artificial Ground.....	17
2.2 Superficial Deposits and Landslips map (1:50,000 scale).....	18
2.2 Superficial Deposits and Landslips.....	19
2.2.1 Superficial Deposits/ Drift Geology.....	19
2.2.2 Permeability of Superficial Ground	19
2.2.3 Landslip.....	19
2.2.4 Landslip Permeability.....	19
2.3 Bedrock and linear features map (1:50,000 scale).....	20
2.3 Bedrock, Solid Geology & linear features.....	21
2.3.1 Bedrock/Solid Geology.....	21
2.3.2 Permeability of Bedrock Ground.....	21
2.3.3 Linear features.....	21
3 Radon Data.....	22
3.1 Radon Affected Areas.....	22
3.2 Radon Protection.....	22
4 Ground Workings map.....	23
4 Ground Workings.....	24
4.1 Historical Surface Ground Working Features derived from Historical Mapping.....	24
4.2 Historical Underground Working Features derived from Historical Mapping.....	24
4.3 Current Ground Workings.....	24
5 Mining, Extraction & Natural Cavities.....	26
5.1 Historical Mining.....	26
5.2 Coal Mining.....	26
5.3 Johnson Poole and Bloomer.....	26
5.4 Non-Coal Mining.....	26
5.5 Non-Coal Mining Cavities.....	27
5.6 Natural Cavities.....	27
5.7 Brine Extraction.....	27
5.8 Gypsum Extraction.....	27
5.9 Tin Mining.....	27
5.10 Clay Mining.....	28
6 Natural Ground Subsidence.....	29
6.1 Shrink-Swell Clay map.....	29
6.2 Landslides map.....	30
6.3 Ground Dissolution of Soluble Rocks map.....	31
6.4 Compressible Deposits map.....	32
6.5 Collapsible Deposits map.....	33
6.6 Running Sand map.....	34

6 Natural Ground Subsidence.....	35
6.1 Shrink-Swell Clays.....	35
6.2 Landslides.....	35
6.3 Ground Dissolution of Soluble Rocks.....	36
6.4 Compressible Deposits.....	36
6.5 Collapsible Deposits.....	36
6.6 Running Sands.....	36
7 Borehole Records.....	38
8 Estimated Background Soil Chemistry.....	39
9 Railways and Tunnels map.....	40
9 Railways and Tunnels.....	41
9.1 Tunnels	41
9.2 Historical Railway and Tunnel Features	41
9.3 Historical Railways.....	42
9.4 Active Railways.....	42
9.5 Railway Projects.....	42

Overview of Findings

The Groundsure Geo Insight provides high quality geo-environmental information that allows geo-environmental professionals and their clients to make informed decisions and be forewarned of potential ground instability problems that may affect the ground investigation, foundation design and possibly remediation options that could lead to possible additional costs.

The report is based on the BGS 1:50,000 and 1:10,000 Digital Geological Map of Great Britain, BGS Geosure data; BRITPITS database; Non-coal mining data and Borehole Records, Coal Authority data including brine extraction areas, PBA non-coal mining and natural cavities database, Johnson Poole and Bloomer mining data and Groundsure's unique database including historical surface ground and underground workings.

For further details on each dataset, please refer to each individual section in the report as listed. Where the database has been searched a numerical result will be recorded. Where the database has not been searched '-' will be recorded.

Section 1: Geology 1:10,000 Scale

1.1 Artificial Ground	1.1 Is there any Artificial Ground/ Made Ground present beneath the study site at 1:10,000 scale?	No
1.2 Superficial Geology and Landslips	1.2.1 Is there any Superficial Ground/Drift Geology present beneath the study site at 1:10,000 scale?*	No
	1.2.2 Are there any records of landslide within 500m of the study site boundary at 1:10,000 scale?	No
1.3 Bedrock, Solid Geology and linear features	1.3.1 For records of Bedrock and Solid Geology beneath the study site* see the detailed findings section.	
	1.3.2 Are there any records of linear features within 500m of the study site boundary at 1:10,000 scale?	No

Section 2: Geology 1:50,000 Scale

2.1 Artificial Ground	2.1.1 Is there any Artificial Ground/ Made Ground present beneath the study site?	No
	2.1.2 Are there any records relating to permeability of artificial ground within the study site*boundary?	No
2.2 Superficial Geology and Landslips	2.2.1 Is there any Superficial Ground/Drift Geology present beneath the study site?*	Yes
	2.2.2 Are there any records of permeability of superficial ground within 500m of the study site?	Yes
	2.2.3 Are there any records of landslide within 500m of the study site boundary?	No
	2.2.4 Are there any records relating to permeability of landslips within the study site* boundary?	No

Section 2: Geology 1:50,000 Scale

2.3 Bedrock, Solid Geology and linear features

2.3.1 For records of Bedrock and Solid Geology beneath the study site* see the detailed findings section.

2.3.2 Are there any records relating to permeability of bedrock ground within the study site boundary?

Yes

2.3.3 Are there any records of linear features within 500m of the study site boundary?

No

Section 3: Radon

3. Radon

3.1 Is the property in a Radon Affected Area as defined by the Health Protection Agency (HPA) and if so what percentage of homes are above the Action Level?

The property is not in a Radon Affected Area, as less than 1% of properties are above the Action Level.

3.2 Radon Protection

No radon protective measures are necessary.

Section 4: Ground Workings

	On-site	0-50m	51-250	251-500	501-1000
4.1 Historical Surface Ground Working Features from Small Scale Mapping	4	0	1	Not Searched	Not Searched
4.2 Historical Underground Workings from Small Scale Mapping	0	0	0	0	0
4.3 Current Ground Workings	0	0	0	0	0

Section 5: Mining, Extraction & Natural Cavities

	On-site	0-50m	51-250	251-500	501-1000
5.1 Historical Mining	0	0	0	0	0
5.2 Coal Mining	0	0	0	0	0
5.3 Johnson Poole and Bloomer Mining Area	0	0	0	0	0
5.4 Non-Coal Mining*	0	0	0	0	0
5.5 Non-Coal Mining Cavities	0	0	0	0	0
5.5 Natural Cavities	0	0	0	0	0


Section 5: Mining, Extraction & Natural Cavities	On-site	0-50m	51-250	251-500	501-1000
5.6 Brine Extraction	0	0	0	0	0
5.7 Gypsum Extraction	0	0	0	0	0
5.8 Tin Mining	0	0	0	0	0
5.9 Clay Mining	0	0	0	0	0
Section 6: Natural Ground Subsidence	On-site				
6.1 Shrink-Swell Clay	Low				
6.2 Landslides	Very Low				
6.3 Ground Dissolution of Soluble Rocks	Negligible				
6.4 Compressible Deposits	Moderate				
6.5 Collapsible Deposits	Negligible				
6.5 Running Sand	Moderate				
Section 7: Borehole Records	On-site	0-50m	51-250		
7 BGS Recorded Boreholes	0	0	0		
Section 8: Estimated Background Soil Chemistry	On-site	0-50m	51-250		
8 Records of Background Soil Chemistry	1	0	0		
Section 9: Railways and Tunnels	On-site	0-50m	51-250	250-500	
9.1 Tunnels	0	0	0	Not Searched	
9.2 Historical Railway and Tunnel Features	0	0	0	Not Searched	
9.3 Historical Railways	0	0	0	Not Searched	
9.4 Active Railways	0	0	0	Not Searched	
9.5 Railway Projects	0	0	0	0	

1:10,000 Scale Availability



1_10,000 Availability Legend

© Crown copyright and database rights 2019.
 Ordnance Survey licence 100035207.

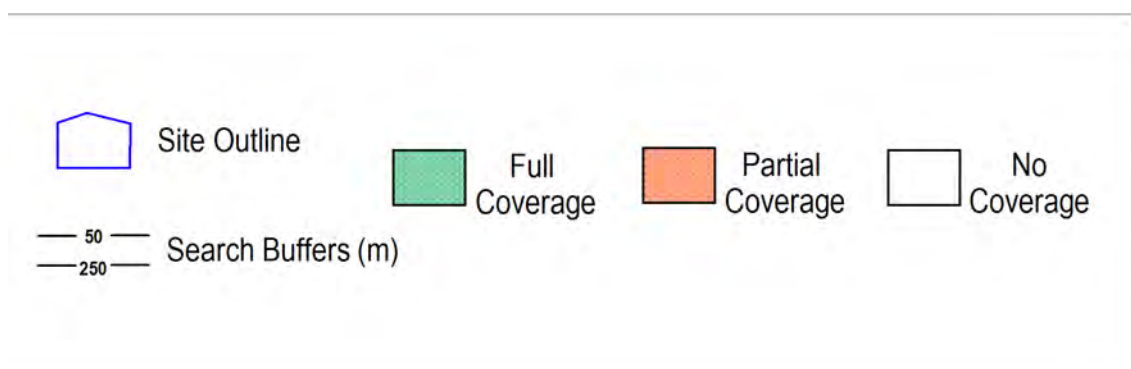

Availability of 1:10,000 Scale Geology Mapping

The following information represents the availability of the key components of the 1:10,000 scale geological data.

ID	Distance	Artificial Coverage	Superficial Coverage	Bedrock Coverage	Mass Movement Coverage
1	0.0	No deposits are mapped	No coverage	No coverage	No coverage


Guidance: The 1:10,000 scale geological interpretation is the most detailed generally available from BGS and is the scale at which most geological surveying is carried out in the field. The database is presented as four types of geology (artificial, mass movement, superficial and bedrock), although not all themes are mapped or available on every map sheet. Therefore a coverage layer showing the availability of the four themes is presented above.

The definitions of coverage are as follows:

Geology	Full Coverage	Partial Coverage	No Coverage
Bedrock	The whole tile has been mapped	Some but not all the tile has been mapped	No coverage
Superficial	The whole tile has been mapped	Some but not all of the tile has been mapped	No coverage
Artificial	Some deposits are mapped on this tile	-	No deposits are mapped
Mass Movement	Some deposits are mapped on this tile	-	No coverage

1 Geology (1:10,000 scale).

1.1 Artificial Ground map (1:10,000 scale)

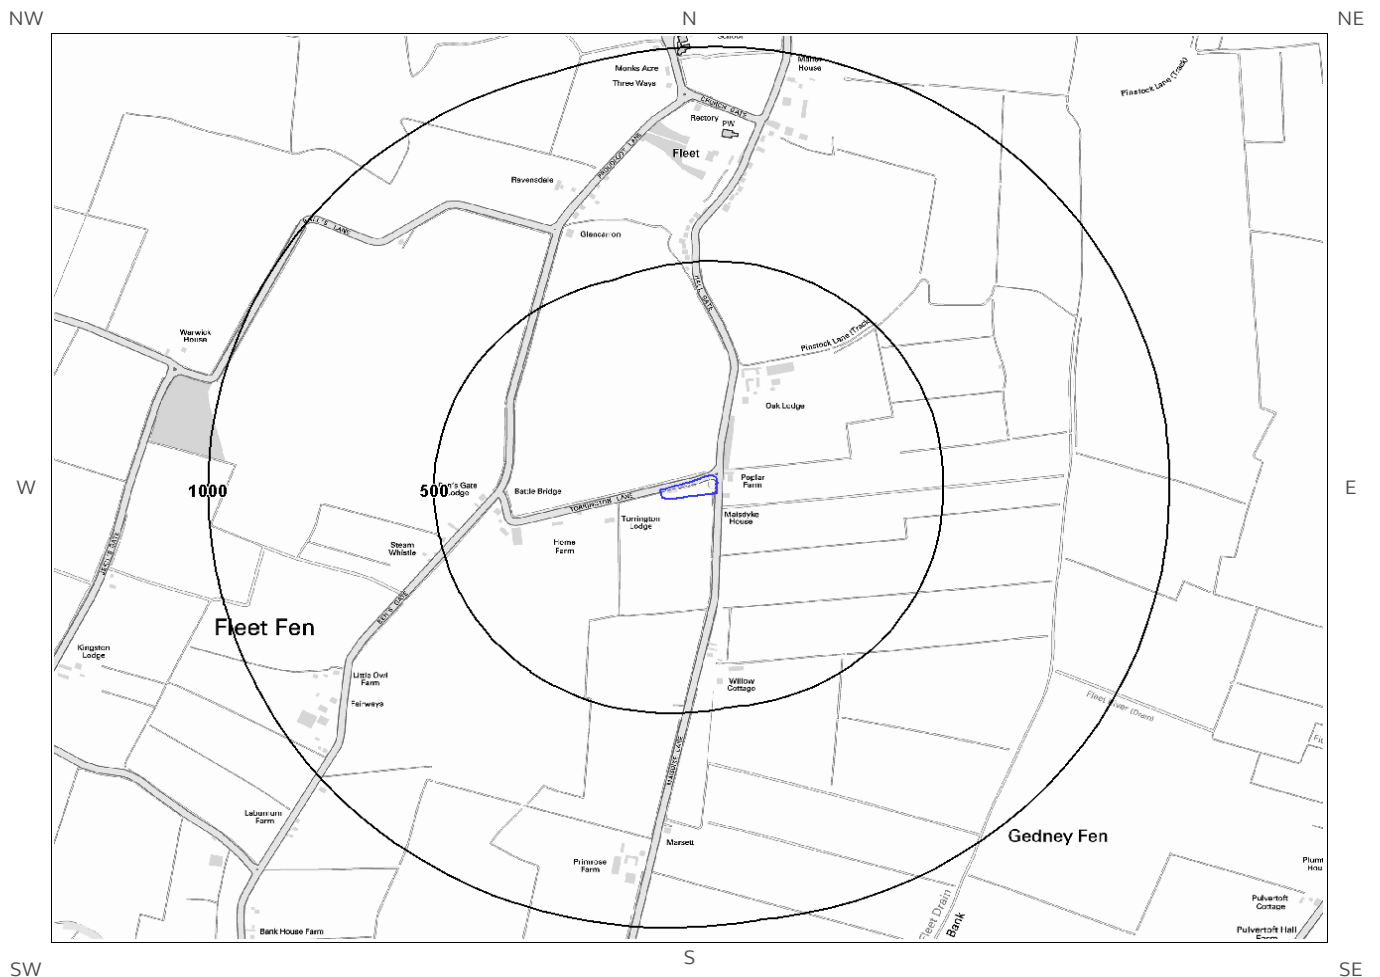

Artificial Ground Legend

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.



1. Geology 1:10,000 scale


1.1 Artificial Ground

The following geological information represented on the mapping is derived from 1:10,000 scale BGS Geological mapping.

Are there any records of Artificial/ Made Ground within 500m of the study site boundary at 1:10,000 scale? No


Database searched and no data found.

1.2 Superficial Deposits and Landslips map (1:10,000 scale)

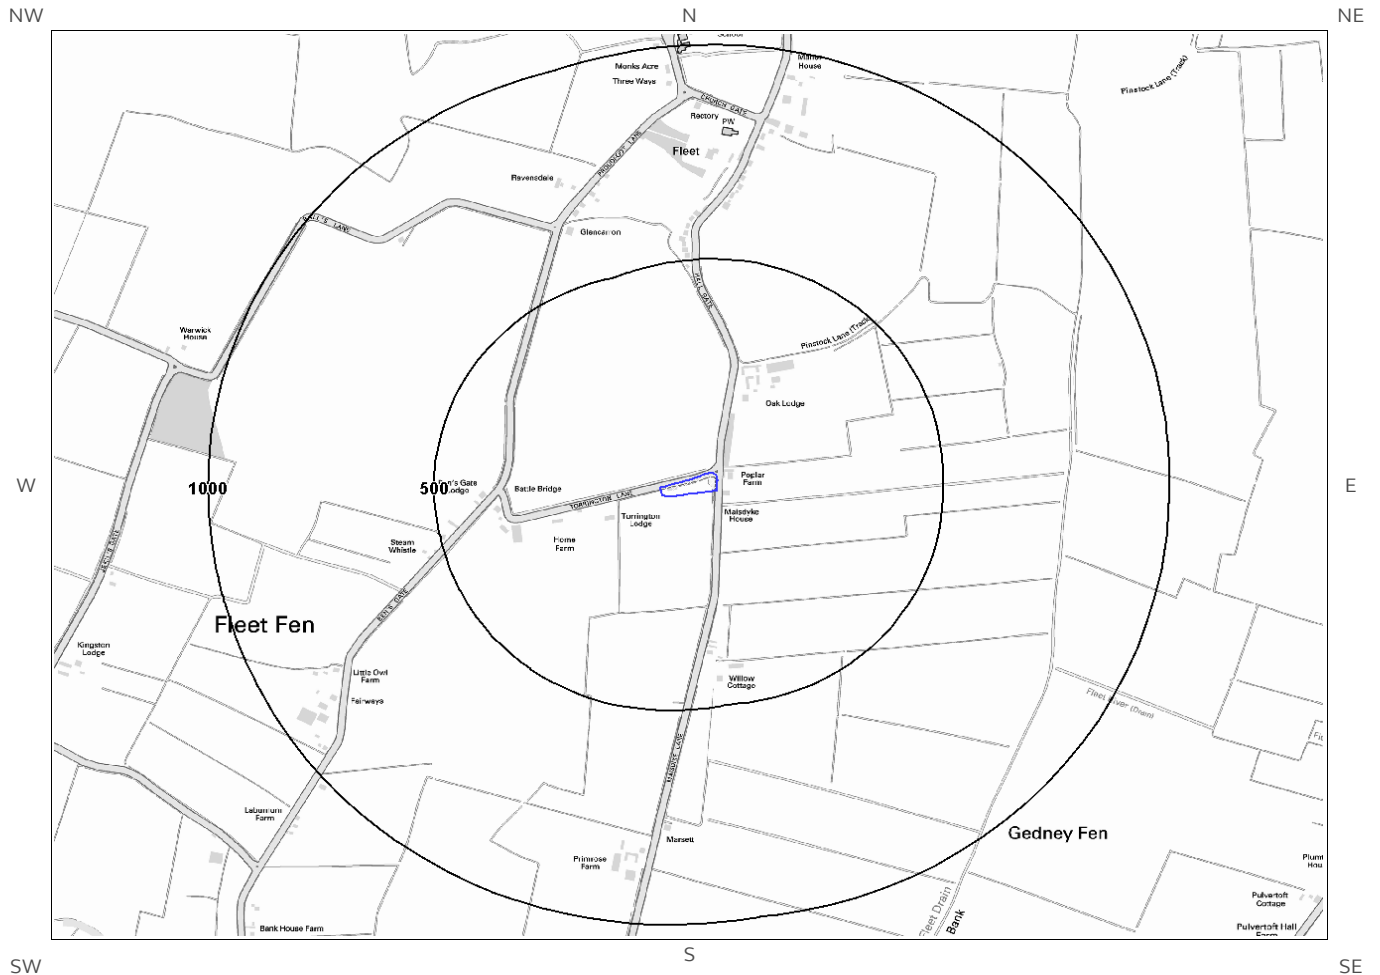

Artificial Ground Legend

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.

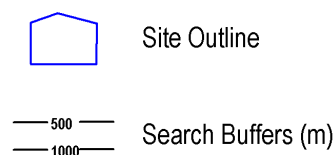

1.2 Superficial Deposits and Landslips

The following geological information represented on the mapping is derived from 1:10,000 scale BGS Geological mapping

1.2.1 Superficial Deposits/ Drift Geology

Are there any records of Superficial Deposits/ Drift Geology within 500m of the study site boundary at 1:10,000 scale? No

Database searched and no data found.

1.2.2 Landslip


Are there any records of Landslip within 500m of the study site boundary at 1:10,000 scale? No

Database searched and no data found.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of Great Britain at 1:10,000 scale


This Geology shows the main components as discrete layers, these are: Artificial / Made Ground, Superficial / Drift Geology and Landslips. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nationwide coverage.

1.3 Bedrock and linear features map (1:10,000 scale)

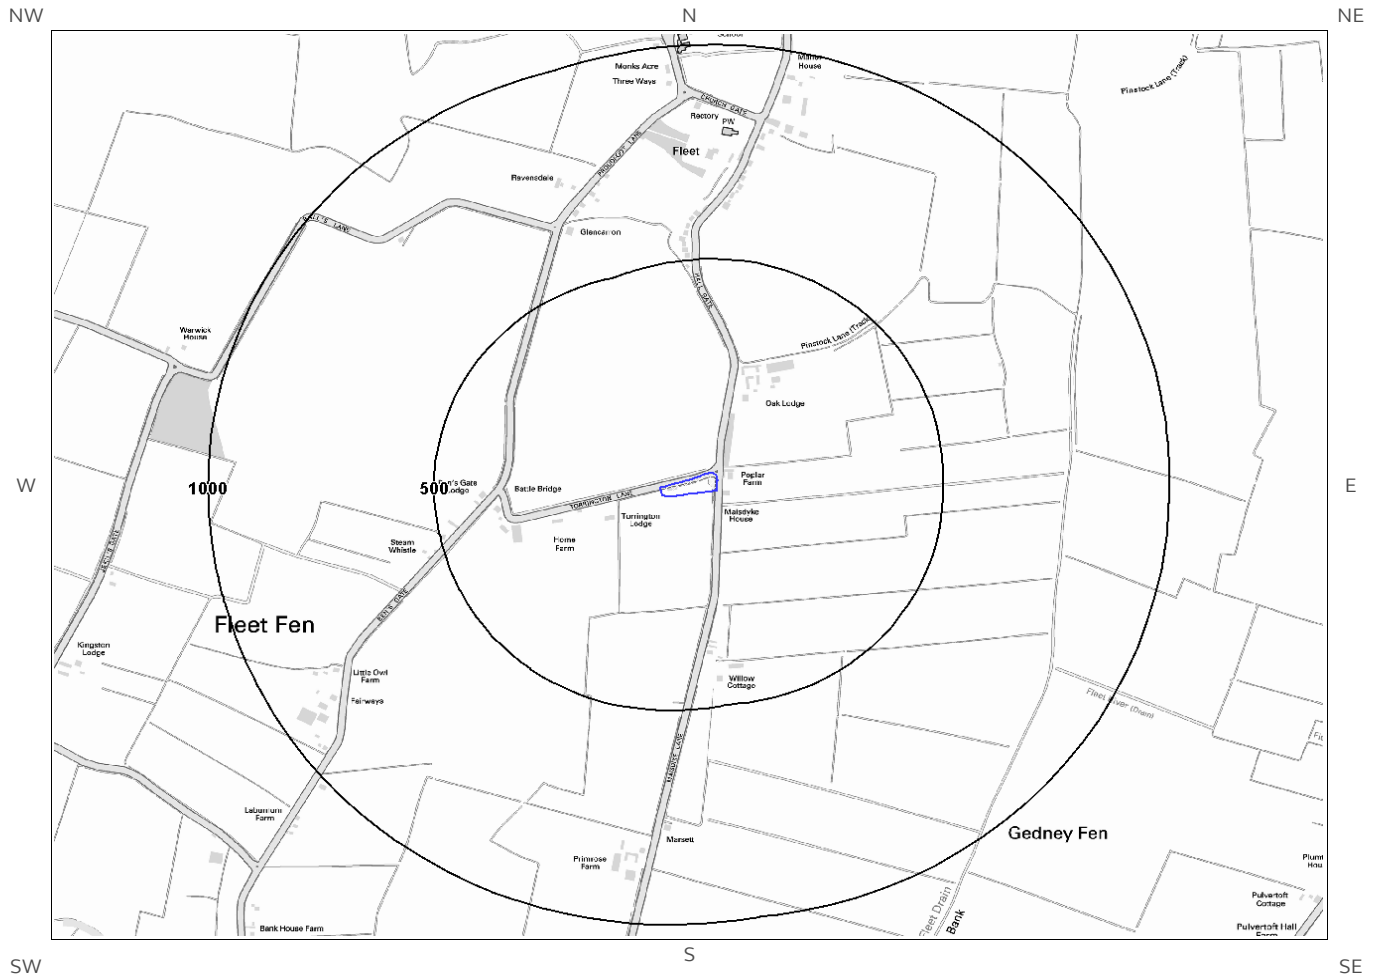

Bedrock and linear features Legend

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.

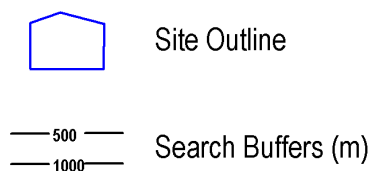

1.3 Bedrock and linear features

The following geological information represented on the mapping is derived from 1:10,000 scale BGS Geological mapping.

1.3.1 Bedrock/ Solid Geology

Records of Bedrock/Solid Geology within 500m of the study site boundary at 1:10,000 scale.

Database searched and no data found at this scale.

1.3.2 Linear features

Are there any records of linear features within 500m of the study site boundary at 1:10,000 scale? No


Database searched and no data found at this scale.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of great Britain at 1:10,000 scale.


This Geology shows the main components as discrete layers, these are: Bedrock/ Solid Geology and linear features such as faults. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nationwide coverage.

2 Geology 1:50,000 Scale

2.1 Artificial Ground map

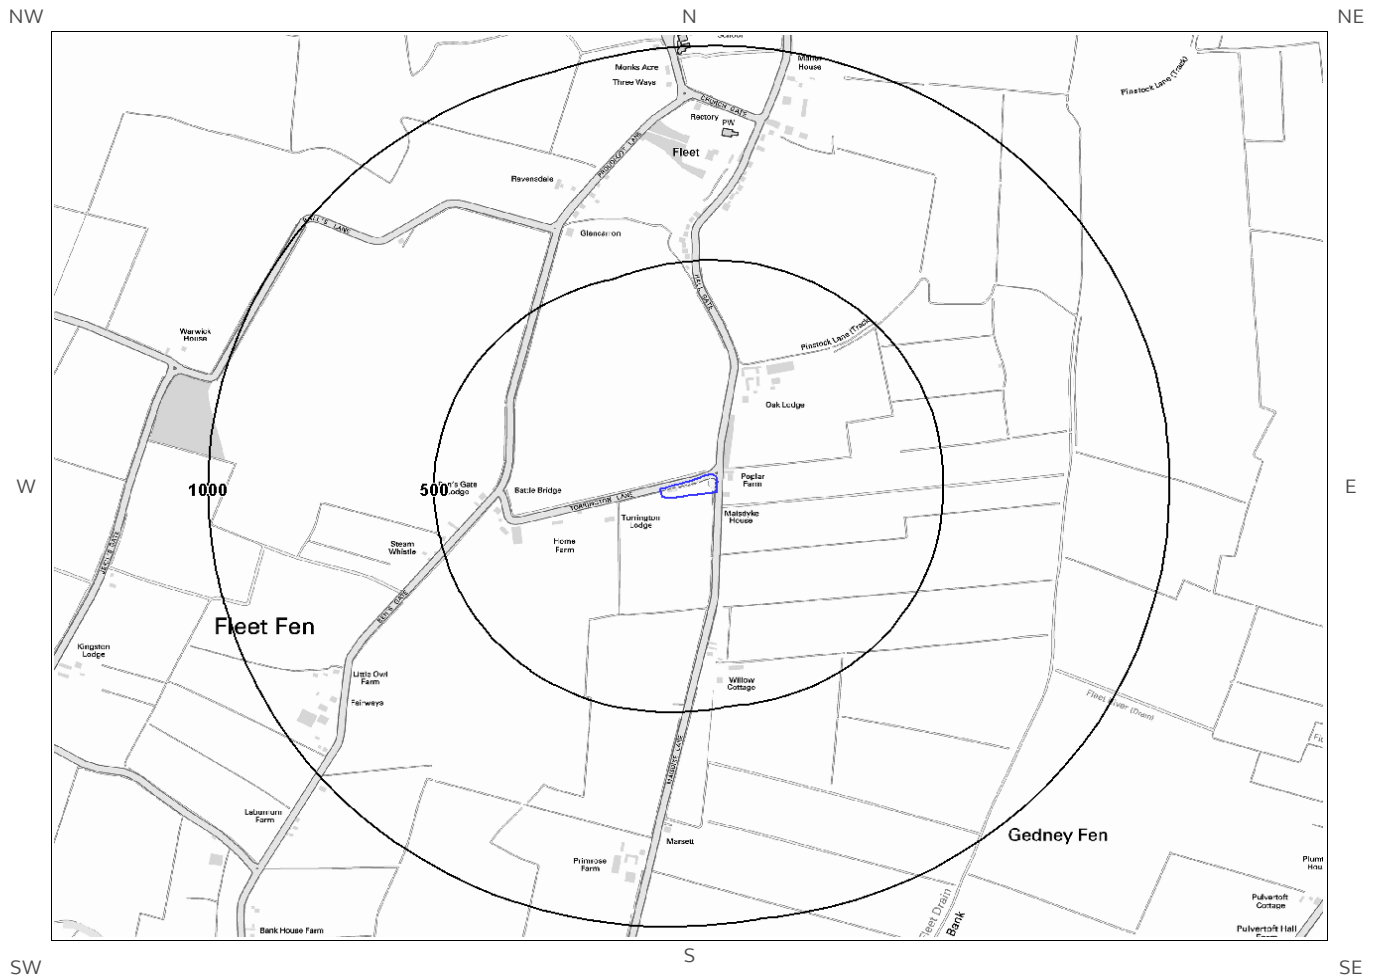

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.

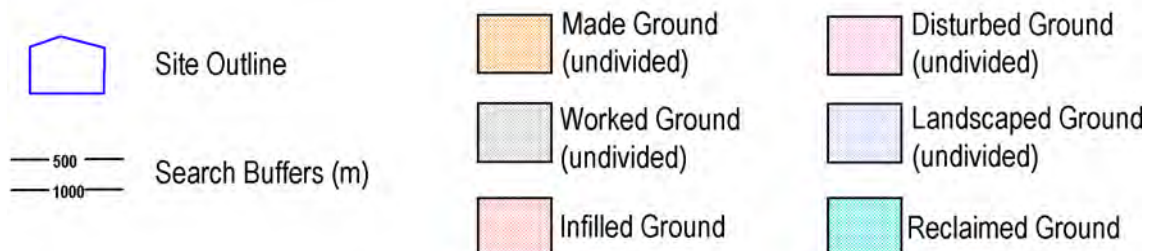

2. Geology 1:50,000 scale

2.1 Artificial Ground

The following geological information represented on the mapping is derived from 1:50,000 scale BGS Geological mapping, Sheet No: 144

2.1.1 Artificial/ Made Ground

Are there any records of Artificial/ Made Ground within 500m of the study site boundary? No


Database searched and no data found.

2.1.2 Permeability of Artificial Ground

Are there any records relating to permeability of artificial ground within the study site boundary? No

Database searched and no data found.


2.2 Superficial Deposits and Landslips map (1:50,000 scale)

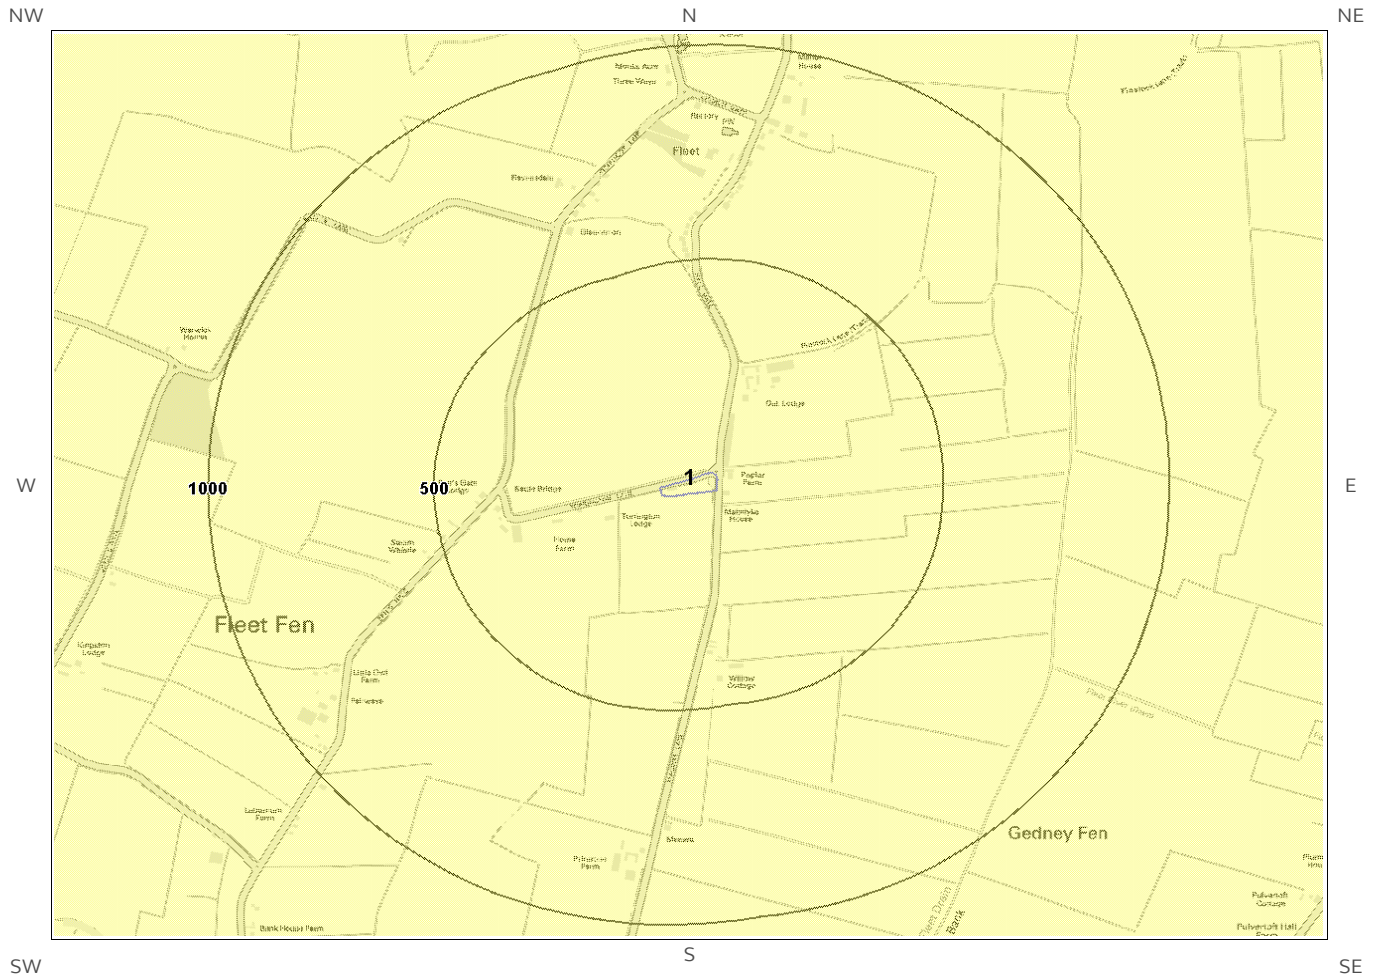

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.



Site Outline



Search Buffers (m)

2.2 Superficial Deposits and Landslips

2.2.1 Superficial Deposits/ Drift Geology

Are there any records of Superficial Deposits/ Drift Geology within 500m of the study site boundary? Yes

ID	Distance	Direction	LEX Code	Description	Rock Description
1	0.0	On Site	TFD-XCZ	TIDAL FLAT DEPOSITS	CLAY AND SILT

2.2.2 Permeability of Superficial Ground

Are there any records relating to permeability of superficial ground within the study site boundary? Yes

Distance (m)	Direction	Flow Type	Maximum Permeability	Minimum Permeability
0.0	On Site	Intergranular	Low	Very Low

2.2.3 Landslip

Are there any records of Landslip within 500m of the study site boundary? No

Database searched and no data found.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of Great Britain at 1:50,000 scale.

This Geology shows the main components as discrete layers, there are: Artificial/ Made Ground, Superficial/ Drift Geology and Landslips. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nationwide coverage.

2.2.4 Landslip Permeability

Are there any records relating to permeability of landslips within the study site boundary? No

Database searched and no data found.


2.3 Bedrock and linear features map (1:50,000 scale)



© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.



Site Outline



Search Buffers (m)

2.3 Bedrock, Solid Geology & linear features

The following geological information represented on the mapping is derived from 1:50,000 scale BGS Geological mapping, Sheet No: 144

2.3.1 Bedrock/Solid Geology

Records of Bedrock/Solid Geology within 500m of the study site boundary:

ID	Distance	Direction	LEX Code	Rock Description	Rock Age
1	0.0	On Site	AMC-MDST	AMPTHILL CLAY FORMATION - MUDSTONE	OXFORDIAN

2.3.2 Permeability of Bedrock Ground

Are there any records relating to permeability of bedrock ground within the study site boundary? Yes

Distance	Direction	Flow Type	Maximum Permeability	Minimum Permeability
0.0	On Site	Fracture	Low	Very Low

2.3.3 Linear features

Are there any records of linear features within 500m of the study site boundary? No

Database searched and no data found.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of Great Britain at 1:50,000 scale.

This Geology shows the main components as discrete layers, these are: Bedrock/Solid Geology and linear features such as faults. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nation wide coverage.

3 Radon Data

3.1 Radon Affected Areas


Is the property in a Radon Affected Area as defined by the Health Protection Agency (HPA) and if so what percentage of homes are above the Action Level? The property is not in a Radon Affected Area, as less than 1% of properties are above the Action Level.

The radon data in this report is supplied by the BGS/Public Health England and is the definitive map of Radon Affected Areas in Great Britain and Northern Ireland. The dataset was created using long-term radon measurements in over 479,000 homes across Great Britain and 23,000 homes across Northern Ireland, combined with geological data. The dataset is considered accurate to 50m to allow for the margin of error in geological lines, and the findings of this report supercede any answer given in the less accurate Indicative Atlas of Radon in Great Britain, which simplifies the data to give the highest risk within any given 1km grid square. As such, the radon atlas is considered indicative, whereas the data given in this report is considered definitive.

3.2 Radon Protection


Is the property in an area where Radon Protection are required for new properties or extensions to existing ones as described in publication BR211 by the Building Research Establishment? No radon protective measures are necessary.

4 Ground Workings map

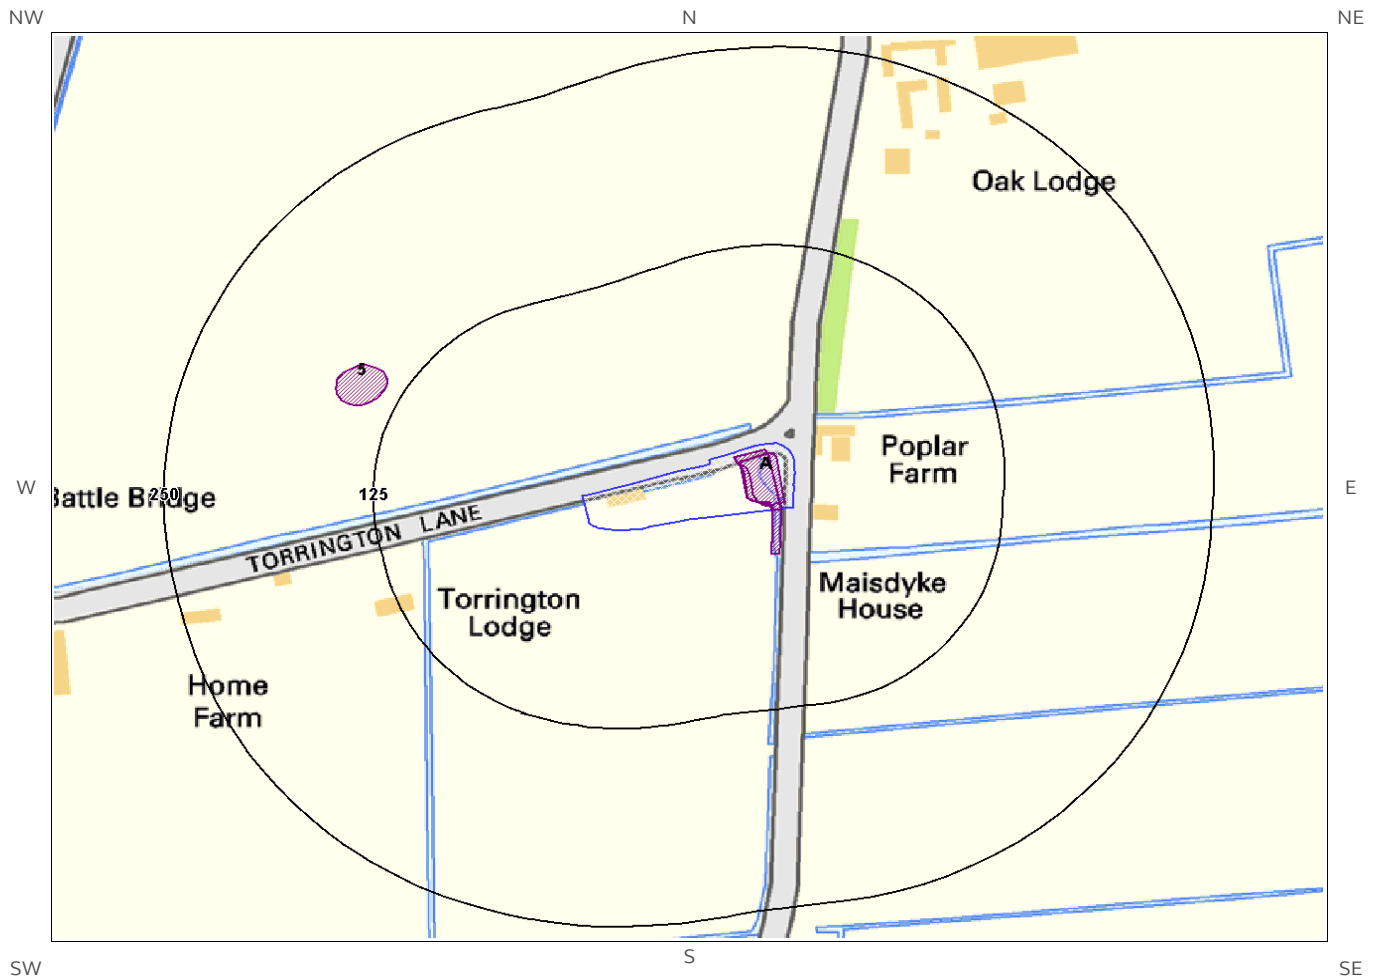

Ground Workings Legend

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.

- | | | | |
|---|--------------------|---|----------------------------------|
|  | Site Outline |  | Historic Surface Ground Workings |
|  | Search Buffers (m) |  | Historic Underground Workings |
| | |  | Current Ground Workings |

4 Ground Workings

4.1 Historical Surface Ground Working Features derived from Historical Mapping

This dataset is based on Groundsure's unique Historical Land Use Database derived from 1:10,560 and 1:10,000 scale historical mapping

Are there any Historical Surface Ground Working Features within 250m of the study site boundary? Yes

ID	Distance (m)	Direction	NGR	Use	Date
1A	0.0	On Site	538843 322859	Pond	1887
2A	0.0	On Site	538840 322858	Pond	1938
3A	0.0	On Site	538847 322845	Pond	1950
4A	0.0	On Site	538847 322845	Pond	1903
5	136.0	NW	538603 322918	Unspecified Pit	1887

4.2 Historical Underground Working Features derived from Historical Mapping

This data is derived from the Groundsure unique Historical Land Use Database. It contains data derived from 1:10,000 and 1:10,560 historical Ordnance Survey Mapping and includes some natural topographical features (Shake Holes for example) as well as manmade features that may have implications for ground stability. Underground and mining features have been identified from surface features such as shafts. The distance that these extend underground is not shown.

Are there any Historical Underground Working Features within 1000m of the study site boundary? No

Database searched and no data found.


4.3 Current Ground Workings

This dataset is derived from the BGS BRITPITS database covering active; inactive mines; quarries; oil wells; gas wells and mineral wharves; and rail deposits throughout the British Isles.

Are there any BGS Current Ground Workings within 1000m of the study site boundary? No


Database searched and no data found.

5 Mining, Extraction & Natural Cavities map

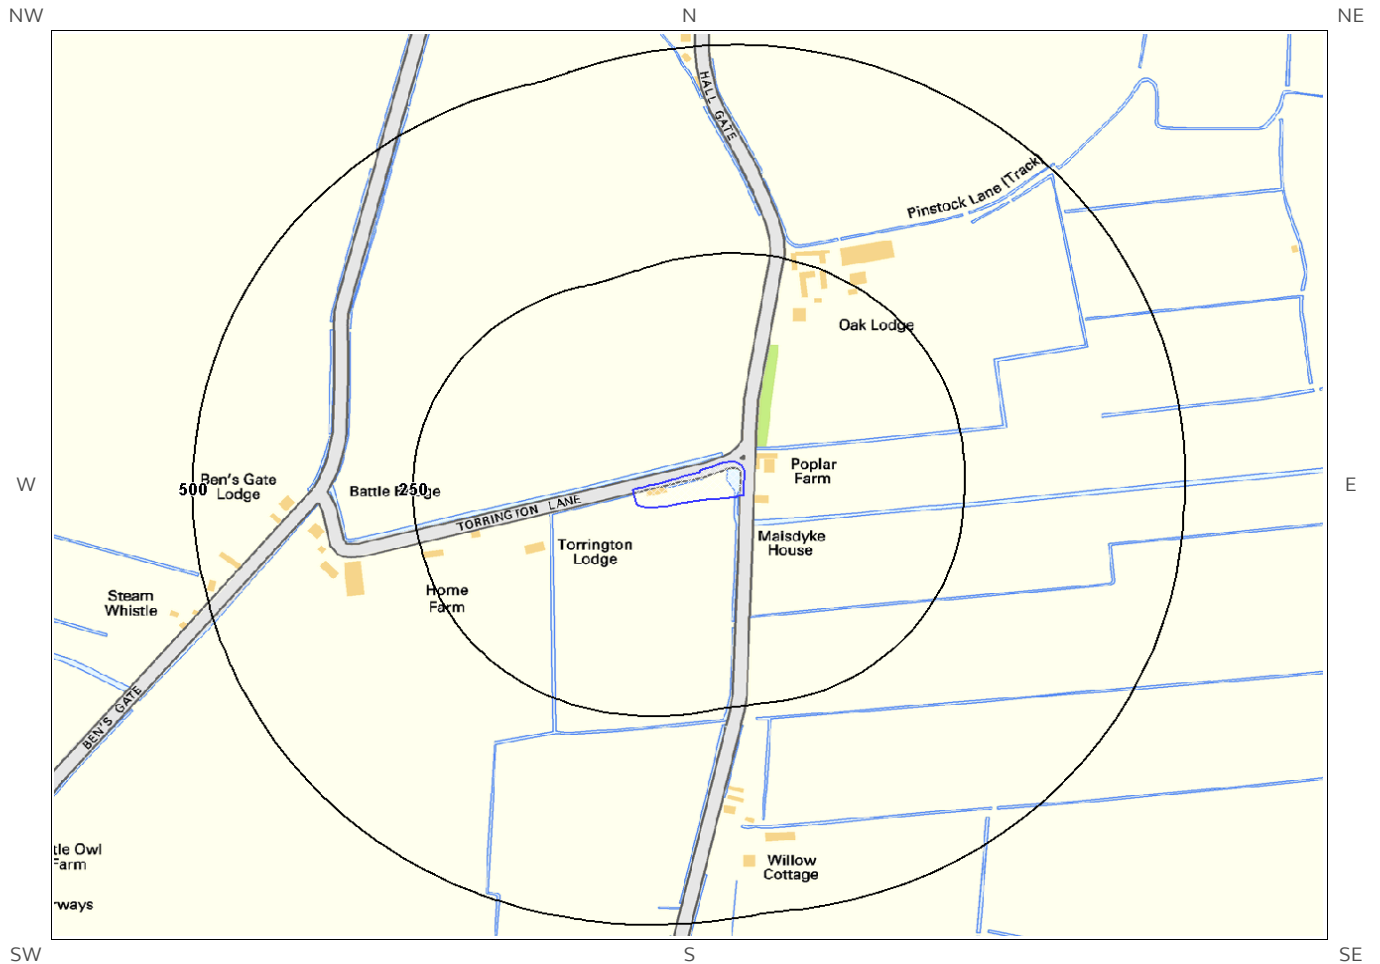

Mining, Extraction and Natural Cavities Legend

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.

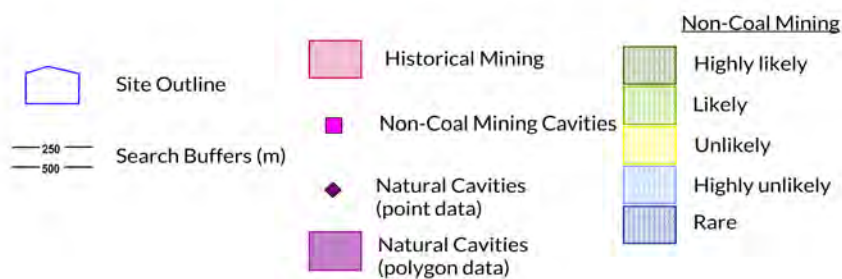

5 Mining, Extraction & Natural Cavities

5.1 Historical Mining

This dataset is derived from Groundsure unique Historical Land-use Database that are indicative of mining or extraction activities.

Are there any Historical Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.2 Coal Mining

This dataset provides information as to whether the study site lies within a known coal mining affected area as defined by the coal authority.

Are there any Coal Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.3 Johnson Poole and Bloomer

This dataset provides information as to whether the study site lies within an area where JPB hold information relating to mining.

Are there any JPB Mining areas within 1000m of the study site boundary? No

The following information provided by JPB is not represented on mapping: Database searched and no data found.

5.4 Non-Coal Mining

This dataset provides information as to whether the study site lies within an area which may have been subject to non-coal historic mining.

Are there any Non-Coal Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.5 Non-Coal Mining Cavities

This dataset provides information from the Peter Brett Associates (PBA) mining cavities database (compiled for the national study entitled “Review of mining instability in Great Britain, 1990” PBA has also continued adding to this database) on mineral extraction by mining.

Are there any Non-Coal Mining cavities within 1000m of the study site boundary? No

Database searched and no data found.

5.6 Natural Cavities

This dataset provides information based on the Peter Brett Associates natural cavities database. The dataset is made up of points and polygons. Where polygons are used these represent an area in which it is expected the cavities could be found. It does not indicate that cavities are present everywhere within the polygon, and caution should be used in the interpretation of this data.

Are there any Natural Cavities within 1000m of the study site boundary? No

Database searched and no data found.

5.7 Brine Extraction

This data provides information from the Cheshire Brine Subsidence Compensation Board.

Are there any Brine Extraction areas within 1000m of the study site boundary? No

Database searched and no data found.

5.8 Gypsum Extraction

This dataset provides information on Gypsum extraction from British Gypsum records.

Are there any Gypsum Extraction areas within 1000m of the study site boundary? No

Database searched and no data found.

5.9 Tin Mining

This dataset provides information on tin mining areas and is derived from tin mining records. This search is based upon postcode information to a sector level..

Are there any Tin Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.10 Clay Mining

This dataset provides information on Kaolin and Ball Clay mining from relevant mining records.


Are there any Clay Mining areas within 1000m of the study site boundary?

No


Database searched and no data found.

6 Natural Ground Subsidence


6.1 Shrink-Swell Clay map

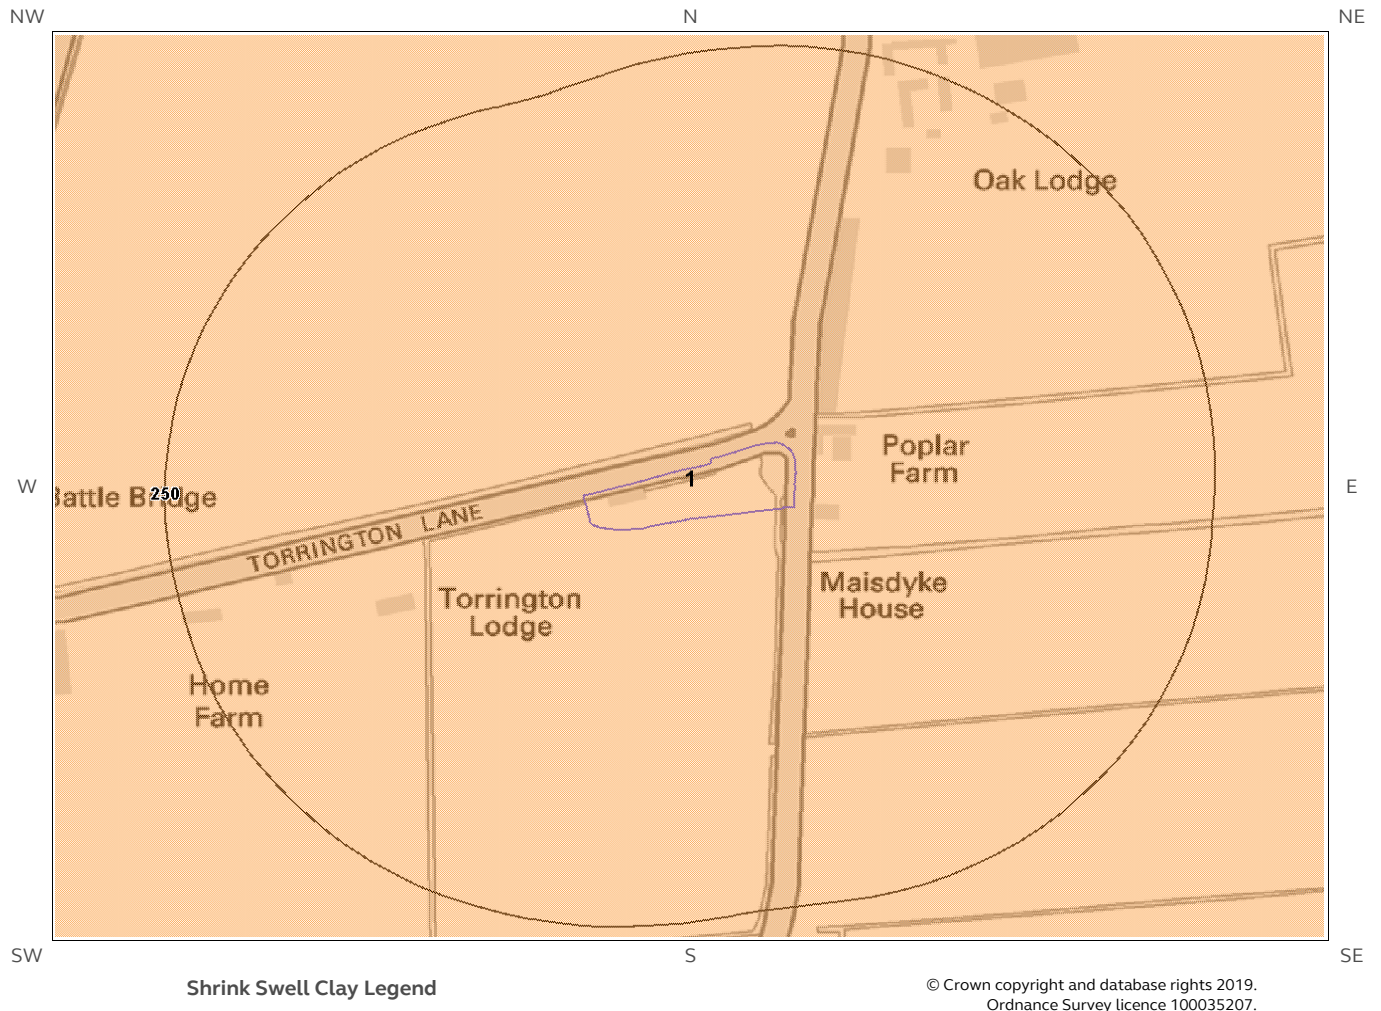


6.2 Landslides map

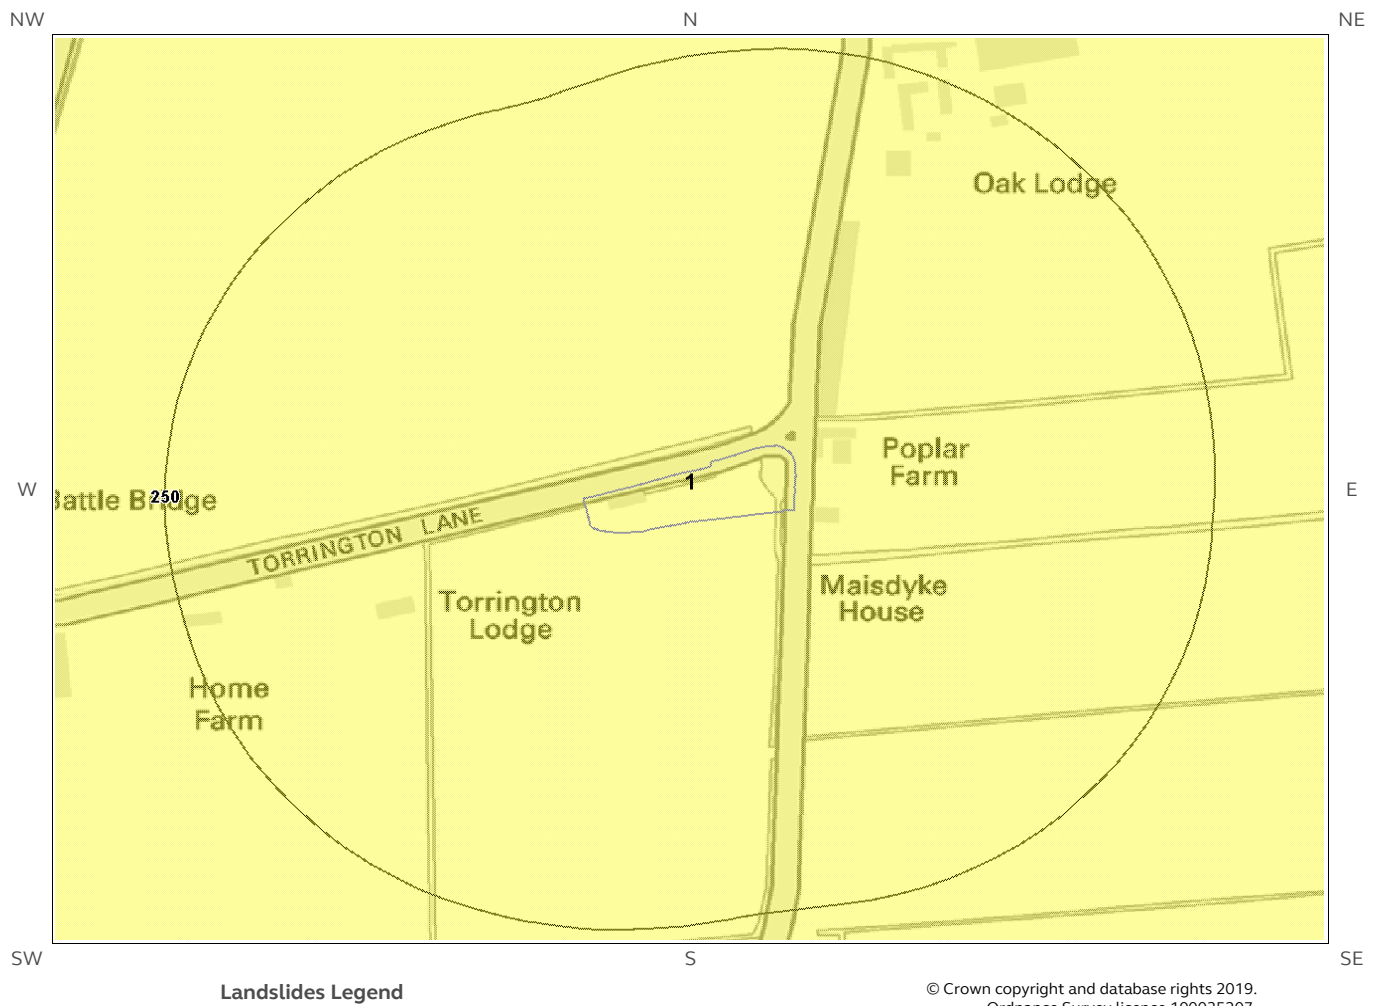

6.3 Ground Dissolution of Soluble Rocks map

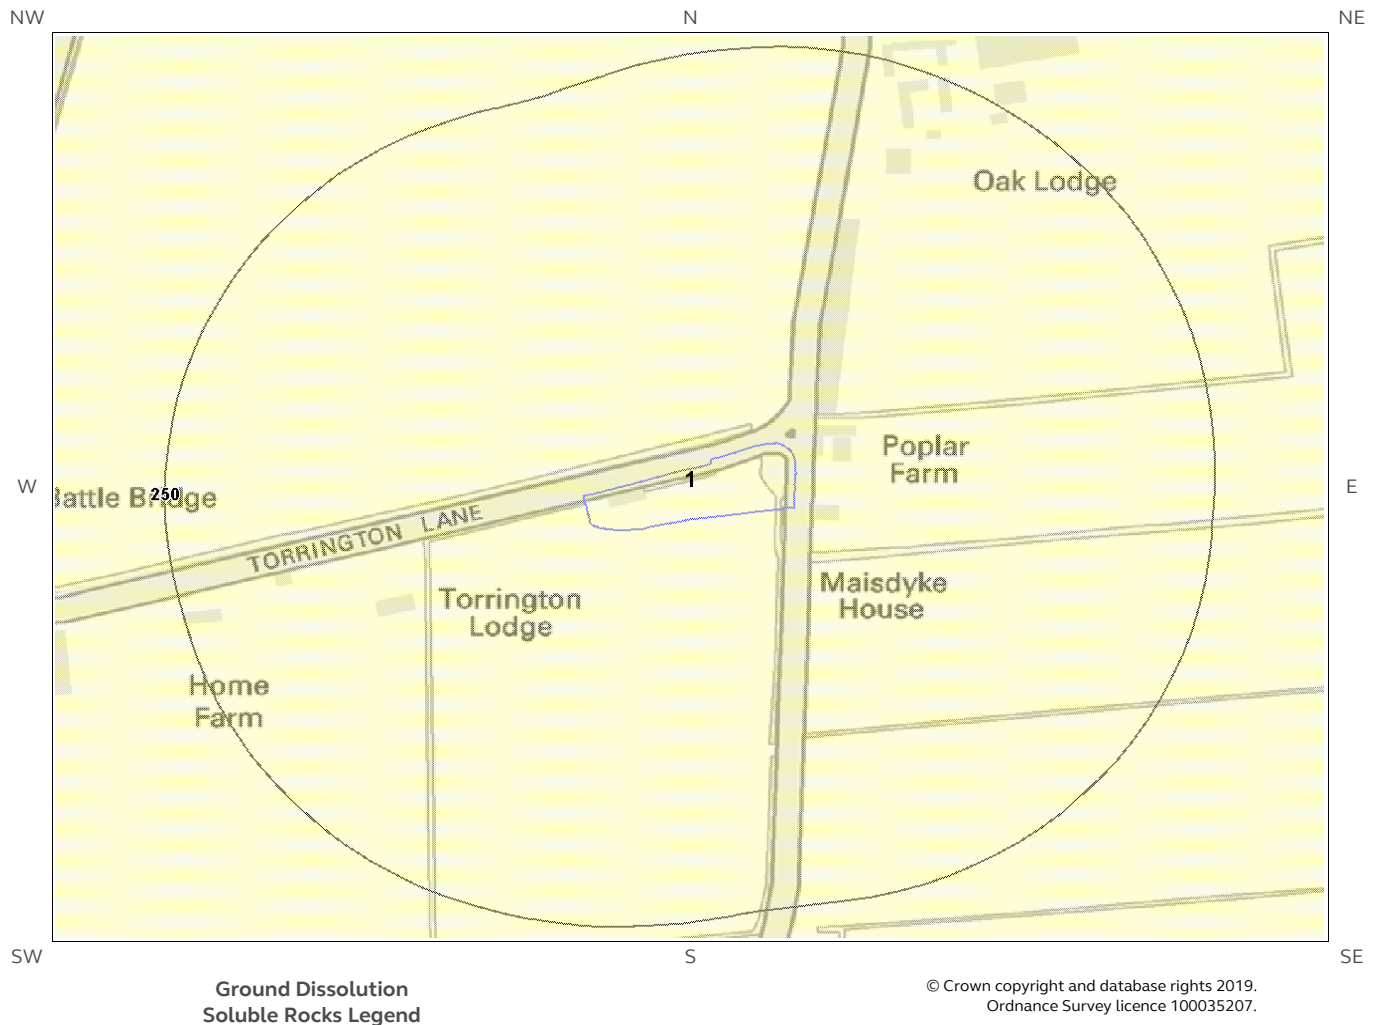

6.4 Compressible Deposits map

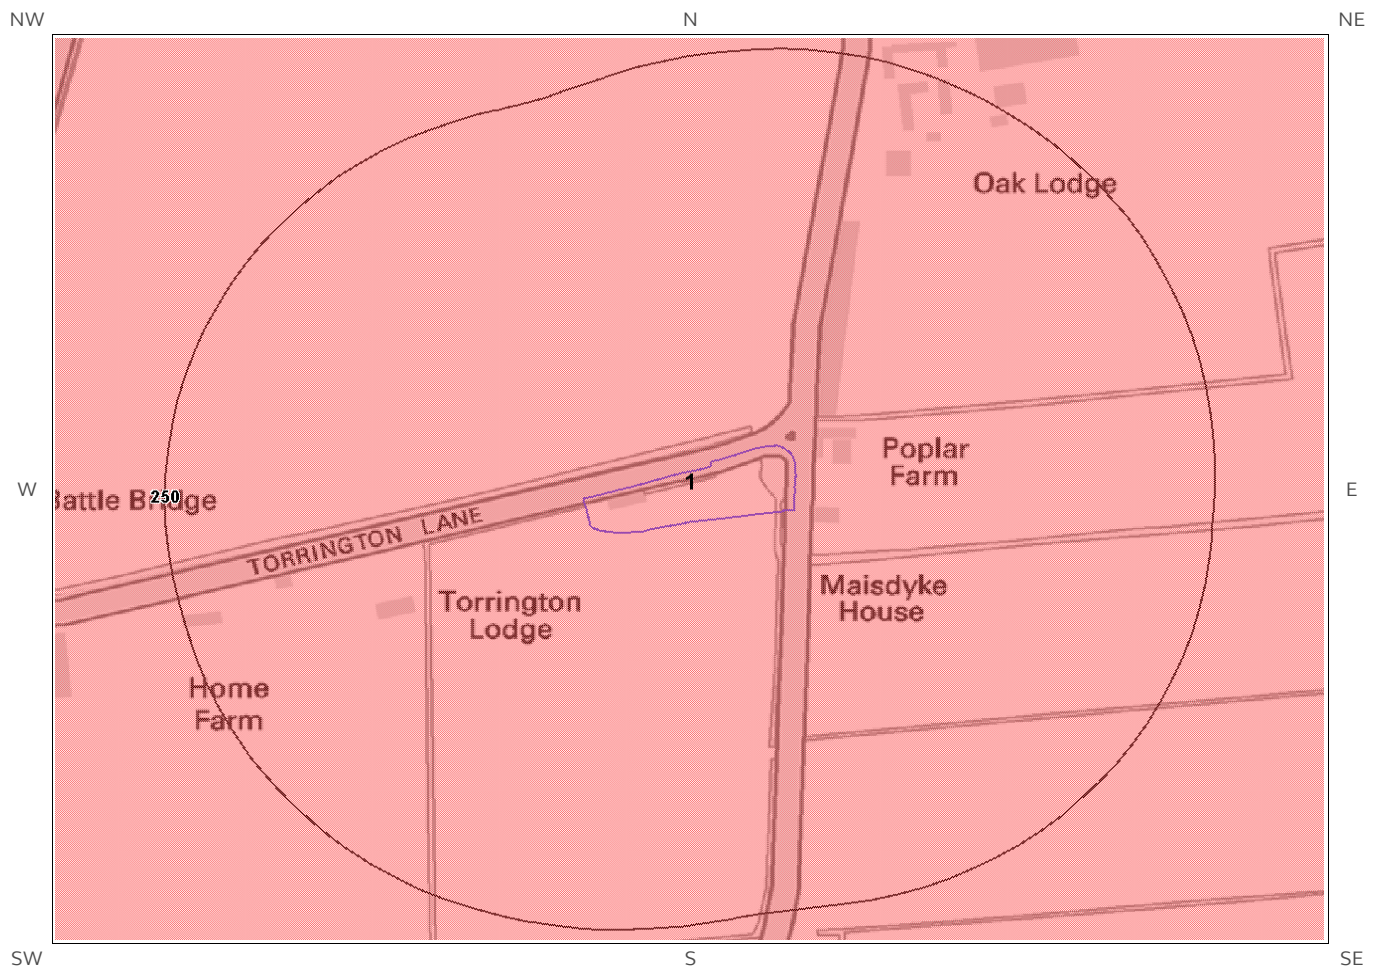


Compressible Deposits Legend

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.



6.5 Collapsible Deposits map

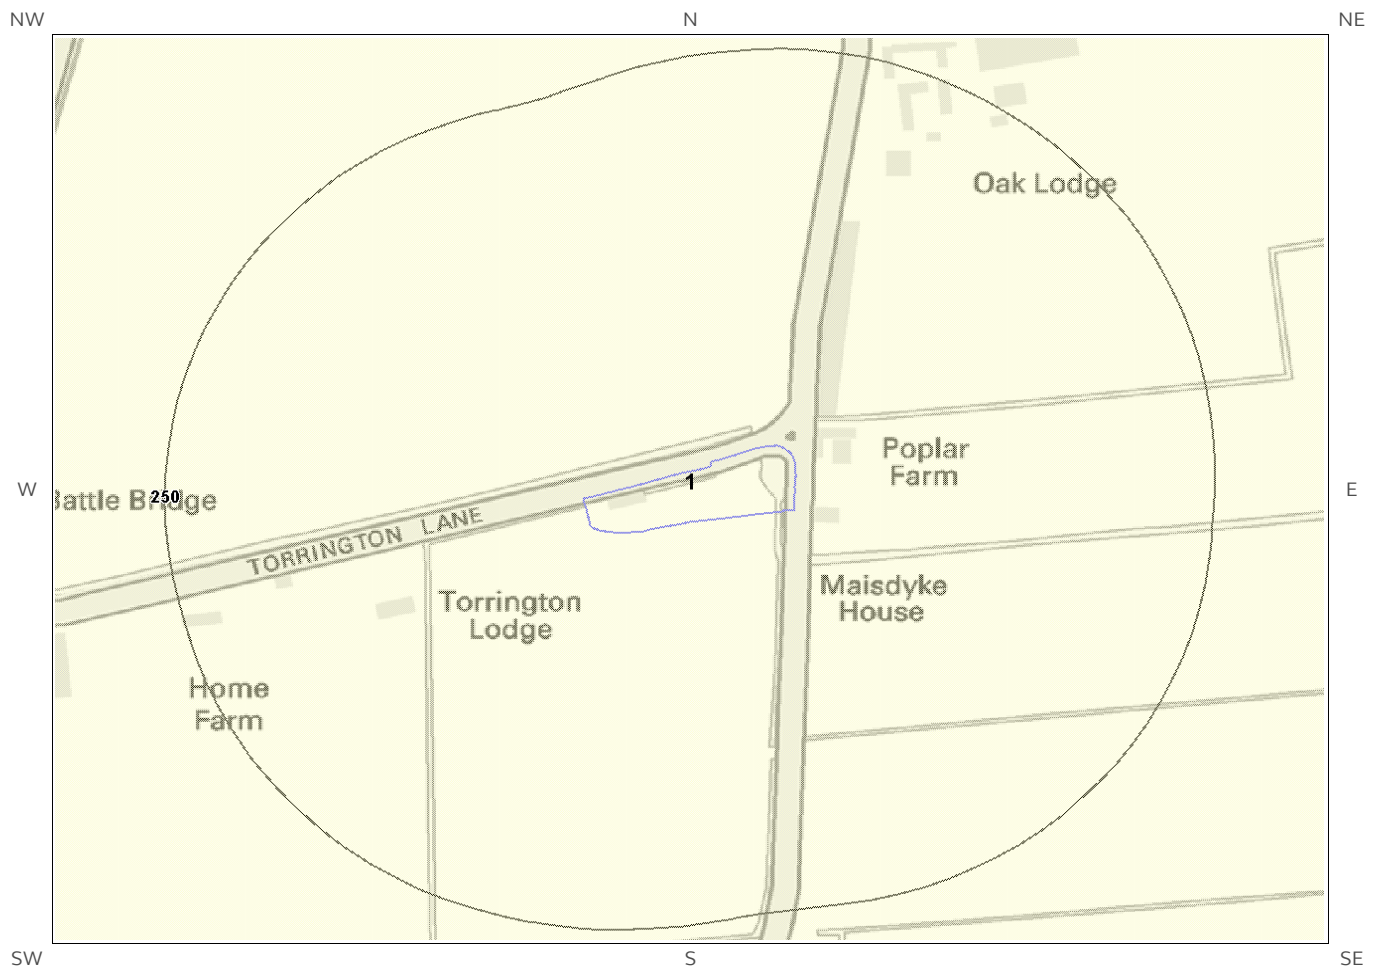


Collapsible Deposits Legend

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.



6.6 Running Sand map

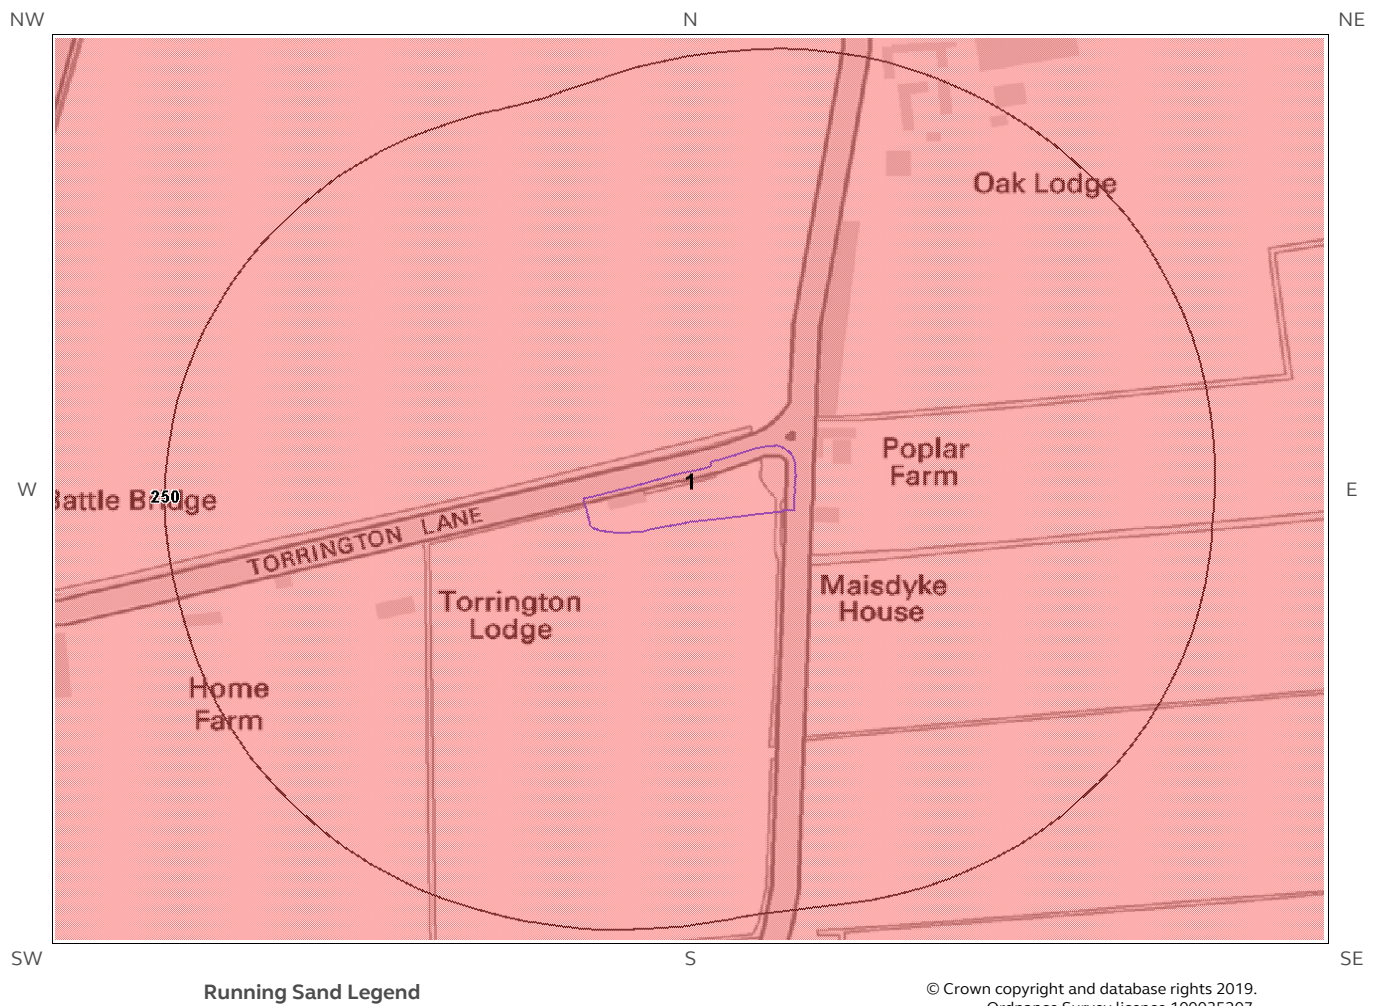

6 Natural Ground Subsidence

The National Ground Subsidence rating is obtained through the 6 natural ground stability hazard datasets, which are supplied by the British Geological Survey (BGS).

The following GeoSure data represented on the mapping is derived from the BGS Digital Geological map of Great Britain at 1:50,000 scale.

What is the maximum hazard rating of natural subsidence within the study site* boundary? Moderate

6.1 Shrink-Swell Clays

The following Shrink Swell information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Low	Ground conditions predominantly medium plasticity. Do not plant trees with high soil moisture demands near to buildings. For new build, consideration should be given to advice published by the National House Building Council (NHBC) and the Building Research Establishment (BRE). There is a possible increase in construction cost to reduce potential shrink-swell problems. For existing property, there is a possible increase in insurance risk, especially during droughts or where vegetation with high moisture demands is present.

6.2 Landslides

The following Landslides information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Very Low	Slope instability problems are unlikely to be present. No special actions required to avoid problems due to landslides. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with landslides.

* This includes an automatically generated 50m buffer zone around the site

6.3 Ground Dissolution of Soluble Rocks

The following Ground Dissolution information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Negligible	Soluble rocks are present, but unlikely to cause problems except under exceptional conditions. No special actions required to avoid problems due to soluble rocks. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with soluble rocks.

6.4 Compressible Deposits

The following Compressible Deposits information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Moderate	Significant potential for compressibility problems. Avoid large differential loadings of ground. Do not drain or de-water ground near the property without technical advice. For new build - consider possibility of compressible ground in ground investigation, construction and building design. Consider effects of groundwater changes. Extra construction costs are likely. For existing property - possible increase in insurance risk from compressibility, especially if water conditions or loading of the ground change significantly.

6.5 Collapsible Deposits

The following Collapsible Rocks information provided by the British Geological Survey:


ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Negligible	No indicators for collapsible deposits identified. No actions required to avoid problems due to collapsible deposits. No special ground investigation required, or increased construction costs or increased financial risk due to potential problems with collapsible deposits.

6.6 Running Sands

The following Running Sands information provided by the British Geological Survey:


ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Moderate	Significant potential for running sand problems with relatively small changes in ground conditions. Avoid large amounts of water entering the ground (for example through pipe leakage or soak-aways). Do not dig (deep) holes into saturated ground near the property without technical advice. For new build - consider the consequences of soil and groundwater conditions during and after construction. For existing property - possible increase in insurance risk from running sand, for example, due to water leakage, high rainfall events or flooding.

7 Borehole Records map

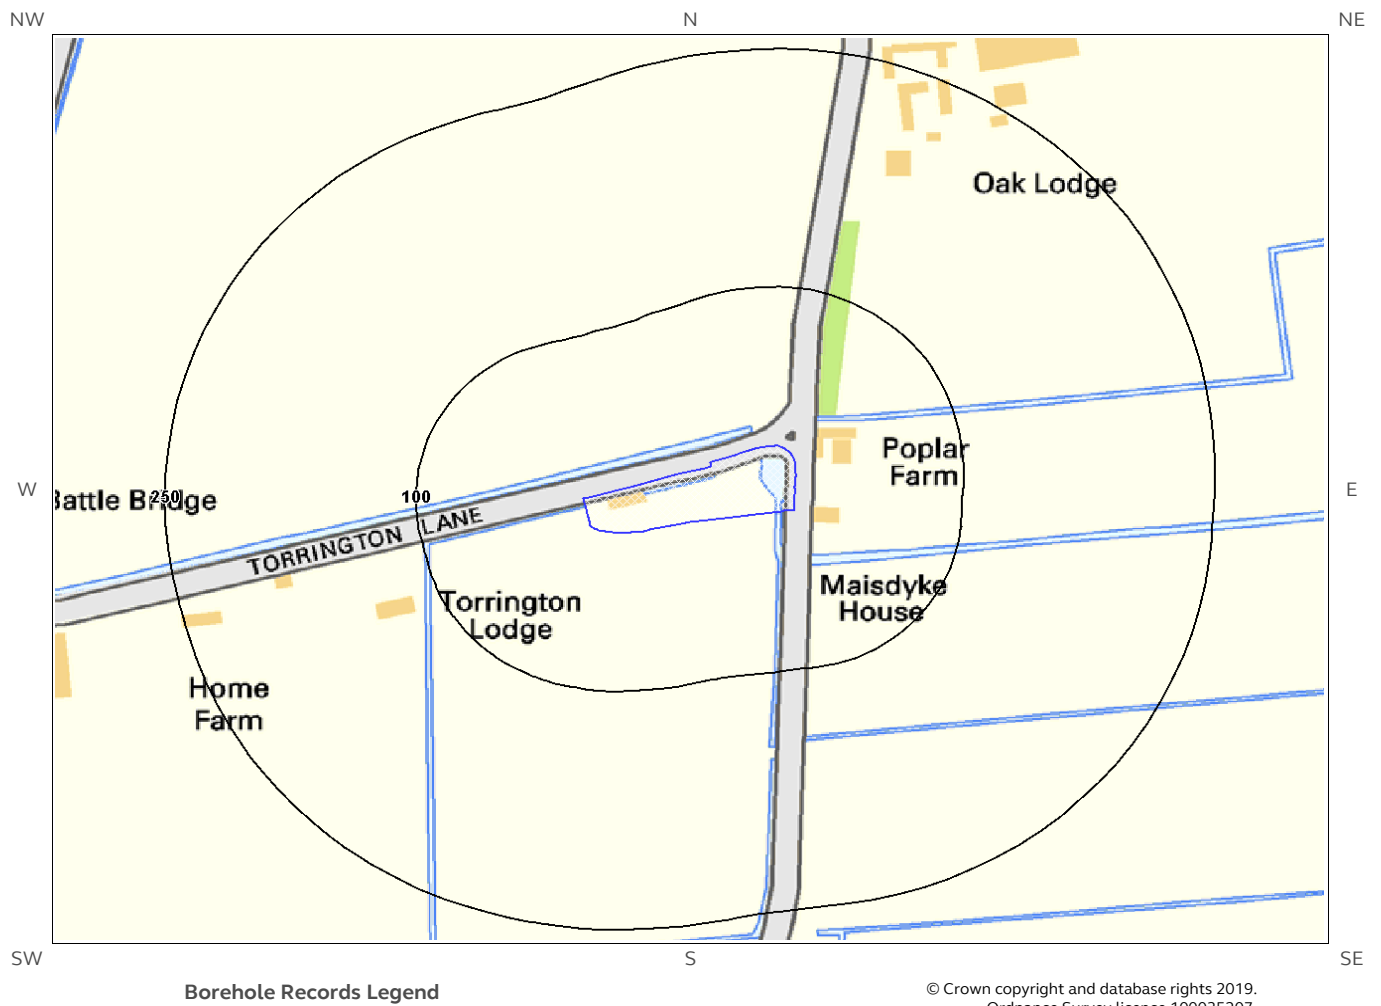

Borehole Records Legend

© Crown copyright and database rights 2019.
 Ordnance Survey licence 100035207.

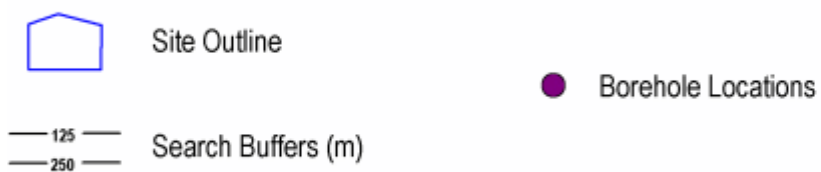

7 Borehole Records

The systematic analysis of data extracted from the BGS Borehole Records database provides the following information.

Records of boreholes within 250m of the study site boundary:

0

Database searched and no data found.

8 Estimated Background Soil Chemistry

Records of background estimated soil chemistry within 250m of the study site boundary:


1

For further information on how this data is calculated and limitations upon its use, please see the Groundsure Geo Insight User Guide, available on request.

Distance (m)	Direction	Sample Type	Arsenic (As)	Cadmium (Cd)	Chromium (Cr)	Nickel (Ni)	Lead (Pb)
0.0	On Site	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg


*As this data is based upon underlying 1:50,000 scale geological information, a 50m buffer has been added to the search radius.

9 Railways and Tunnels map

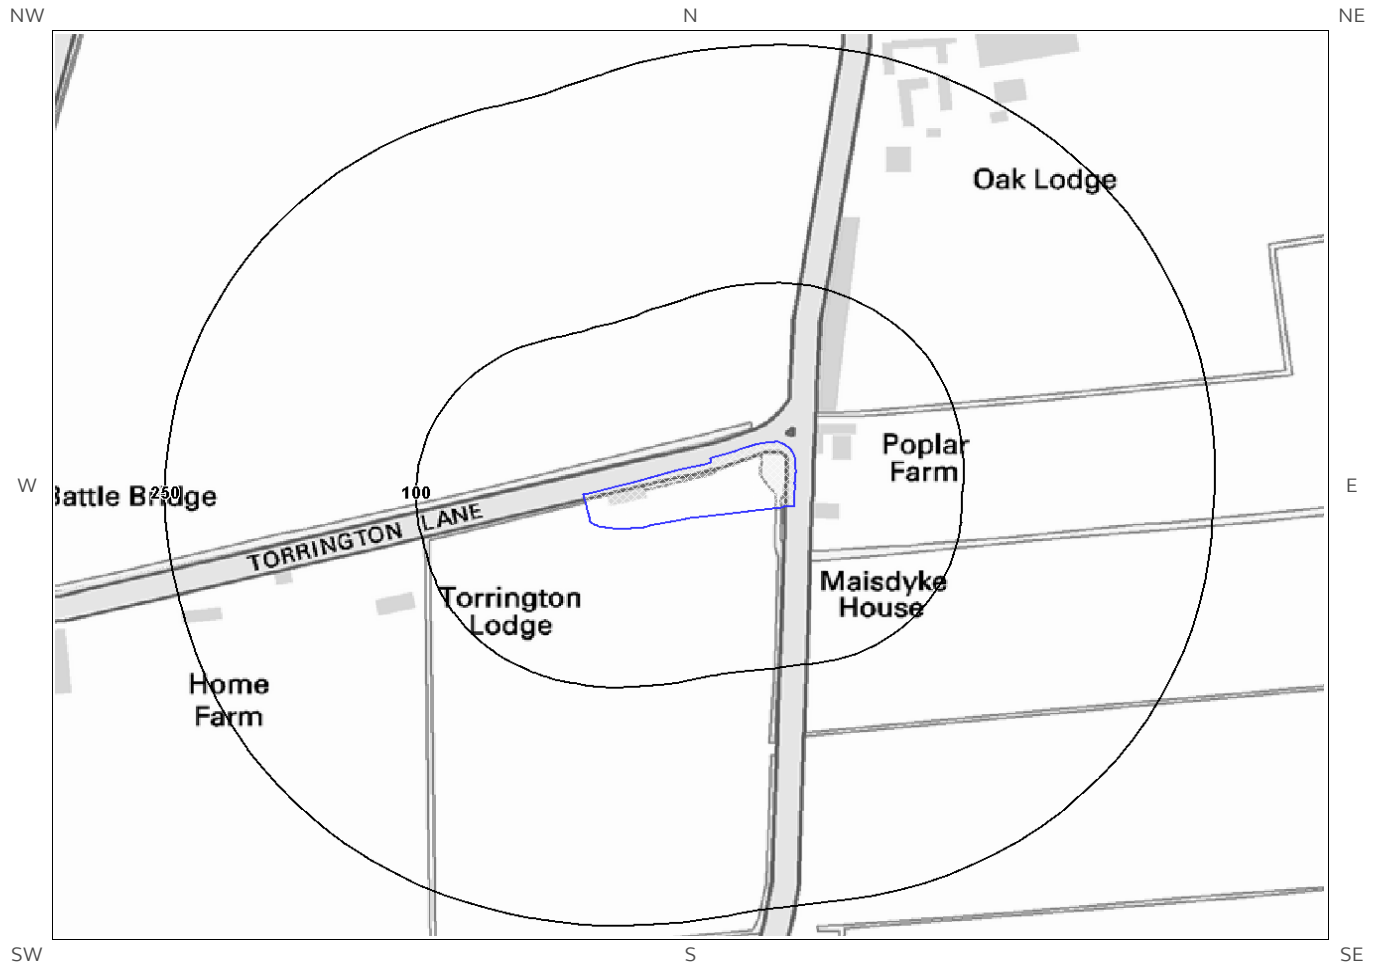

Railways and Tunnels Legend

© Crown copyright and database rights 2019.
 Ordnance Survey licence 100035207.
 © OpenStreetMapContributors

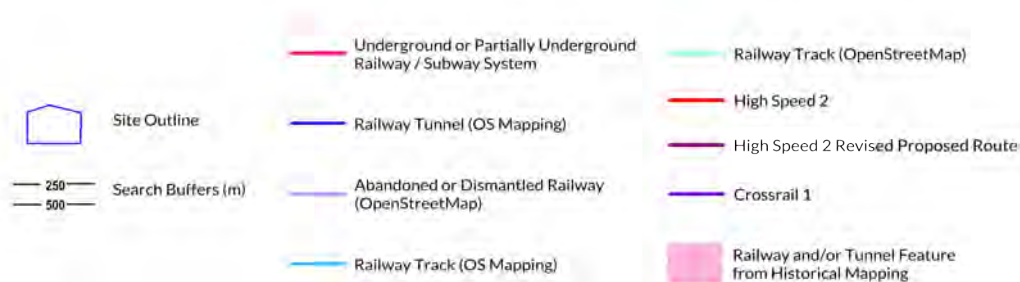

9 Railways and Tunnels

9.1 Tunnels

This data is derived from OpenStreetMap and provides information on the possible locations of underground railway systems in the UK - the London Underground, the Tyne & Wear Metro and the Glasgow Subway.

Have any underground railway lines been identified within the study site boundary? No

Have any underground railway lines been identified within 250m of the study site boundary? No

Database searched and no data found.

Any records that have been identified are represented on the Railways and Tunnels map.

This data is derived from Ordnance Survey mapping and provides information on the possible locations of railway tunnels forming part of the UK overground railway network.

Have any other railway tunnels been identified within the site boundary? No

Have any other railway tunnels been identified within 250m of the site boundary? No

Database searched and no data found.

Any records that have been identified are represented on the Railways and Tunnels map.

9.2 Historical Railway and Tunnel Features

This data is derived from Groundsure's unique Historical Land-use Database and contains features relating to tunnels, railway tracks or associated works that have been identified from historical Ordnance Survey mapping.

Have any historical railway or tunnel features been identified within the study site boundary? No

Have any historical railway or tunnel features been identified within 250m of the study site boundary? No

Database searched and no data found.

Any records that have been identified are represented on the Railways and Tunnels map.

9.3 Historical Railways

This data is derived from OpenStreetMap and provides information on the possible alignments of abandoned or dismantled railway lines in proximity to the study site.

Have any historical railway lines been identified within the study site boundary? No

Have any historical railway lines been identified within 250m of the study site boundary? No

Database searched and no data found.

Multiple sections of the same track may be listed in the detail above
Any records that have been identified are represented on the Railways and Tunnels map.

9.4 Active Railways

These datasets are derived from Ordnance Survey mapping and OpenStreetMap and provide information on the possible locations of active railway lines in proximity to the study site.

Have any active railway lines been identified within the study site boundary? No

Have any active railway lines been identified within 250m of the study site boundary? No

Database searched and no data found.

Multiple sections of the same track may be listed in the detail above
Any records that have been identified are represented on the Railways and Tunnels map.

9.5 Railway Projects

These datasets provide information on the location of large scale railway projects High Speed 2 and Crossrail 1 .

Is the study site within 5km of the route of the High Speed 2 rail project? No

Is the study site within 500m of the route of the Crossrail 1 rail project? No

Further information on proximity to these routes, the project construction status and associated works can be obtained through the purchase of a Groundsure HS2 and Crossrail 1 Report.

The route data has been digitised from publicly available maps by Groundsure. The route as provided relates to the Crossrail 1 project only, and does not include any details of the Crossrail 2 project, as final details of the route for Crossrail 2 are still under consultation.

Please note that this assessment takes account of both the original Phase 2b proposed route and the amended route proposed in 2016. As the Phase 2b route is still under consultation, Groundsure are providing information on both options until the final route is formally confirmed. Practitioners should take account of this uncertainty when advising clients.

Contact Details

Groundsure Helpline
Telephone: 08444 159 000
info@groundsure.com



British Geological Survey Enquiries

Kingsley Dunham Centre
Keyworth, Nottingham NG12 5GG
Tel: 0115 936 3143.
Fax: 0115 936 3276.
Email: enquiries@bgs.ac.uk
Web: www.bgs.ac.uk



BGS Geological Hazards Reports and general geological enquiries

British Gypsum

British Gypsum Ltd
East Leake
Loughborough
Leicestershire
LE12 6HX



The Coal Authority

200 Lichfield Lane
Mansfield
Notts NG18 4RG
Tel: 0345 7626 848
DX 716176 Mansfield 5
www.coal.gov.uk



Public Health England

Public information access office
Public Health England, Wellington House
133-155 Waterloo Road, London, SE1 8UG
<https://www.gov.uk/government/organisations/public-health-england>
Email: enquiries@phe.gov.uk
Main switchboard: 020 7654 8000



Johnson Poole & Bloomer Limited

Harris and Pearson Building, Brettell Lane
Brierley Hill, West Midlands
DY5 3LH
Tel: +44 (0) 1384 262 000
Email: enquiries.gs@jpb.co.uk
Website: www.jpb.co.uk



Ordnance Survey

Adanac Drive, Southampton
SO16 0AS
Tel: 08456 050505
Website: <http://www.ordnancesurvey.co.uk/>



Getmapping PLC

Virginia Villas, High Street, Hartley Witney,
Hampshire RG27 8NW
Tel: 01252 845444
Website: <http://www1.getmapping.com/>



Peter Brett Associates
Caversham Bridge House
Waterman Place
Reading
Berkshire RG1 8DN
Tel: +44 (0)118 950 0761 E-mail: reading@pba.co.uk
Website: <http://www.peterbrett.com/home>



Acknowledgements: Ordnance Survey © Crown Copyright and/or Database Right. All Rights Reserved. Licence Number [03421028].
This report has been prepared in accordance with the Groundsure Ltd standard Terms and Conditions of business for work of this nature.

Standard Terms and Conditions

Groundsure's Terms and Conditions can be viewed online at this link:
<https://www.groundsure.com/terms-and-conditions-may25-2018>

APPENDIX 2

ENVIRO-INSIGHT REPORT



Earth Environmental & Geotechnical Southern Ltd	Groundsure Reference:	GS-5777358
KINGSBURY HOUSE, KINGSBURY SQUARE, MELKSHAM, SN12 6HL	Your Reference:	R0160
	Report Date	25 Jan 2019
	Report Delivery Method:	Email - pdf

Enviro Insight

Address: Mulberry Barn, TORRINGTON LANE, FLEET, SPALDING,

Dear Sir/ Madam,

Thank you for placing your order with Groundsure. Please find enclosed the **Groundsure Enviro Insight** as requested.

If you need any further assistance, please do not hesitate to contact our helpline on 08444 159000 quoting the above Groundsure reference number.

Yours faithfully,

Managing Director
Groundsure Limited

Enc.
Groundsure Enviroinsight

Address: Mulberry Barn, TORRINGTON LANE, FLEET, SPALDING,

Date: 25 Jan 2019

Reference: GS-5777358

Client: Earth Environmental & Geotechnical Southern Ltd



Aerial Photograph Capture date: 06-Apr-2015

Grid Reference: 538804,322856

Site Size: 0.41ha

Report Reference: GS-5777358

Client Reference: R0160

Contents Page

Contents Page	3
Overview of Findings	6
Using this report	10
1. Historical Land Use	11
1. Historical Industrial Sites	12
1.1 Potentially Contaminative Uses identified from 1:10,000 scale Mapping	12
1.2 Additional Information – Historical Tank Database	12
1.3 Additional Information – Historical Energy Features Database	12
1.4 Additional Information – Historical Petrol and Fuel Site Database	12
1.5 Additional Information – Historical Garage and Motor Vehicle Repair Database	12
1.6 Historical military sites	13
1.7 Potentially Infilled Land	13
2. Environmental Permits, Incidents and Registers Map	14
2. Environmental Permits, Incidents and Registers	15
2.1 Industrial Sites Holding Licences and/or Authorisations	15
2.1.1 Records of historic IPC Authorisations within 500m of the study site	15
2.1.2 Records of Part A(1) and IPPC Authorised Activities within 500m of the study site	15
2.1.3 Records of Red List Discharge Consents (potentially harmful discharges to controlled waters) within 500m of the study site	15
2.1.4 Records of List 1 Dangerous Substances Inventory Sites within 500m of the study site	15
2.1.5 Records of List 2 Dangerous Substance Inventory Sites within 500m of the study site	15
2.1.6 Records of Part A(2) and Part B Activities and Enforcements within 500m of the study site	16
2.1.7 Records of Category 3 or 4 Radioactive Substances Authorisations	16
2.1.8 Records of Licensed Discharge Consents within 500m of the study site	16
2.1.9 Records of Water Industry Referrals (potentially harmful discharges to the public sewer) within 500m of the study site	16
2.1.10 Records of Planning Hazardous Substance Consents and Enforcements within 500m of the study site	16
2.2 Dangerous or Hazardous Sites	16
2.3 Environment Agency/Natural Resources Wales Recorded Pollution Incidents	17
2.3.1 Records of National Incidents Recording System, List 2 within 500m of the study site	17
2.3.2 Records of National Incidents Recording System, List 1 within 500m of the study site	17
2.4 Sites Determined as Contaminated Land under Part 2A EPA 1990	17
3. Landfill and Other Waste Sites Map	18
3. Landfill and Other Waste Sites	19
3.1 Landfill Sites	19
3.1.1 Records from Environment Agency/Natural Resources Wales landfill data within 1000m of the study site	19
3.1.2 Records of Environment Agency/Natural Resources Wales historic landfill sites within 1500m of the study site	19
3.1.3 Records of BGS/DoE non-operational landfill sites within 1500m of the study site	20
3.1.4 Records of Landfills from Local Authority and Historical Mapping Records within 1500m of the study site	20
3.2 Other Waste Sites	20
3.2.1 Records of waste treatment, transfer or disposal sites within 500m of the study site	20
3.2.2 Records of Environment Agency/Natural Resources Wales licensed waste sites within 1500m of the study site	20
4. Current Land Use Map	21
4. Current Land Uses	22
4.1 Current Industrial Data	22
4.2 Petrol and Fuel Sites	22
4.3 National Grid High Voltage Underground Electricity Transmission Cables	22
4.4 National Grid High Pressure Gas Transmission Pipelines	22

5. Geology	23
5.1 Artificial Ground and Made Ground.....	23
5.2 Superficial Ground and Drift Geology	23
5.3 Bedrock and Solid Geology	23
6 Hydrogeology and Hydrology	24
6a. Aquifer Within Superficial Geology	24
6b. Aquifer Within Bedrock Geology and Abstraction Licences	25
6c. Hydrogeology – Source Protection Zones and Potable Water Abstraction Licences	26
6d. Hydrogeology – Source Protection Zones within confined aquifer	27
6e. Hydrology – Watercourse Network and River Quality	28
6.Hydrogeology and Hydrology	29
6.1 Aquifer within Superficial Deposits.....	29
6.2 Aquifer within Bedrock Deposits.....	29
6.3 Groundwater Abstraction Licences.....	29
6.4 Surface Water Abstraction Licences.....	29
6.5 Potable Water Abstraction Licences.....	30
6.6 Source Protection Zones.....	30
6.7 Source Protection Zones within Confined Aquifer.....	30
6.8 Groundwater Vulnerability and Soil Leaching Potential.....	30
6.9 River Quality.....	30
6.9.1 Biological Quality:.....	30
6.9.2 Chemical Quality:.....	31
6.10 Ordnance Survey MasterMap Water Network.....	31
6.11 Surface Water Features.....	37
7a. Environment Agency/Natural Resources Wales Flood Map for Planning (from rivers and the sea)	38
7b. Environment Agency/Natural Resources Wales Risk of Flooding from Rivers and the Sea (RoFRaS)	39
Map	39
7 Flooding	40
7.1 River and Coastal Zone 2 Flooding.....	40
7.2 River and Coastal Zone 3 Flooding.....	40
7.3 Risk of Flooding from Rivers and the Sea (RoFRaS) Flood Rating.....	41
7.4 Flood Defences.....	41
7.5 Areas benefiting from Flood Defences.....	41
7.6 Areas benefiting from Flood Storage.....	41
7.7 Groundwater Flooding Susceptibility Areas.....	41
7.8 Groundwater Flooding Confidence Areas.....	42
8. Designated Environmentally Sensitive Sites Map	43
8. Designated Environmentally Sensitive Sites	44
8.1 Records of Sites of Special Scientific Interest (SSSI) within 2000m of the study site:.....	44
8.2 Records of National Nature Reserves (NNR) within 2000m of the study site:.....	44
8.3 Records of Special Areas of Conservation (SAC) within 2000m of the study site:.....	44
8.4 Records of Special Protection Areas (SPA) within 2000m of the study site:.....	44
8.5 Records of Ramsar sites within 2000m of the study site:.....	44
8.6 Records of Ancient Woodland within 2000m of the study site:	45
8.7 Records of Local Nature Reserves (LNR) within 2000m of the study site:.....	45
8.8 Records of World Heritage Sites within 2000m of the study site:.....	45
8.9 Records of Environmentally Sensitive Areas within 2000m of the study site:	45
8.10 Records of Areas of Outstanding Natural Beauty (AONB) within 2000m of the study site:	45
8.11 Records of National Parks (NP) within 2000m of the study site:	45
8.12 Records of Nitrate Sensitive Areas within 2000m of the study site:.....	45
8.13 Records of Nitrate Vulnerable Zones within 2000m of the study site:.....	46

8.14 Records of Green Belt land within 2000m of the study site:.....	46
9. Natural Hazards Findings.....	47
9.1 Detailed BGS GeoSure Data.....	47
9.1.1 Shrink Swell.....	47
9.1.2 Landslides.....	47
9.1.3 Soluble Rocks.....	47
9.1.4 Compressible Ground.....	48
9.1.5 Collapsible Rocks.....	48
9.1.6 Running Sand.....	48
9.2 Radon.....	49
9.2.1 Radon Affected Areas.....	49
9.2.2 Radon Protection.....	49
10. Mining.....	50
10.1 Coal Mining.....	50
10.2 Non-Coal Mining.....	50
10.3 Brine Affected Areas	50
Contact Details.....	51
Standard Terms and Conditions.....	53

Overview of Findings

For further details on each dataset, please refer to each individual section in the main report as listed. Where the database has been searched a numerical result will be recorded. Where the database has not been searched '-' will be recorded.

Section 1: Historical Industrial Sites	On-site	0-50	51-250	251-500
1.1 Potentially Contaminative Uses identified from 1:10,000 scale mapping	0	0	1	0
1.2 Additional Information – Historical Tank Database	N/A	N/A	N/A	N/A
1.3 Additional Information – Historical Energy Features Database	N/A	N/A	N/A	N/A
1.4 Additional Information – Historical Petrol and Fuel Site Database	N/A	N/A	N/A	N/A
1.5 Additional Information – Historical Garage and Motor Vehicle Repair Database	N/A	N/A	N/A	N/A
1.6 Historical military sites	0	0	0	0
1.7 Potentially Infilled Land	4	0	1	0
Section 2: Environmental Permits, Incidents and Registers	On-site	0-50m	51-250	251-500
2.1 Industrial Sites Holding Environmental Permits and/or Authorisations				
2.1.1 Records of historic IPC Authorisations	0	0	0	0
2.1.2 Records of Part A(1) and IPPC Authorised Activities	0	0	0	0
2.1.3 Records of Red List Discharge Consents	0	0	0	0
2.1.4 Records of List 1 Dangerous Substances Inventory sites	0	0	0	0
2.1.5 Records of List 2 Dangerous Substances Inventory sites	0	0	0	0
2.1.6 Records of Part A(2) and Part B Activities and Enforcements	0	0	0	0
2.1.7 Records of Category 3 or 4 Radioactive Substances Authorisations	0	0	0	0
2.1.8 Records of Licensed Discharge Consents	0	0	0	0
2.1.9 Records of Water Industry Referrals	0	0	0	0
2.1.10 Records of Planning Hazardous Substance Consents and Enforcements within 500m of the study site	0	0	0	0
2.2 Records of COMAH and NIHHS sites	0	0	0	0
2.3 Environment Agency/Natural Resources Wales Recorded Pollution Incidents				
2.3.1 National Incidents Recording System, List 2	0	0	0	0
2.3.2 National Incidents Recording System, List 1	0	0	0	0
2.4 Sites Determined as Contaminated Land under Part 2A EPA 1990	0	0	0	0

Section 3: Landfill and Other Waste Sites	On-site	0-50m	51-250	251-500	501-1000	1000-1500
3.1 Landfill Sites						
3.1.1 Environment Agency/Natural Resources Wales Registered Landfill Sites	0	0	0	0	0	Not searched
3.1.2 Environment Agency/Natural Resources Wales Historic Landfill Sites	0	0	0	0	0	3
3.1.3 BGS/DoE Landfill Site Survey	0	0	0	0	0	0
3.1.4 Records of Landfills in Local Authority and Historical Mapping Records	0	0	0	0	0	1
3.2 Landfill and Other Waste Sites Findings						
3.2.1 Operational and Non-Operational Waste Treatment, Transfer and Disposal Sites	0	0	0	0	Not searched	Not searched
3.2.2 Environment Agency/Natural Resources Wales Licensed Waste Sites	0	0	0	0	0	0

Section 4: Current Land Use	On-site	0-50m	51-250	251-500
4.1 Current Industrial Sites Data	0	0	0	Not searched
4.2 Records of Petrol and Fuel Sites	0	0	0	0
4.3 National Grid Underground Electricity Cables	0	0	0	0
4.4 National Grid Gas Transmission Pipelines	0	0	0	0

Section 5: Geology	
5.1 Records of Artificial Ground and Made Ground present beneath the study site	None identified
5.2 Records of Superficial Ground and Drift Geology present beneath the study site	Identified
5.3 For records of Bedrock and Solid Geology beneath the study site see the detailed findings section.	

Section 6: Hydrogeology and Hydrology				0-500m		
6.1 Records of Strata Classification in the Superficial Geology within 500m of the study site				Identified		
6.2 Records of Strata Classification in the Bedrock Geology within 500m of the study site				Identified		
	On-site	0-50m	51-250	251-500	501-1000	1000-2000
6.3 Groundwater Abstraction Licences (within 2000m of the study site)	0	0	0	0	0	0
6.4 Surface Water Abstraction Licences (within 2000m of the study site)	0	0	0	0	0	0
6.5 Potable Water Abstraction Licences (within 2000m of the study site)	0	0	0	0	0	0
6.6 Source Protection Zones (within 500m of the study site)	0	0	0	0	Not searched	Not searched
6.7 Source Protection Zones within Confined Aquifer	0	0	0	0	Not searched	Not searched
6.8 Groundwater Vulnerability and Soil Leaching Potential (within 500m of the study site)	0	0	#250GWV #	#500GWV #	Not searched	Not searched

Section 6: Hydrogeology and Hydrology

0-500m

	On-site	0-50m	51-250	251-500	501-1000	1000-1500
6.9 Environment Agency/Natural Resources Wales information on river quality within 1500m of the study site	No	No	No	No	No	No
6.10 Ordnance Survey MasterMap Water Network entries within 500m of the site	4	6	4	54	Not searched	Not searched
6.11 Surface water features within 250m of the study site	Yes	Yes	Yes	Not searched	Not searched	Not searched

Section 7: Flooding

7.1 Environment Agency Zone 2 floodplains within 250m of the study site	Identified					
7.2 Environment Agency/Natural Resources Wales Zone 3 floodplains within 250m of the study site	Identified					
7.3 Risk of flooding from Rivers and the Sea (RoFRaS) rating for the study site	Low					
7.4 Flood Defences within 250m of the study site	None identified					
7.5 Areas benefiting from Flood Defences within 250m of the study site	None identified					
7.6 Areas used for Flood Storage within 250m of the study site	None identified					
7.7 Maximum BGS Groundwater Flooding susceptibility within 50m of the study site	Not Prone					
7.8 BGS confidence rating for the Groundwater Flooding susceptibility areas	Not Applicable					

Section 8: Designated Environmentally Sensitive Sites

	On-site	0-50m	51-250	251-500	501-1000	1000-2000
8.1 Records of Sites of Special Scientific Interest (SSSI)	0	0	0	0	0	0
8.2 Records of National Nature Reserves (NNR)	0	0	0	0	0	0
8.3 Records of Special Areas of Conservation (SAC)	0	0	0	0	0	0
8.4 Records of Special Protection Areas (SPA)	0	0	0	0	0	0
8.5 Records of Ramsar sites	0	0	0	0	0	0
8.6 Records of Ancient Woodlands	0	0	0	0	0	0
8.7 Records of Local Nature Reserves (LNR)	0	0	0	0	0	0
8.8 Records of World Heritage Sites	0	0	0	0	0	0
8.9 Records of Environmentally Sensitive Areas	0	0	0	0	0	0

Section 8: Designated Environmentally Sensitive Sites	On-site	0-50m	51-250	251-500	501-1000	1000-2000
8.10 Records of Areas of Outstanding Natural Beauty (AONB)	0	0	0	0	0	0
8.11 Records of National Parks	0	0	0	0	0	0
8.12 Records of Nitrate Sensitive Areas	0	0	0	0	0	0
8.13 Records of Nitrate Vulnerable Zones	0	0	0	0	0	0
8.14 Records of Green Belt land	0	0	0	0	0	0

Section 9: Natural Hazards	
9.1 Maximum risk of natural ground subsidence	Moderate
9.1.1 Maximum Shrink-Swell hazard rating identified on the study site	Low
9.1.2 Maximum Landslides hazard rating identified on the study site	Very Low
9.1.3 Maximum Soluble Rocks hazard rating identified on the study site	Negligible
9.1.4 Maximum Compressible Ground hazard rating identified on the study site	Moderate
9.1.5 Maximum Collapsible Rocks hazard rating identified on the study site	Negligible
9.1.6 Maximum Running Sand hazard rating identified on the study site	Moderate
9.2 Radon	
9.2.1 Is the property in a Radon Affected Area as defined by the Health Protection Agency (HPA) and if so what percentage of homes are above the Action Level?	The site is not in a Radon Affected Area, as less than 1% of properties are above the Action Level.
9.2.2 Is the property in an area where Radon Protection are required for new properties or extensions to existing ones as described in publication BR211 by the Building Research Establishment?	No radon protective measures are necessary.

Section 10: Mining	
10.1 Coal mining areas within 75m of the study site	None identified
10.2 Non-Coal Mining areas within 50m of the study site boundary	None identified
10.3 Brine affected areas within 75m of the study site	None identified

Using this report

The following report is designed by Environmental Consultants for Environmental Professionals bringing together the most up-to-date market leading environmental data. This report is provided under and subject to the Terms & Conditions agreed between Groundsure and the Client. The document contains the following sections:

1. Historical Industrial Sites

Provides information on past land uses that may pose a risk to the study site in terms of potential contamination from activities or processes. Potentially Infilled Land features are also included. This search is conducted using radii of up to 500m.

2. Environmental Permits, Incidents and Registers

Provides information on Regulated Industrial Activities and Pollution Incidents as recorded by Regulatory Authorities, and sites determined as Contaminated Land. This search is conducted using radii up to 500m.

3. Landfills and Other Waste Sites

Provides information on landfills and other waste sites that may pose a risk to the study site. This search is conducted using radii up to 1500m.

4. Current Land Uses

Provides information on current land uses that may pose a risk to the study site in terms of potential contamination from activities or processes. These searches are conducted using radii of up to 500m. This includes information on potentially contaminative industrial sites, petrol stations and fuel sites as well as high pressure gas pipelines and underground electricity transmission lines.

5. Geology

Provides information on artificial and superficial deposits and bedrock beneath the study site.

6. Hydrogeology and Hydrology

Provides information on productive strata within the bedrock and superficial geological layers, abstraction licences, Source Protection Zones (SPZs) and river quality. These searches are conducted using radii of up to 2000m.

7. Flooding

Provides information on river and coastal flooding, flood defences, flood storage areas and groundwater flood areas. This search is conducted using radii of up to 250m.

8. Designated Environmentally Sensitive Sites

Provides information on the Sites of Special Scientific Interest (SSSI), National Nature Reserves (NNR), Special Areas of Conservation (SAC), Special Protection Areas (SPA), Ramsar sites, Local Nature Reserves (LNR), Areas of Outstanding Natural Beauty (AONB), National Parks (NP), Environmentally Sensitive Areas, Nitrate Sensitive Areas, Nitrate Vulnerable Zones and World Heritage Sites and Scheduled Ancient Woodland. These searches are conducted using radii of up to 2000m.

9. Natural Hazards

Provides information on a range of natural hazards that may pose a risk to the study site. These factors include natural ground subsidence and radon..

10. Mining

Provides information on areas of coal and non-coal mining and brine affected areas.

11. Contacts

This section of the report provides contact points for statutory bodies and data providers that may be able to provide further information on issues raised within this report. Alternatively, Groundsure provide a free Technical Helpline (08444 159000) for further information and guidance.


Note: Maps

Only certain features are placed on the maps within the report. All features represented on maps found within this search are given an identification number. This number identifies the feature on the mapping and correlates it to the additional information provided below. This identification number precedes all other information and takes the following format -Id: 1, Id: 2, etc. Where numerous features on the same map are in such close proximity that the numbers would obscure each other a letter identifier is used instead to represent the features. (e.g. Three features which overlap may be given the identifier "A" on the map and would be identified separately as features 1A, 3A, 10A on the data tables provided).


Where a feature is reported in the data tables to a distance greater than the map area, it is noted in the data table as "Not Shown".

All distances given in this report are in Metres (m). Directions are given as compass headings such as N: North, E: East, NE: North East from the nearest point of the study site boundary.

1. Historical Land Use

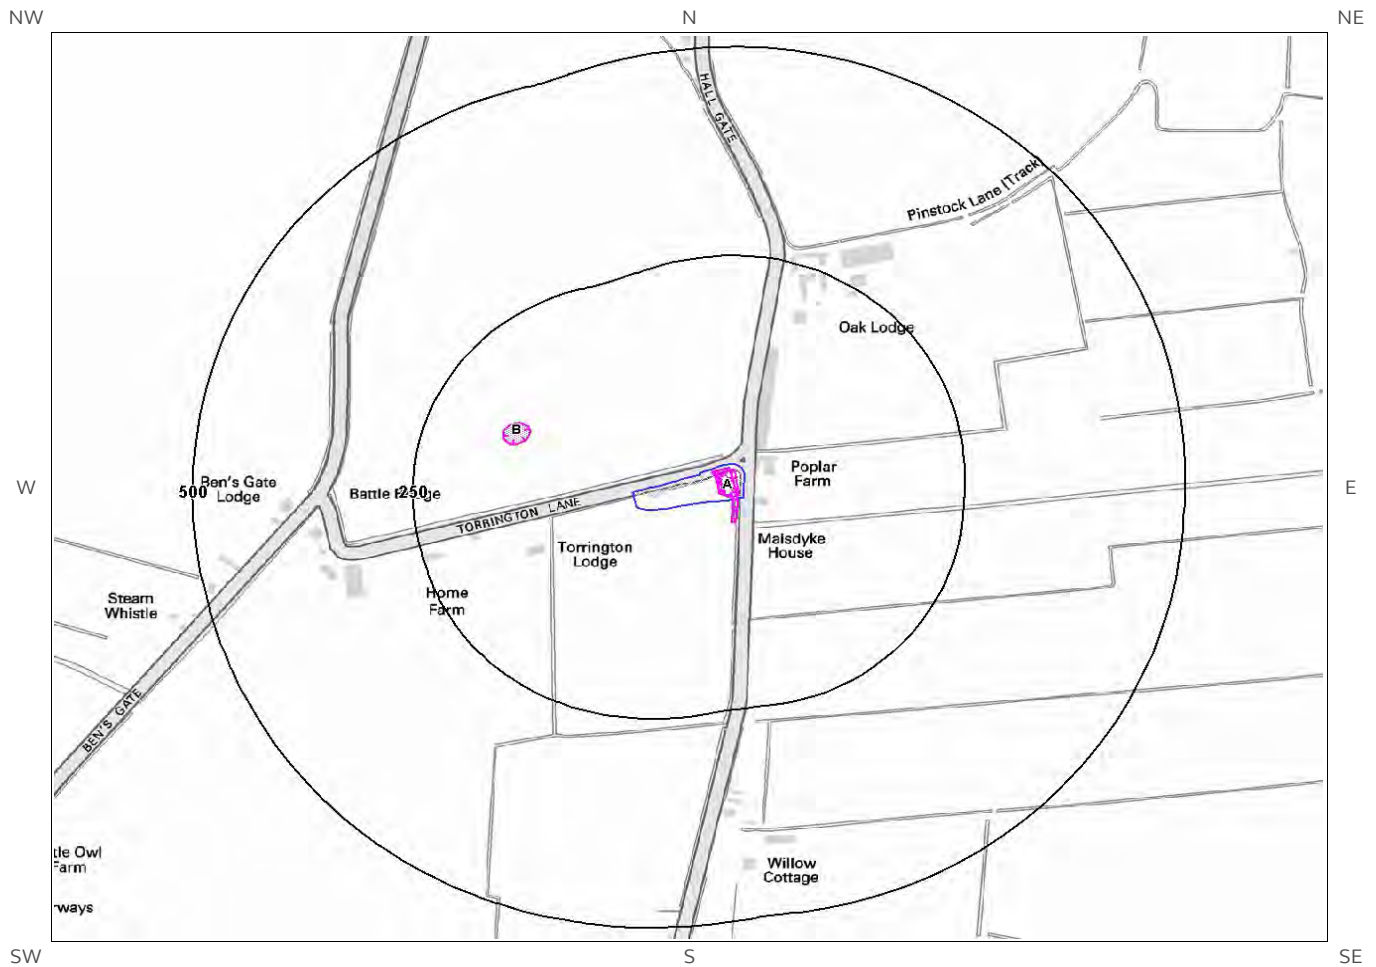

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.

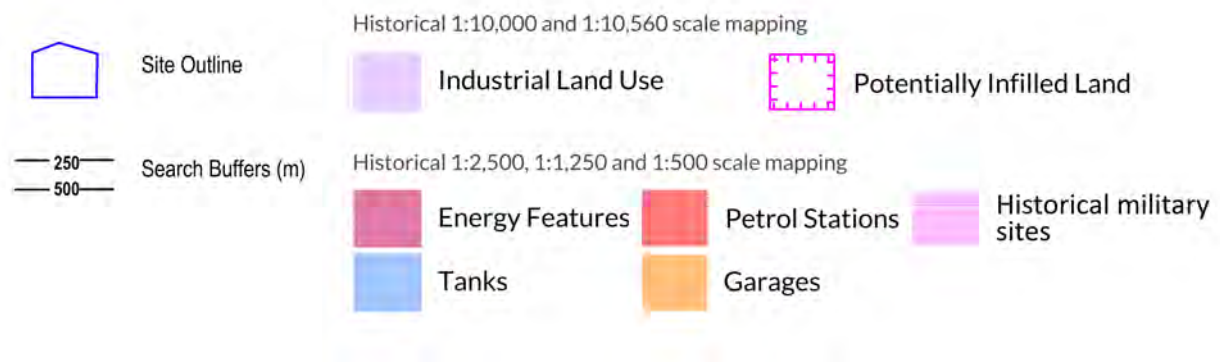

1. Historical Industrial Sites

1.1 Potentially Contaminative Uses identified from 1:10,000 scale Mapping

The systematic analysis of data extracted from standard 1:10,560 and 1:10,000 scale historical maps provides the following information:

Records of sites with a potentially contaminative past land use within 500m of the search boundary: 1

ID	Distance [m]	Direction	Use	Date
1B	136	NW	Unspecified Pit	1887

1.2 Additional Information – Historical Tank Database

The systematic analysis of data extracted from High Detailed 1:1,250 and 1:2,500 scale historical maps provides the following information.

No data available in this area.

1.3 Additional Information – Historical Energy Features Database

The systematic analysis of data extracted from High Detailed 1:1,250 and 1:2,500 scale historical maps provides the following information.

No data available in this area.

1.4 Additional Information – Historical Petrol and Fuel Site Database

The systematic analysis of data extracted from High Detailed 1:1,250 and 1:2,500 scale historical maps provides the following information.

No data available in this area.

1.5 Additional Information – Historical Garage and Motor Vehicle Repair Database

The systematic analysis of data extracted from High Detailed 1:1,250 and 1:2,500 scale historical maps provides the following information.

No data available in this area.

1.6 Historical military sites

Certain military installations were not noted on historic mapping for security reasons. Whilst not all military land is necessarily of concern, Groundsure has researched and digitised a number of Ordnance Factories and other military industrial features (e.g. Ordnance Depots, Munitions Testing Grounds) which may be of contaminative concern. This research was drawn from a number of different sources, and should not be regarded as a definitive or exhaustive database of potentially contaminative military installations. The boundaries of sites within this database have been estimated from the best evidence available to Groundsure at the time of compilation.

Records of historical military sites within 500m of the search boundary: 0

Database searched and no data found.


1.7 Potentially Infilled Land

Records of Potentially Infilled Features from 1:10,000 scale mapping within 500m of the study site: 5

The following Historical Potentially Infilled Features derived from the Historical Mapping information is provided by Groundsure:

ID	Distance(m)	Direction	Use	Date
2A	0	On Site	Pond	1903
3A	0	On Site	Pond	1950
4A	0	On Site	Pond	1938
5A	0	On Site	Pond	1887
6B	136	NW	Unspecified Pit	1887

2. Environmental Permits, Incidents and Registers Map

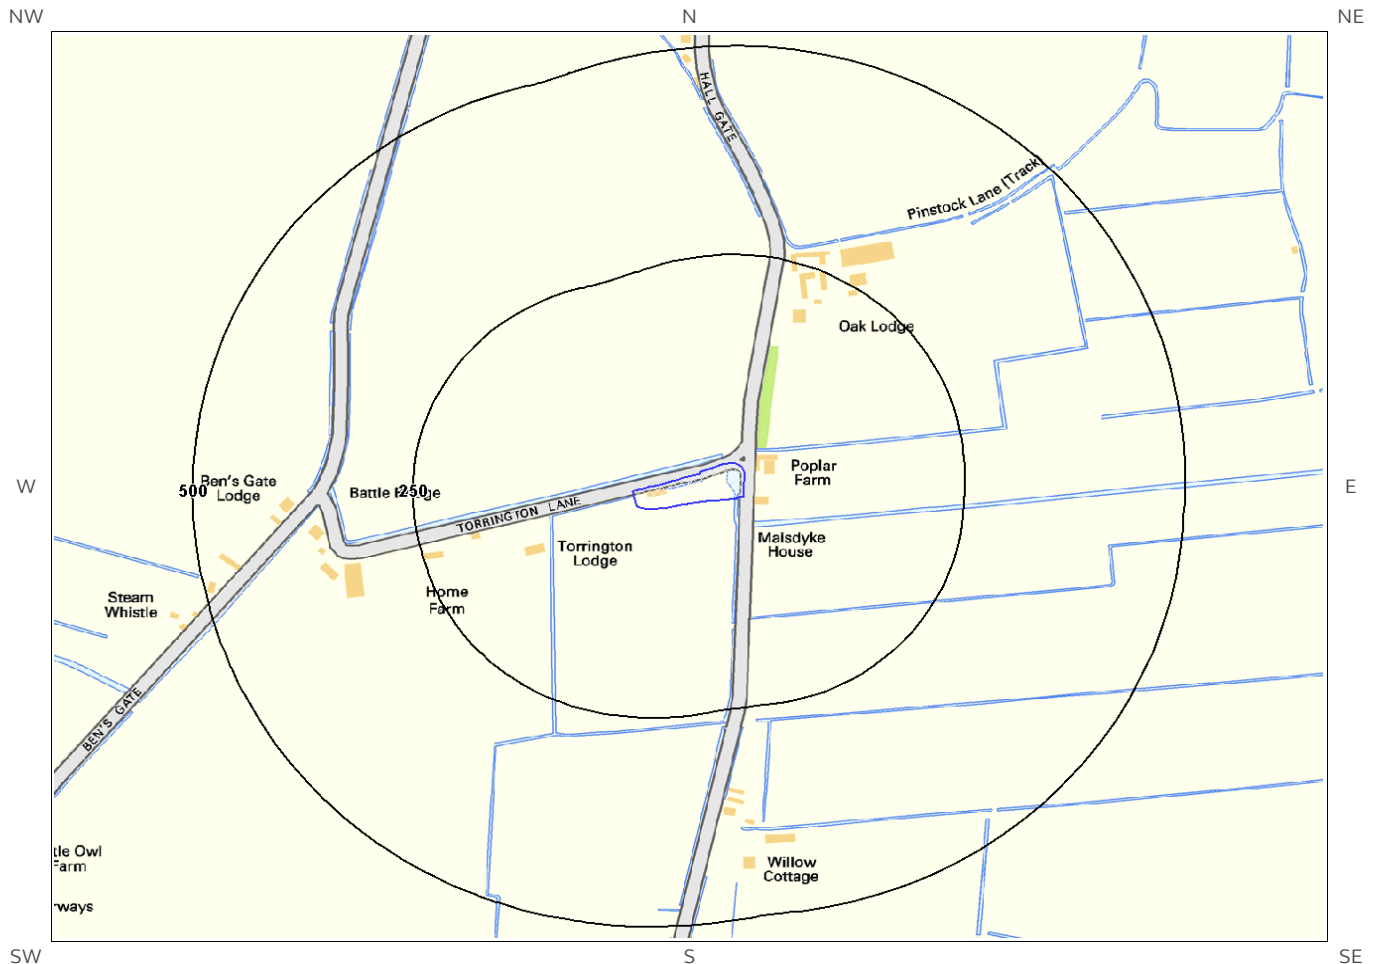

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.



2. Environmental Permits, Incidents and Registers

2.1 Industrial Sites Holding Licences and/or Authorisations

Searches of information provided by the Environment Agency/Natural Resources Wales and Local Authorities reveal the following information:

2.1.1 Records of historic IPC Authorisations within 500m of the study site:

0

Database searched and no data found.

2.1.2 Records of Part A(1) and IPPC Authorised Activities within 500m of the study site:

0

Database searched and no data found.

2.1.3 Records of Red List Discharge Consents (potentially harmful discharges to controlled waters) within 500m of the study site:

0

Database searched and no data found.

2.1.4 Records of List 1 Dangerous Substances Inventory Sites within 500m of the study site:

0

Database searched and no data found.

2.1.5 Records of List 2 Dangerous Substance Inventory Sites within 500m of the study site:

0

Database searched and no data found.

2.1.6 Records of Part A(2) and Part B Activities and Enforcements within 500m of the study site:

0

Database searched and no data found.

2.1.7 Records of Category 3 or 4 Radioactive Substances Authorisations:

0

Database searched and no data found.

2.1.8 Records of Licensed Discharge Consents within 500m of the study site:

0

Database searched and no data found.

2.1.9 Records of Water Industry Referrals (potentially harmful discharges to the public sewer) within 500m of the study site:

0

Database searched and no data found.

2.1.10 Records of Planning Hazardous Substance Consents and Enforcements within 500m of the study site:

0

Database searched and no data found.

2.2 Dangerous or Hazardous Sites

Records of COMAH & NIHHS sites within 500m of the study site:

0

Database searched and no data found.

2.3 Environment Agency/Natural Resources Wales Recorded Pollution Incidents

2.3.1 Records of National Incidents Recording System, List 2 within 500m of the study site:

0

Database searched and no data found.

2.3.2 Records of National Incidents Recording System, List 1 within 500m of the study site:

0



Database searched and no data found.

2.4 Sites Determined as Contaminated Land under Part 2A EPA 1990

Records of sites determined as contaminated land under Section 78R of the Environmental Protection Act 1990 are there within 500m of the study site 0

Database searched and no data found.

3. Landfill and Other Waste Sites Map

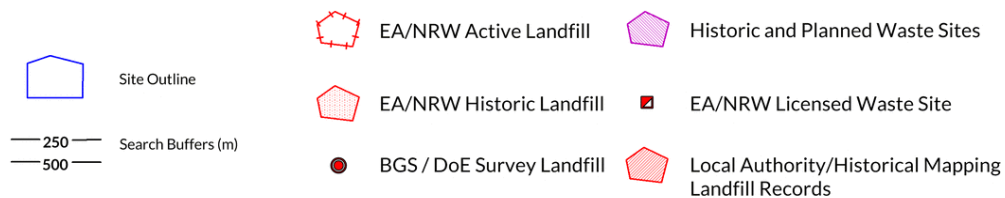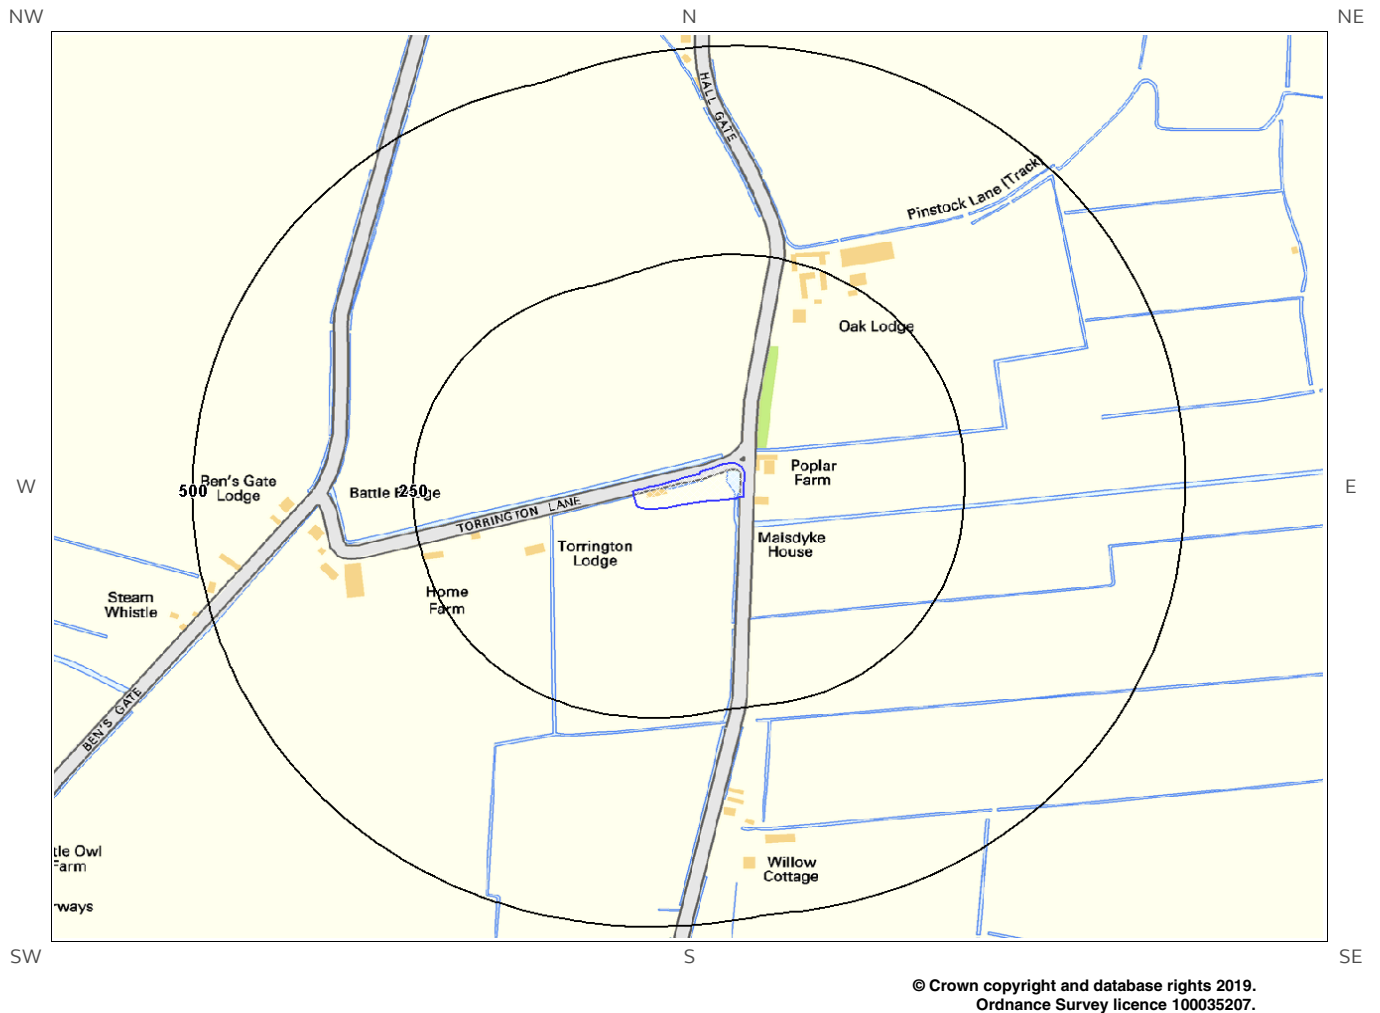

3. Landfill and Other Waste Sites

3.1 Landfill Sites

3.1.1 Records from Environment Agency/Natural Resources Wales landfill data within 1000m of the study site:

0

Database searched and no data found.

3.1.2 Records of Environment Agency/Natural Resources Wales historic landfill sites within 1500m of the study site:

3

The following landfill records are represented as either points or polygons on the Landfill and Other Waste Sites map:

ID	Distance (m)	Direction	NGR	Details
Not shown	1293	SW		Site Address: Millbank Road, Fleet, Spalding, Lincolnshire Waste Licence: Yes Site Reference: L076, 60, SH-6-01/89, 2500/5315 Waste Type: Inert Environmental Permitting Regulations (Waste) Reference: - Licence Issue: 29-Jan-1988 Licence Surrendered: 31-Dec-1988 Licence Holder Address: 17 Spalding Road, Holbeach, Lincolnshire Operator: - Licence Holder: Mr M R Tointon First Recorded: 01-Jan-1985 Last Recorded: -
Not shown	1304	S		Site Address: Gedney Fen, Bullock's Short Gate, Sutton St James, Lincolnshire Waste Licence: - Site Reference: RD7-43-01/89, SH-43-01/89, 2500/5059 Waste Type: Household Environmental Permitting Regulations (Waste) Reference: - Licence Issue: Licence Surrendered: Licence Holder Address: - Operator: - Licence Holder: - First Recorded: - Last Recorded: -
Not shown	1342	S		Site Address: Delph Bank, Bullock's Short Gate, Sutton St James, Lincolnshire Waste Licence: - Site Reference: SH-42-01/89, RD7-42-01/89, 2500/5058 Waste Type: Household Environmental Permitting Regulations (Waste) Reference: - Licence Issue: Licence Surrendered: Licence Holder Address: - Operator: - Licence Holder: - First Recorded: - Last Recorded: -

3.1.3 Records of BGS/DoE non-operational landfill sites within 1500m of the study site:

0

Database searched and no data found.

3.1.4 Records of Landfills from Local Authority and Historical Mapping Records within 1500m of the study site:

1

The following landfill records are represented as points or polygons on the Landfill and Other Waste Sites map:

ID	Distance (m)	Direction	NGR	Site Address	Source	Data Type
Not shown	1092	W	537662 323106	Refuse Tip	1968 mapping	Polygon

3.2 Other Waste Sites

3.2.1 Records of waste treatment, transfer or disposal sites within 500m of the study site:

0


Database searched and no data found.

3.2.2 Records of Environment Agency/Natural Resources Wales licensed waste sites within 1500m of the study site:

0

Database searched and no data found.

4. Current Land Use Map

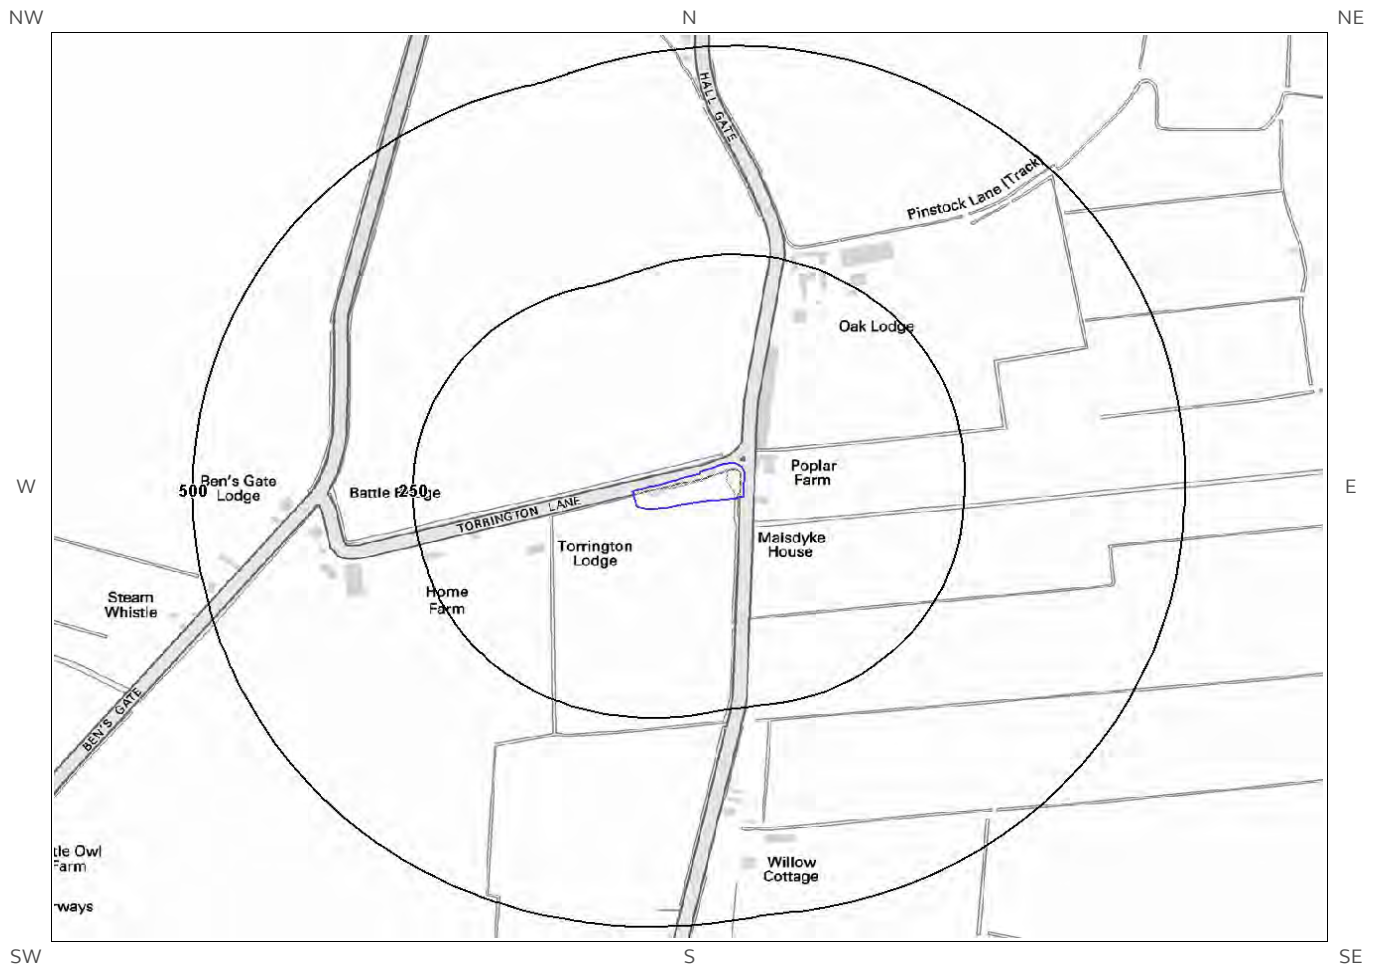

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.



4. Current Land Uses

4.1 Current Industrial Data

Records of potentially contaminative industrial sites within 250m of the study site: 0

Database searched and no data found.

4.2 Petrol and Fuel Sites

Records of petrol or fuel sites within 500m of the study site: 0

Database searched and no data found.

4.3 National Grid High Voltage Underground Electricity Transmission Cables

This dataset identifies the high voltage electricity transmission lines running between generating power plants and electricity substations. The dataset does not include the electricity distribution network (smaller, lower voltage cables distributing power from substations to the local user network). This information has been extracted from databases held by National Grid and is provided for information only with no guarantee as to its completeness or accuracy. National Grid do not offer any warranty as to the accuracy of the available data and are excluded from any liability for any such inaccuracies or errors.

Records of National Grid high voltage underground electricity transmission cables within 500m of the study site: 0

Database searched and no data found.

4.4 National Grid High Pressure Gas Transmission Pipelines

This dataset identifies high-pressure, large diameter pipelines which carry gas between gas terminals, power stations, compressors and storage facilities. The dataset does not include the Local Transmission System (LTS) which supplies gas directly into homes and businesses. This information has been extracted from databases held by National Grid and is provided for information only with no guarantee as to its completeness or accuracy. National Grid do not offer any warranty as to the accuracy of the available data and are excluded from any liability for any such inaccuracies or errors.

Records of National Grid high pressure gas transmission pipelines within 500m of the study site: 0

Database searched and no data found.

5. Geology

5.1 Artificial Ground and Made Ground

Database searched and no data found.

The database has been searched on site, including a 50m buffer.

5.2 Superficial Ground and Drift Geology

The database has been searched on site, including a 50m buffer.

Lex Code	Description	Rock Type
TFD-XCZ	TIDAL FLAT DEPOSITS	CLAY AND SILT

5.3 Bedrock and Solid Geology

The database has been searched on site, including a 50m buffer.

Lex Code	Description	Rock Type
AMC-MDST	AMPTHILL CLAY FORMATION	MUDSTONE


(Derived from the BGS 1:50,000 Digital Geological Map of Great Britain)

6 Hydrogeology and Hydrology

6a. Aquifer Within Superficial Geology




© Crown copyright and database rights 2019
Ordnance Survey licence 100035207.

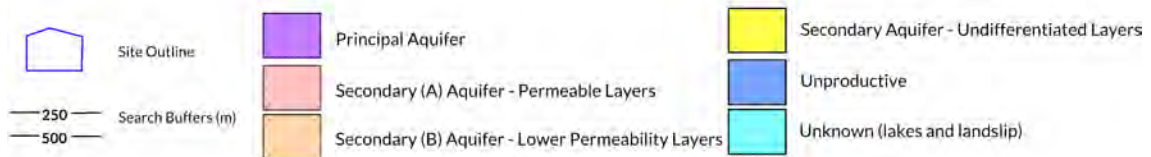


6b. Aquifer Within Bedrock Geology and Abstraction Licences




© Crown copyright and database rights 2019
Ordnance Survey licence 100035207.

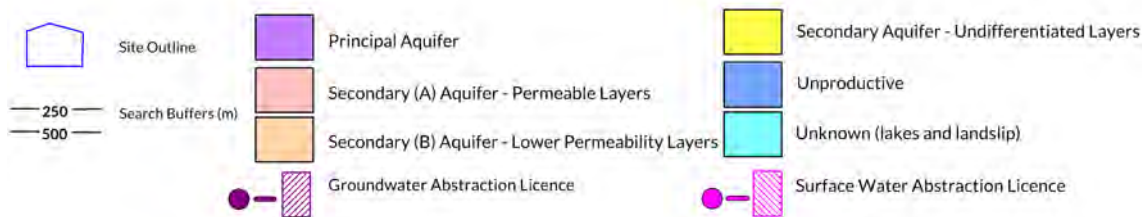


6c. Hydrogeology – Source Protection Zones and Potable Water Abstraction Licences

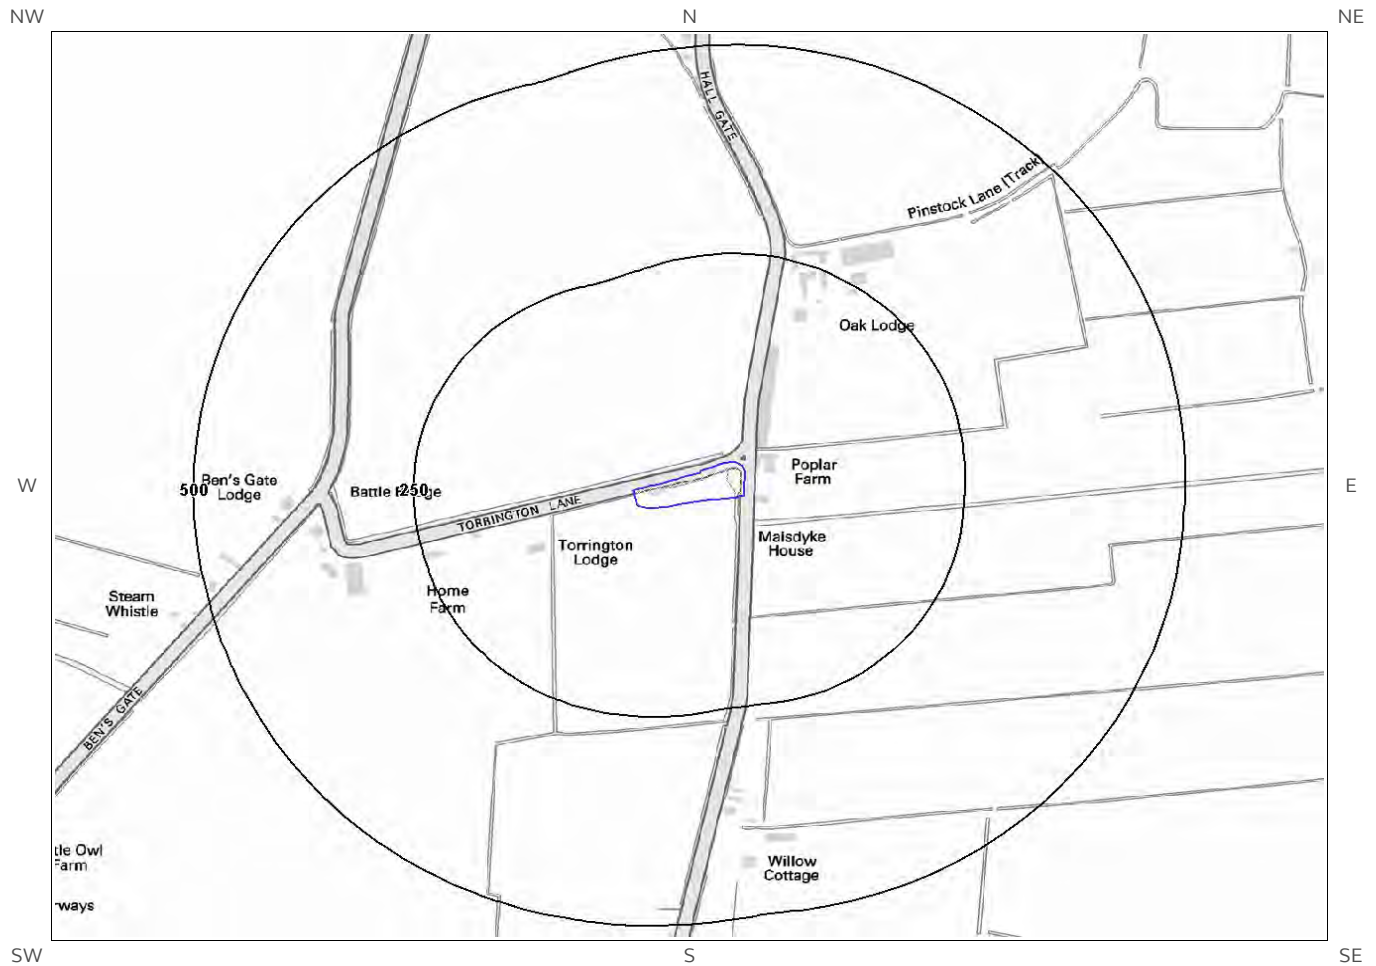

© Crown copyright and database rights 2019
Ordnance Survey licence 100035207.

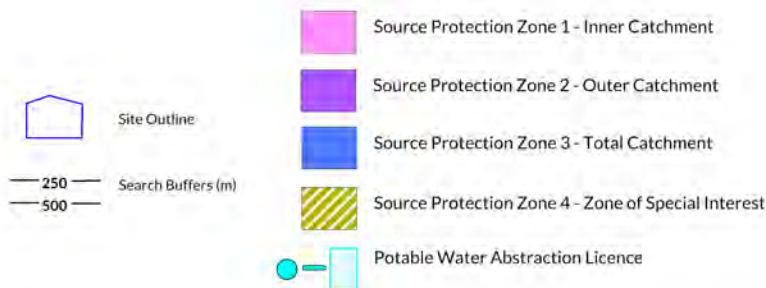


6d. Hydrogeology – Source Protection Zones within confined aquifer

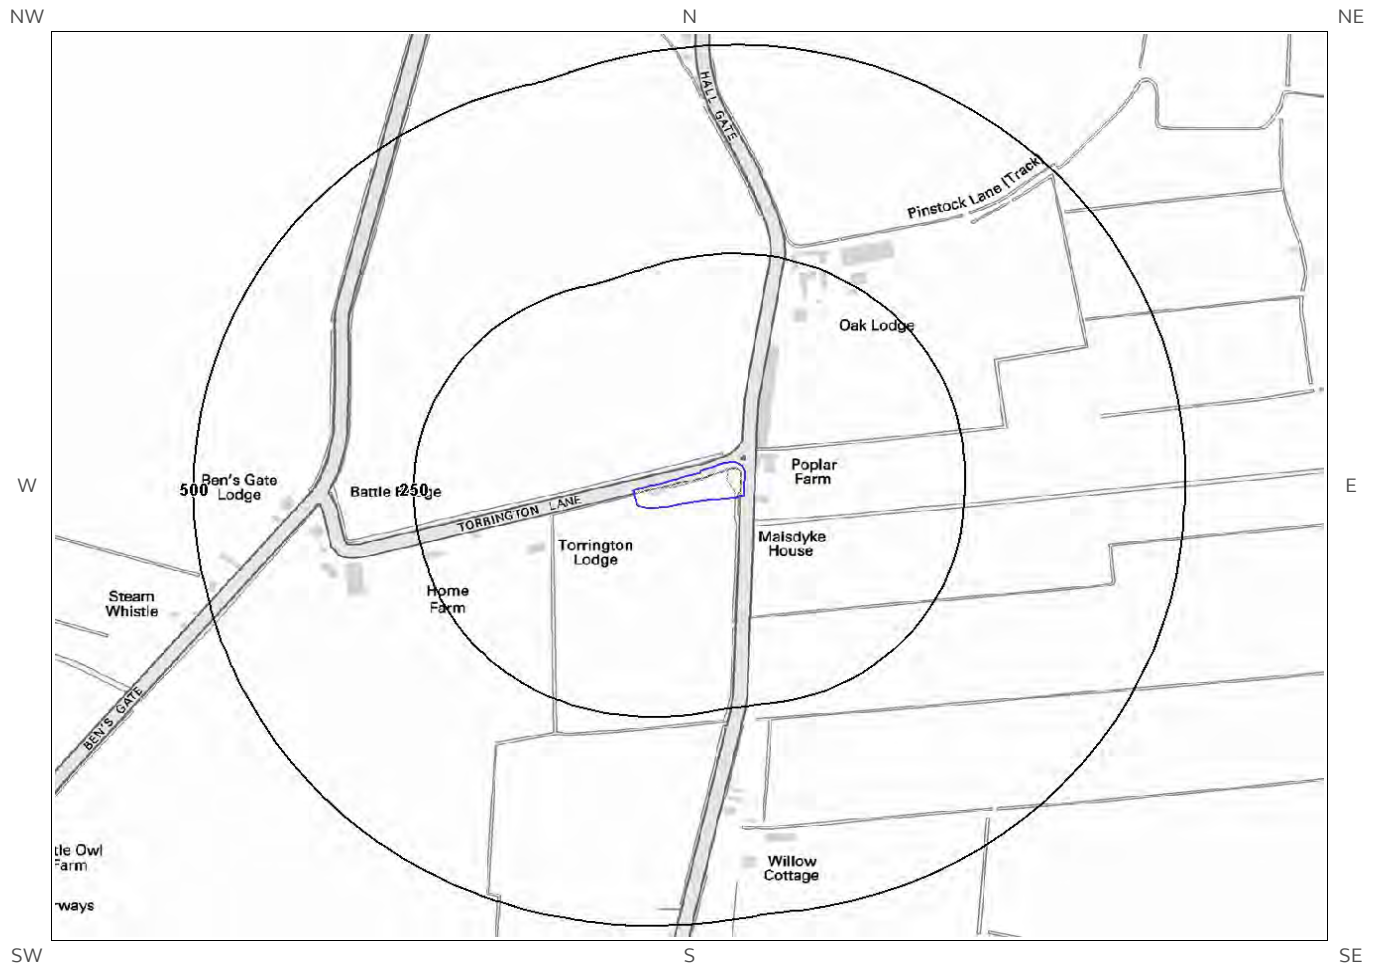

© Crown copyright and database rights 2019
Ordnance Survey licence 100035207.



6e. Hydrology – Watercourse Network and River Quality

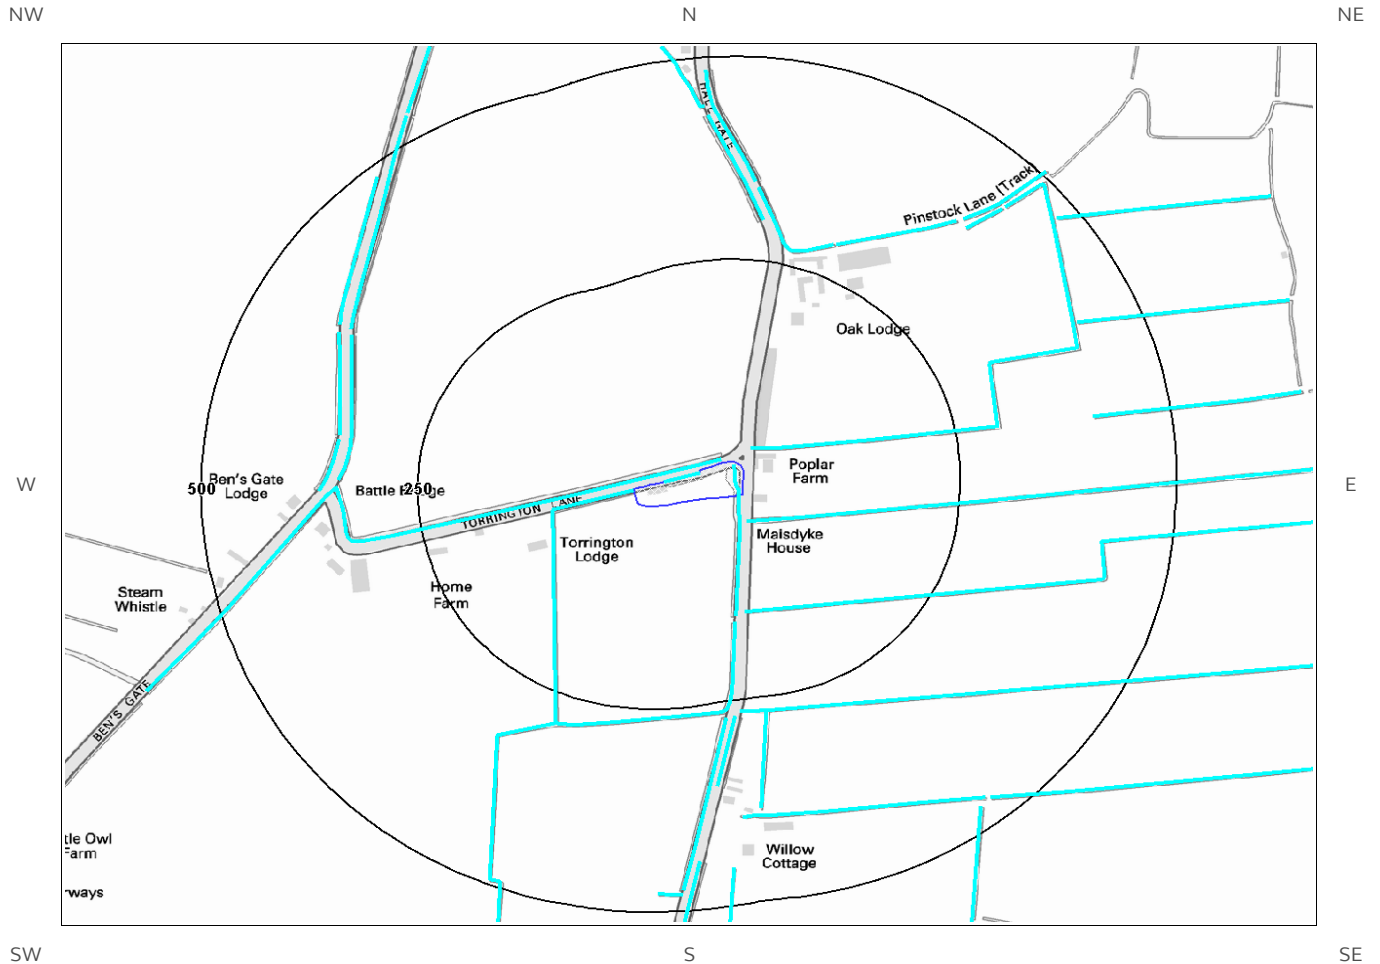

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.



6. Hydrogeology and Hydrology

6.1 Aquifer within Superficial Deposits

Records of strata classification within the superficial geology at or in proximity to the property Yes

From 1 April 2010, the Environment Agency/Natural Resources Wales's Groundwater Protection Policy has been using aquifer designations consistent with the Water Framework Directive. For further details on the designation and interpretation of this information, please refer to the Groundsure Enviro Insight User Guide.

The following aquifer records are shown on the Aquifer within Superficial Geology Map (6a):

ID	Distance (m)	Direction	Designation	Description
1	0	On Site	Unproductive	These are rock layers or drift deposits with low permeability that have negligible significance for water supply or river base flow

6.2 Aquifer within Bedrock Deposits

Records of strata classification within the bedrock geology at or in proximity to the property Yes

From 1 April 2010, the Environment Agency/Natural Resources Wales's Groundwater Protection Policy has been using aquifer designations consistent with the Water Framework Directive. For further details on the designation and interpretation of this information, please refer to the Groundsure Enviro Insight User Guide.

The following aquifer records are shown on the Aquifer within Bedrock Geology Map (6b):

ID	Distance (m)	Direction	Designation	Description
1	0	On Site	Unproductive	These are rock layers or drift deposits with low permeability that have negligible significance for water supply or river base flow

6.3 Groundwater Abstraction Licences

Groundwater Abstraction Licences within 2000m of the study site None identified

Database searched and no data found.

6.4 Surface Water Abstraction Licences

Surface Water Abstraction Licences within 2000m of the study site None identified

Database searched and no data found.

6.5 Potable Water Abstraction Licences

Potable Water Abstraction Licences within 2000m of the study site

None identified

Database searched and no data found.

6.6 Source Protection Zones

Source Protection Zones within 500m of the study site

None identified

Database searched and no data found.

6.7 Source Protection Zones within Confined Aquifer

Source Protection Zones within the Confined Aquifer within 500m of the study site

None identified

Historically, Source Protection Zone maps have been focused on regulation of activities which occur at or near the ground surface, such as prevention of point source pollution and bacterial contamination of water supplies. Sources in confined aquifers were often considered to be protected from these surface pressures due to the presence of a low permeability confining layer (e.g. glacial till, clay). The increased interest in subsurface activities such as onshore oil and gas exploration, ground source heating and cooling requires protection zones for confined sources to be marked on SPZ maps where this has not already been done.

Database searched and no data found.

6.8 Groundwater Vulnerability and Soil Leaching Potential

Environment Agency/Natural Resources Wales information on groundwater vulnerability and soil leaching potential within 500m of the study site

None identified

Database searched and no data found.

6.9 River Quality

Environment Agency/Natural Resources Wales information on river quality within 1500m of the study site

None identified

6.9.1 Biological Quality:

Database searched and no data found.

6.9.2 Chemical Quality:

Database searched and no data found.

6.10 Ordnance Survey MasterMap Water Network

Ordnance Survey MasterMap Water Network entries within 500m of the study site

This watercourse information is provided by Ordnance Survey MasterMap Water Network. The data provides a detailed centre line following the curve of the waterway precisely, so all distances provided in the report should be understood as measurements to the centreline rather than a measurement to the nearest point of the watercourse. Underground watercourses are inferred from entry and exit points so caution is advised in using these to indicate precise locations of underground watercourses when planning site investigation and development.

The following Ordnance Survey MasterMap Water Network records are represented on the Hydrology Map (6e):

ID	Distance/ Direction	Name	Type of Watercourse	Additional Details
1	0 On Site	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 4.8
2	0 On Site	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.5
10	0 On Site	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 4.8
11	0 On Site	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.5
3	1 W	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.9
12	1 W	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.9
4	5 N	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 4.6
13	5 N	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal

ID	Distance/ Direction	Name	Type of Watercourse	Additional Details
				conditions) Average Width in Watercourse Section (m): 4.6
5	24 NE	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.0
14	24 NE	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.0
6	32 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 5.0
15	32 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 5.0
7	143 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.4
16	143 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.4
8	154 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.7
17	154 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.7
9	264 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.1
18	264 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.1
10	266 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.4
11	266 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.3

ID	Distance/ Direction	Name	Type of Watercourse	Additional Details
19	266 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.4
20	266 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.3
12	269 N	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.8
13	269 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.3
Not shown	269 N	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.8
Not shown	269 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.3
14	270 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.6
Not shown	270 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.6
15	287 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.6
Not shown	287 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.6
16	293 NE	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.2
Not shown	293 NE	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.2
17	300	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface

ID	Distance/ Direction	Name	Type of Watercourse	Additional Details
	N			Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.6
Not shown	300 N	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.6
18	332 W	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.8
Not shown	332 W	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.8
19	346 W	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.4
20	346 W	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.2
Not shown	346 W	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.4
Not shown	346 W	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.2
21	347 N	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.6
Not shown	347 N	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.6
22	381 NW	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.2
31	381 NW	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.2
23	391 NE	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions)

ID	Distance/ Direction	Name	Type of Watercourse	Additional Details
				Average Width in Watercourse Section (m): 1.9
Not shown	391 NE	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 1.9
24	394 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.8
Not shown	394 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.8
25	395 NW	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.2
Not shown	395 NW	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.2
26	398 NE	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.2
Not shown	398 NE	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.2
27	410 E	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.2
Not shown	410 E	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.2
28	427 NE	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.0
Not shown	427 NE	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.0
29	440 N	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.7

ID	Distance/ Direction	Name	Type of Watercourse	Additional Details
30	440 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.5
Not shown	440 N	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.7
Not shown	440 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.5
31	453 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): Not Provided
Not shown	453 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): Not Provided
32	470 SE	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.8
Not shown	470 SE	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.8
33	472 SE	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.1
Not shown	472 SE	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.1
34	476 NE	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.6
Not shown	476 NE	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.6
35	478 S	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 1.8
Not shown	478	Not Specified	Inland river not influenced by normal tidal action.	Catchment Area: Nene Relationship to Ground Level: On ground surface

ID	Distance/ Direction	Name	Type of Watercourse	Additional Details
	S			Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 1.8

6.11 Surface Water Features


Surface water features within 250m of the study site

Identified

The following surface water records are not represented on mapping:

Distance (m)	Direction
0	On Site
0	On Site
1	W
4	N
23	NE
28	S
142	S



7a. Environment Agency/Natural Resources Wales Flood Map for Planning (from rivers and the sea)

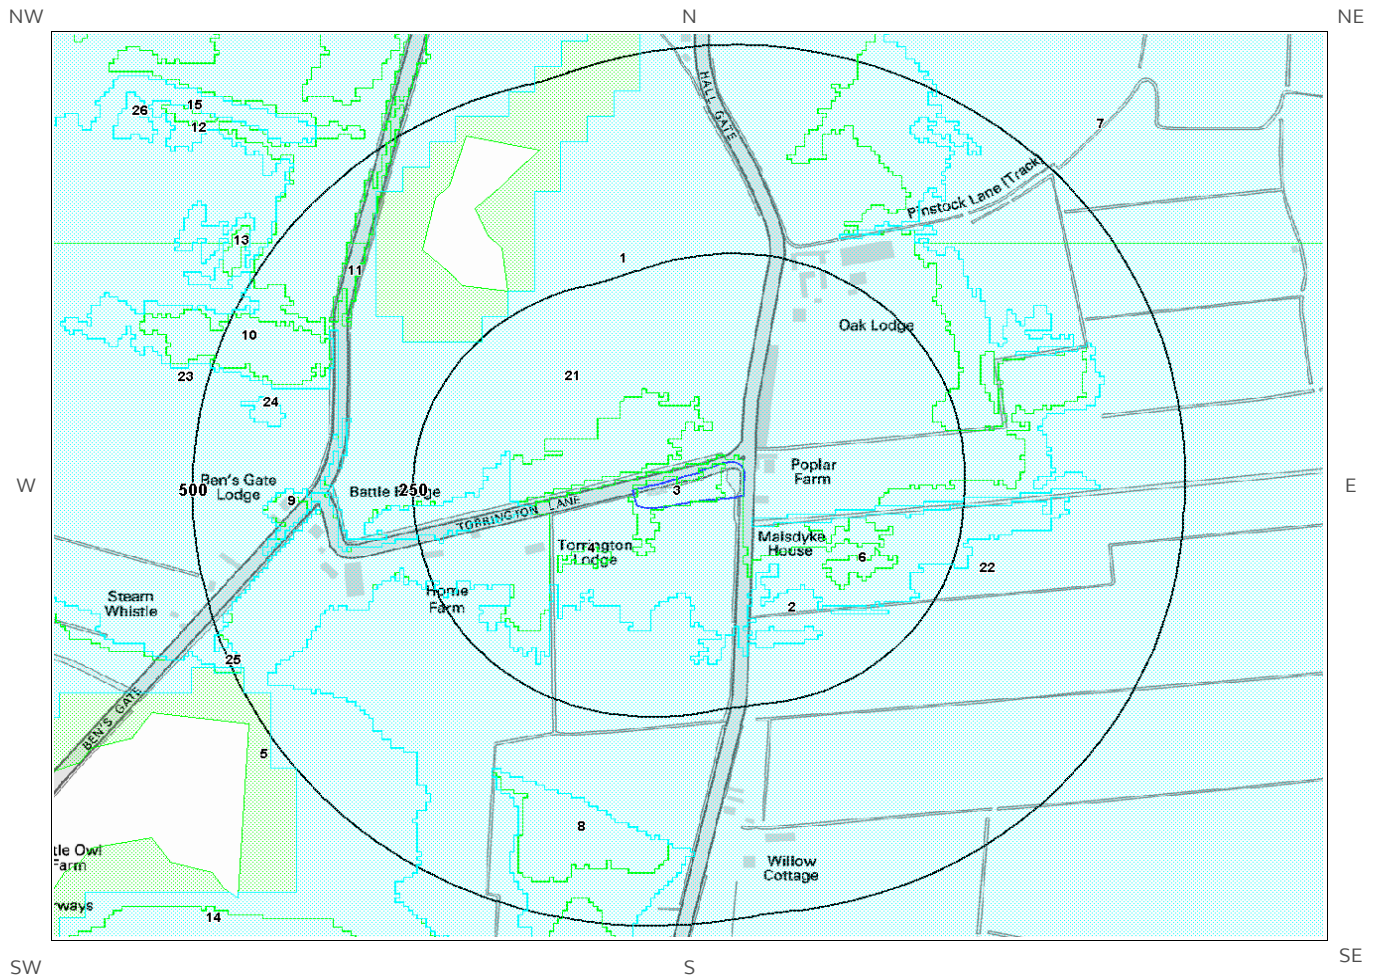

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.



7b. Environment Agency/Natural Resources Wales Risk of Flooding from Rivers and the Sea (RoFRaS) Map

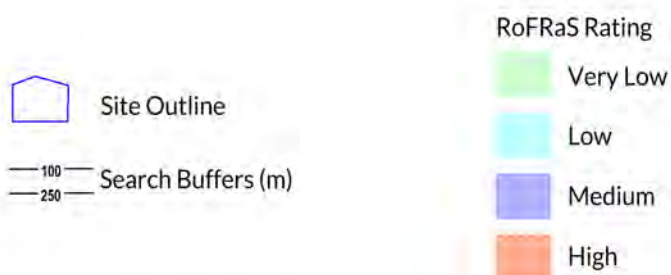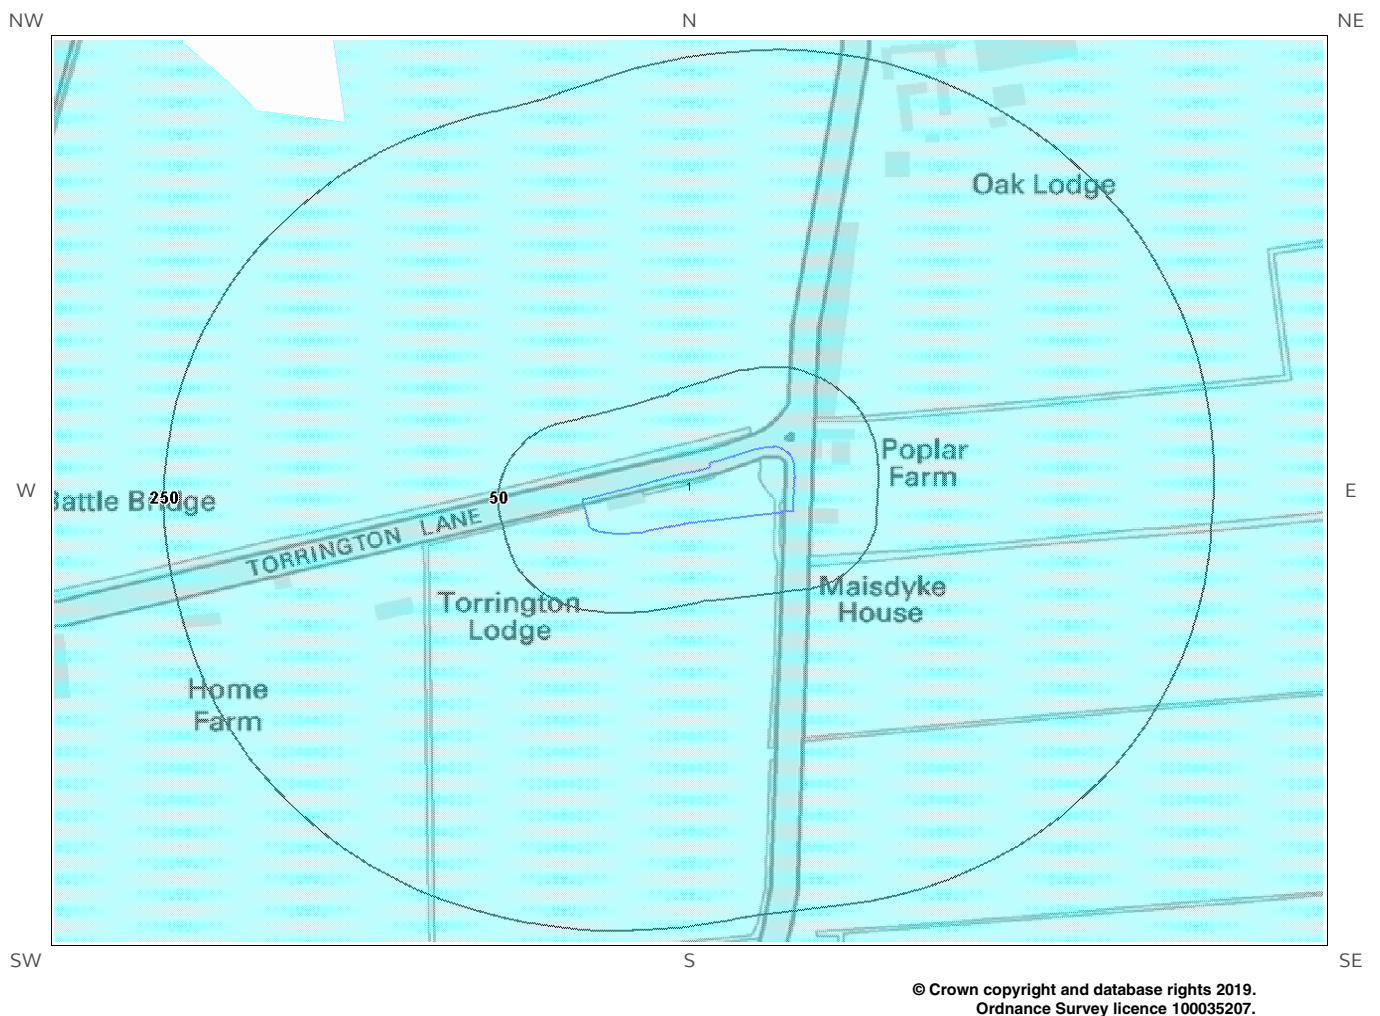

7 Flooding

7.1 River and Coastal Zone 2 Flooding

Environment Agency/Natural Resources Wales Zone 2 floodplain within 250m

Identified

Environment Agency/Natural Resources Wales Zone 2 floodplains estimate the annual probability of flooding as between 1 in 1000 (0.1%) and 1 in 100 (1%) from rivers and between 1 in 1000 (0.1%) and 1 in 200 (0.5%) from the sea. Any relevant data is represented on Map 7a – Flood Map for Planning:

ID	Distance (m)	Direction	Update	Type
1	0	On Site	12-Oct-2018	Zone 2 - (Fluvial /Tidal Models)
2	0	On Site	12-Oct-2018	Zone 2 - (Fluvial /Tidal Models)
3	0	On Site	12-Oct-2018	Zone 2 - (Fluvial /Tidal Models)
4	63	SW	12-Oct-2018	Zone 2 - (Fluvial /Tidal Models)
5	99	W	12-Oct-2018	Zone 2 - (Fluvial /Tidal Models)
6	120	SE	12-Oct-2018	Zone 2 - (Fluvial /Tidal Models)

7.2 River and Coastal Zone 3 Flooding

Environment Agency/Natural Resources Wales Zone 3 floodplain within 250m

Identified

Zone 3 shows the extent of a river flood with a 1 in 100 (1%) or greater chance of occurring in any year or a sea flood with a 1 in 200 (0.5%) or greater chance of occurring in any year. Any relevant data is represented on Map 7a – Flood Map for Planning.

ID	Distance (m)	Direction	Update	Type
1	0	On Site	12-Oct-2018	Zone 3 - (Fluvial Models)
2	27	S	12-Oct-2018	Zone 3 - (Fluvial Models)
3	116	W	12-Oct-2018	Zone 3 - (Fluvial Models)

7.3 Risk of Flooding from Rivers and the Sea (RoFRaS) Flood Rating

Highest risk of flooding onsite

Low

The Environment Agency/Natural Resources Wales RoFRaS database provides an indication of river and coastal flood risk at a national level on a 50m grid with the flood rating at the centre of the grid calculated and given above. The data considers the probability that the flood defences will overtop or breach by considering their location, type, condition and standard of protection.

RoFRaS data for the study site indicates the property is in an area with a Low (greater than 1 in 1000 but less than 1 in 100) chance of flooding in any given year.

Any relevant data within 250m is represented on the RoFRaS Flood map. Data to 50m is reported in the table below.

ID	Distance (m)	Direction	RoFRaS flood Risk
1	0.0	On Site	Low

7.4 Flood Defences

Flood Defences within 250m of the study site

None identified

Database searched and no data found.

7.5 Areas benefiting from Flood Defences

Areas benefiting from Flood Defences within 250m of the study site

None identified

7.6 Areas benefiting from Flood Storage

Areas used for Flood Storage within 250m of the study site

None identified

7.7 Groundwater Flooding Susceptibility Areas

7.7.1 British Geological Survey groundwater flooding susceptibility areas within 50m of the boundary of the study site

None identified

Notes: Groundwater flooding may either be associated with shallow unconsolidated sedimentary aquifers which overlie unproductive aquifers (Superficial Deposits Flooding), or with unconfined aquifers (Clearwater Flooding).

7.7.2 Highest susceptibility to groundwater flooding in the search area based on the underlying geological conditions

Not Prone

The area is not considered to be prone to groundwater flooding based on rock type.

7.8 Groundwater Flooding Confidence Areas


British Geological Survey confidence rating in this result

Not Applicable


Notes: Groundwater flooding is defined as the emergence of groundwater at the ground surface or the rising of groundwater into man-made ground under conditions where the normal range of groundwater levels is exceeded.

The confidence rating is on a threefold scale - Low, Moderate and High. This provides a relative indication of the BGS confidence in the accuracy of the susceptibility result for groundwater flooding. This is based on the amount and precision of the information used in the assessment. In areas with a relatively lower level of confidence the susceptibility result should be treated with more caution. In other areas with higher levels of confidence the susceptibility result can be used with more confidence.

8. Designated Environmentally Sensitive Sites Map

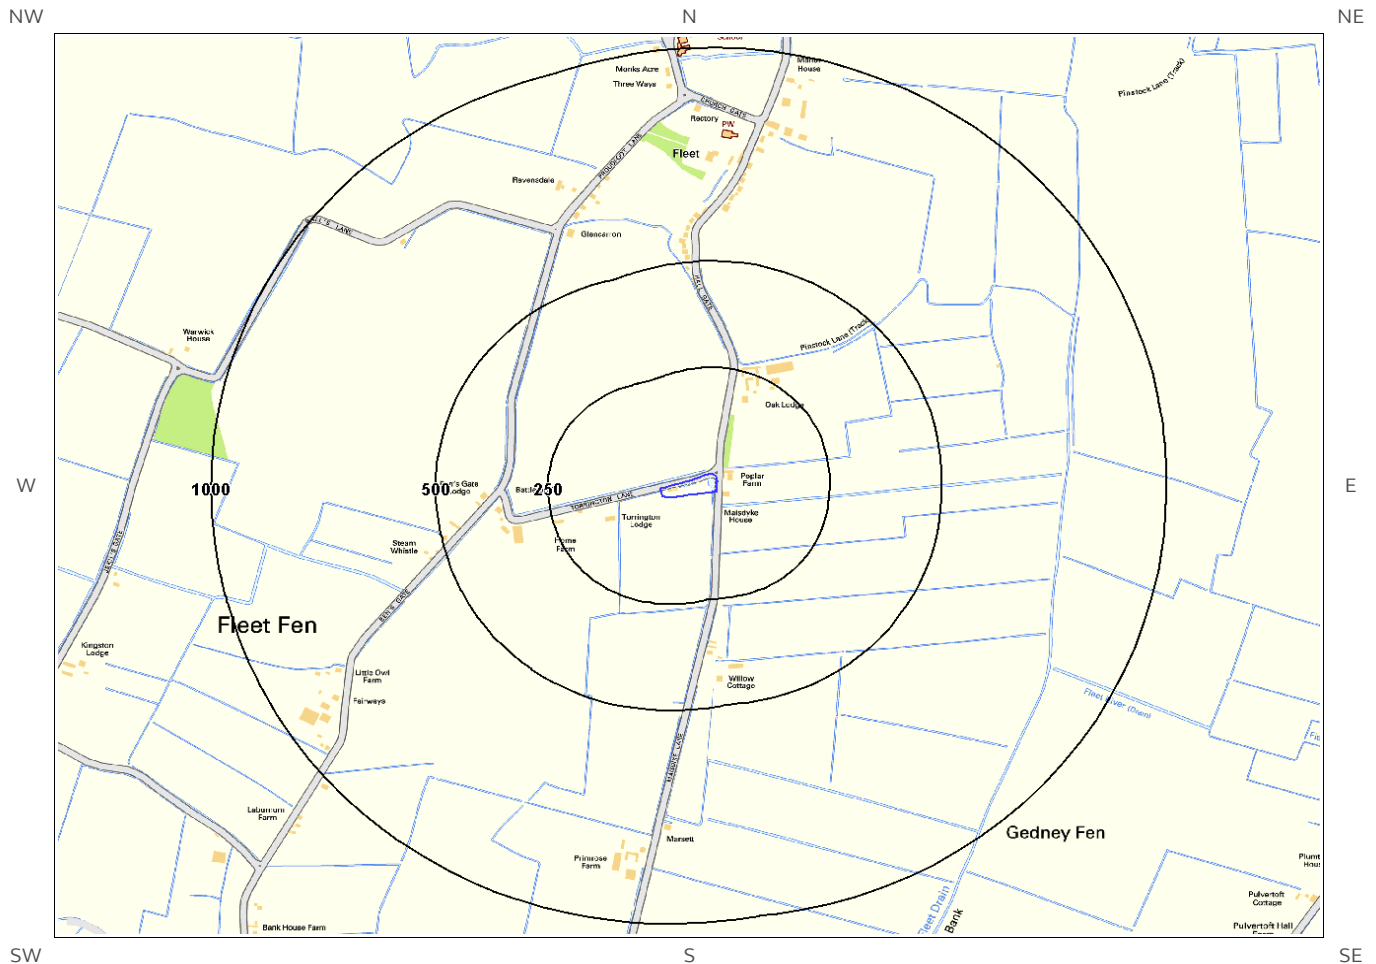

© Crown copyright and database rights 2019.
Ordnance Survey licence 100035207.

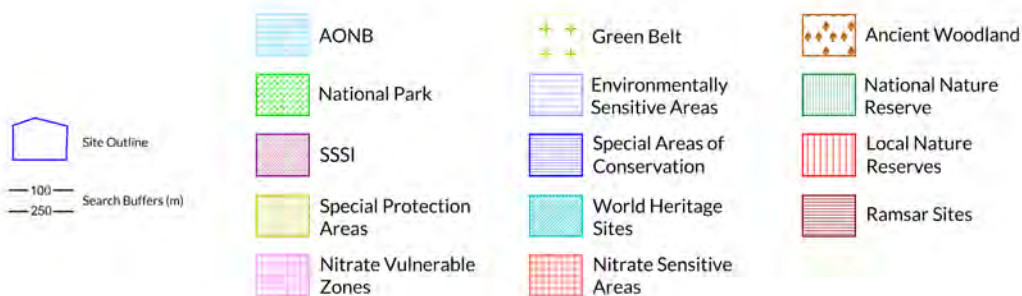

8. Designated Environmentally Sensitive Sites

Designated Environmentally Sensitive Sites within 2000m of the study site

None identified

8.1 Records of Sites of Special Scientific Interest (SSSI) within 2000m of the study site:

0

Database searched and no data found.

8.2 Records of National Nature Reserves (NNR) within 2000m of the study site:

0

Database searched and no data found.

8.3 Records of Special Areas of Conservation (SAC) within 2000m of the study site:

0

Database searched and no data found.

8.4 Records of Special Protection Areas (SPA) within 2000m of the study site:

0

Database searched and no data found.

8.5 Records of Ramsar sites within 2000m of the study site:

0

Database searched and no data found.

8.6 Records of Ancient Woodland within 2000m of the study site:

0

Database searched and no data found.

8.7 Records of Local Nature Reserves (LNR) within 2000m of the study site:

0

Database searched and no data found.

8.8 Records of World Heritage Sites within 2000m of the study site:

0

Database searched and no data found.

8.9 Records of Environmentally Sensitive Areas within 2000m of the study site:

0

Database searched and no data found.

8.10 Records of Areas of Outstanding Natural Beauty (AONB) within 2000m of the study site:

0

Database searched and no data found.

8.11 Records of National Parks (NP) within 2000m of the study site:

0

Database searched and no data found.

8.12 Records of Nitrate Sensitive Areas within 2000m of the study site:

0

Database searched and no data found.

8.13 Records of Nitrate Vulnerable Zones within 2000m of the study site:

0

Database searched and no data found.

8.14 Records of Green Belt land within 2000m of the study site:

0

Database searched and no data found.

9. Natural Hazards Findings

9.1 Detailed BGS GeoSure Data

BGS GeoSure Data has been searched to 50m. The data is included in tabular format. If you require further information on geology and ground stability, please obtain a **Groundsure Geo Insight**, available from our **website**. The following information has been found:

9.1.1 Shrink Swell

Maximum Shrink-Swell** hazard rating identified on the study site Low

The following natural subsidence information provided by the British Geological Survey is not represented on mapping:

Hazard
Ground conditions predominantly medium plasticity. Do not plant trees with high soil moisture demands near to buildings. For new build, consideration should be given to advice published by the National House Building Council (NHBC) and the Building Research Establishment (BRE). There is a possible increase in construction cost to reduce potential shrink-swell problems. For existing property, there is a possible increase in insurance risk, especially during droughts or where vegetation with high moisture demands is present.

9.1.2 Landslides

Maximum Landslide* hazard rating identified on the study site Very Low

The following natural subsidence information provided by the British Geological Survey is not represented on mapping:

Hazard
Slope instability problems are unlikely to be present. No special actions required to avoid problems due to landslides. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with landslides.

9.1.3 Soluble Rocks

Maximum Soluble Rocks* hazard rating identified on the study site Negligible

The following natural subsidence information provided by the British Geological Survey is not represented on mapping:

Hazard
Soluble rocks are present, but unlikely to cause problems except under exceptional conditions. No special actions required to avoid problems due to soluble rocks. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with soluble rocks.

* This indicates an automatically generated 50m buffer and site.

9.1.4 Compressible Ground

Maximum Compressible Ground* hazard rating identified on the study site

Moderate

The following natural subsidence information provided by the British Geological Survey is not represented on mapping:

Hazard
Significant potential for compressibility problems. Avoid large differential loadings of ground. Do not drain or de-water ground near the property without technical advice. For new build consider possibility of compressible ground in ground investigation, construction and building design. Consider effects of groundwater changes. Extra construction costs are likely. For existing property possible increase in insurance risk from compressibility, especially if water conditions or loading of the ground change significantly.

9.1.5 Collapsible Rocks

Maximum Collapsible Rocks* hazard rating identified on the study site

Negligible

The following natural subsidence information provided by the British Geological Survey is not represented on mapping:

Hazard
No indicators for collapsible deposits identified. No actions required to avoid problems due to collapsible deposits. No special ground investigation required, or increased construction costs or increased financial risk due to potential problems with collapsible deposits.

9.1.6 Running Sand

Maximum Running Sand** hazard rating identified on the study site

Moderate

The following natural subsidence information provided by the British Geological Survey is not represented on mapping:

Hazard
Significant potential for running sand problems with relatively small changes in ground conditions. Avoid large amounts of water entering the ground (for example through pipe leakage or soak-aways). Do not dig (deep) holes into saturated ground near the property without technical advice. For new build consider the consequences of soil and groundwater conditions during and after construction. For existing property possible increase in insurance risk from running sand, for example, due to water leakage, high rainfall events or flooding.

* This indicates an automatically generated 50m buffer and site.

9.2 Radon

9.2.1 Radon Affected Areas

Is the property in a Radon Affected Area as defined by the Health Protection Agency (HPA) and if so what percentage of homes are above the Action Level? The site is not in a Radon Affected Area, as less than 1% of properties are above the Action Level.

The radon data in this report is supplied by the BGS/Public Health England and is the definitive map of Radon Affected Areas in Great Britain and Northern Ireland. The dataset was created using long-term radon measurements in over 479,000 homes across Great Britain and 23,000 homes across Northern Ireland, combined with geological data. The dataset is considered accurate to 50m to allow for the margin of error in geological lines, and the findings of this report supercede any answer given in the less accurate Indicative Atlas of Radon in Great Britain, which simplifies the data to give the highest risk within any given 1km grid square. As such, the radon atlas is considered indicative, whereas the data given in this report is considered definitive.

9.2.2 Radon Protection

Is the property in an area where Radon Protection are required for new properties or extensions to existing ones as described in publication BR211 by the Building Research Establishment? No radon protective measures are necessary.

10. Mining

10.1 Coal Mining

Coal mining areas within 75m of the study site

None identified

Database searched and no data found.

10.2 Non-Coal Mining

Non-Coal Mining areas within 50m of the study site boundary

None identified

Database searched and no data found.

10.3 Brine Affected Areas

Brine affected areas within 75m of the study site

None identified

Guidance: No Guidance Required.

Contact Details

Groundsure Helpline
Telephone: 08444 159 000
info@groundsure.com

British Geological Survey Enquiries
Kingsley Dunham Centre
Keyworth, Nottingham NG12 5GG
Tel: 0115 936 3143.
Fax: 0115 936 3276.
Email:
Web: www.bgs.ac.uk

BGS Geological Hazards Reports and general geological enquiries:
enquiries@bgs.ac.uk

Environment Agency
National Customer Contact Centre, PO Box 544
Rotherham, S60 1BY
Tel: 03708 506 506
Web: www.environment-agency.gov.uk
Email: enquiries@environment-agency.gov.uk

Public Health England
Public information access office
Public Health England, Wellington House
133-155 Waterloo Road, London, SE1 8UG
www.gov.uk/phe
Email: enquiries@phe.gov.uk
Main switchboard: 020 7654 8000

The Coal Authority
200 Lichfield Lane
Mansfield
Notts NG18 4RG
Tel: 0345 7626 848
DX 716176 Mansfield 5
www.coal.gov.uk

Ordnance Survey
Adanac Drive, Southampton
SO16 0AS
Tel: 08456 050505

Local Authority
Authority: South Holland District Council
Phone: 01775 761 161
Web: <http://www.sholland.gov.uk/>
Address: Council Offices, Priory Road, Spalding, Lincolnshire, PE11

Gemapping PLC
Virginia Villas, High Street, Hartley Witney,
Hampshire RG27 8NW
Tel: 01252 845444



Acknowledgements: Site of Special Scientific Interest, National Nature Reserve, Ramsar Site, Special Protection Area, Special Area of Conservation data is provided by, and used with the permission of, Natural England/Natural Resources Wales who retain the Copyright and Intellectual Property Rights for the data.

PointX © Database Right/Copyright, Thomson Directories Limited © Copyright Link Interchange Network Limited © Database Right/Copyright and Ordnance Survey © Crown Copyright and/or Database Right. All Rights Reserved. Licence Number [03421028].

This report has been prepared in accordance with the Groundsure Ltd standard Terms and Conditions of business for work of this nature.

Standard Terms and Conditions

Groundsure's Terms and Conditions can be viewed online at this link:

<https://www.groundsure.com/terms-and-conditions-may25-2018>

Site Details:

Mulberry Barn, TORRINGTON
LANE, FLEET, SPALDING

Client Ref: R0160
Report Ref: GS-5777360
Grid Ref: 538799, 322854

Map Name: County Series

Map date: 1888

Scale: 1:2,500

Printed at: 1:2,500



Surveyed 1888
Revised 1888
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1888
Revised 1888
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1888
Revised 1888
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1888
Revised 1888
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 25 January 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

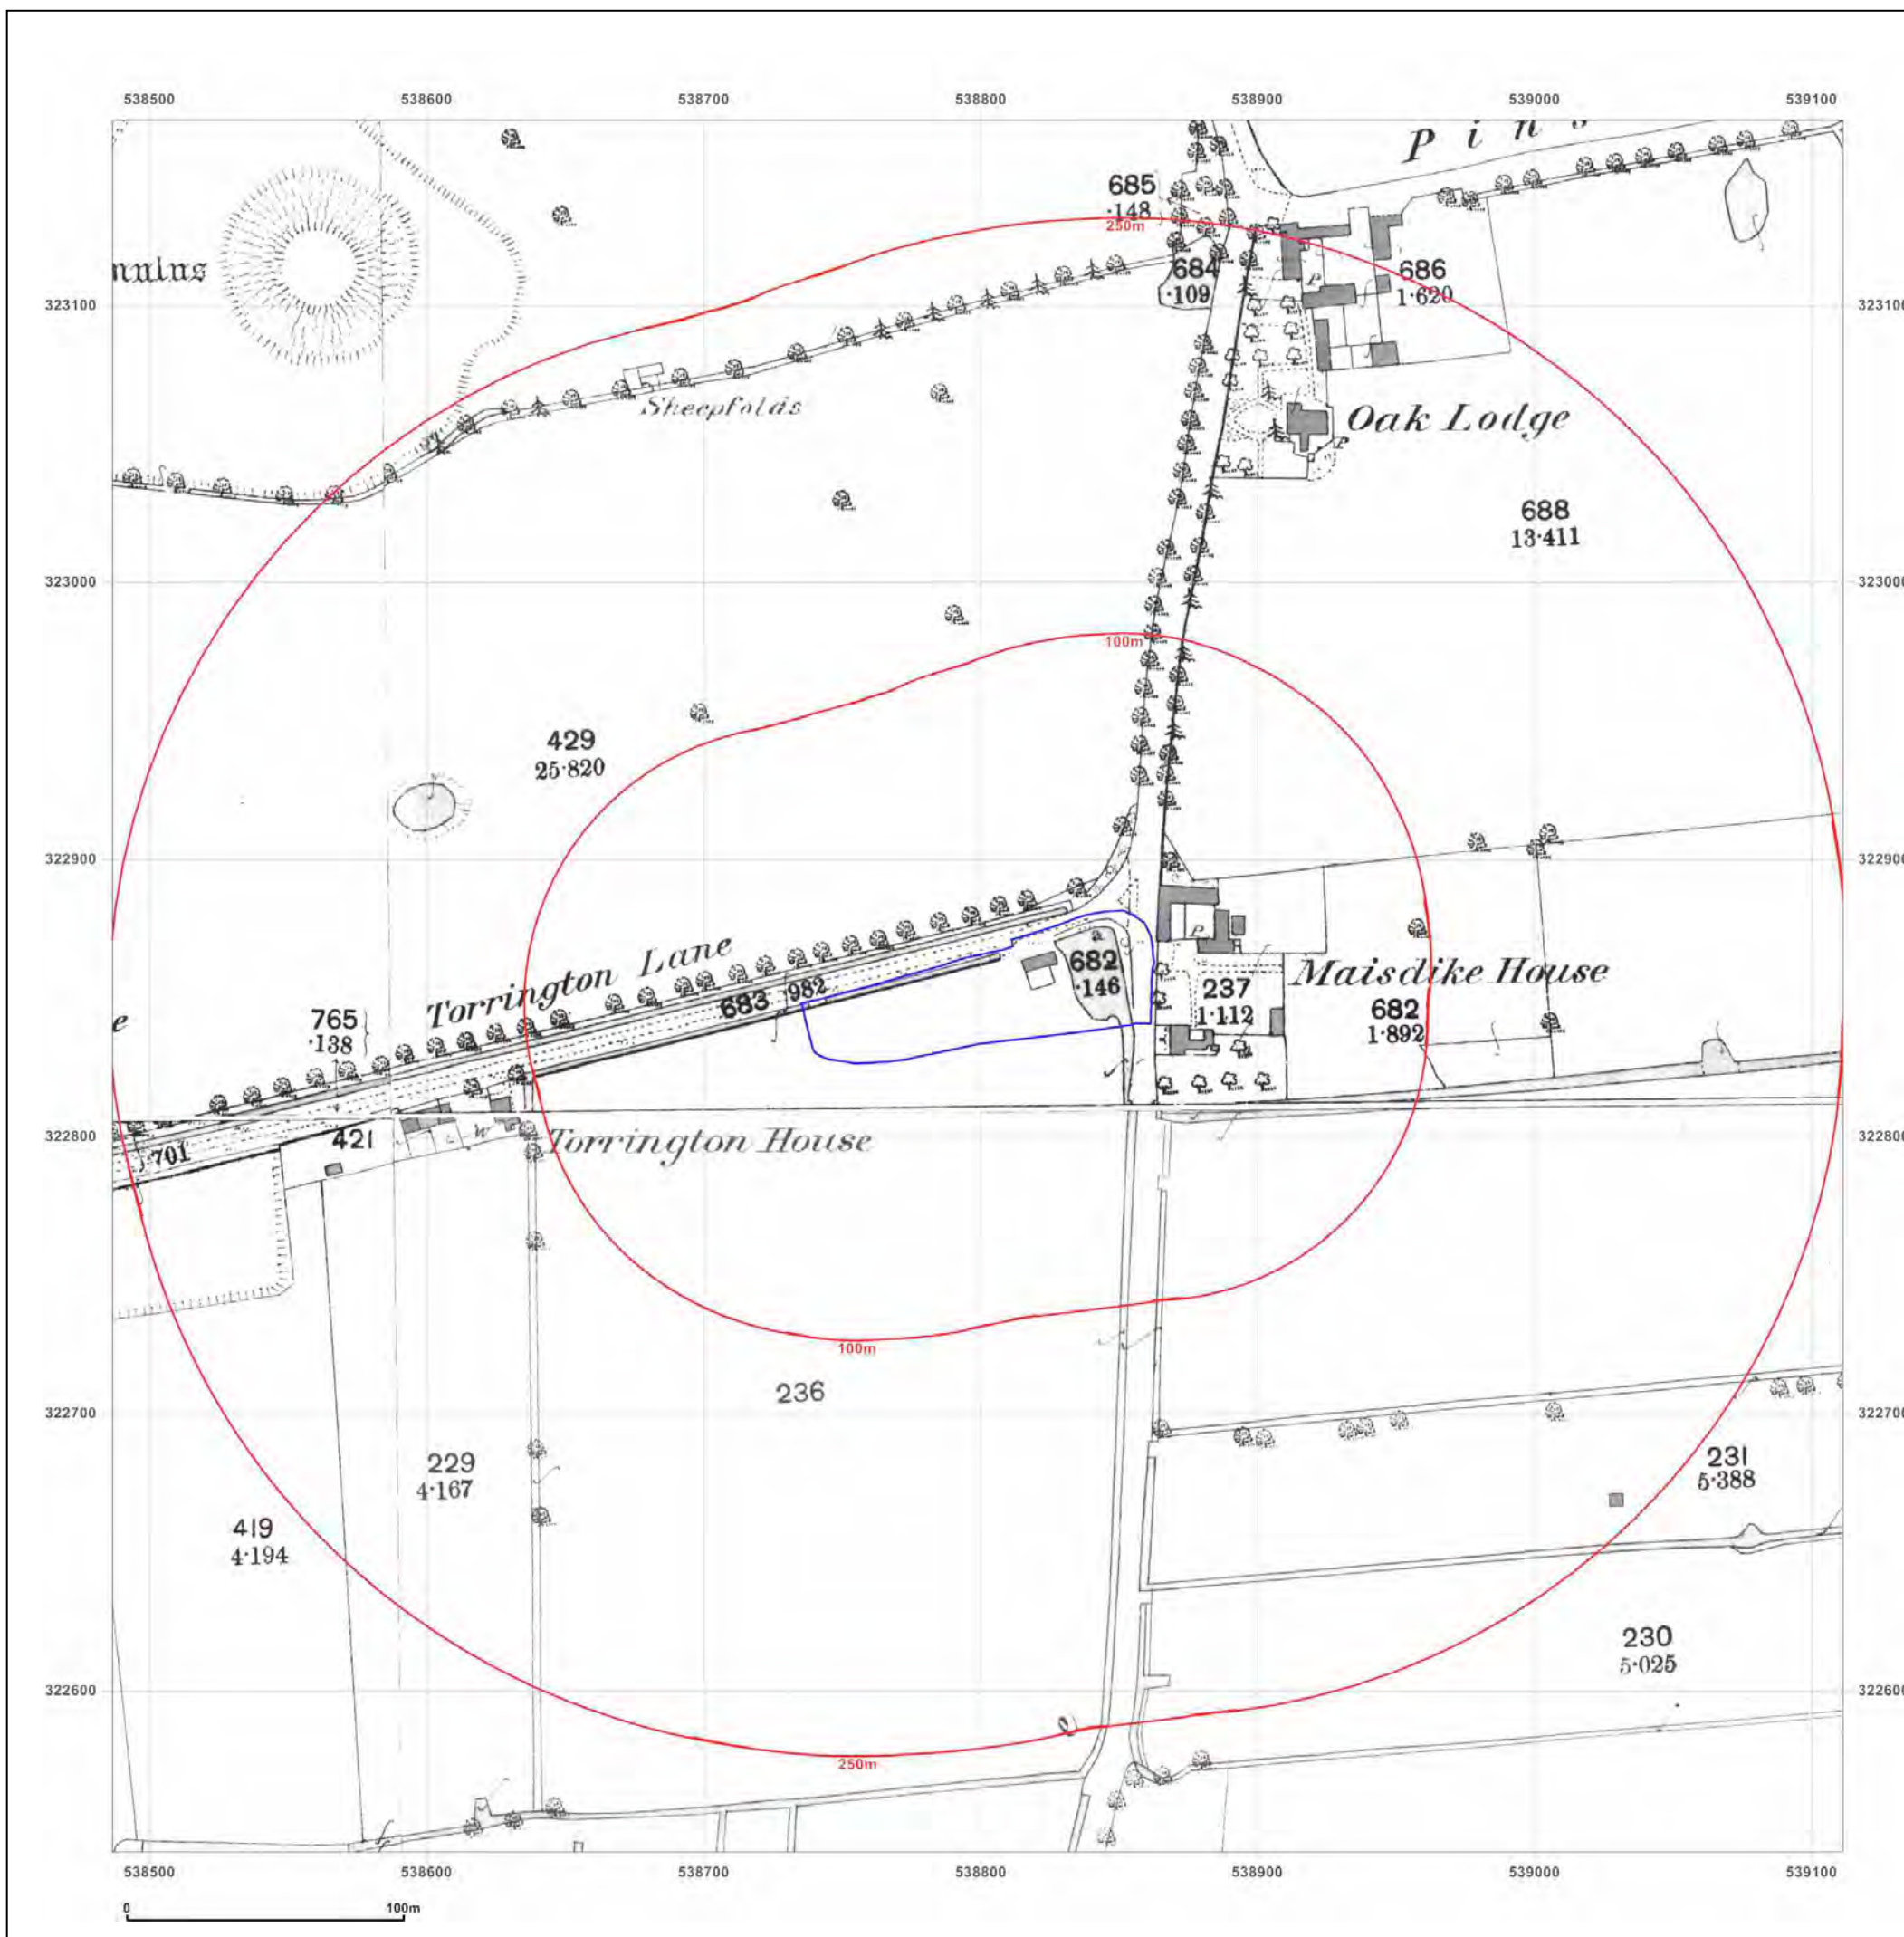

Site Details:

Mulberry Barn, TORRINGTON
LANE, FLEET, SPALDING

Client Ref: R0160
Report Ref: GS-5777360
Grid Ref: 538799, 322854

Map Name: County Series

Map date: 1904

Scale: 1:2,500

Printed at: 1:2,500



Surveyed 1904
Revised 1904
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1904
Revised 1904
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1904
Revised 1904
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1904
Revised 1904
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 25 January 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

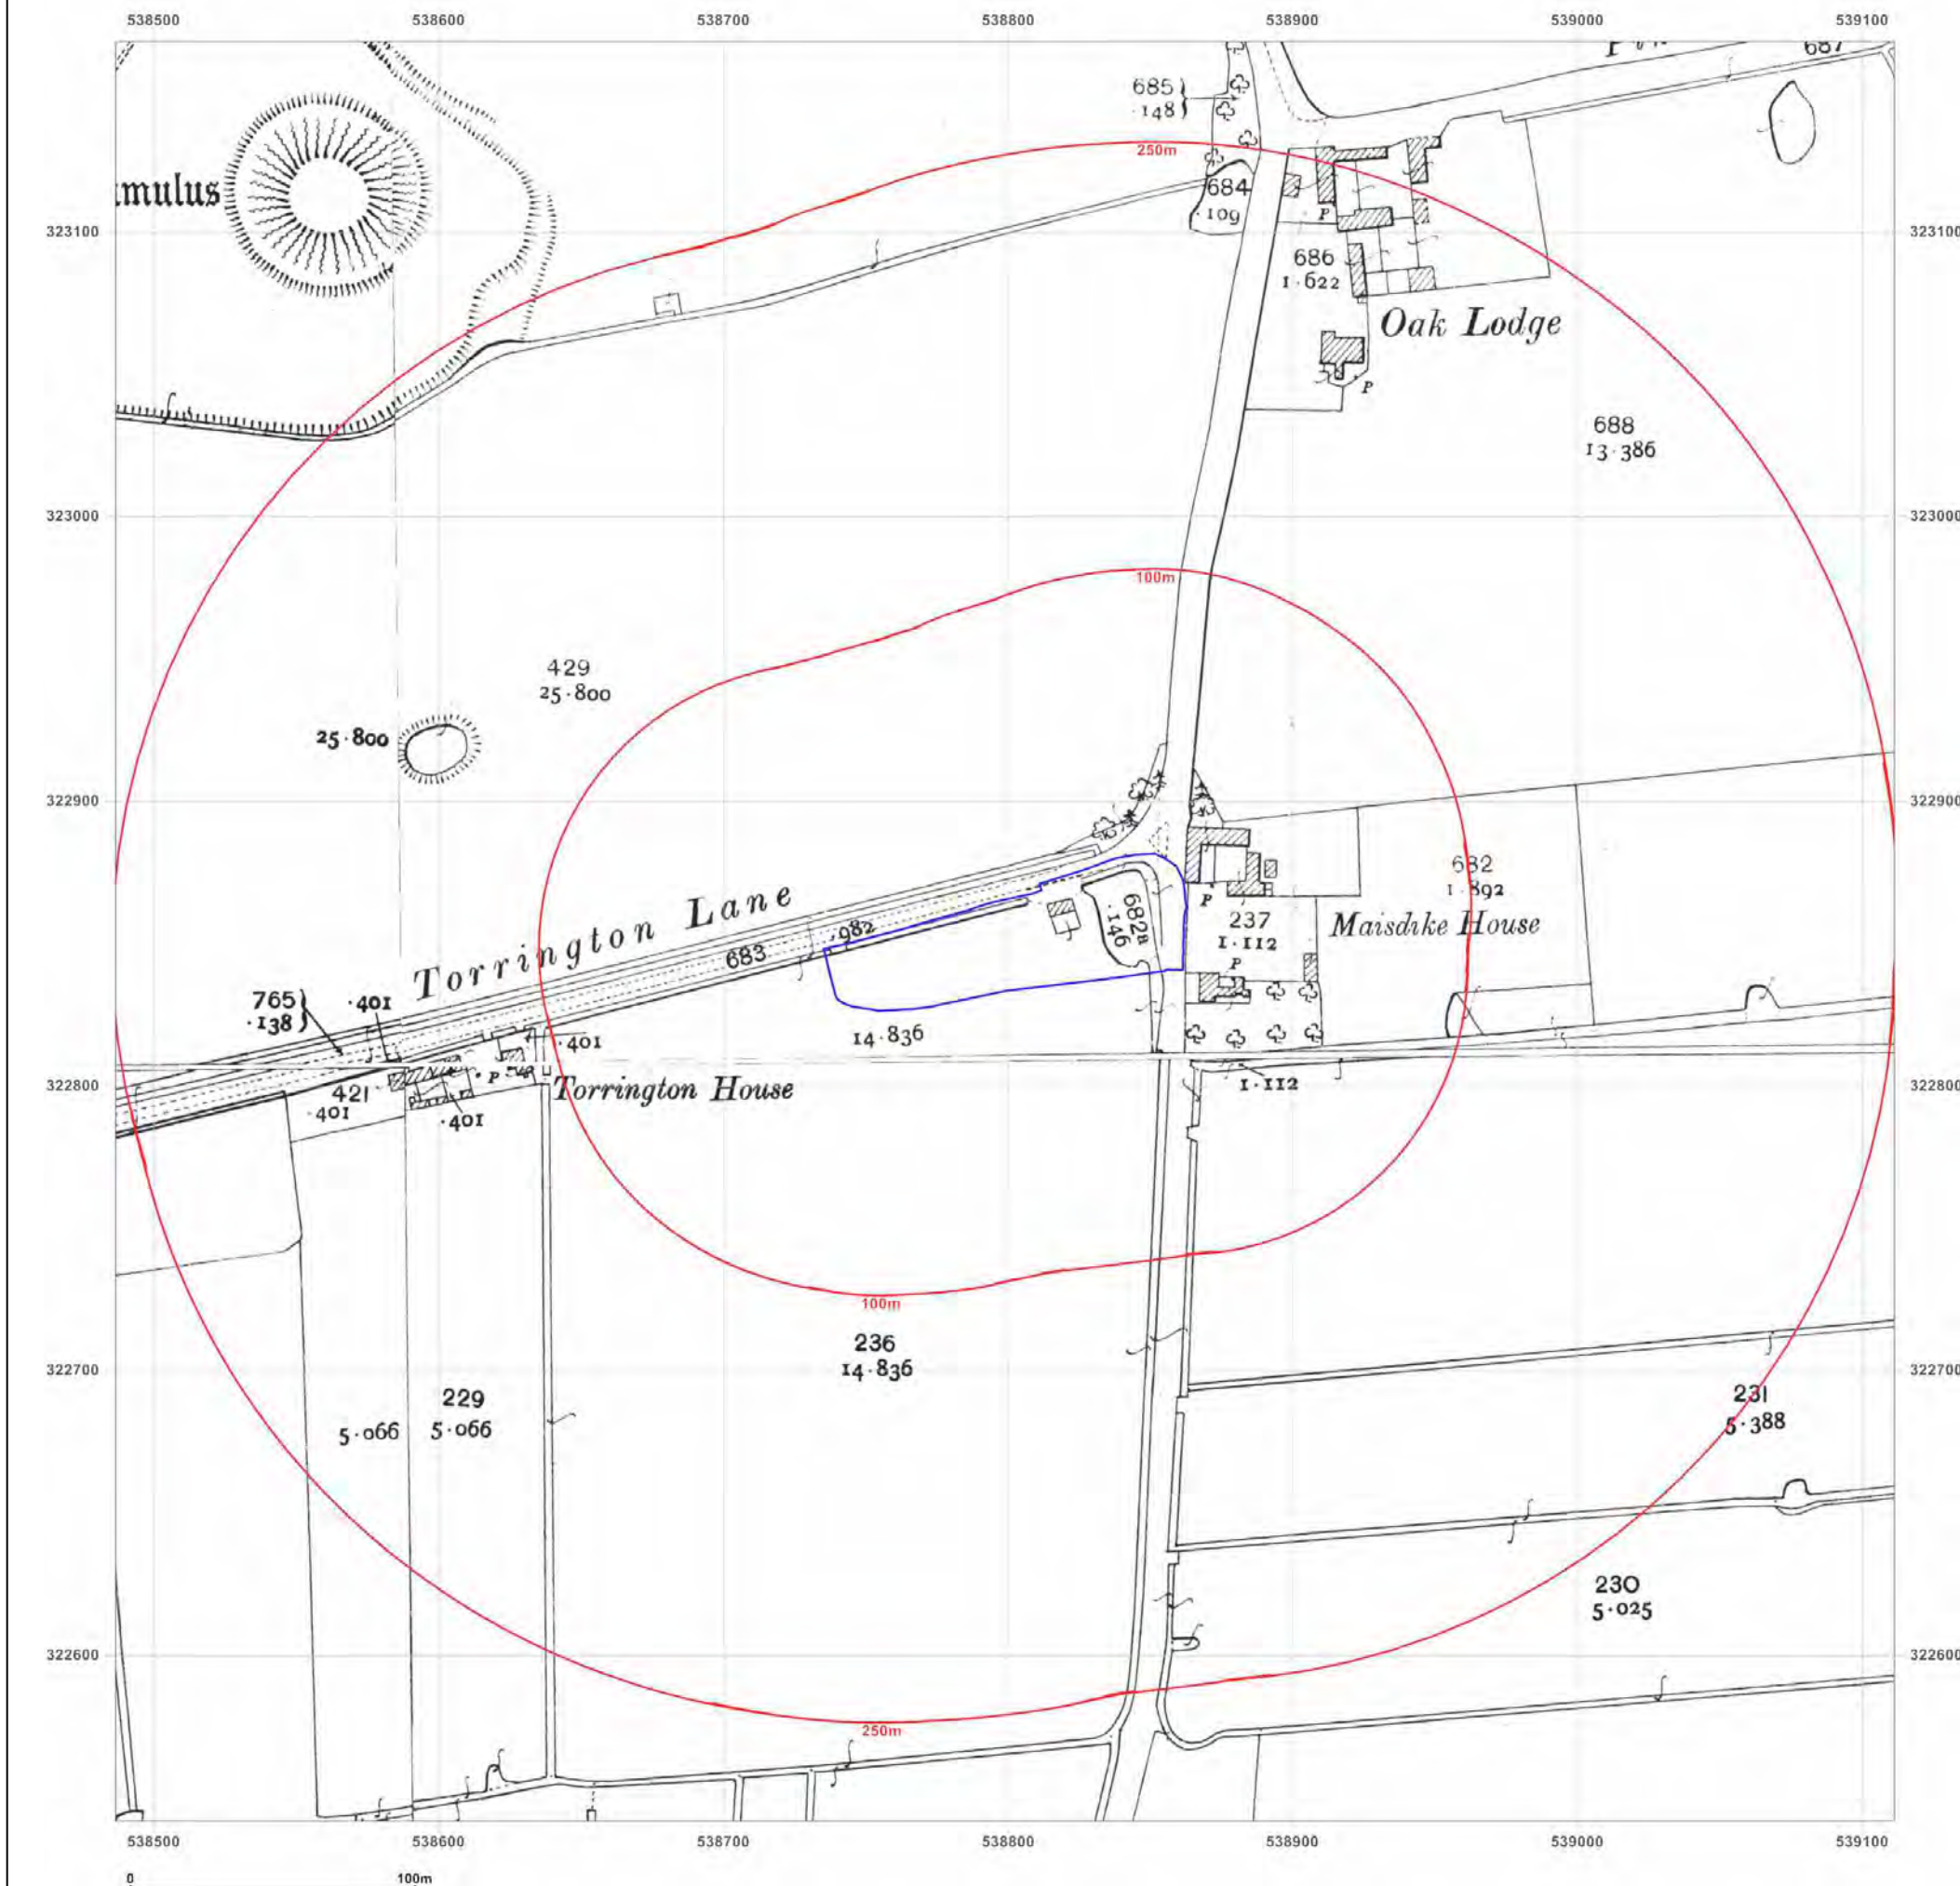

Site Details:

Mulberry Barn, TORRINGTON
LANE, FLEET, SPALDING

Client Ref: R0160
Report Ref: GS-5777360
Grid Ref: 538799, 322854

Map Name: County Series

Map date: 1931


Scale: 1:2,500

Printed at: 1:2,500



Surveyed 1931
Revised 1931
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1931
Revised 1931
Edition N/A
Copyright N/A
Levelled N/A

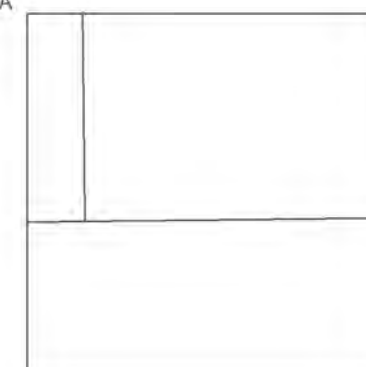


Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 25 January 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

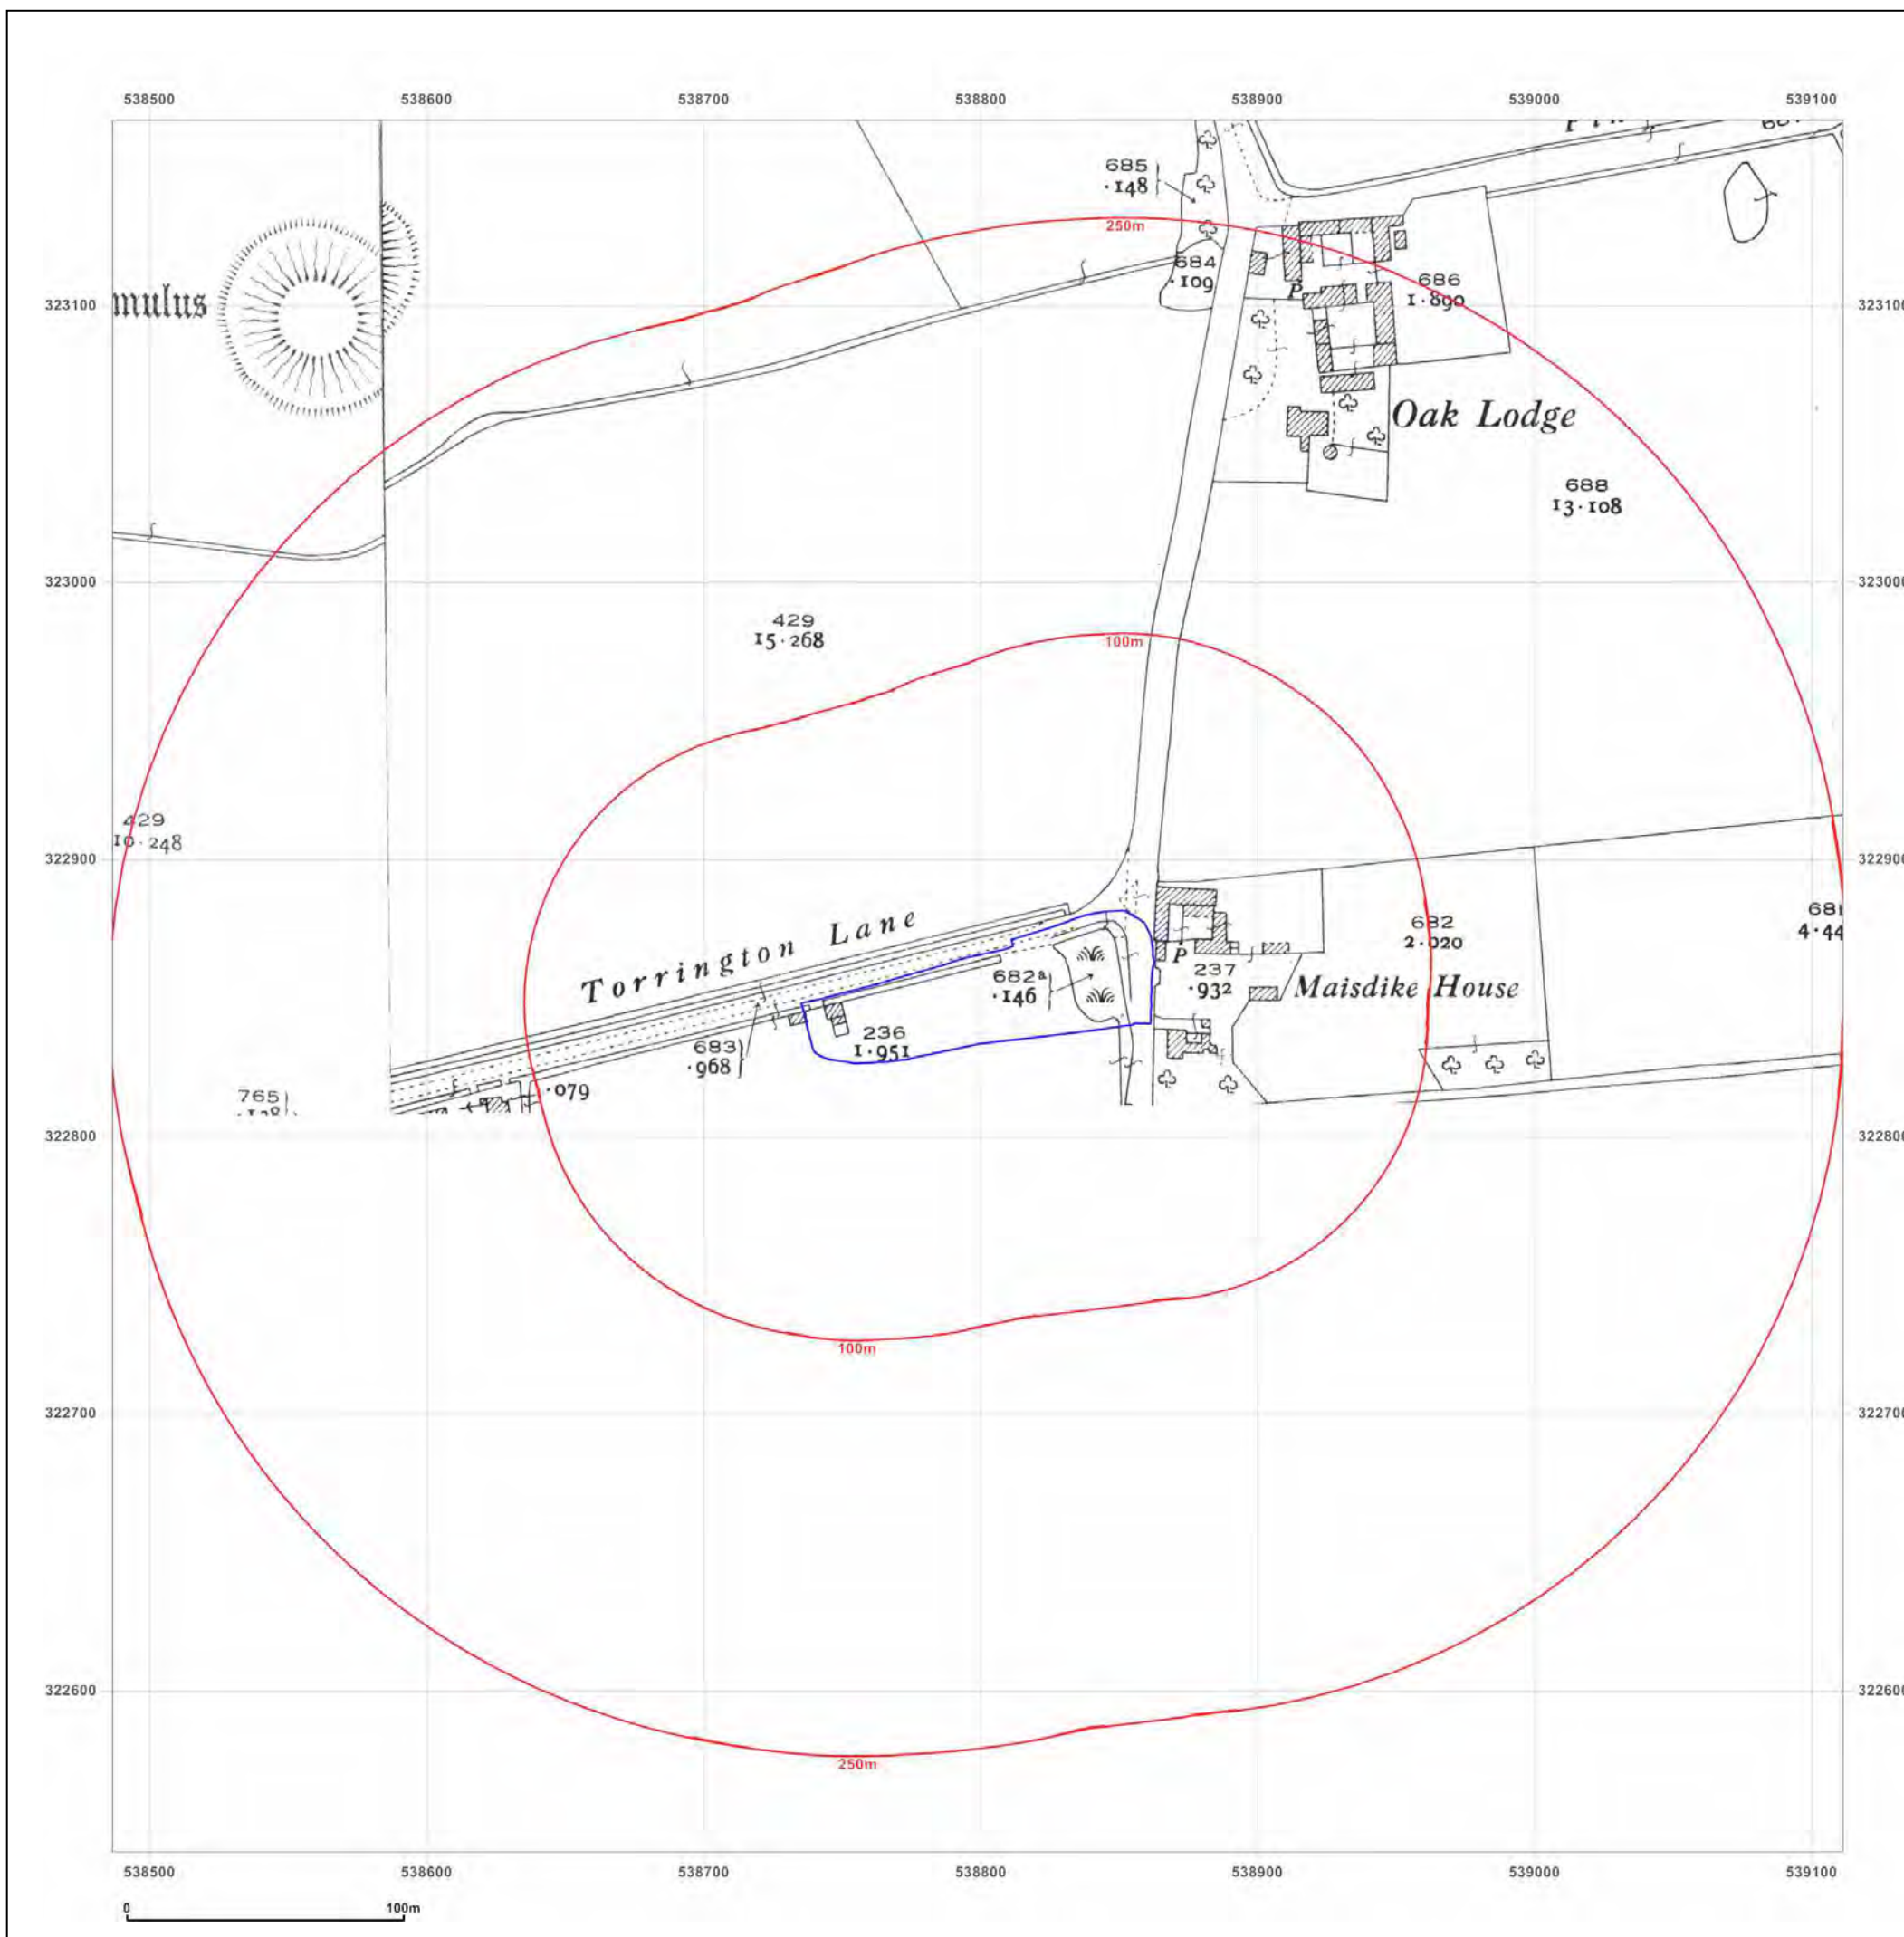

Site Details:

Mulberry Barn, TORRINGTON
LANE, FLEET, SPALDING

Client Ref: R0160
Report Ref: GS-5777360
Grid Ref: 538799, 322854

Map Name: National Grid

Map date: 1967

Scale: 1:2,500

Printed at: 1:2,500



Surveyed 1967
Revised 1967
Edition N/A
Copyright 1969
Levelled 1965

Surveyed 1967
Revised 1967
Edition N/A
Copyright 1969
Levelled 1965




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 25 January 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

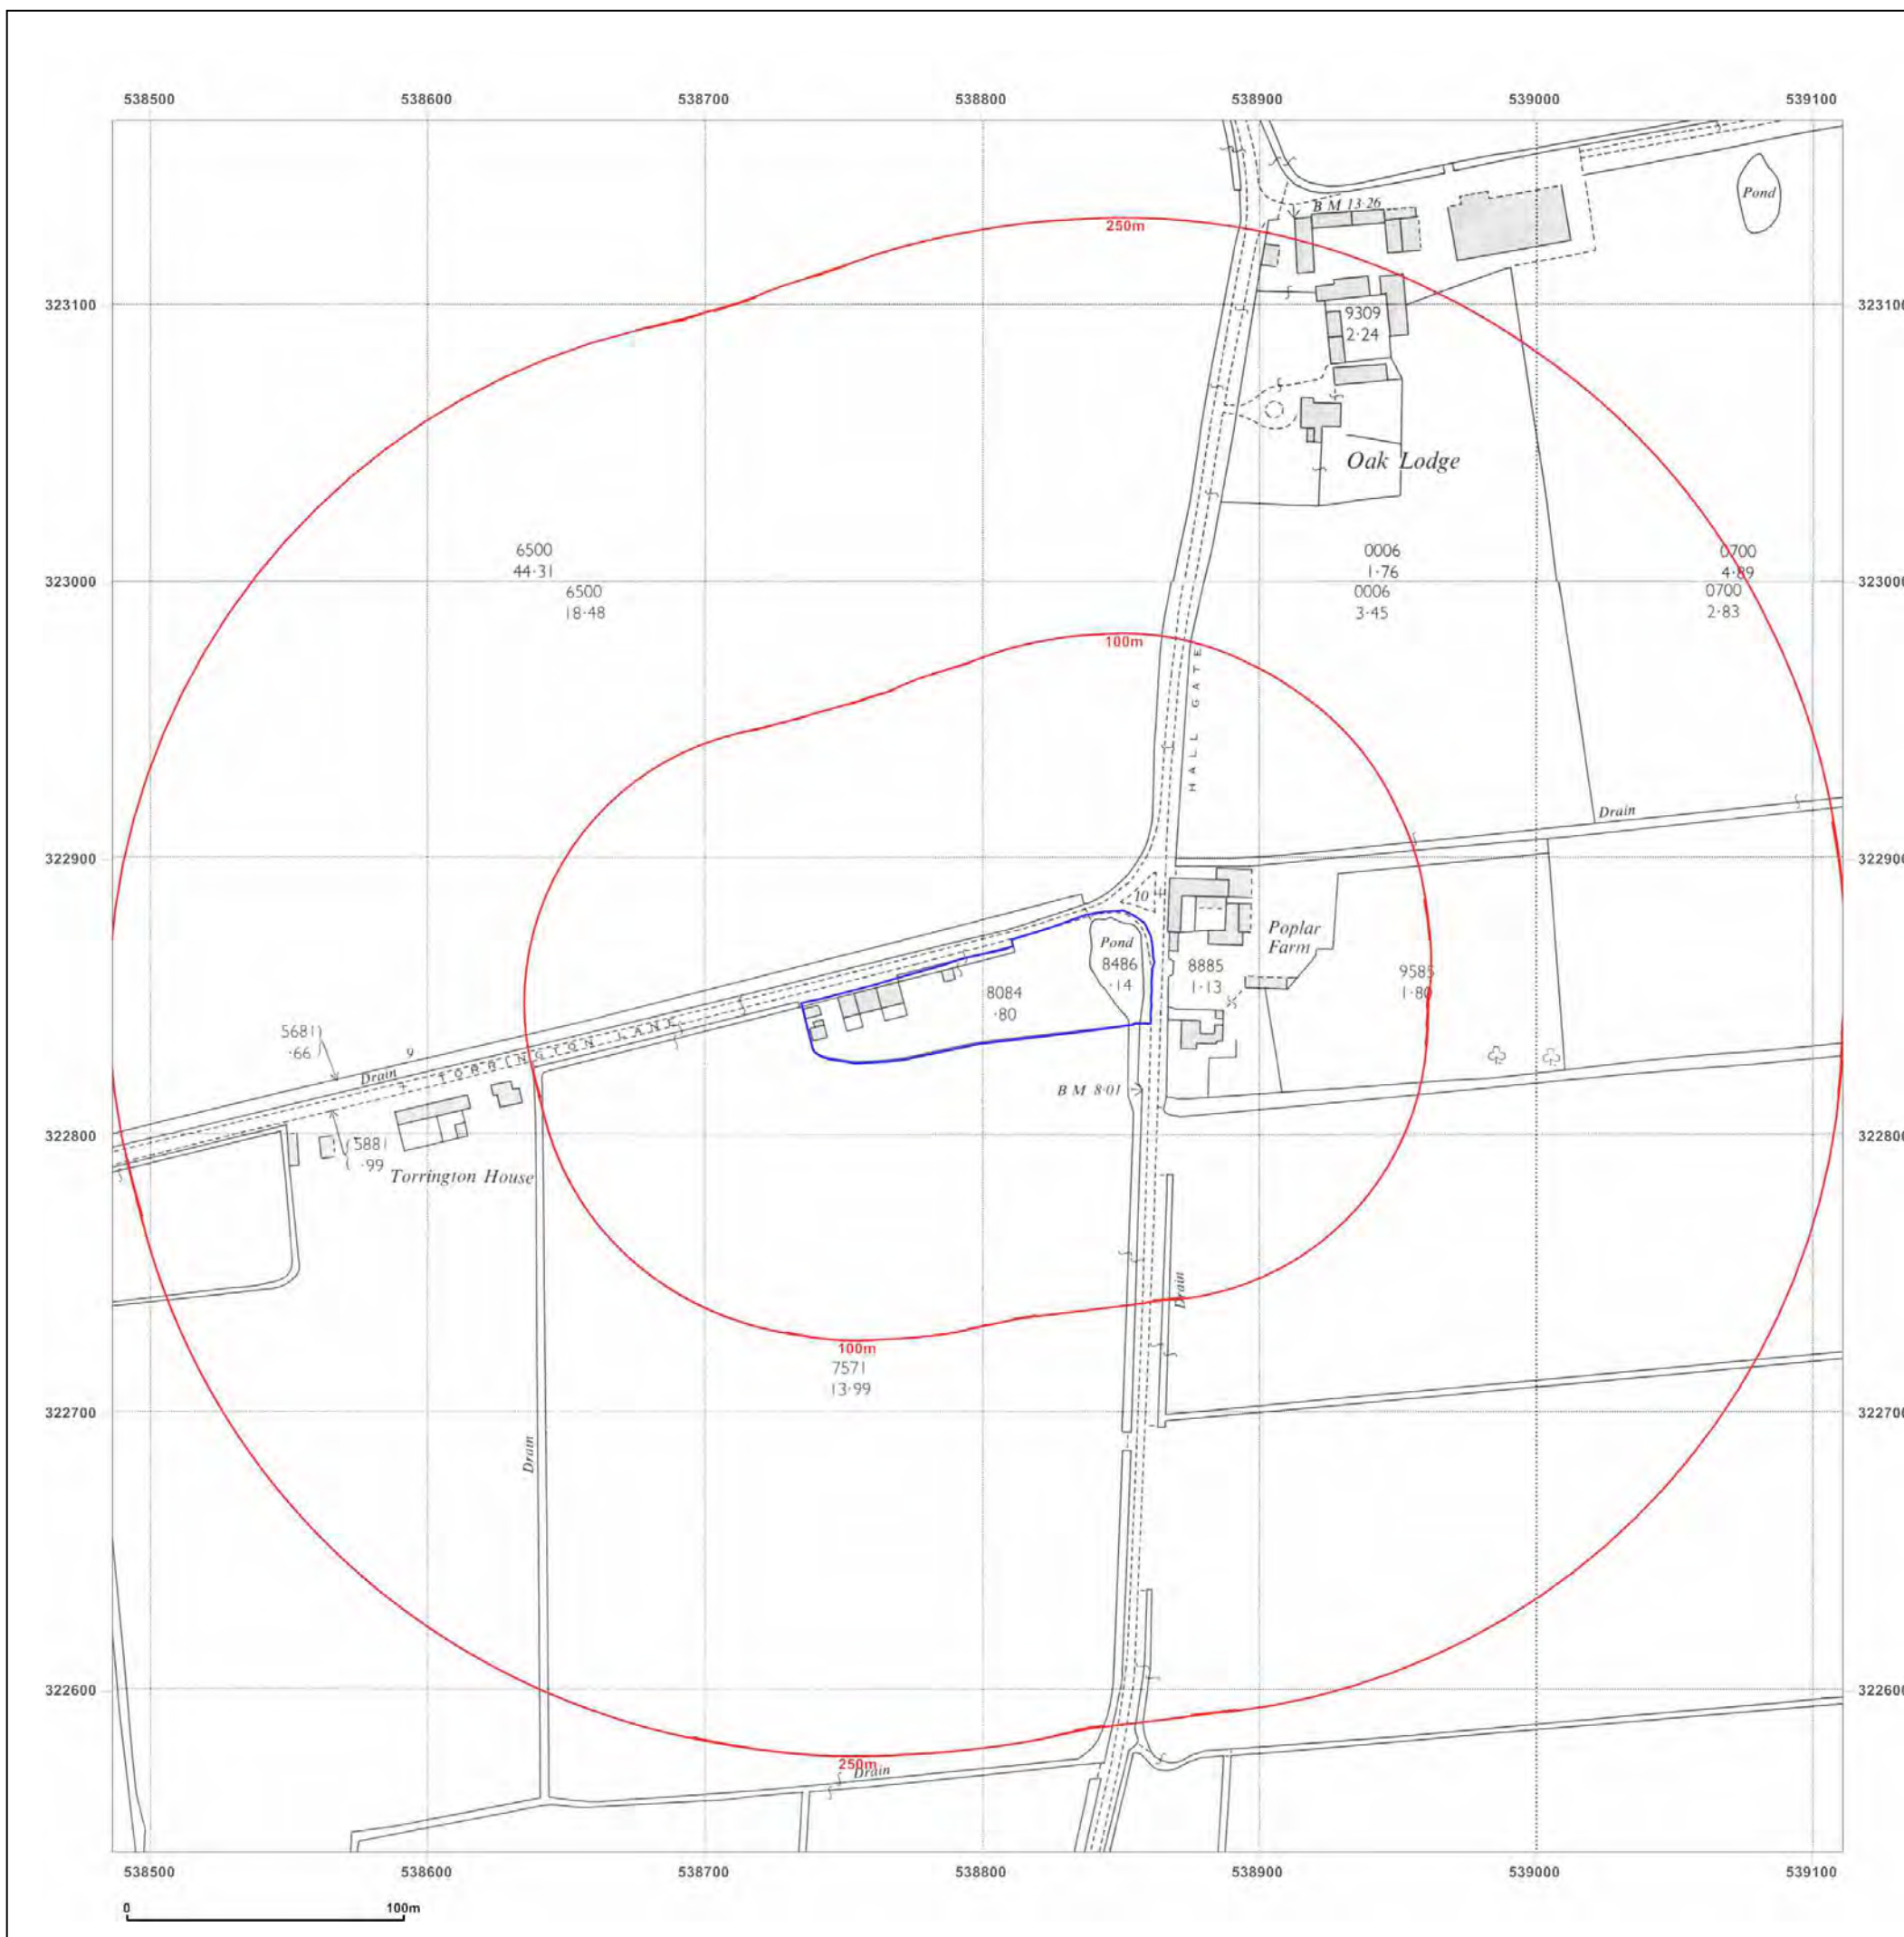

Site Details:

Mulberry Barn, TORRINGTON
LANE, FLEET, SPALDING

Client Ref: R0160
Report Ref: GS-5777360
Grid Ref: 538799, 322854

Map Name: National Grid

Map date: 1969

Scale: 1:2,500

Printed at: 1:2,500



Surveyed N/A
Revised N/A
Edition N/A
Copyright N/A
Levelled N/A

Surveyed N/A
Revised N/A
Edition N/A
Copyright N/A
Levelled N/A

Surveyed N/A
Revised N/A
Edition N/A
Copyright N/A
Levelled N/A

Surveyed N/A
Revised N/A
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 25 January 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

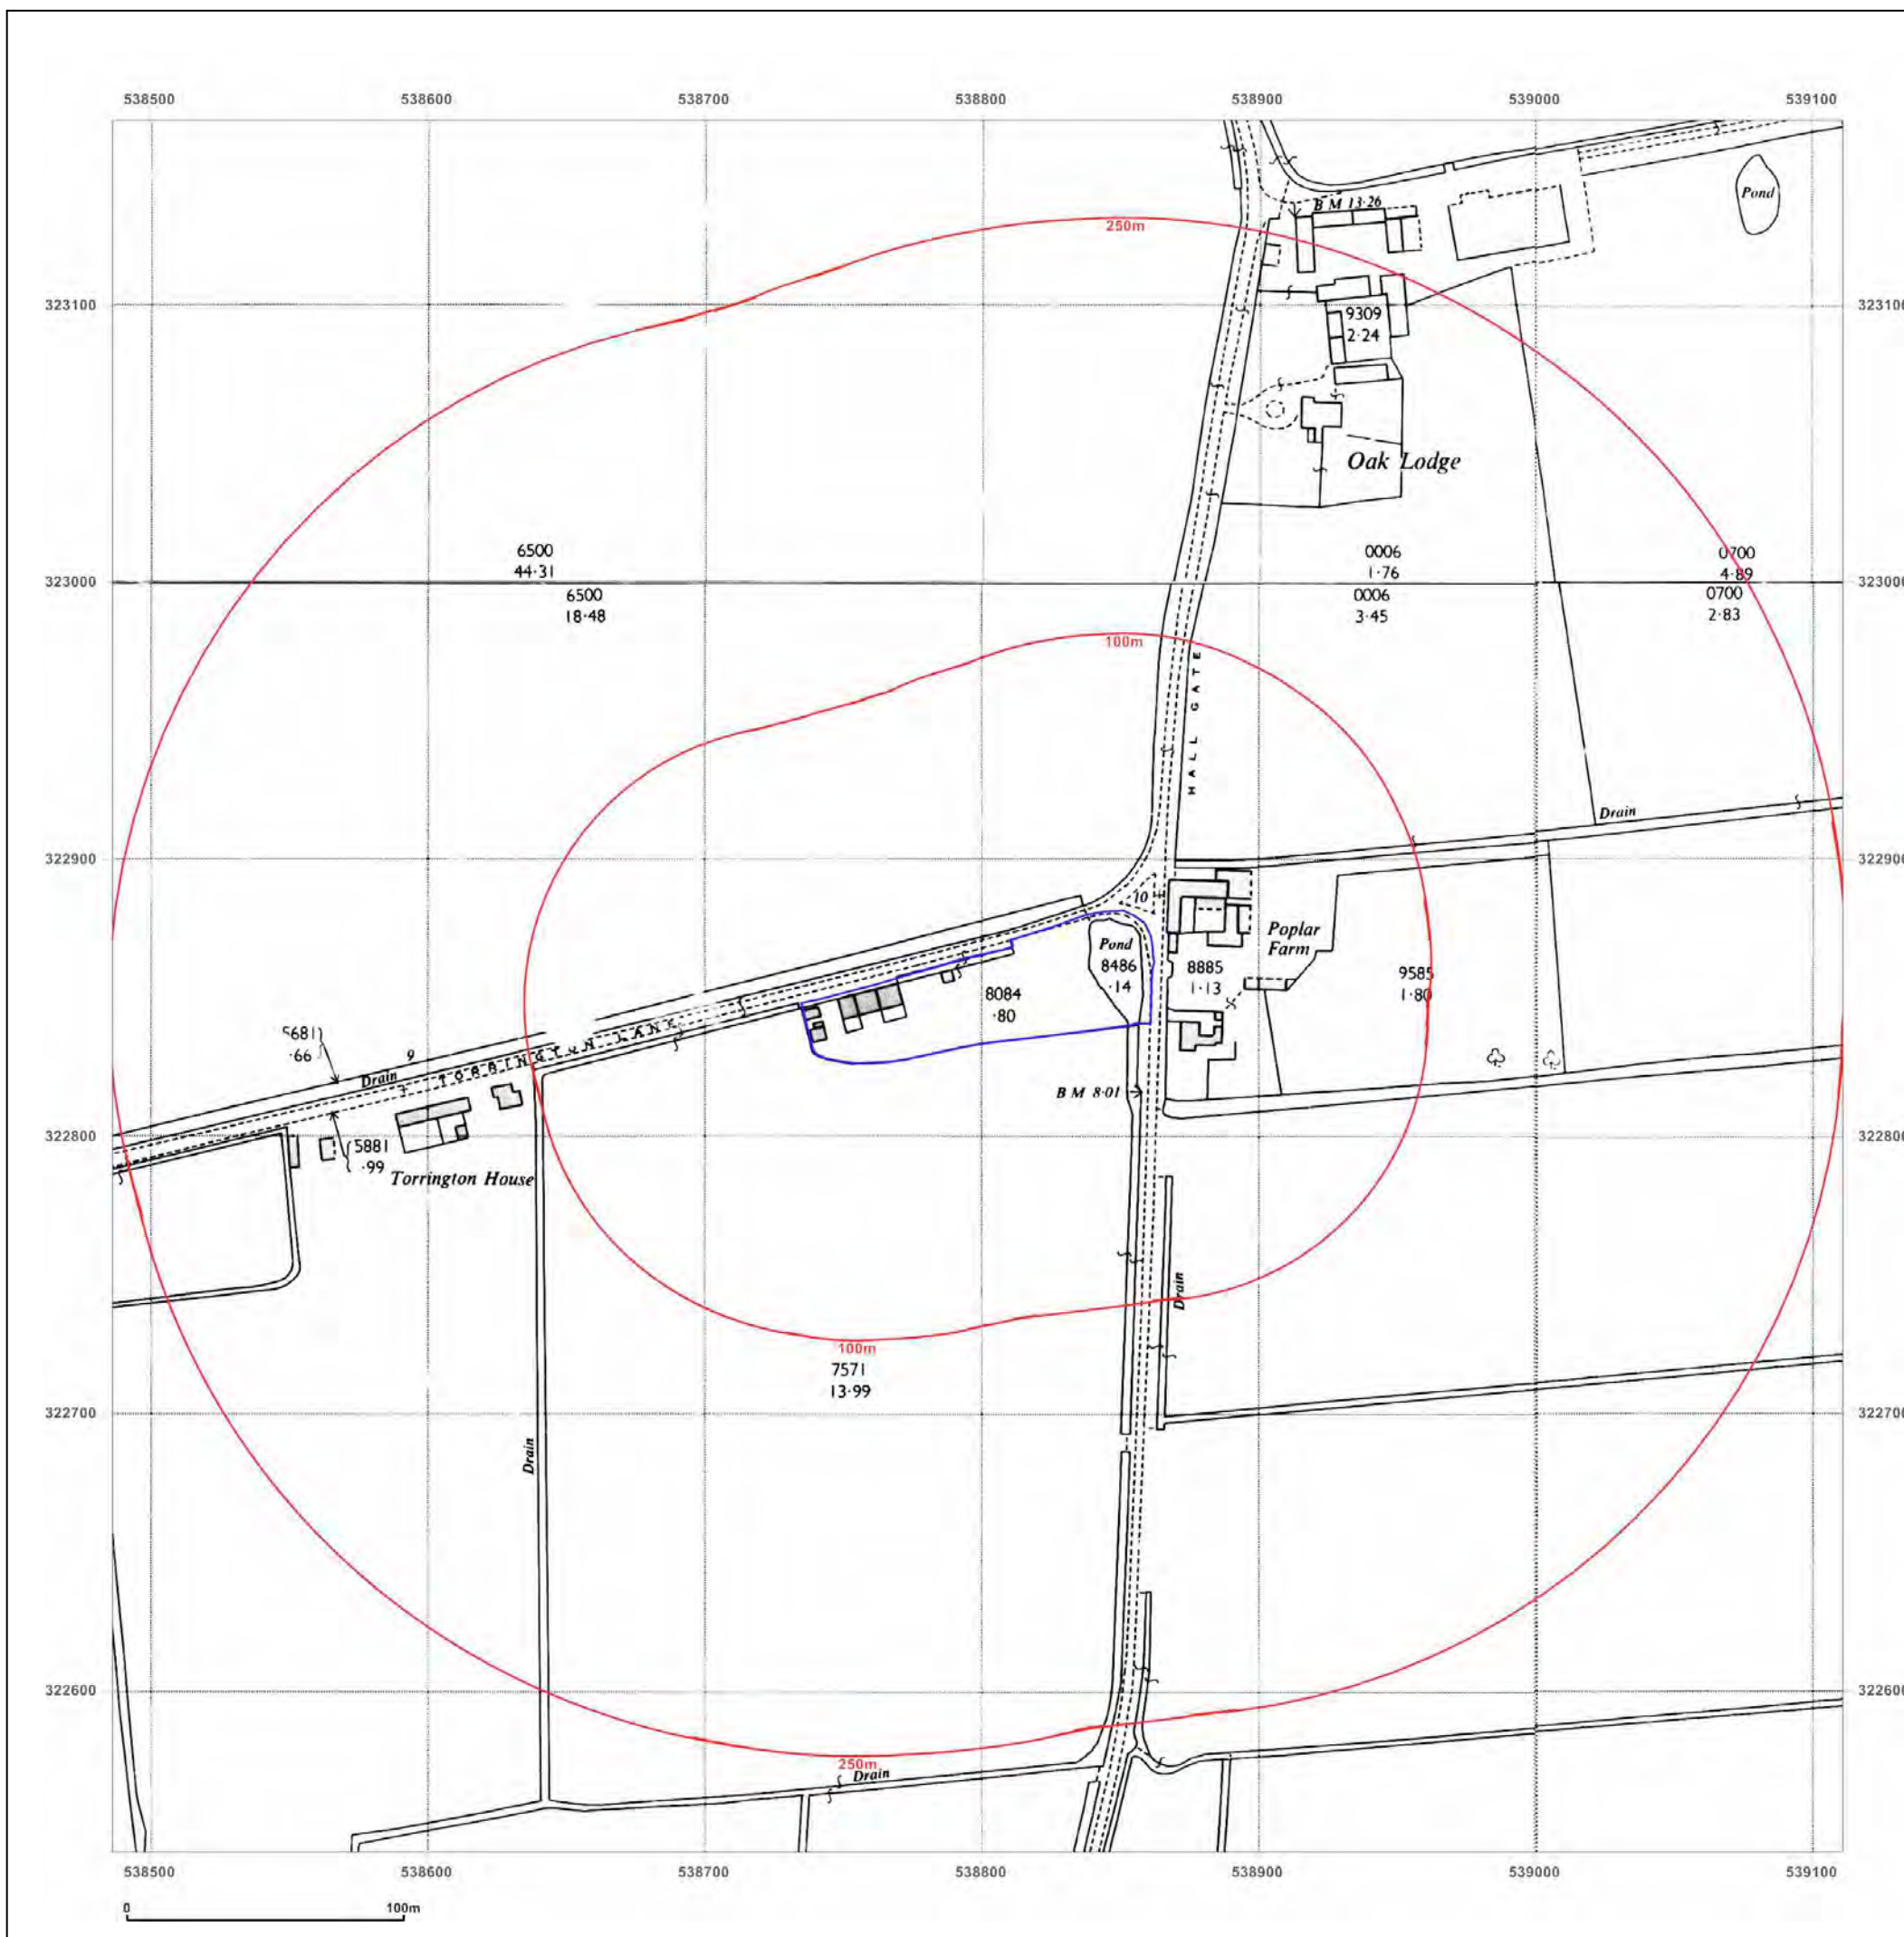

Site Details:

Mulberry Barn, TORRINGTON
LANE, FLEET, SPALDING

Client Ref: R0160
Report Ref: GS-5777360
Grid Ref: 538799, 322854

Map Name: National Grid

Map date: 1969


Scale: 1:2,500

Printed at: 1:2,500



Surveyed N/A
Revised N/A
Edition N/A
Copyright N/A
Levelled N/A

Surveyed N/A
Revised N/A
Edition N/A
Copyright N/A
Levelled N/A

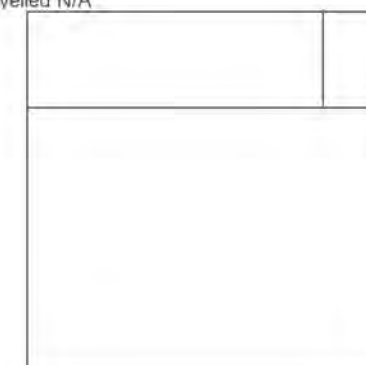


Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 25 January 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

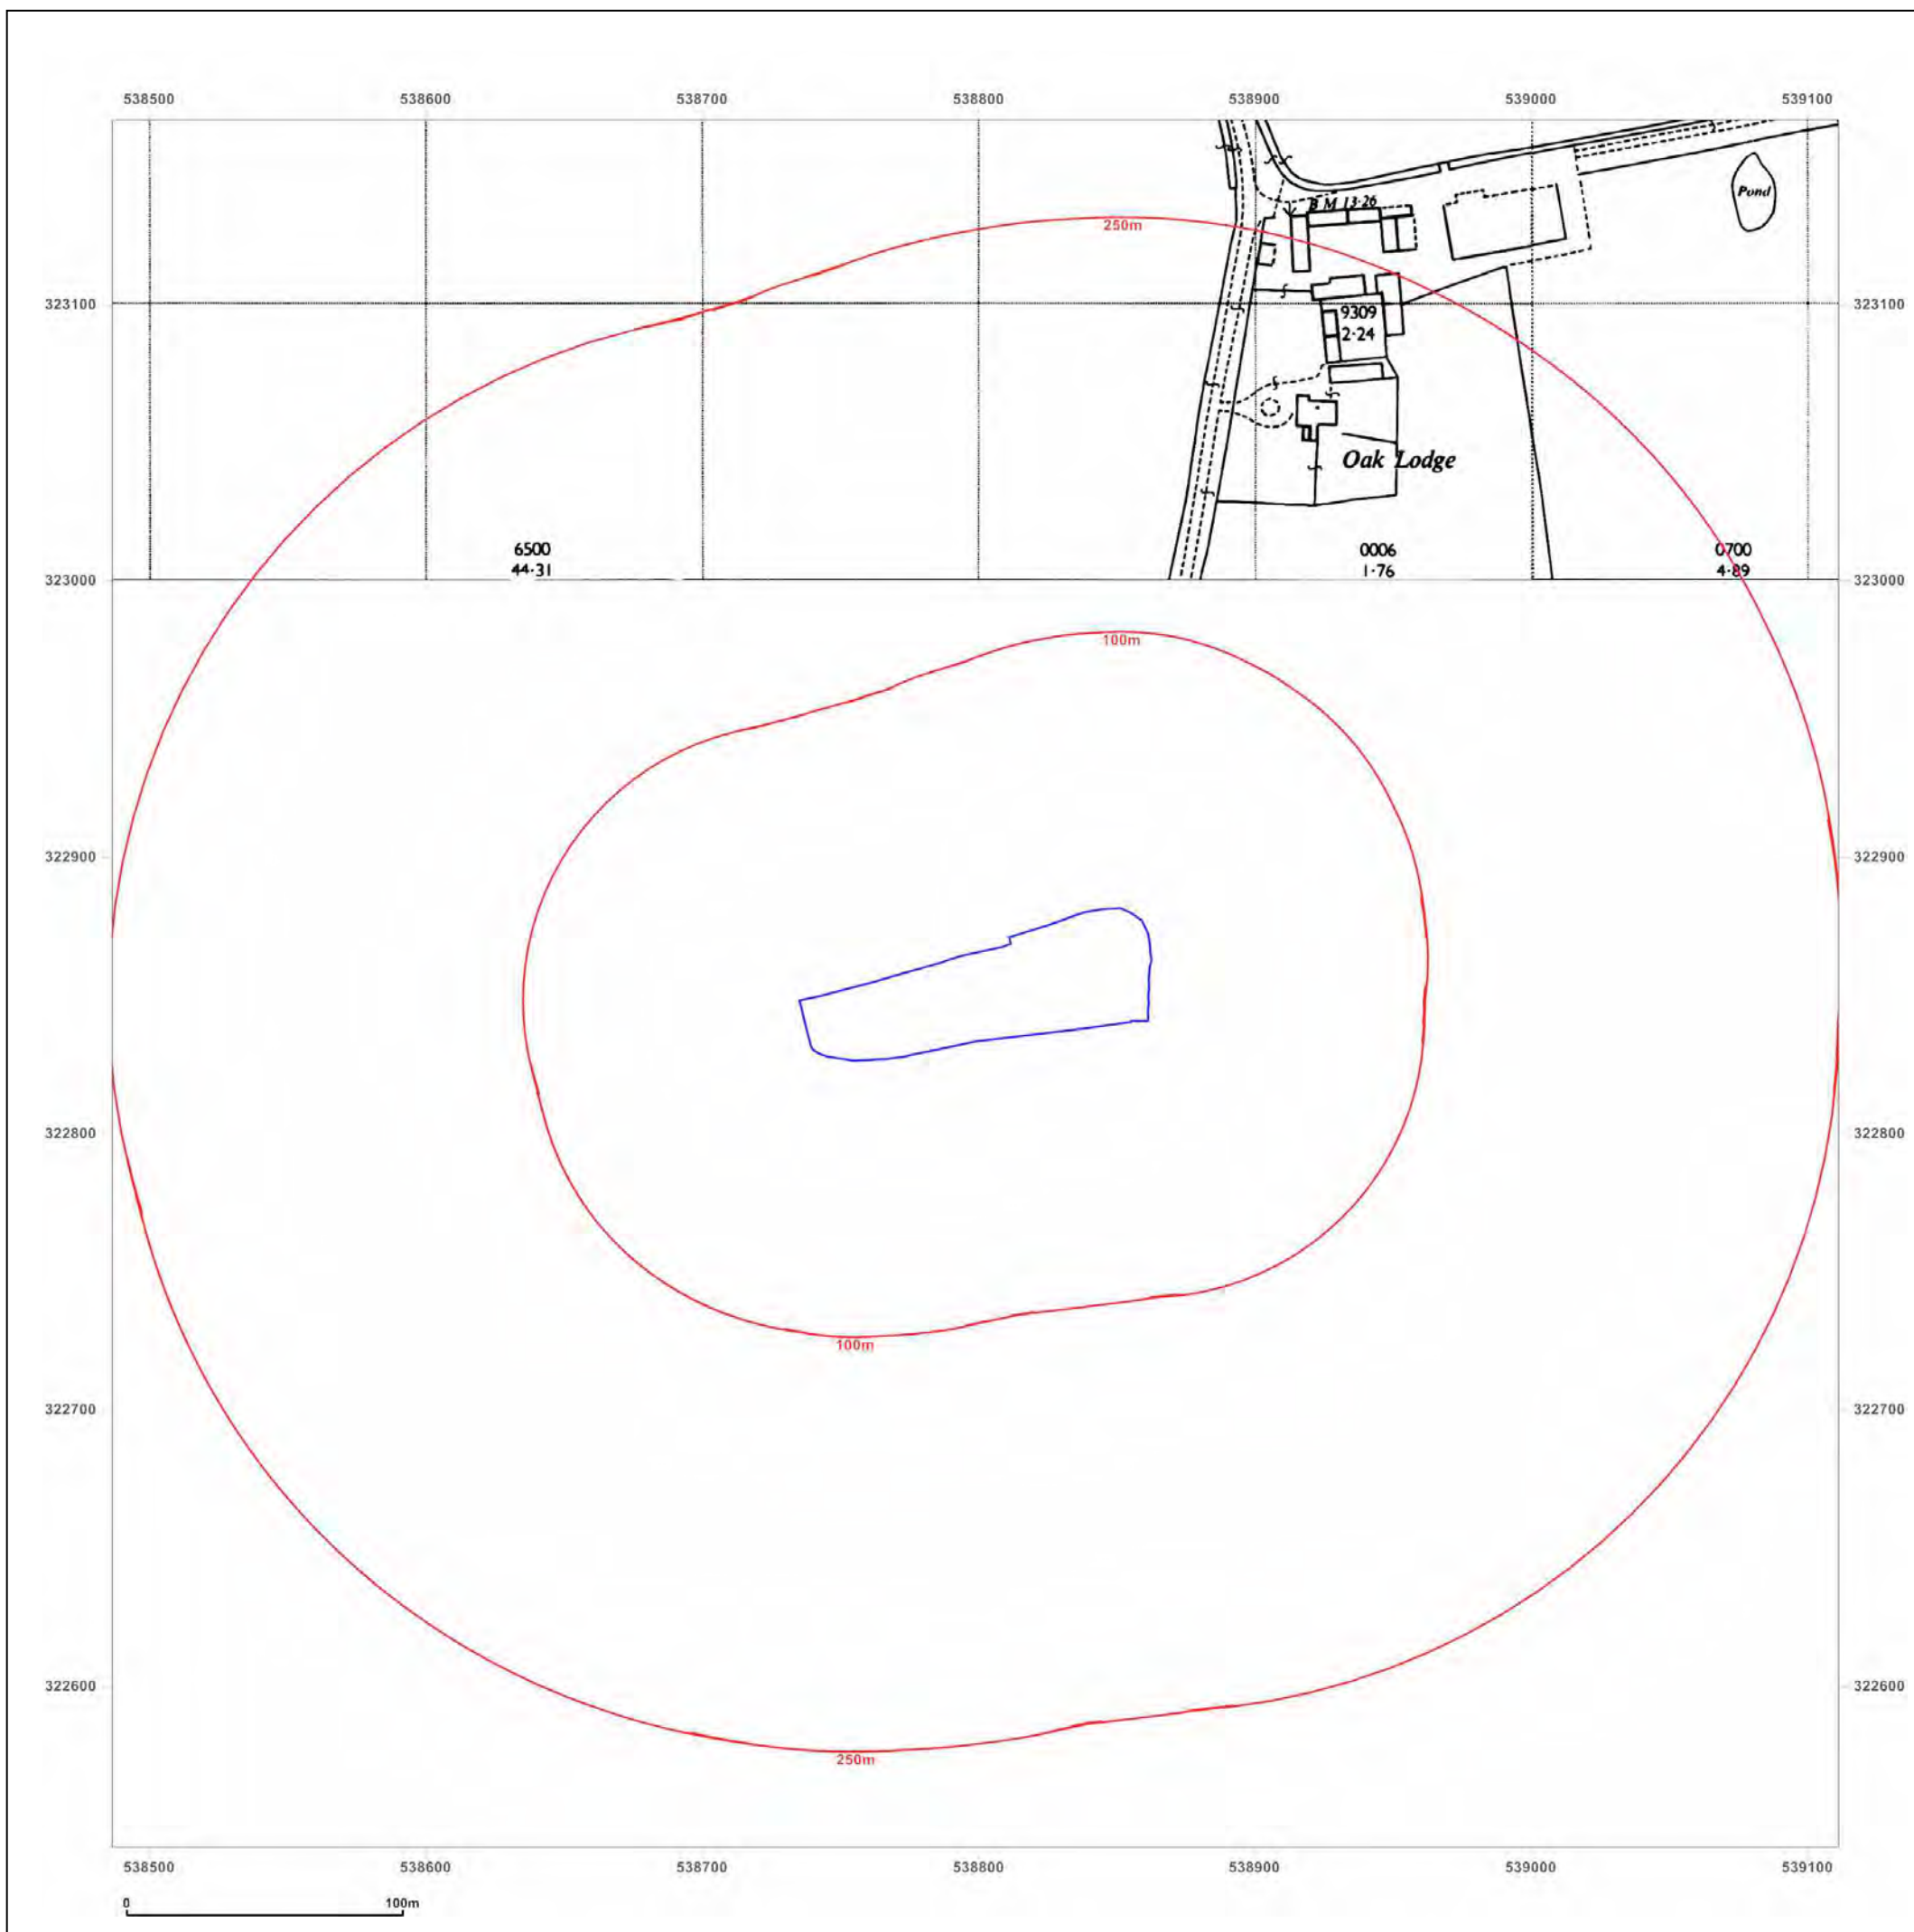

Site Details:

Mulberry Barn, TORRINGTON
LANE, FLEET, SPALDING

Client Ref: R0160
Report Ref: GS-5777360
Grid Ref: 538799, 322854

Map Name: National Grid

Map date: 1991-1995

Scale: 1:2,500

Printed at: 1:2,500



Surveyed 1991
Revised 1991
Edition N/A
Copyright 1991
Levelled N/A

Surveyed N/A
Revised N/A
Edition N/A
Copyright 1995
Levelled N/A

Surveyed N/A
Revised N/A
Edition N/A
Copyright 1995
Levelled N/A

Surveyed N/A
Revised N/A
Edition N/A
Copyright 1995
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 25 January 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

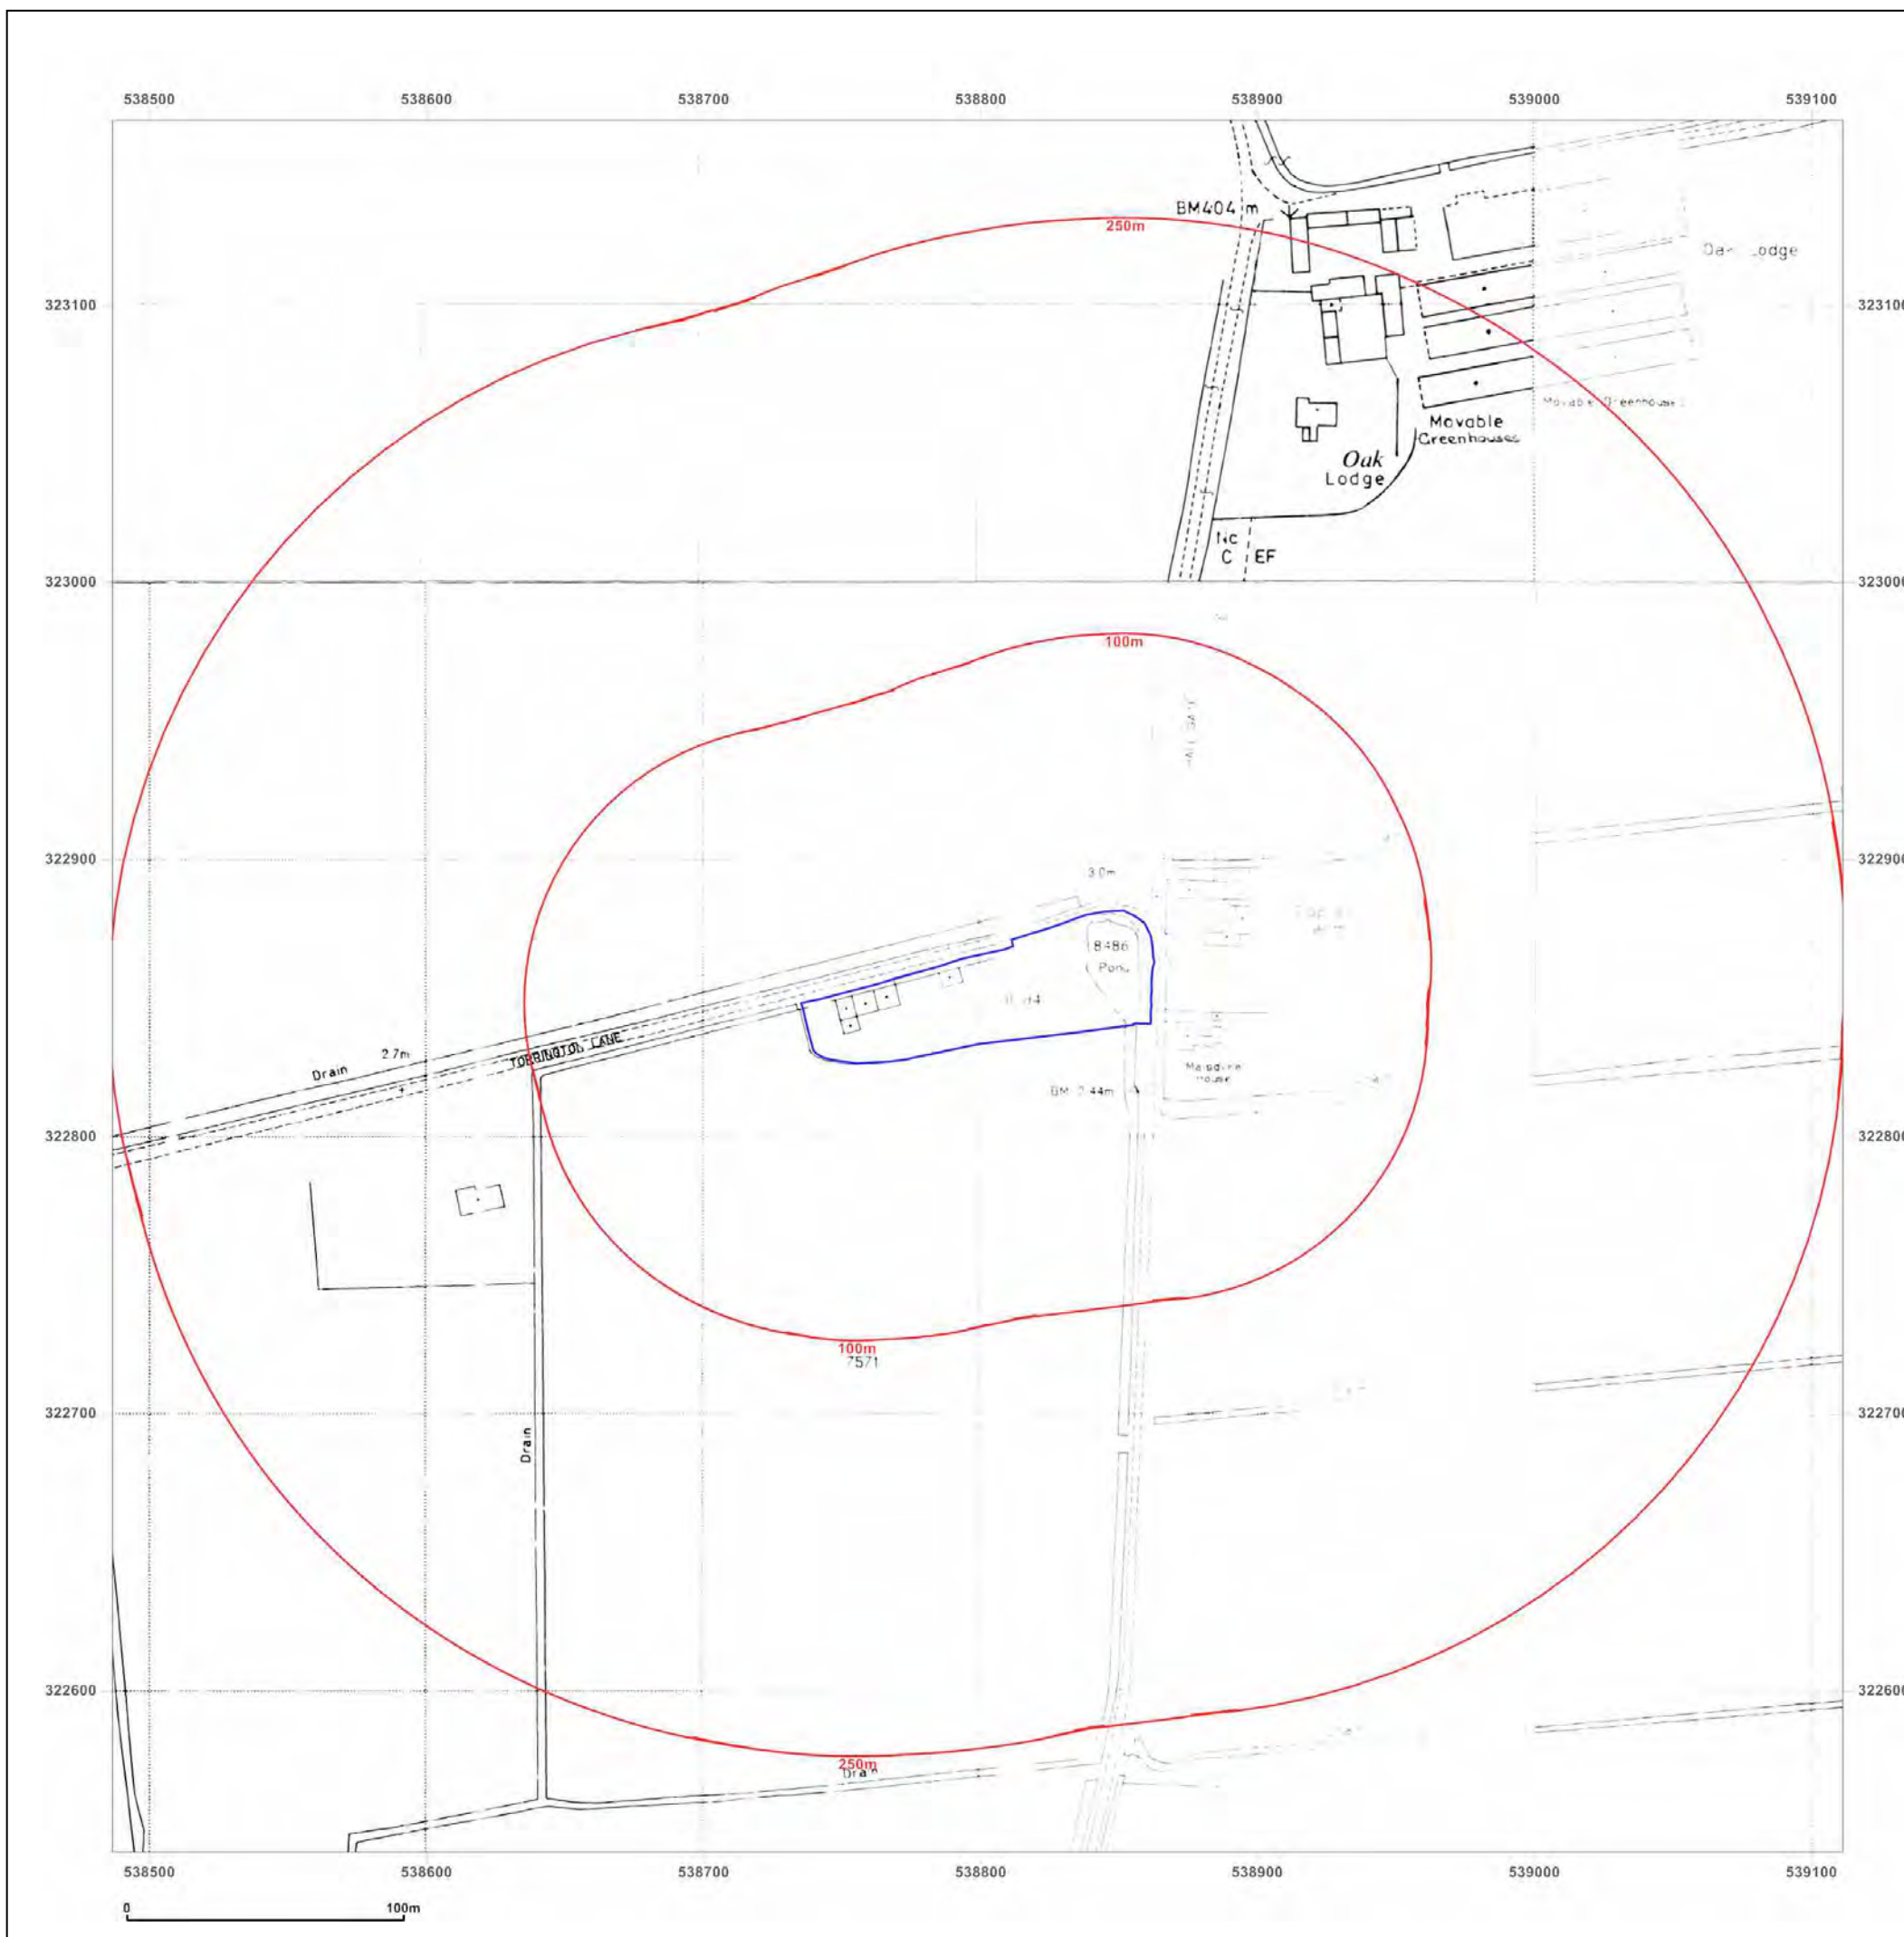

Site Details:

Mulberry Barn, TORRINGTON
LANE, FLEET, SPALDING

Client Ref: R0160
Report Ref: GS-5777360
Grid Ref: 538799, 322854

Map Name: National Grid

Map date: 1991-1995

Scale: 1:2,500

Printed at: 1:2,500



Surveyed N/A
Revised N/A
Edition N/A
Copyright 1995
Levelled N/A

Surveyed 1991
Revised 1991
Edition N/A
Copyright 1991
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 25 January 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

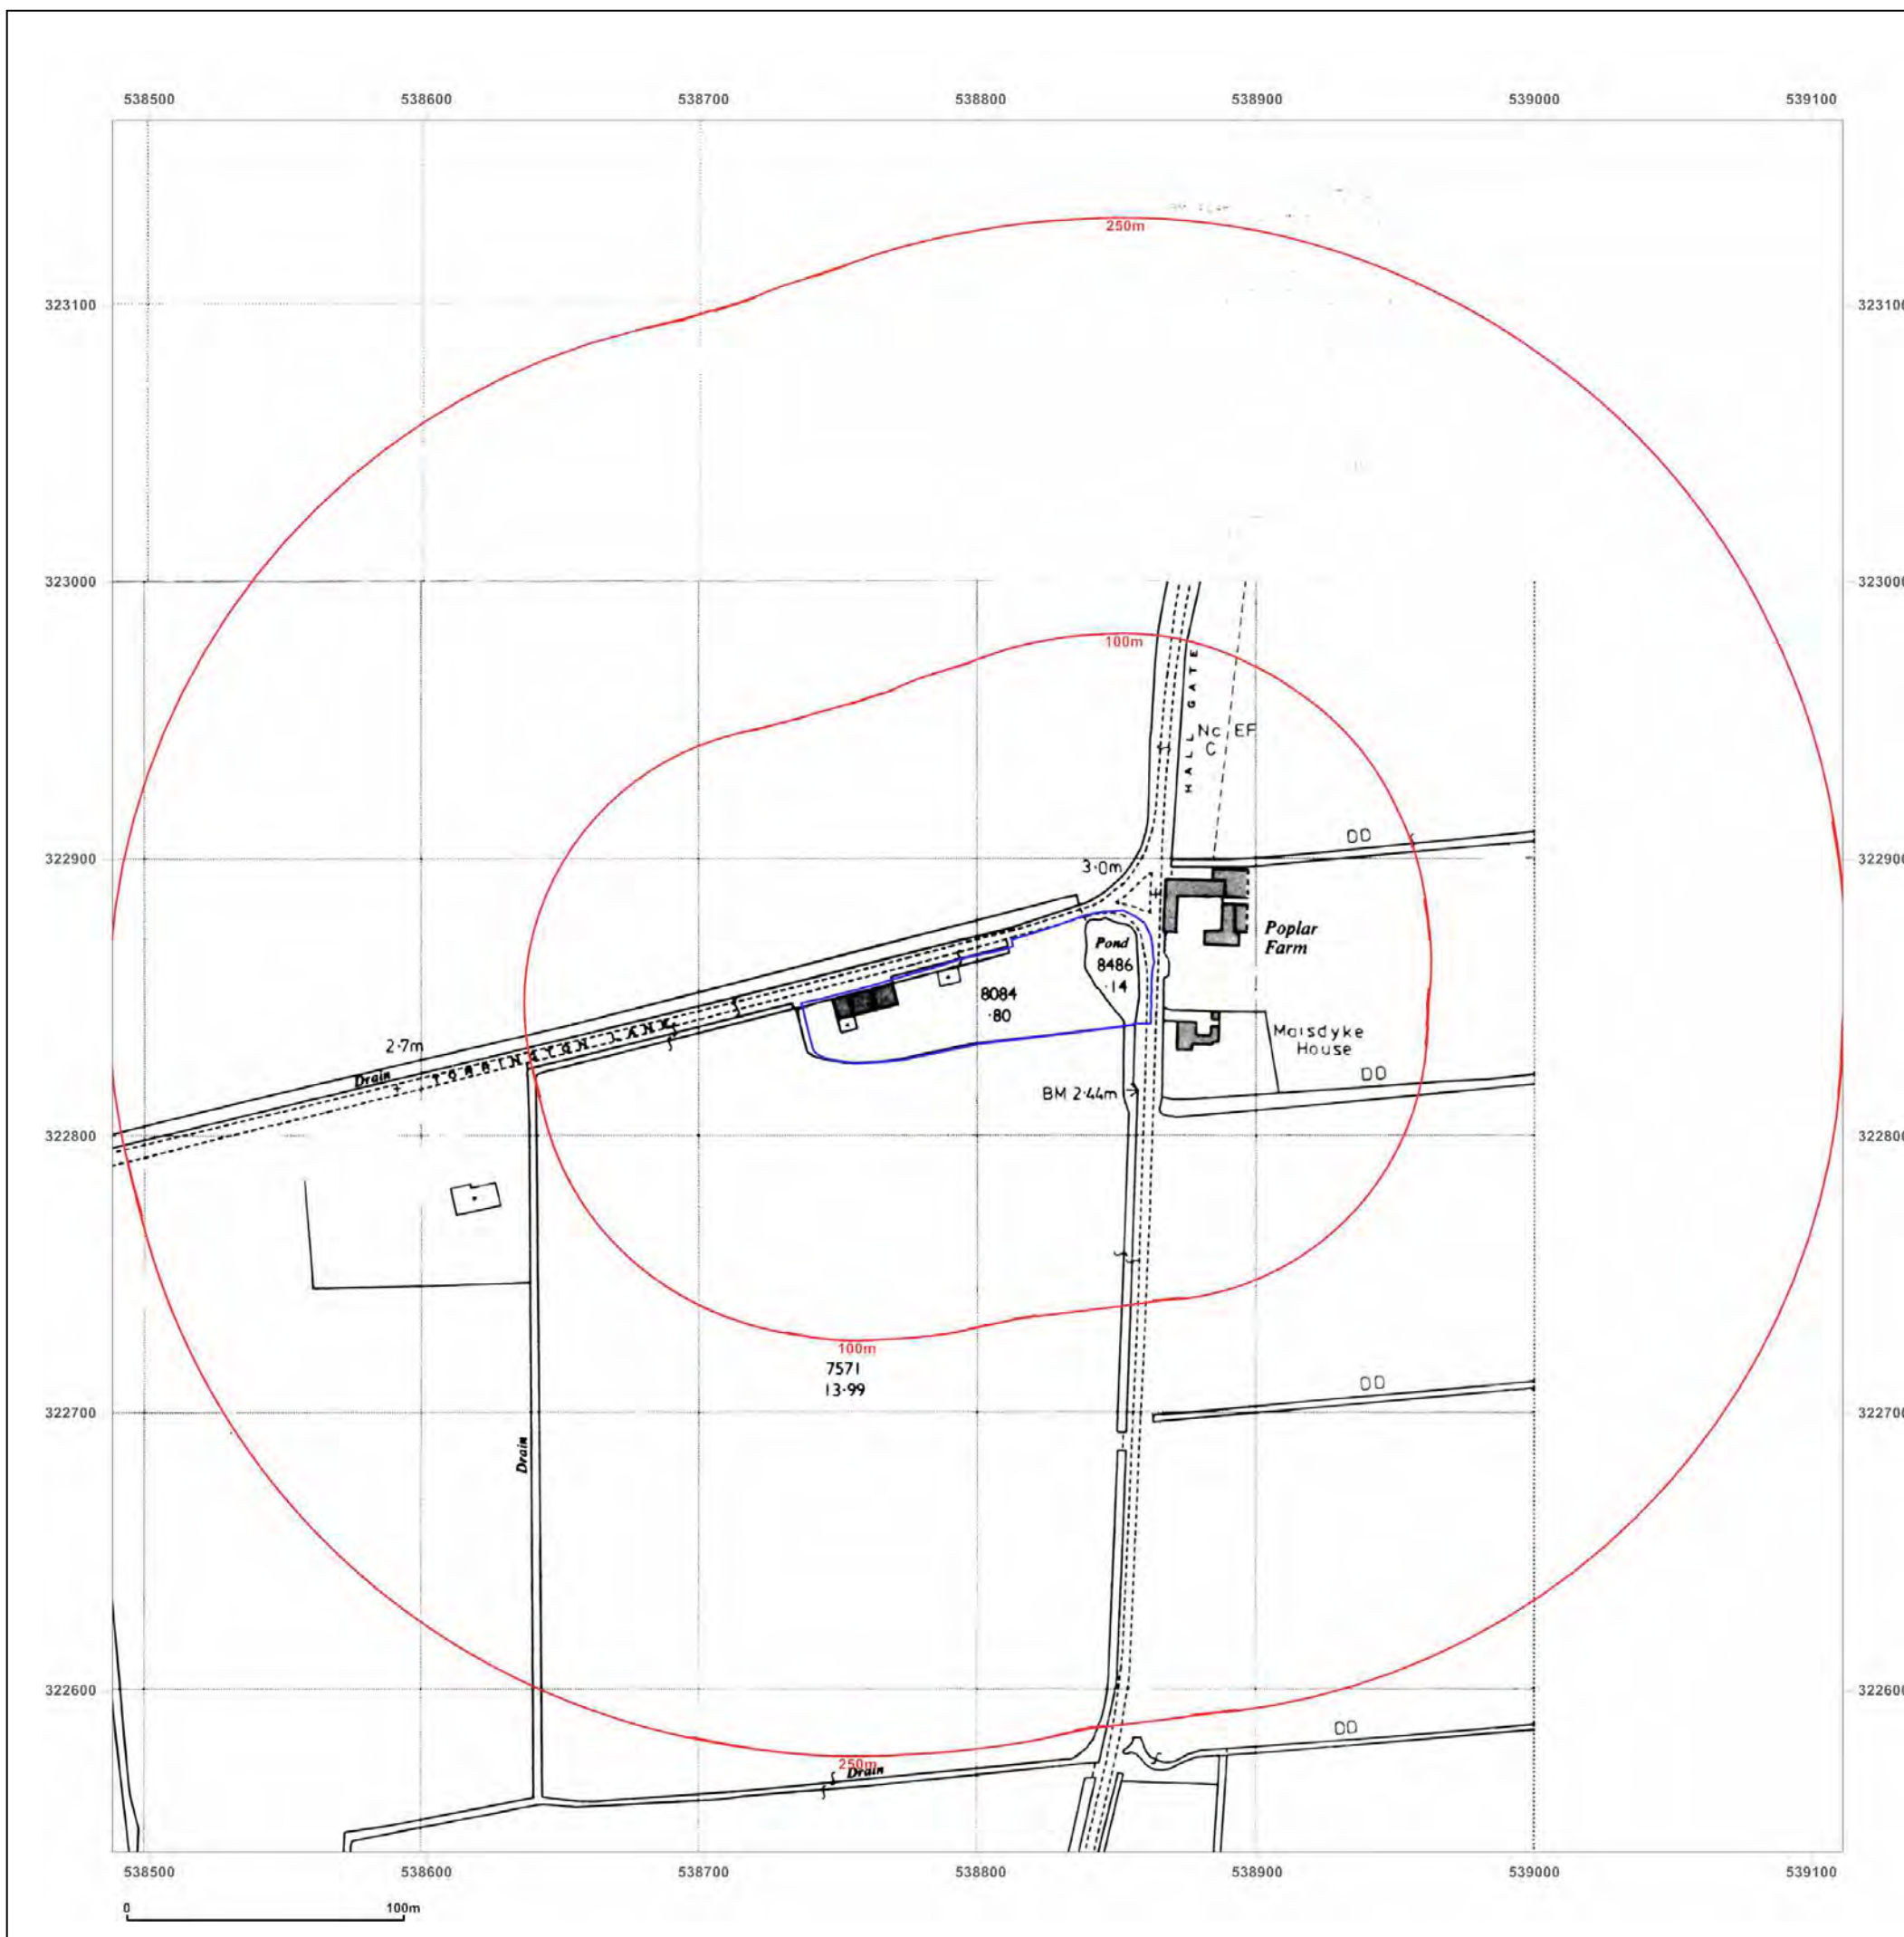

Site Details:

Mulberry Barn, TORRINGTON
LANE, FLEET, SPALDING

Client Ref: R0160
Report Ref: GS-5777360
Grid Ref: 538799, 322854

Map Name: County Series


Map date: 1887

Scale: 1:10,560

Printed at: 1:10,560



Surveyed 1887
Revised 1887
Edition N/A
Copyright N/A
Levelled N/A

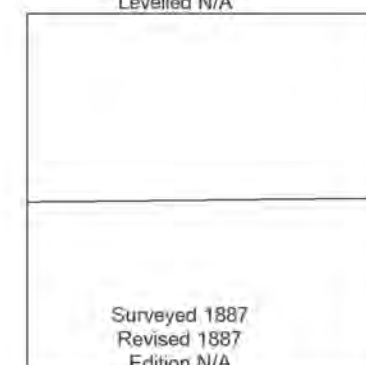

Surveyed 1887
Revised 1887
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 25 January 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

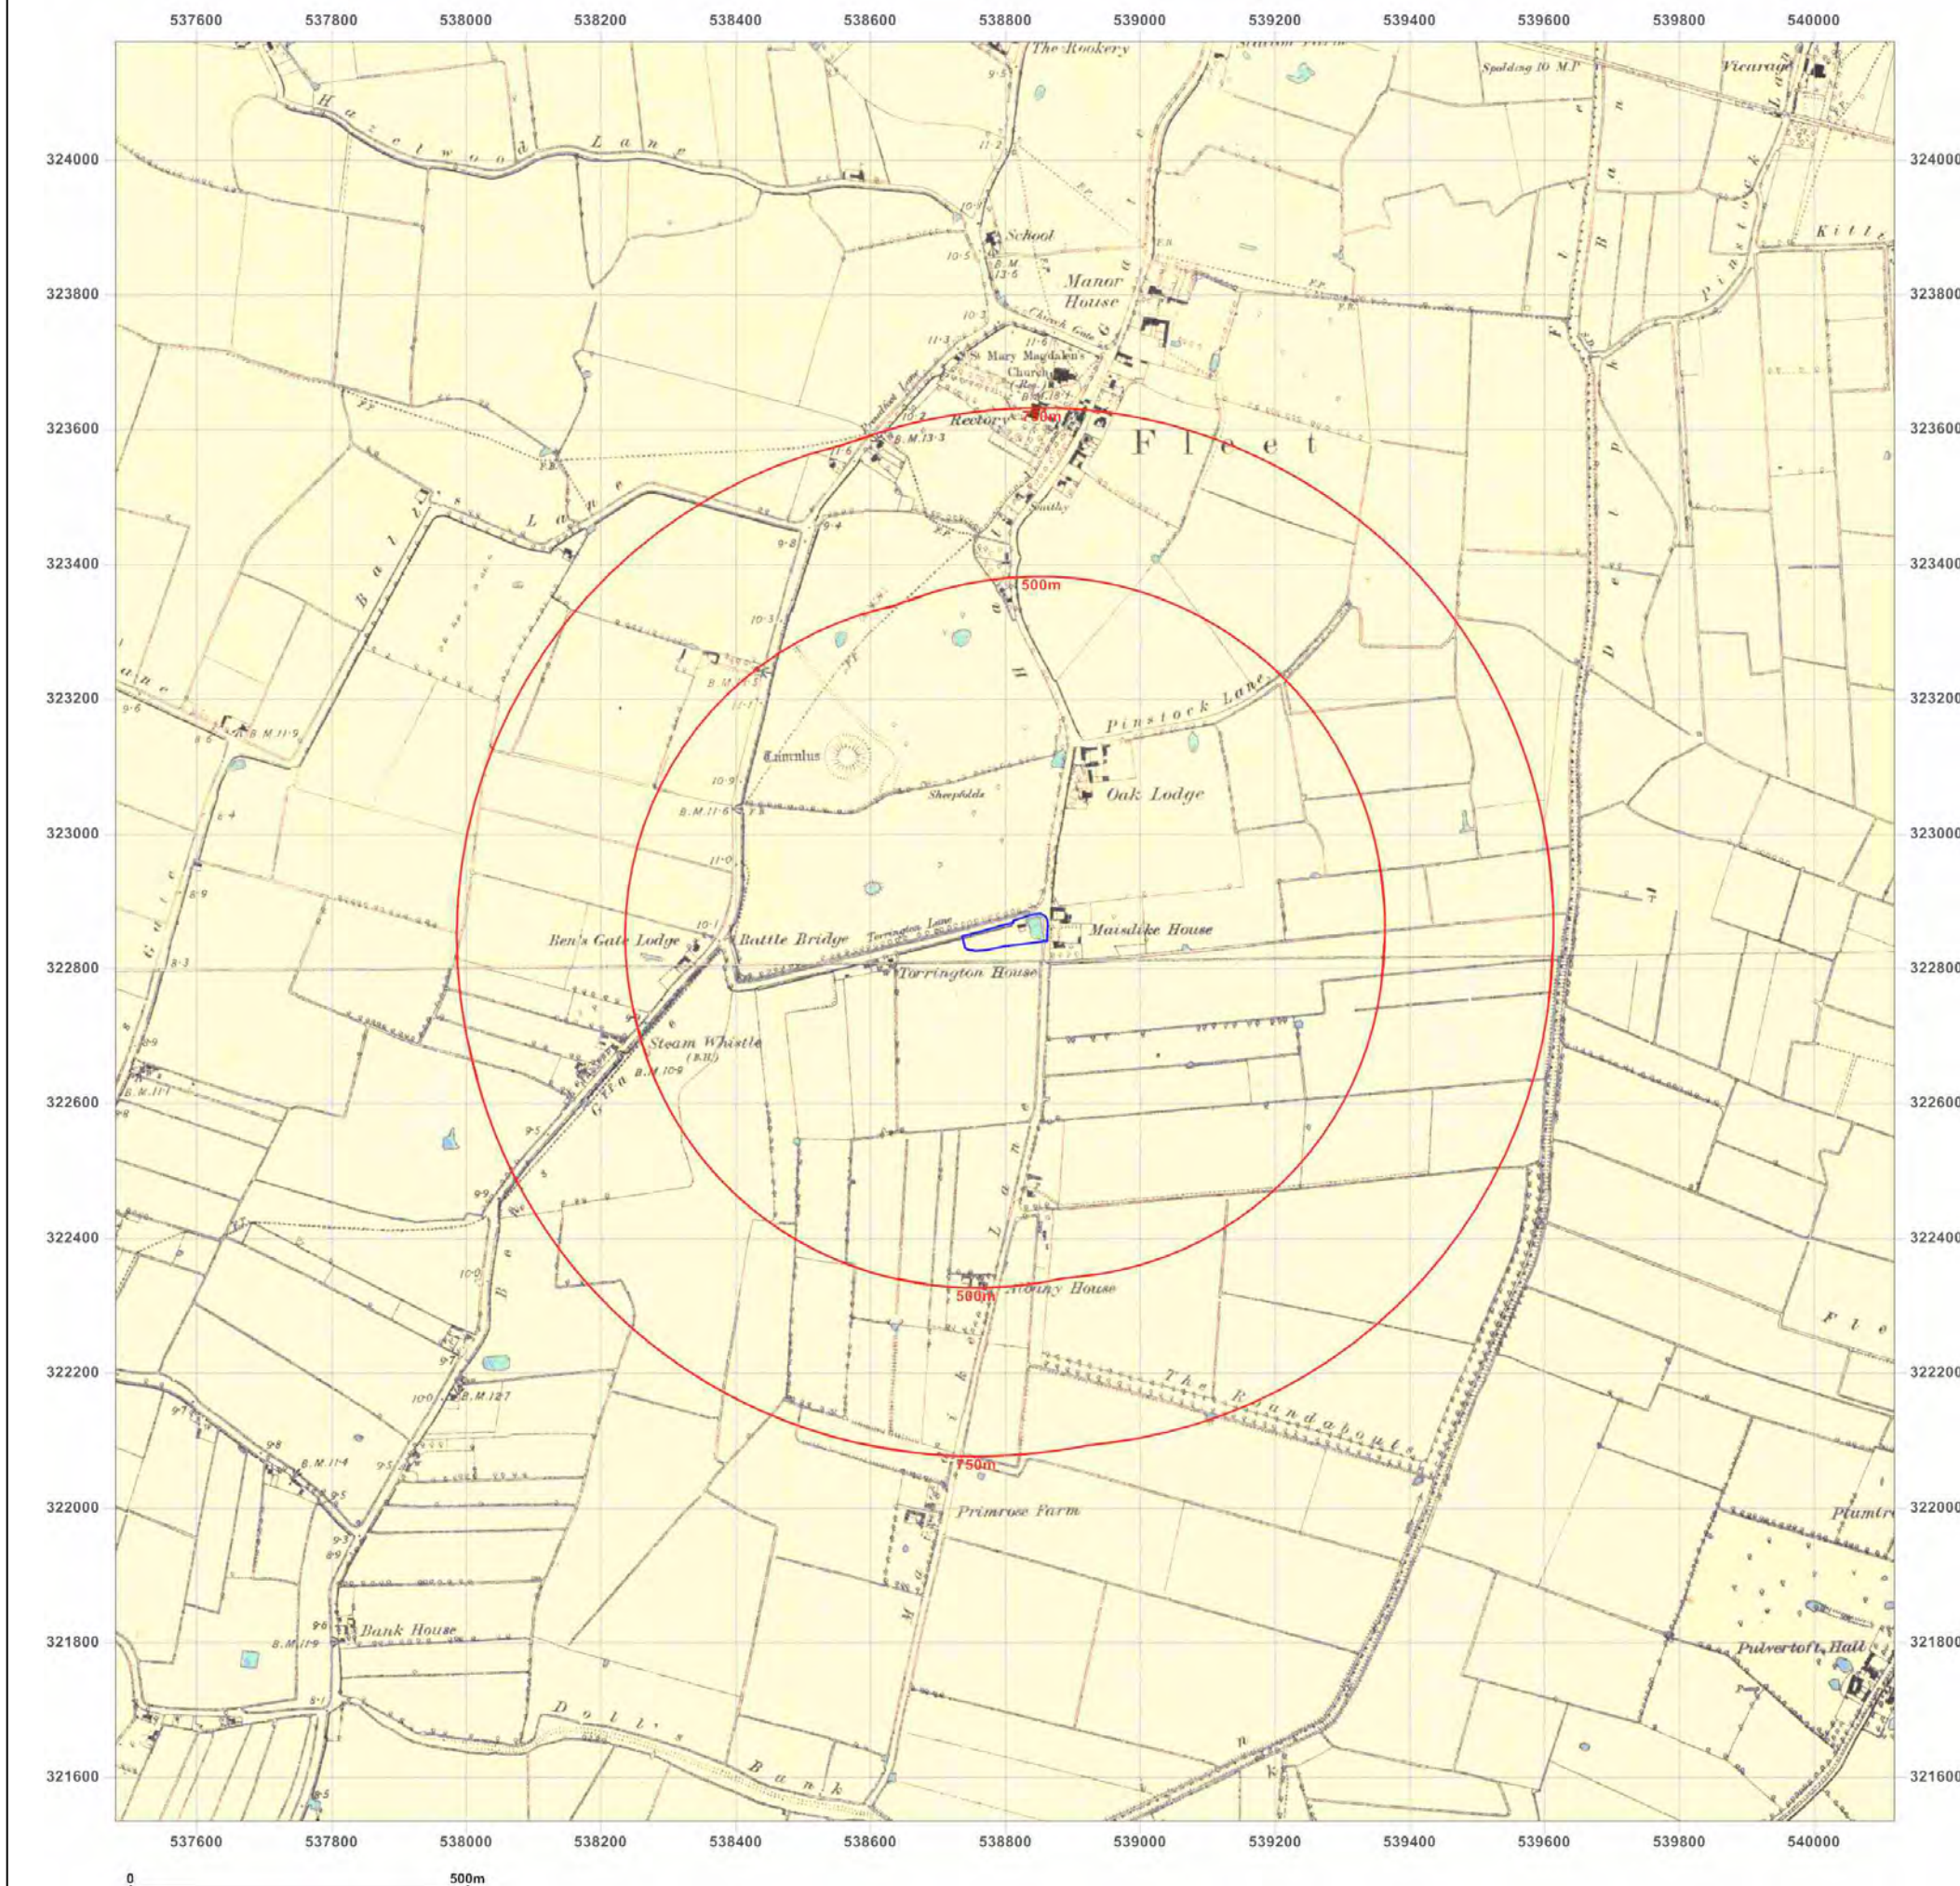

Site Details:

Mulberry Barn, TORRINGTON
LANE, FLEET, SPALDING

Client Ref: R0160
Report Ref: GS-5777360
Grid Ref: 538799, 322854

Map Name: County Series

Map date: 1903

Scale: 1:10,560

Printed at: 1:10,560



Surveyed 1886
Revised 1903
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1886
Revised 1903
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 25 January 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

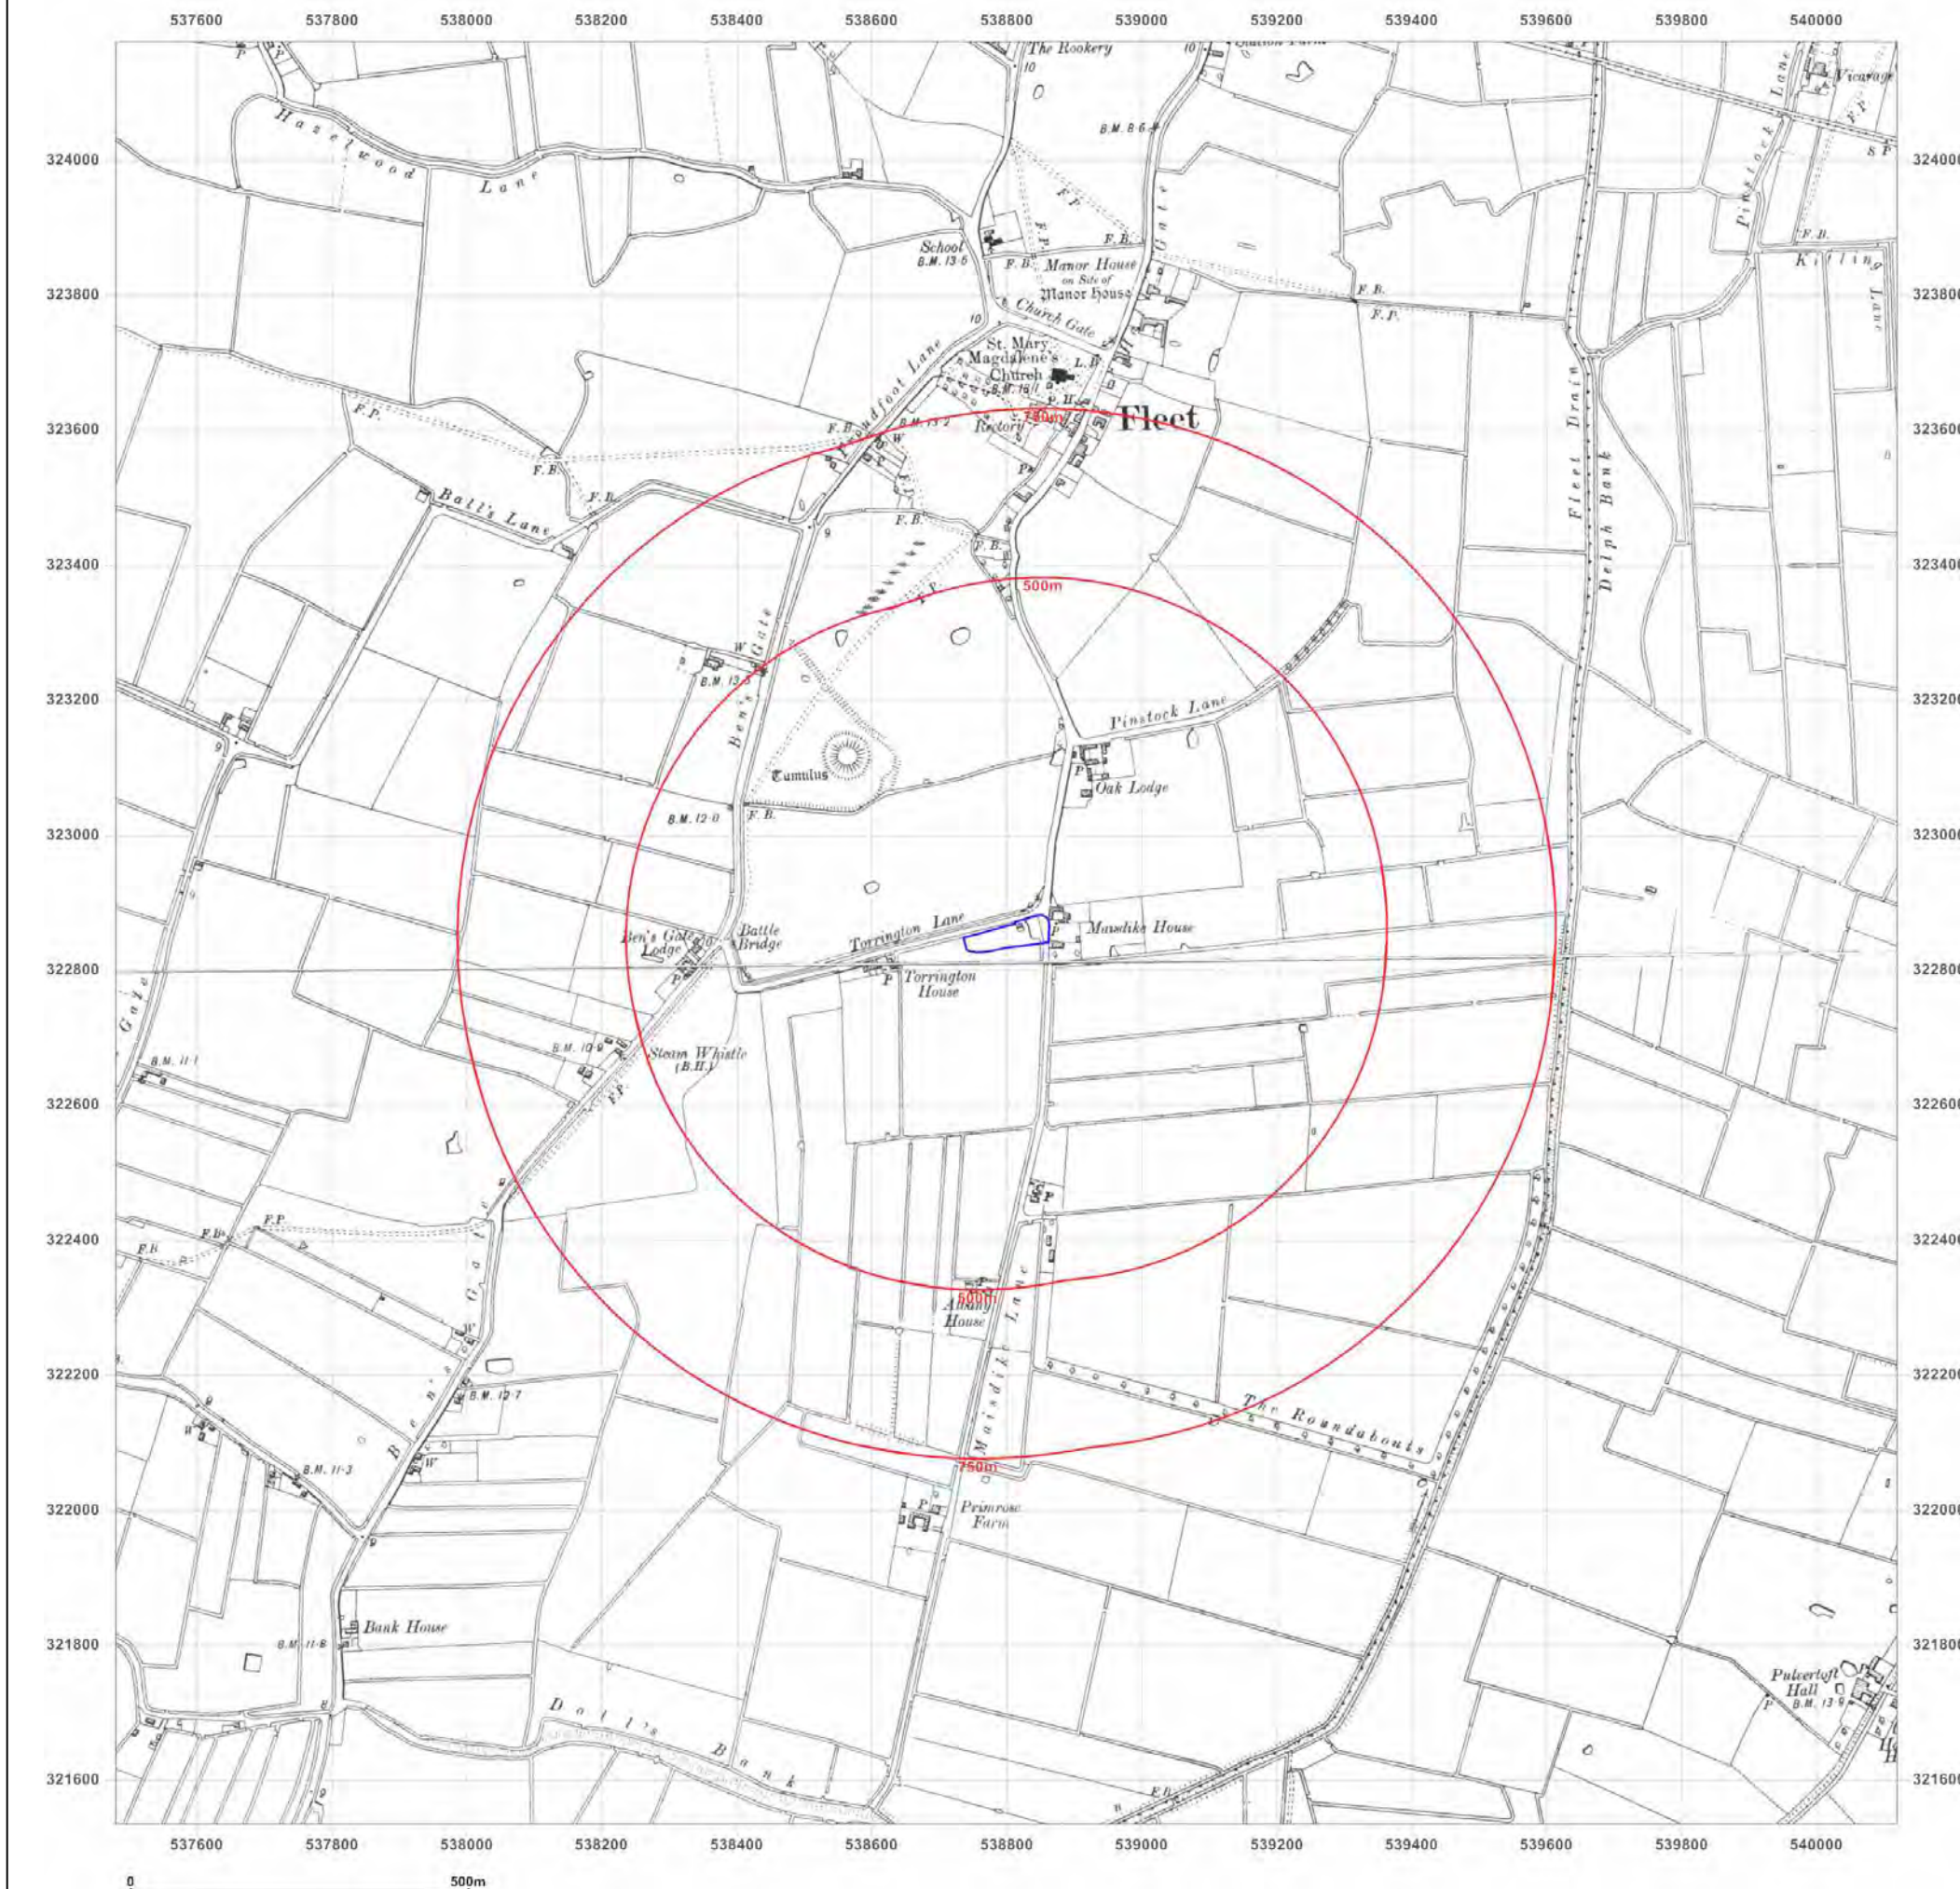

Site Details:

Mulberry Barn, TORRINGTON
LANE, FLEET, SPALDING

Client Ref: R0160
Report Ref: GS-5777360
Grid Ref: 538799, 322854

Map Name: County Series

Map date: 1903-1905

Scale: 1:10,560

Printed at: 1:10,560



Surveyed 1886
Revised 1903
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1886
Revised 1905
Edition 1905
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 25 January 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

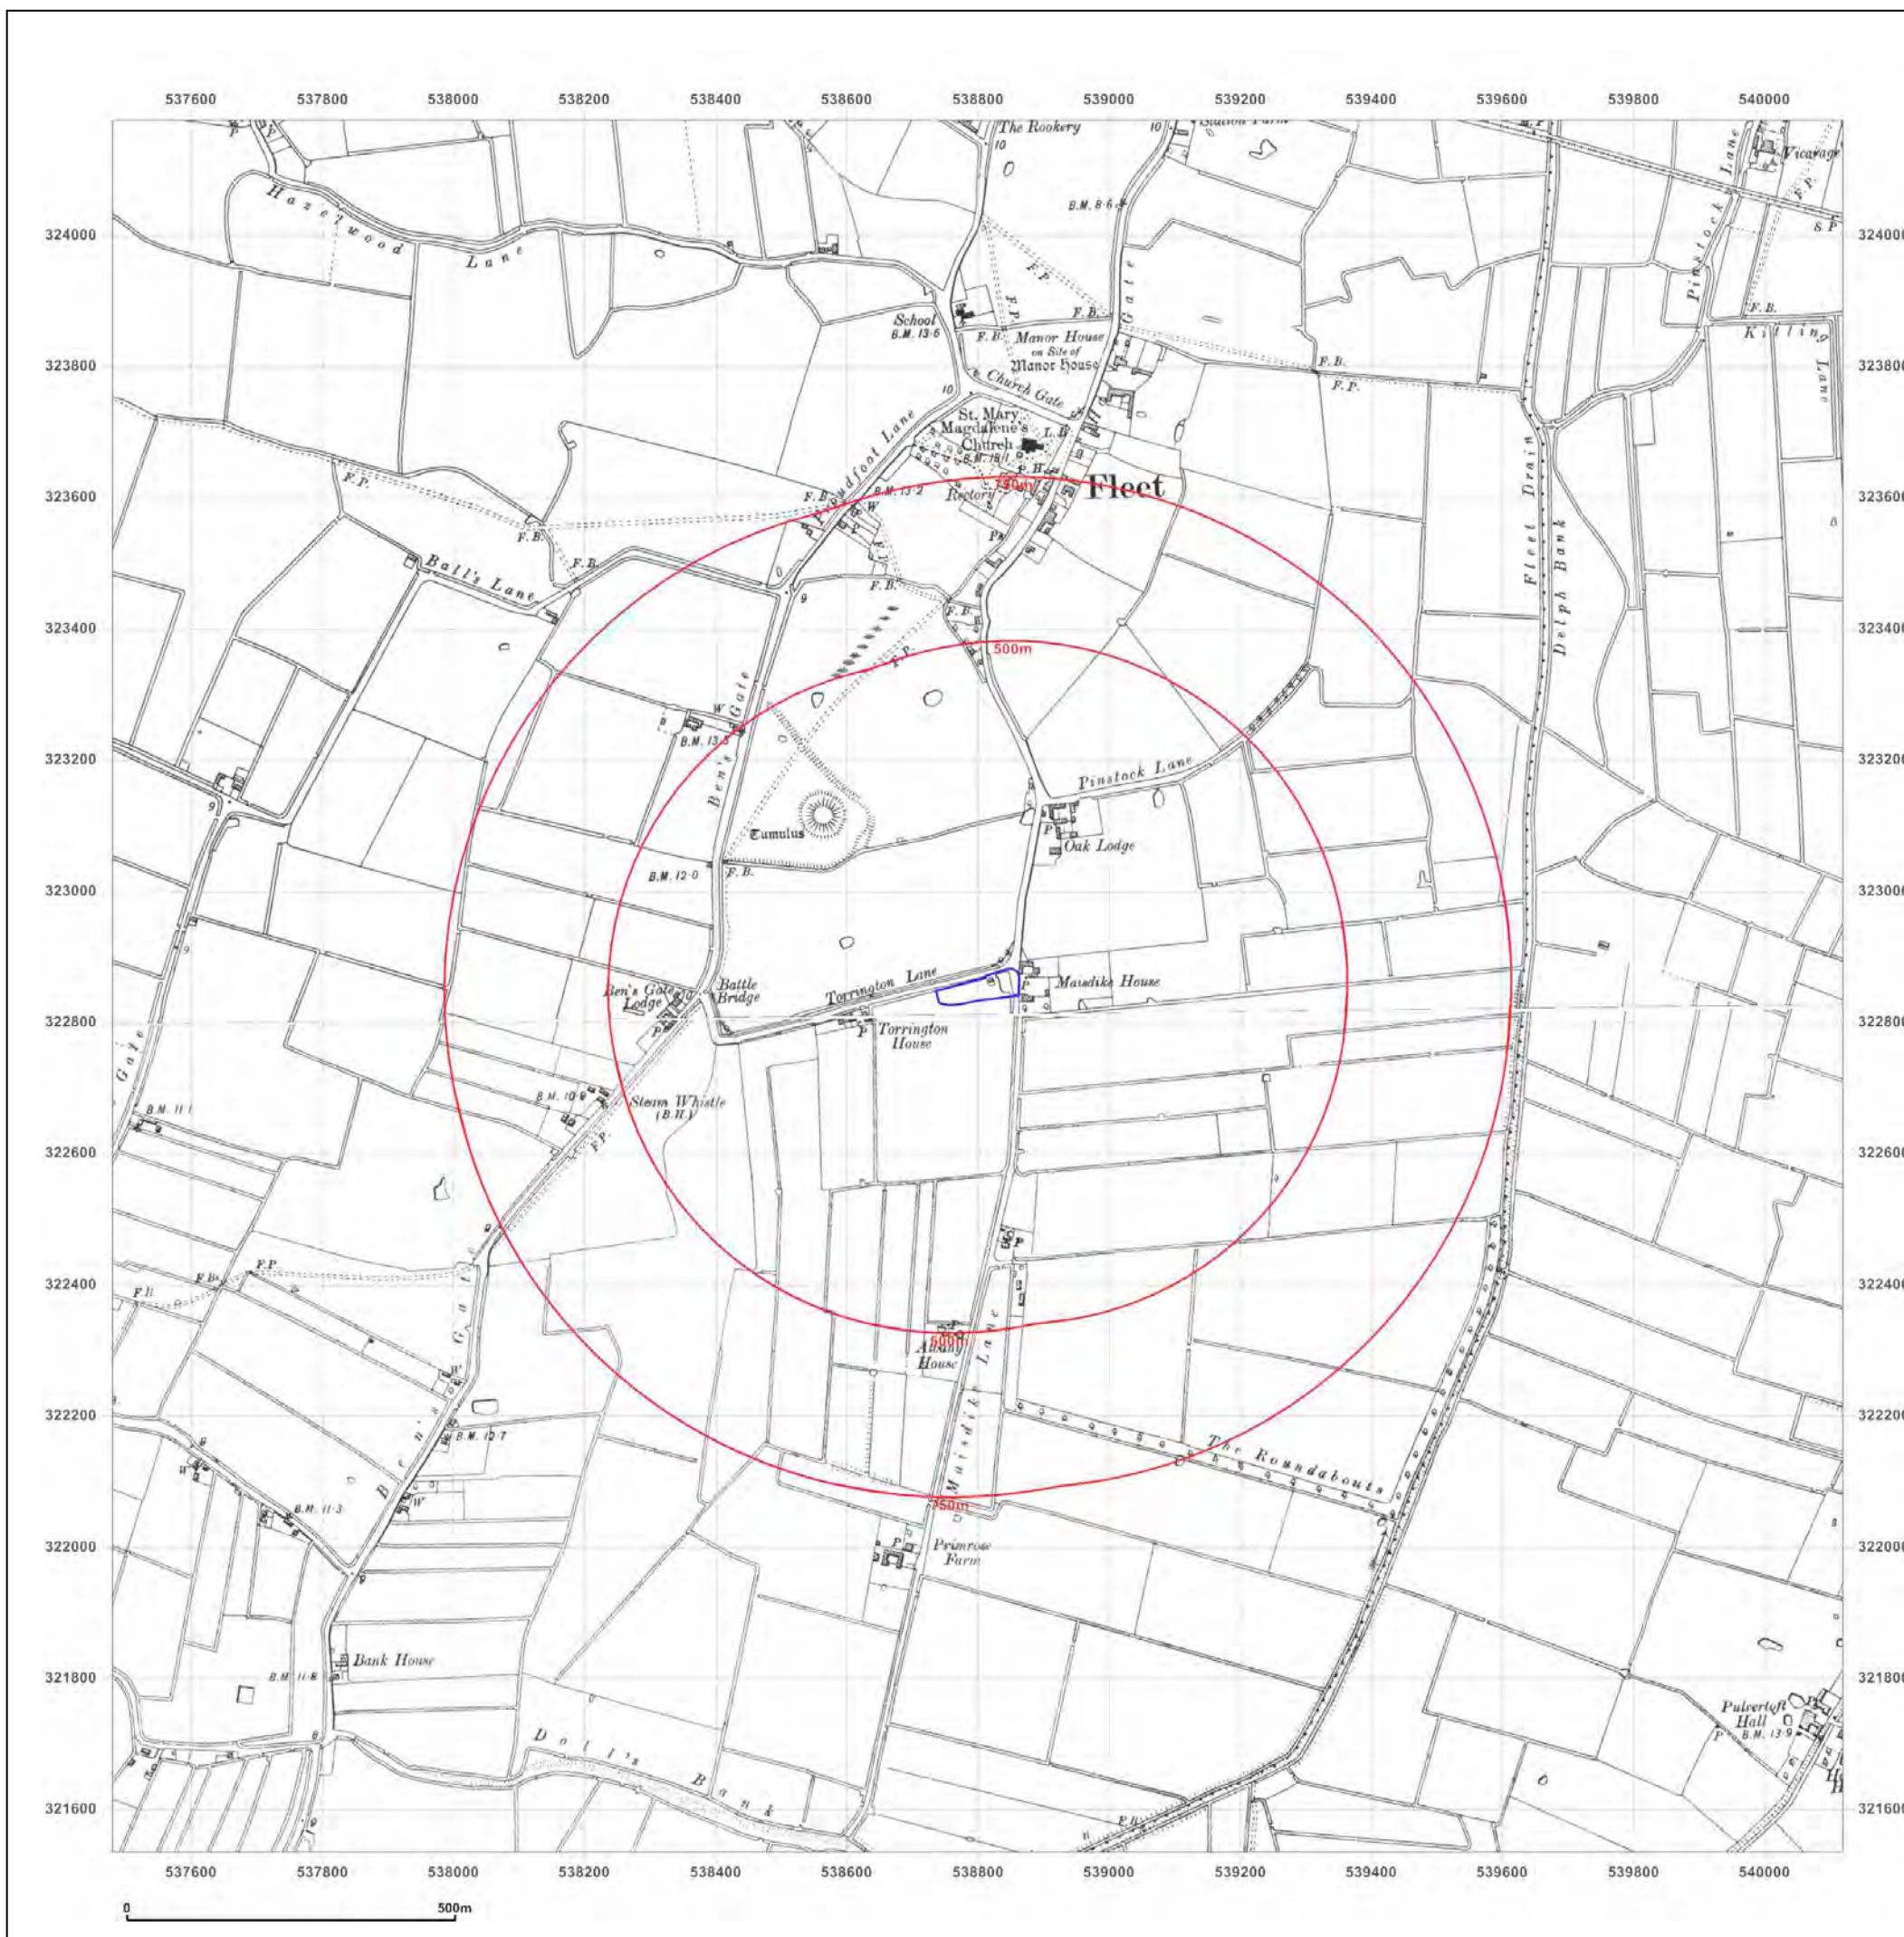

Site Details:

Mulberry Barn, TORRINGTON
LANE, FLEET, SPALDING

Client Ref: R0160
Report Ref: GS-5777360
Grid Ref: 538799, 322854

Map Name: County Series


Map date: 1929

Scale: 1:10,560

Printed at: 1:10,560



Surveyed 1886
Revised 1929
Edition N/A
Copyright N/A
Levelled N/A

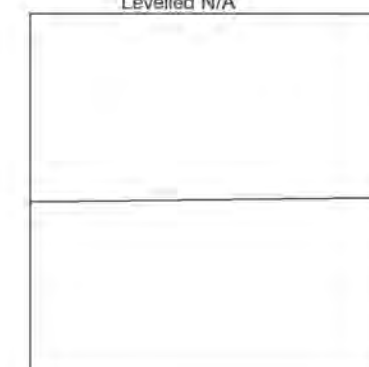


Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 25 January 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

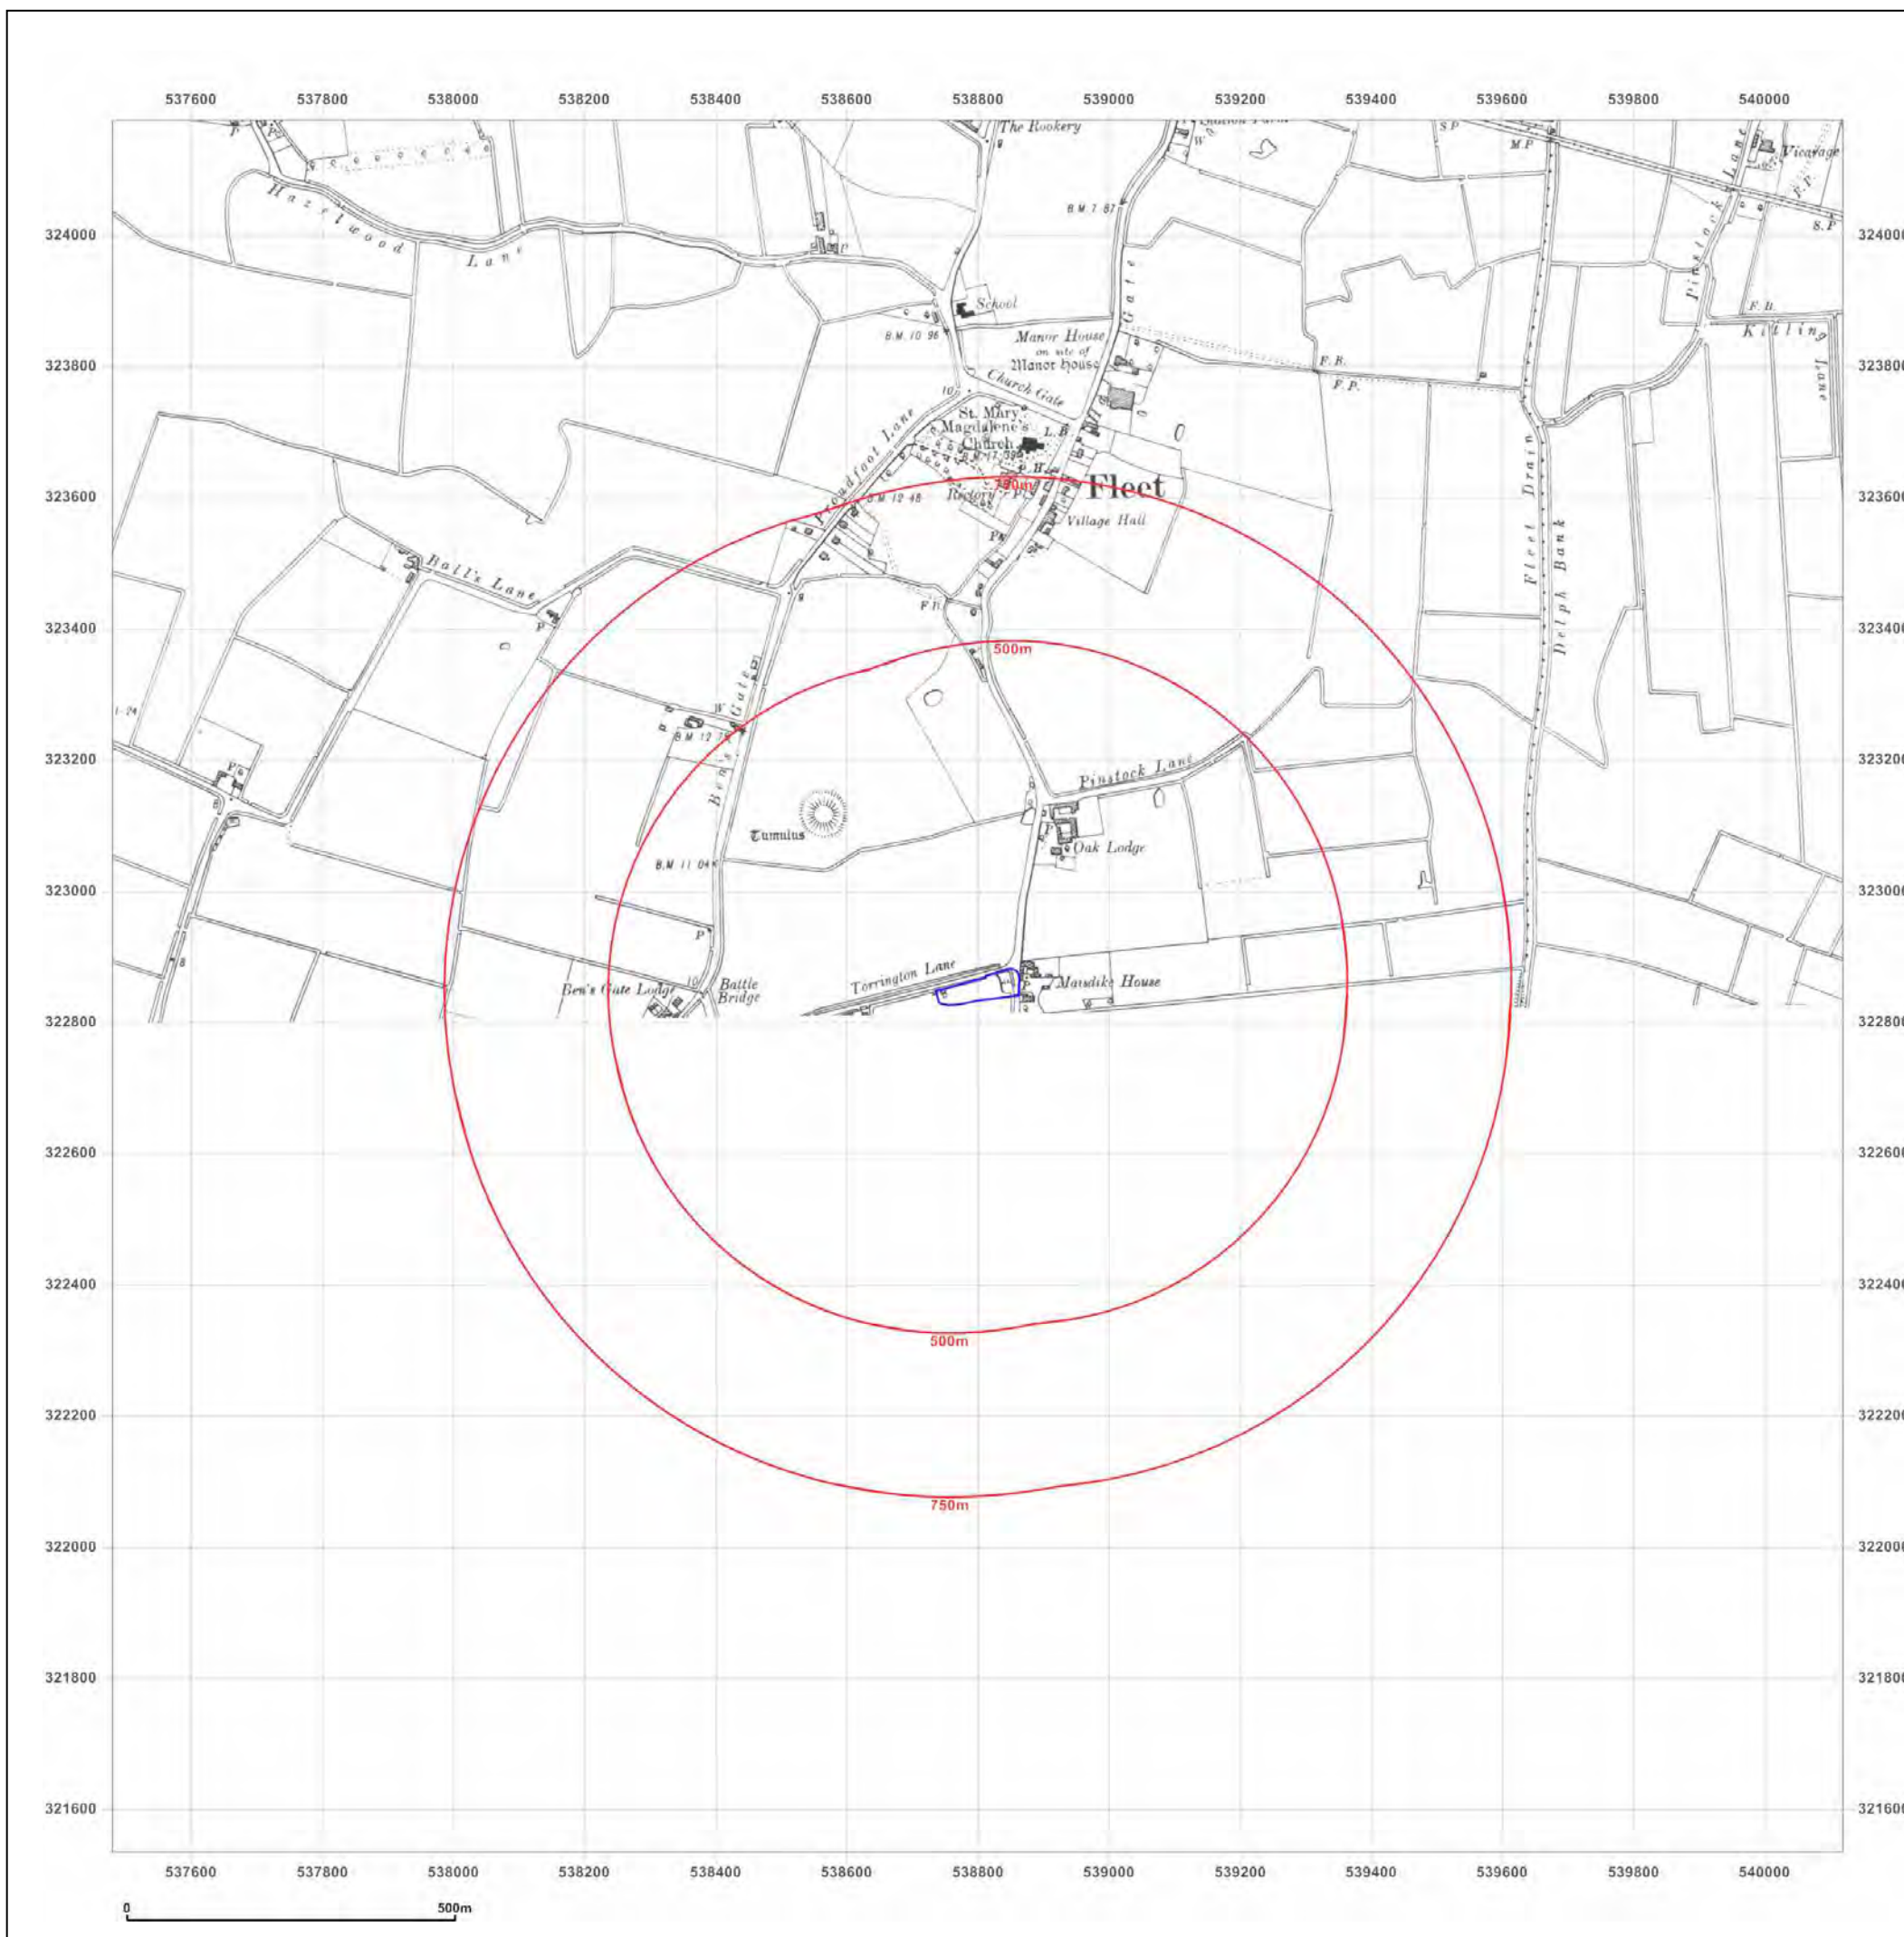

Site Details:

Mulberry Barn, TORRINGTON
LANE, FLEET, SPALDING

Client Ref: R0160
Report Ref: GS-5777360
Grid Ref: 538799, 322854

Map Name: County Series


Map date: 1950

Scale: 1:10,560

Printed at: 1:10,560



Surveyed 1886
Revised 1950
Edition N/A
Copyright N/A
Levelled N/A

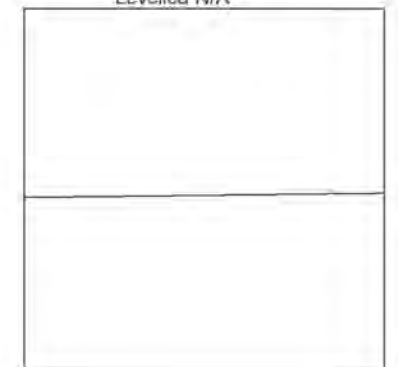


Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 25 January 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

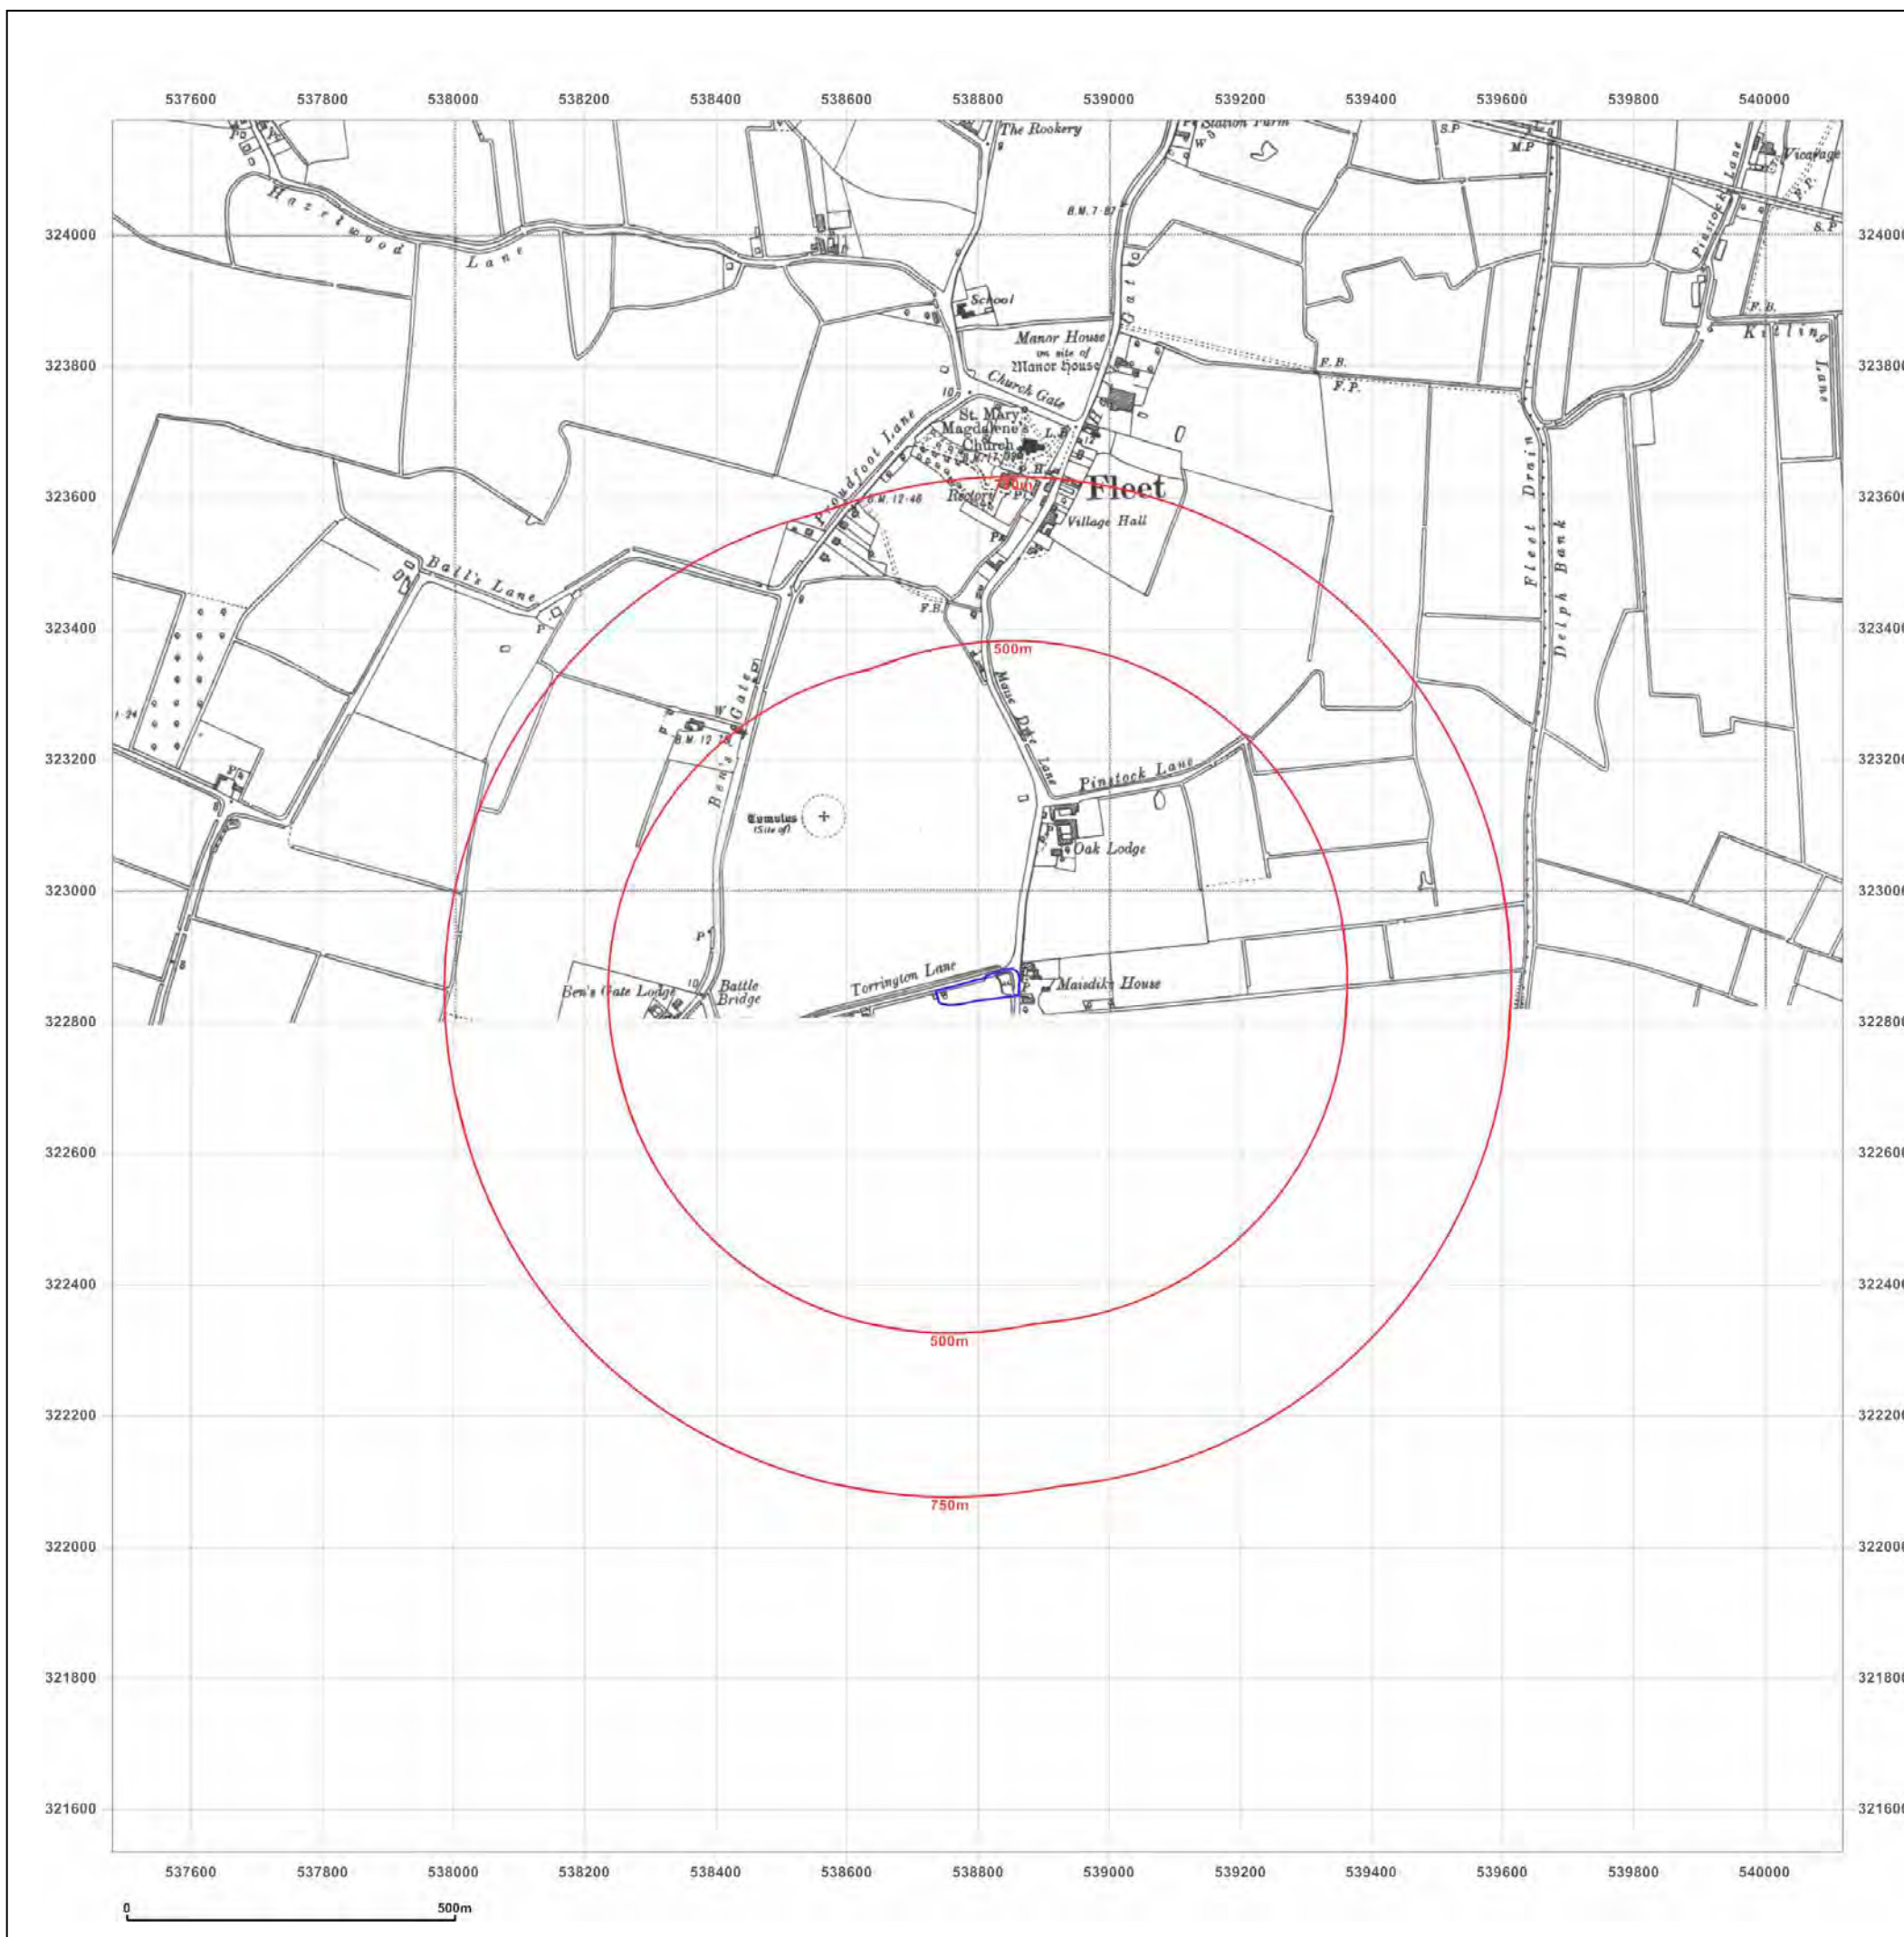

Site Details:

Mulberry Barn, TORRINGTON
LANE, FLEET, SPALDING

Client Ref: R0160
Report Ref: GS-5777360
Grid Ref: 538799, 322854

Map Name: Provisional

Map date: 1958

Scale: 1:10,560

Printed at: 1:10,560



Surveyed N/A
Revised 1958
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1950
Revised 1950
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 25 January 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

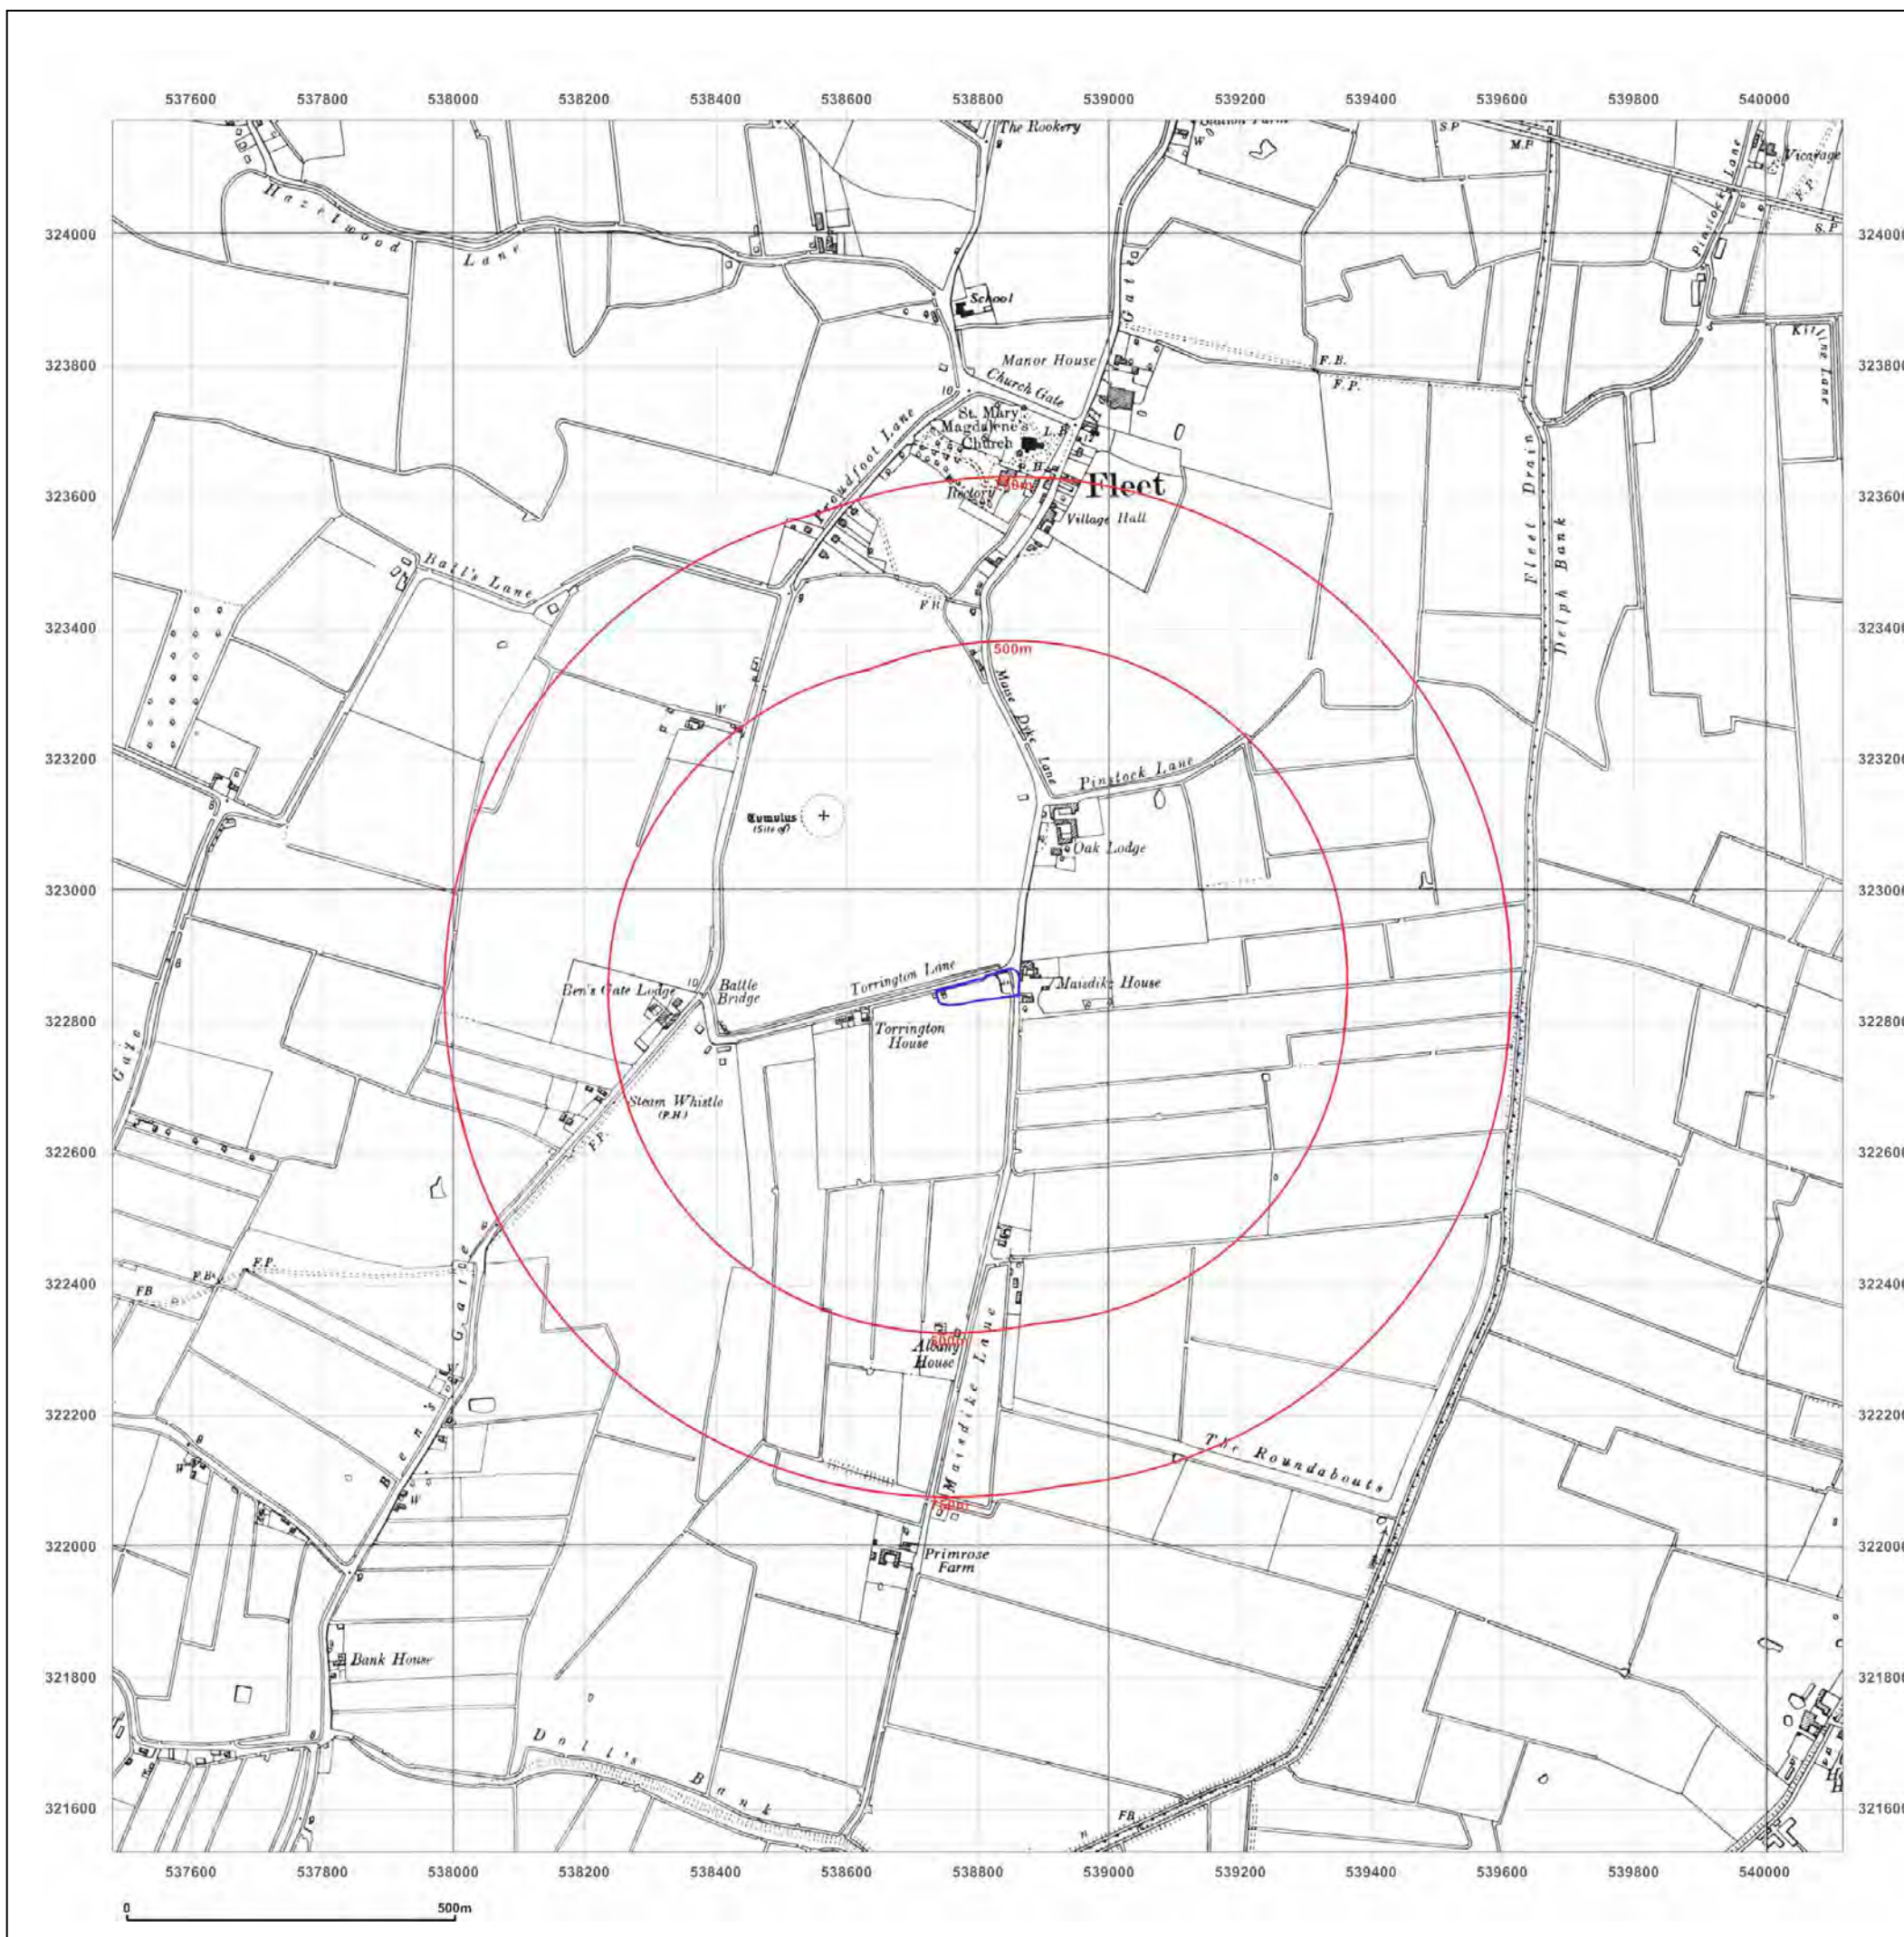

Site Details:

Mulberry Barn, TORRINGTON
LANE, FLEET, SPALDING

Client Ref: R0160
Report Ref: GS-5777360
Grid Ref: 538799, 322854

Map Name: National Grid

Map date: 1970-1975

Scale: 1:10,000

Printed at: 1:10,000



Surveyed 1968
Revised 1970
Edition N/A
Copyright 1970
Levelled N/A

Surveyed 1971
Revised 1975
Edition N/A
Copyright 1975
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 25 January 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

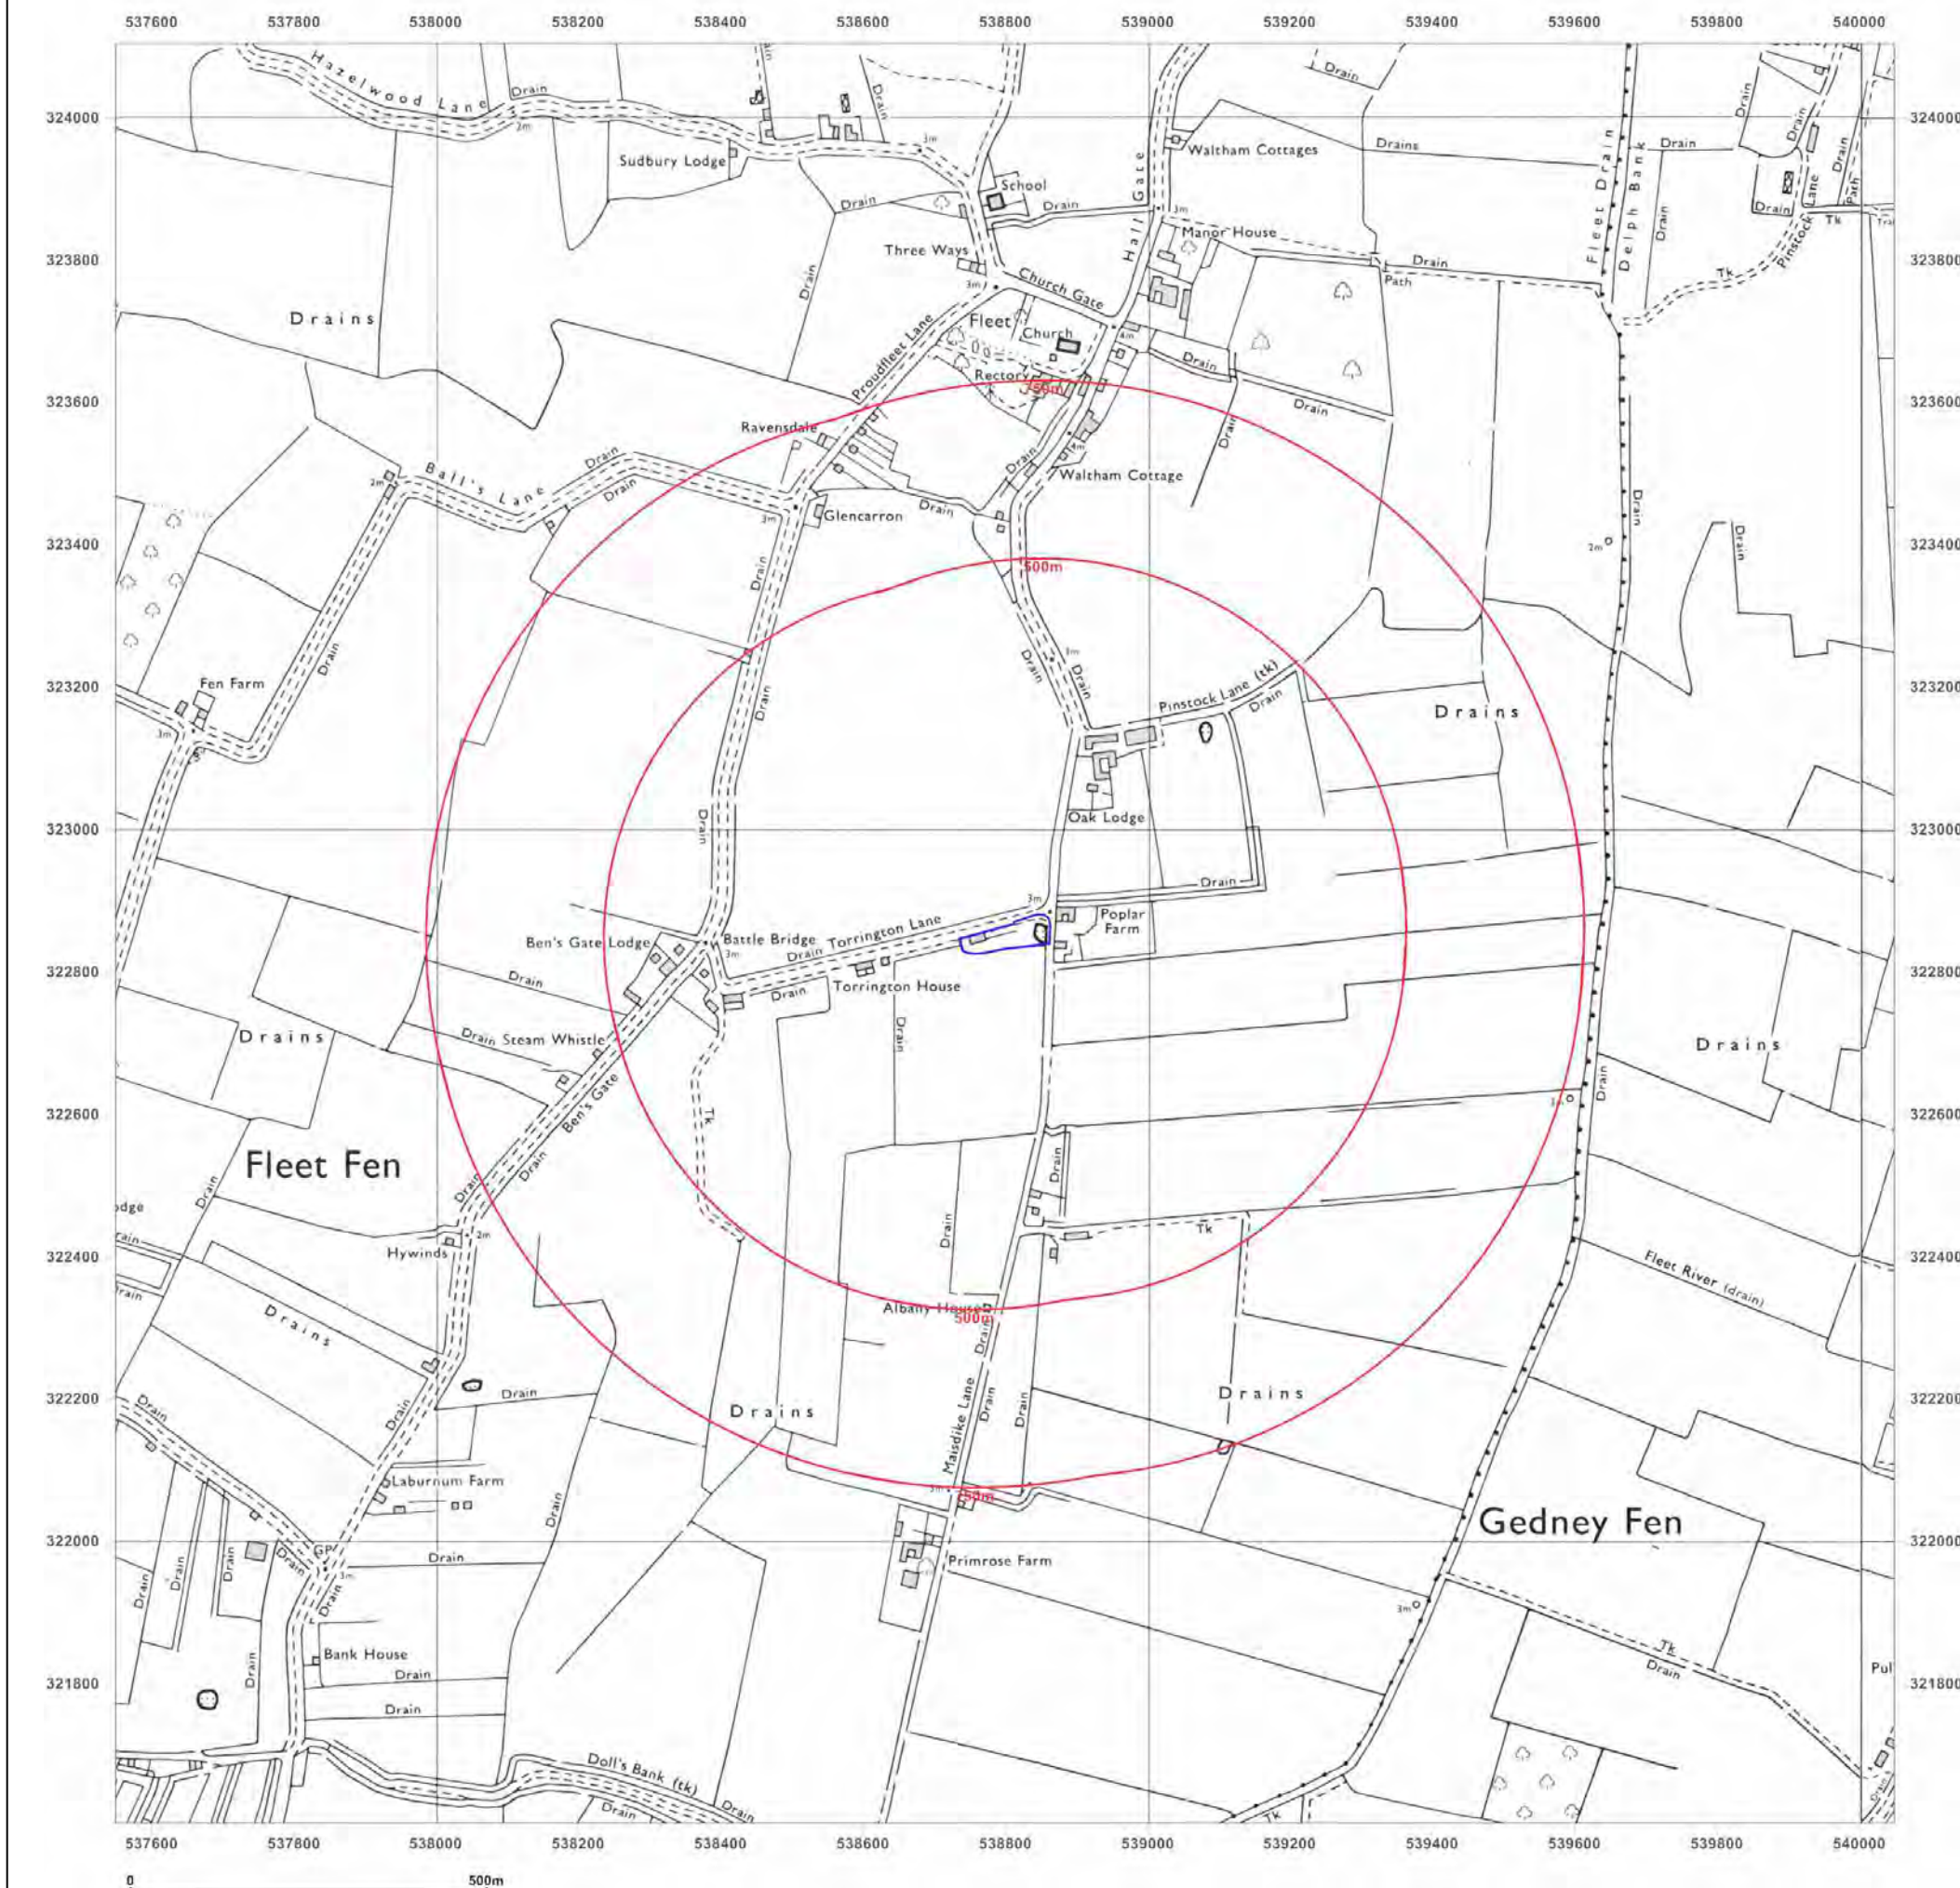

Site Details:

Mulberry Barn, TORRINGTON
LANE, FLEET, SPALDING

Client Ref: R0160
Report Ref: GS-5777360
Grid Ref: 538799, 322854

Map Name: National Grid

Map date: 1991-1992

Scale: 1:10,000

Printed at: 1:10,000



Surveyed 1991
Revised 1992
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1990
Revised 1991
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 25 January 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

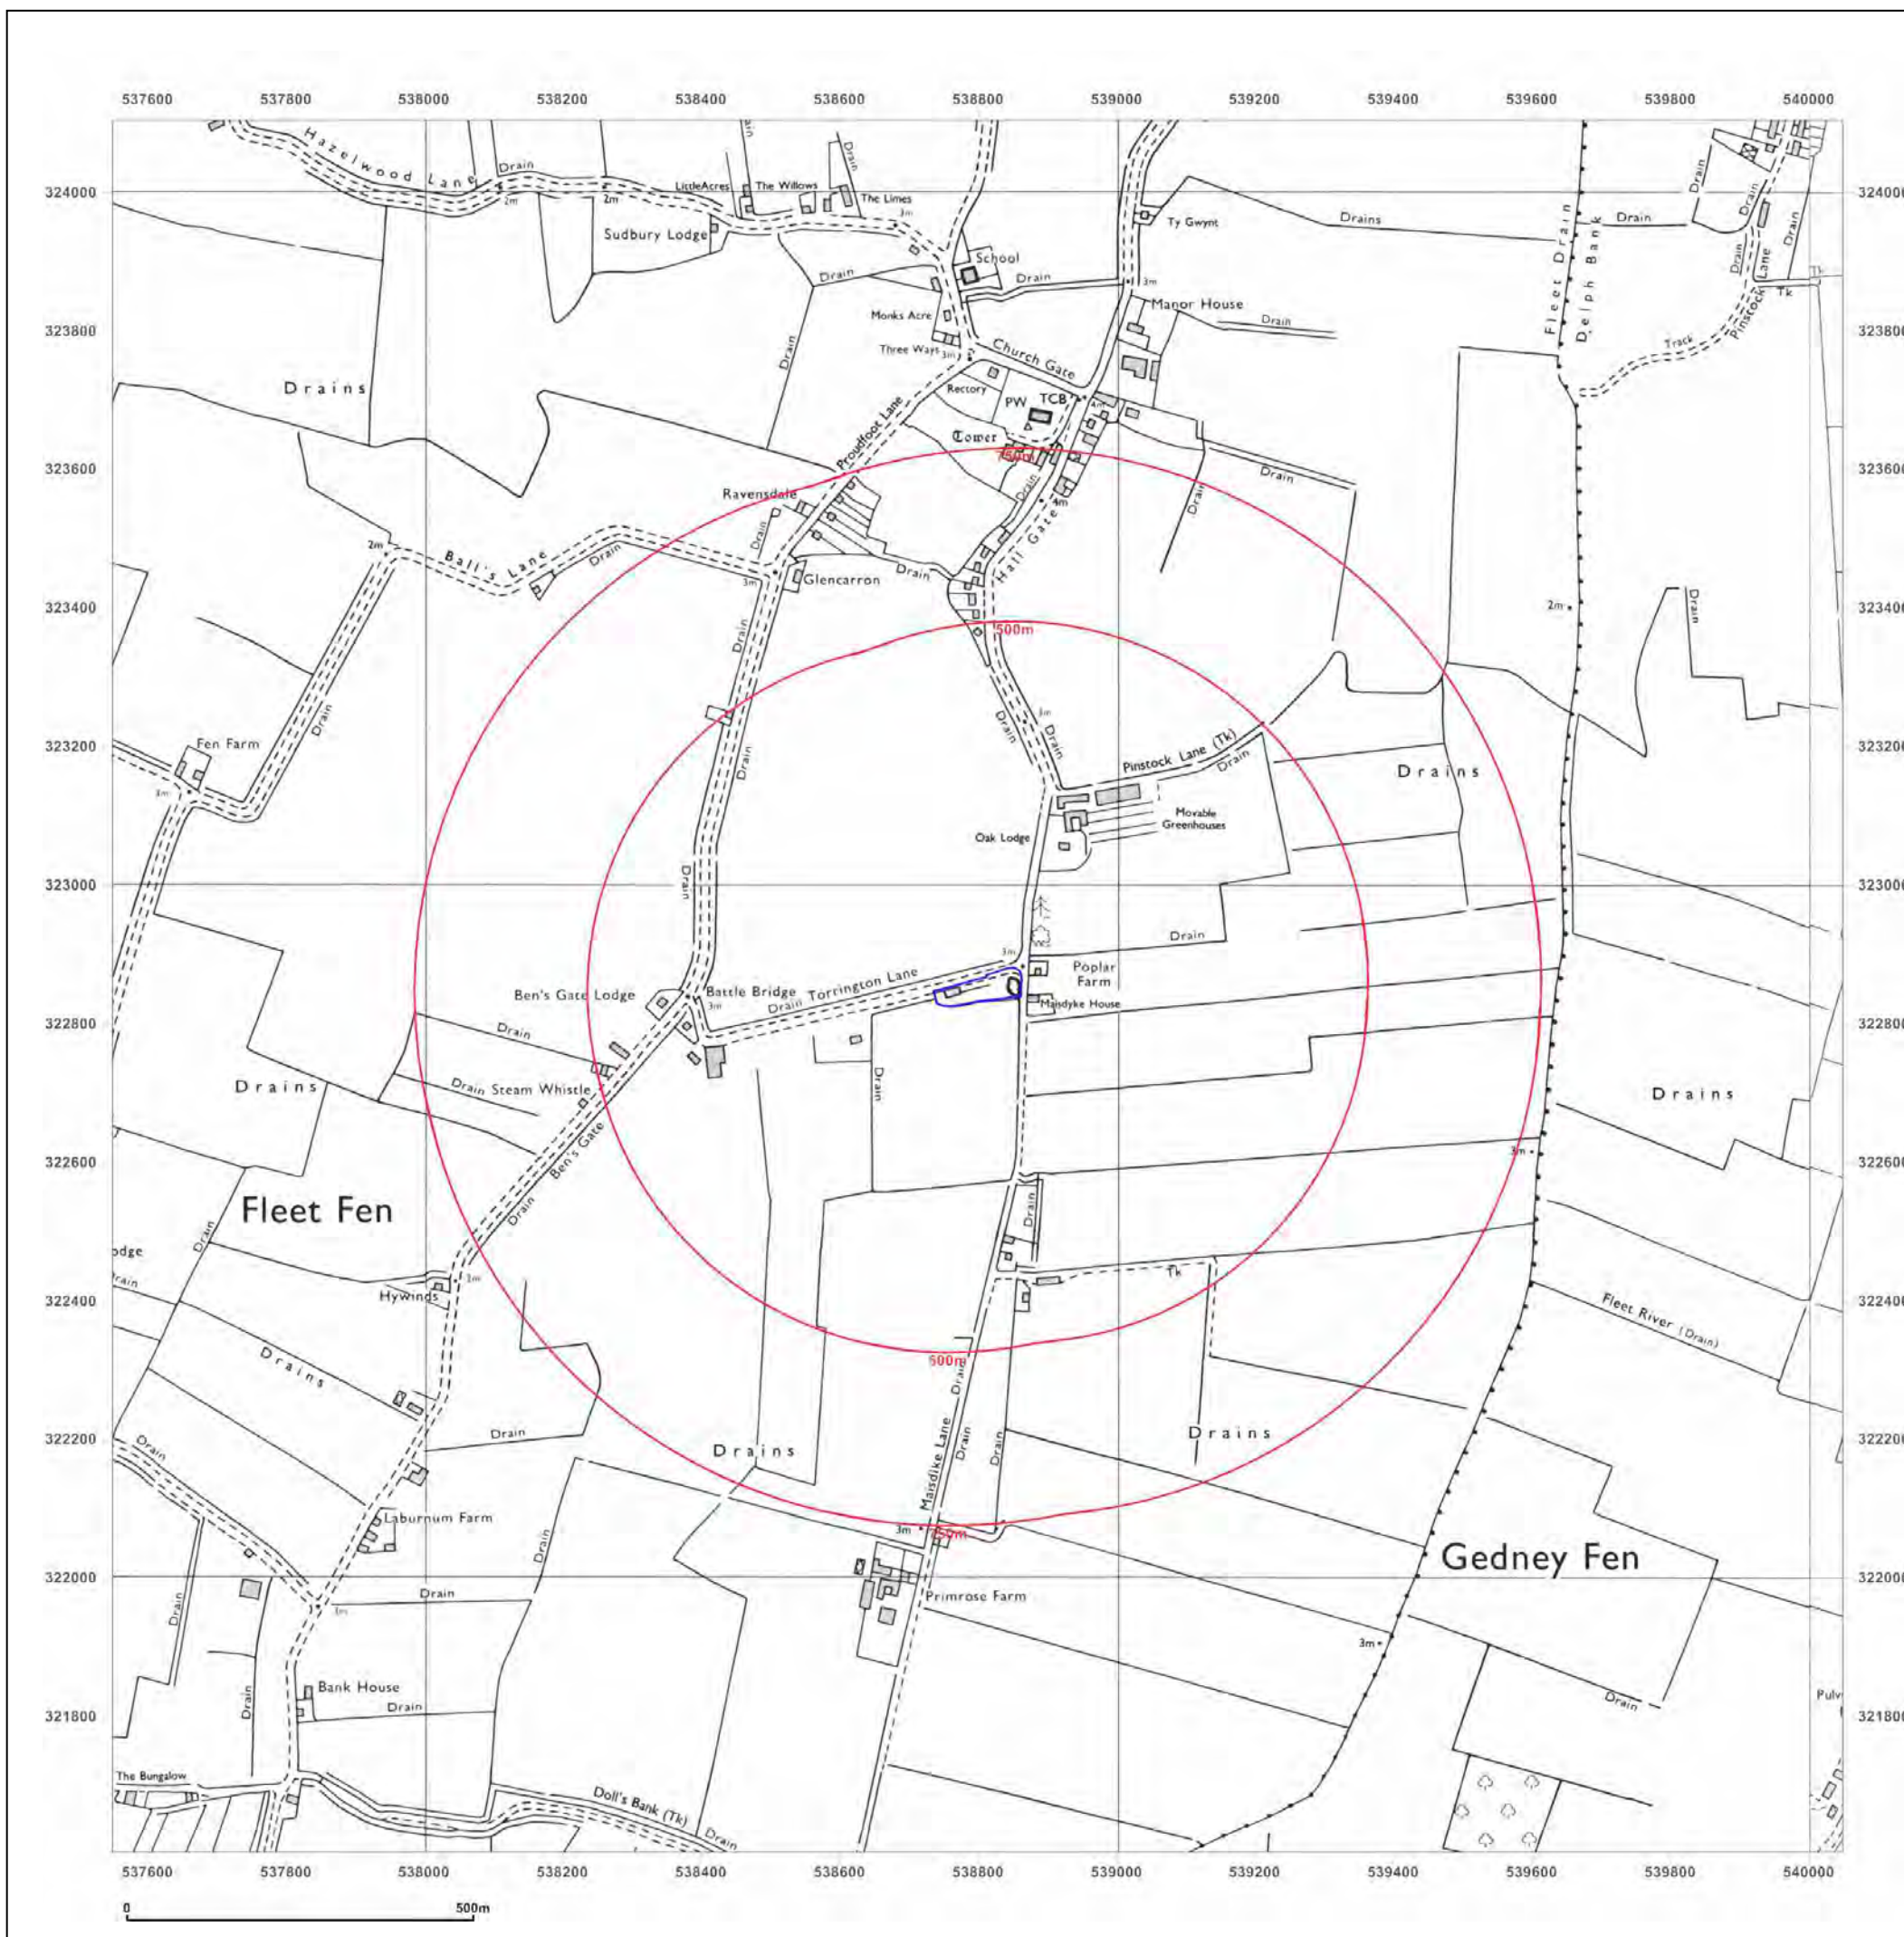

Site Details:

Mulberry Barn, TORRINGTON
LANE, FLEET, SPALDING

Client Ref: R0160
Report Ref: GS-5777360
Grid Ref: 538799, 322854

Map Name: 1:10,000 Raster

Map date: 2002

Scale: 1:10,000

Printed at: 1:10,000




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 25 January 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

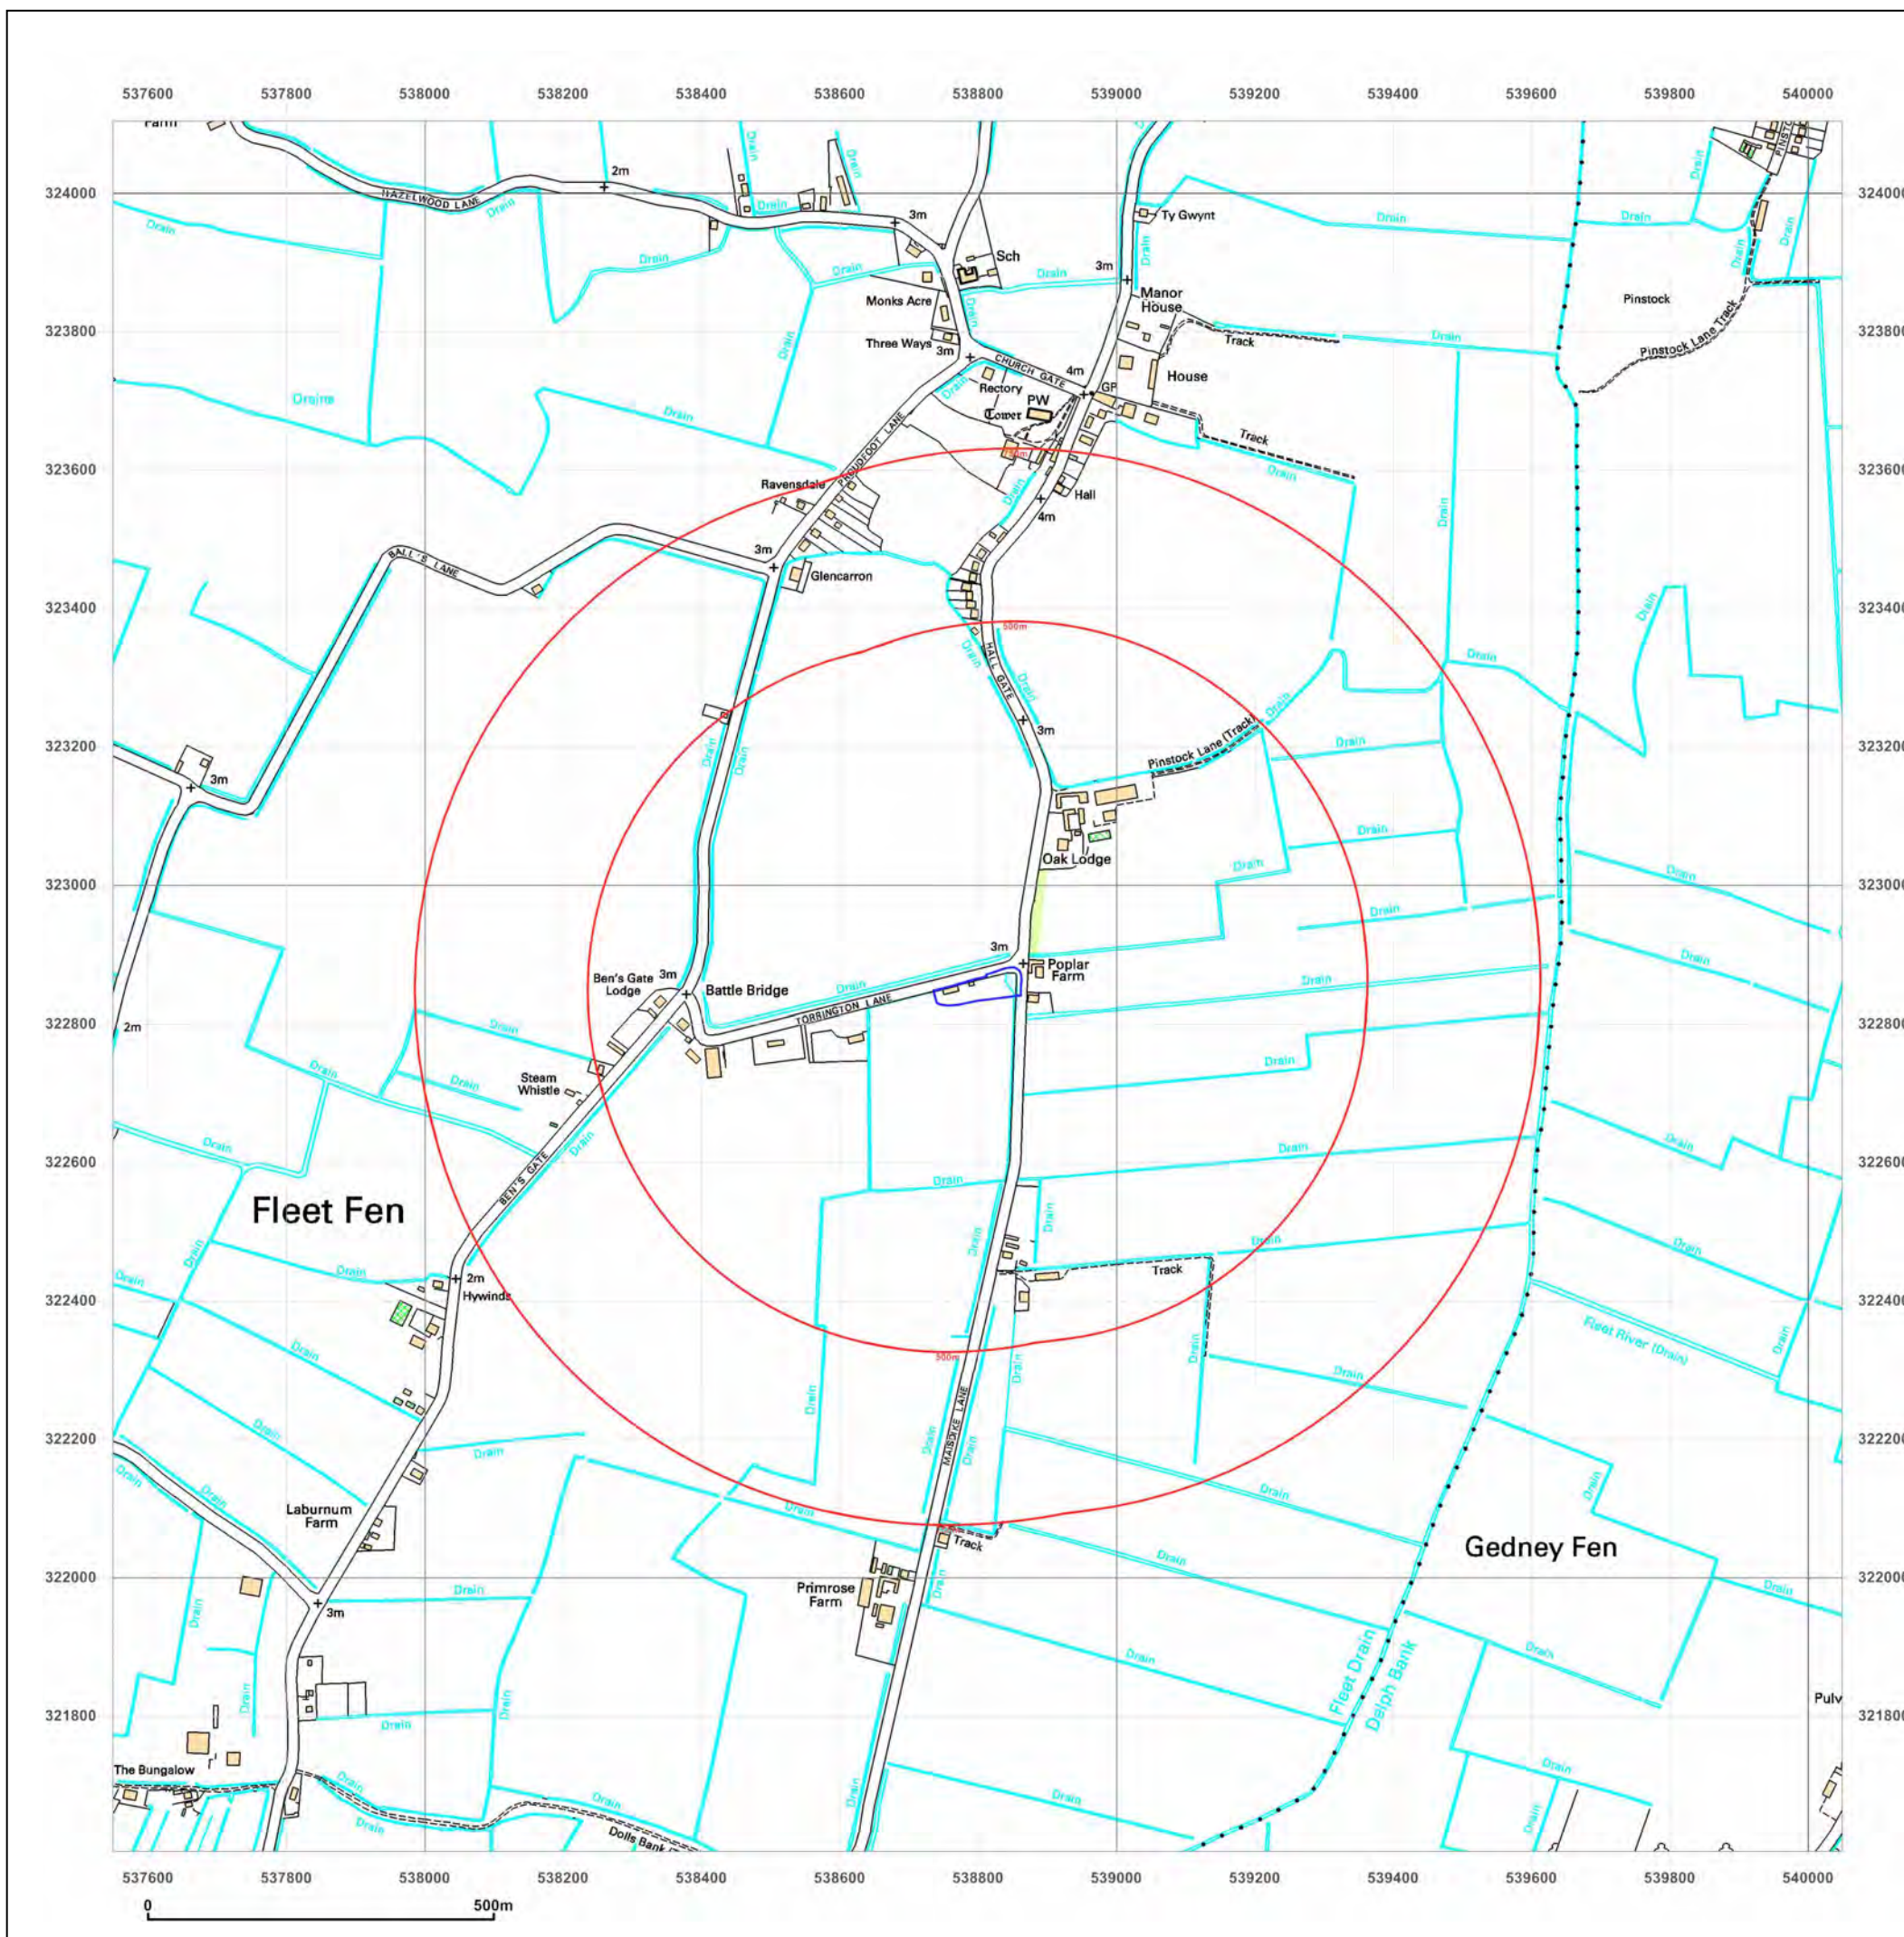

Site Details:

Mulberry Barn, TORRINGTON
LANE, FLEET, SPALDING

Client Ref: R0160
Report Ref: GS-5777360
Grid Ref: 538799, 322854

Map Name: National Grid

Map date: 2010

Scale: 1:10,000

Printed at: 1:10,000




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 25 January 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

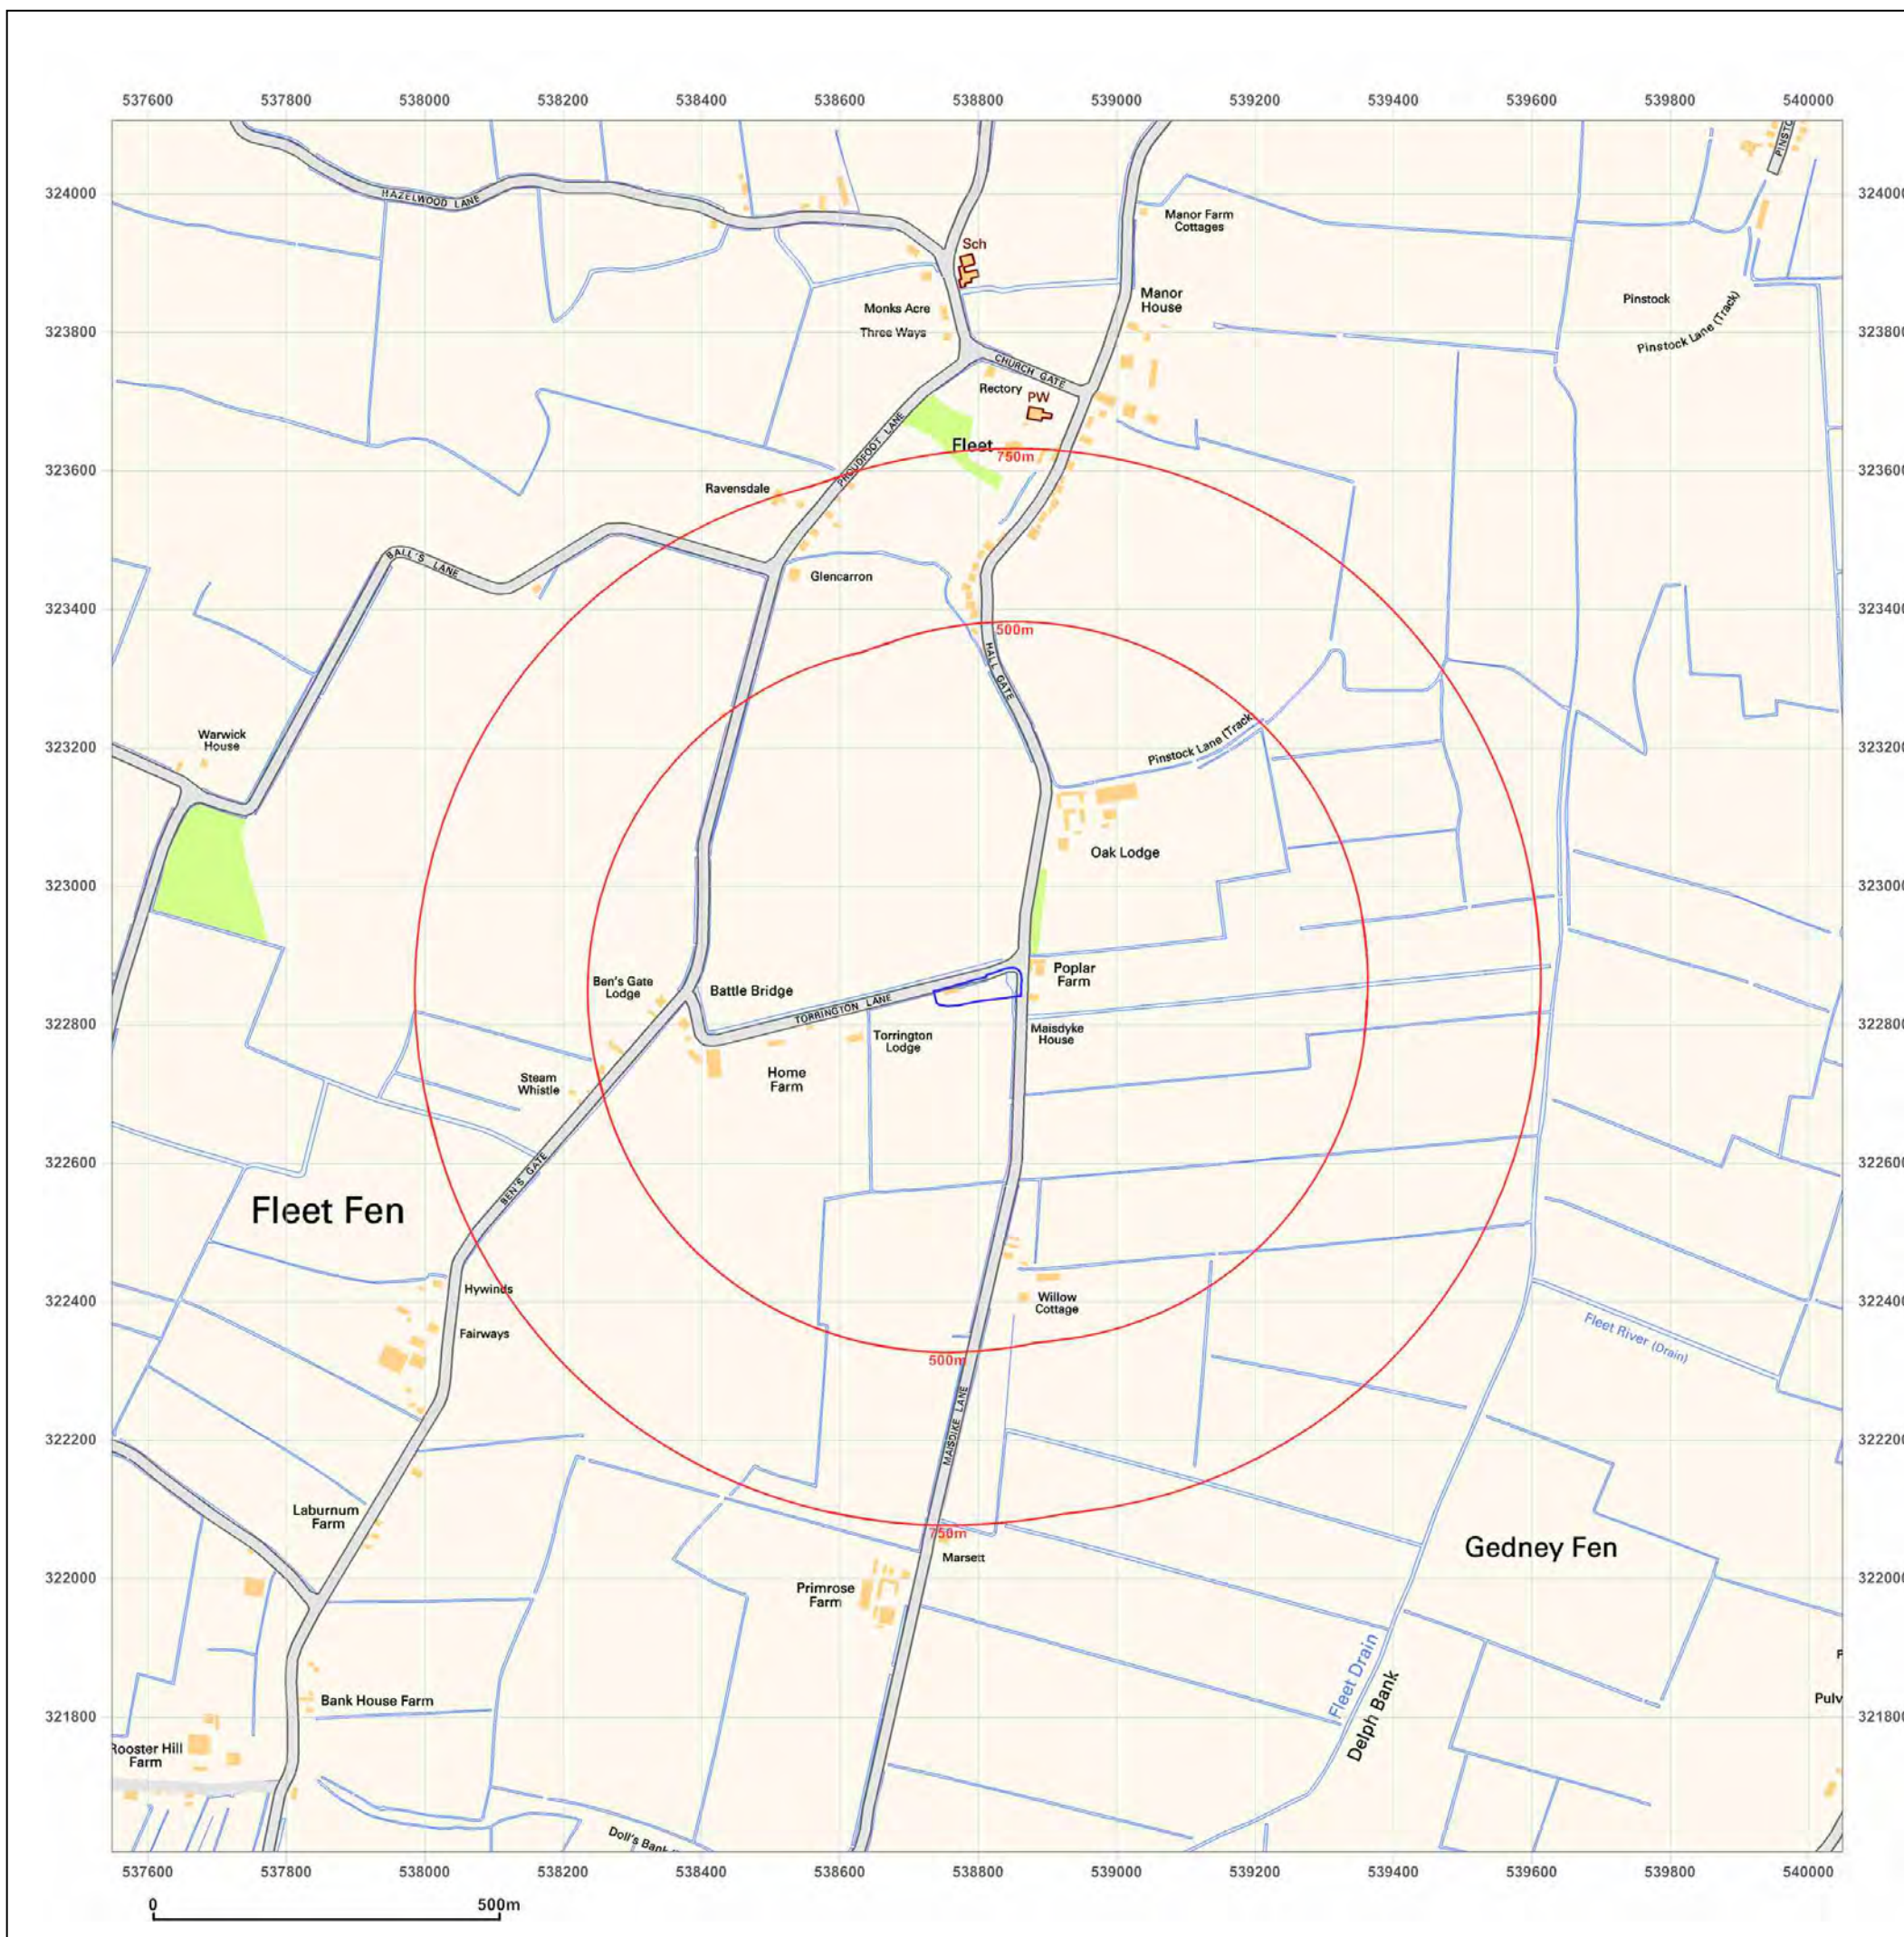

Site Details:

Mulberry Barn, TORRINGTON
LANE, FLEET, SPALDING

Client Ref: R0160
Report Ref: GS-5777360
Grid Ref: 538799, 322854

Map Name: National Grid

Map date: 2014

Scale: 1:10,000

Printed at: 1:10,000




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 25 January 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

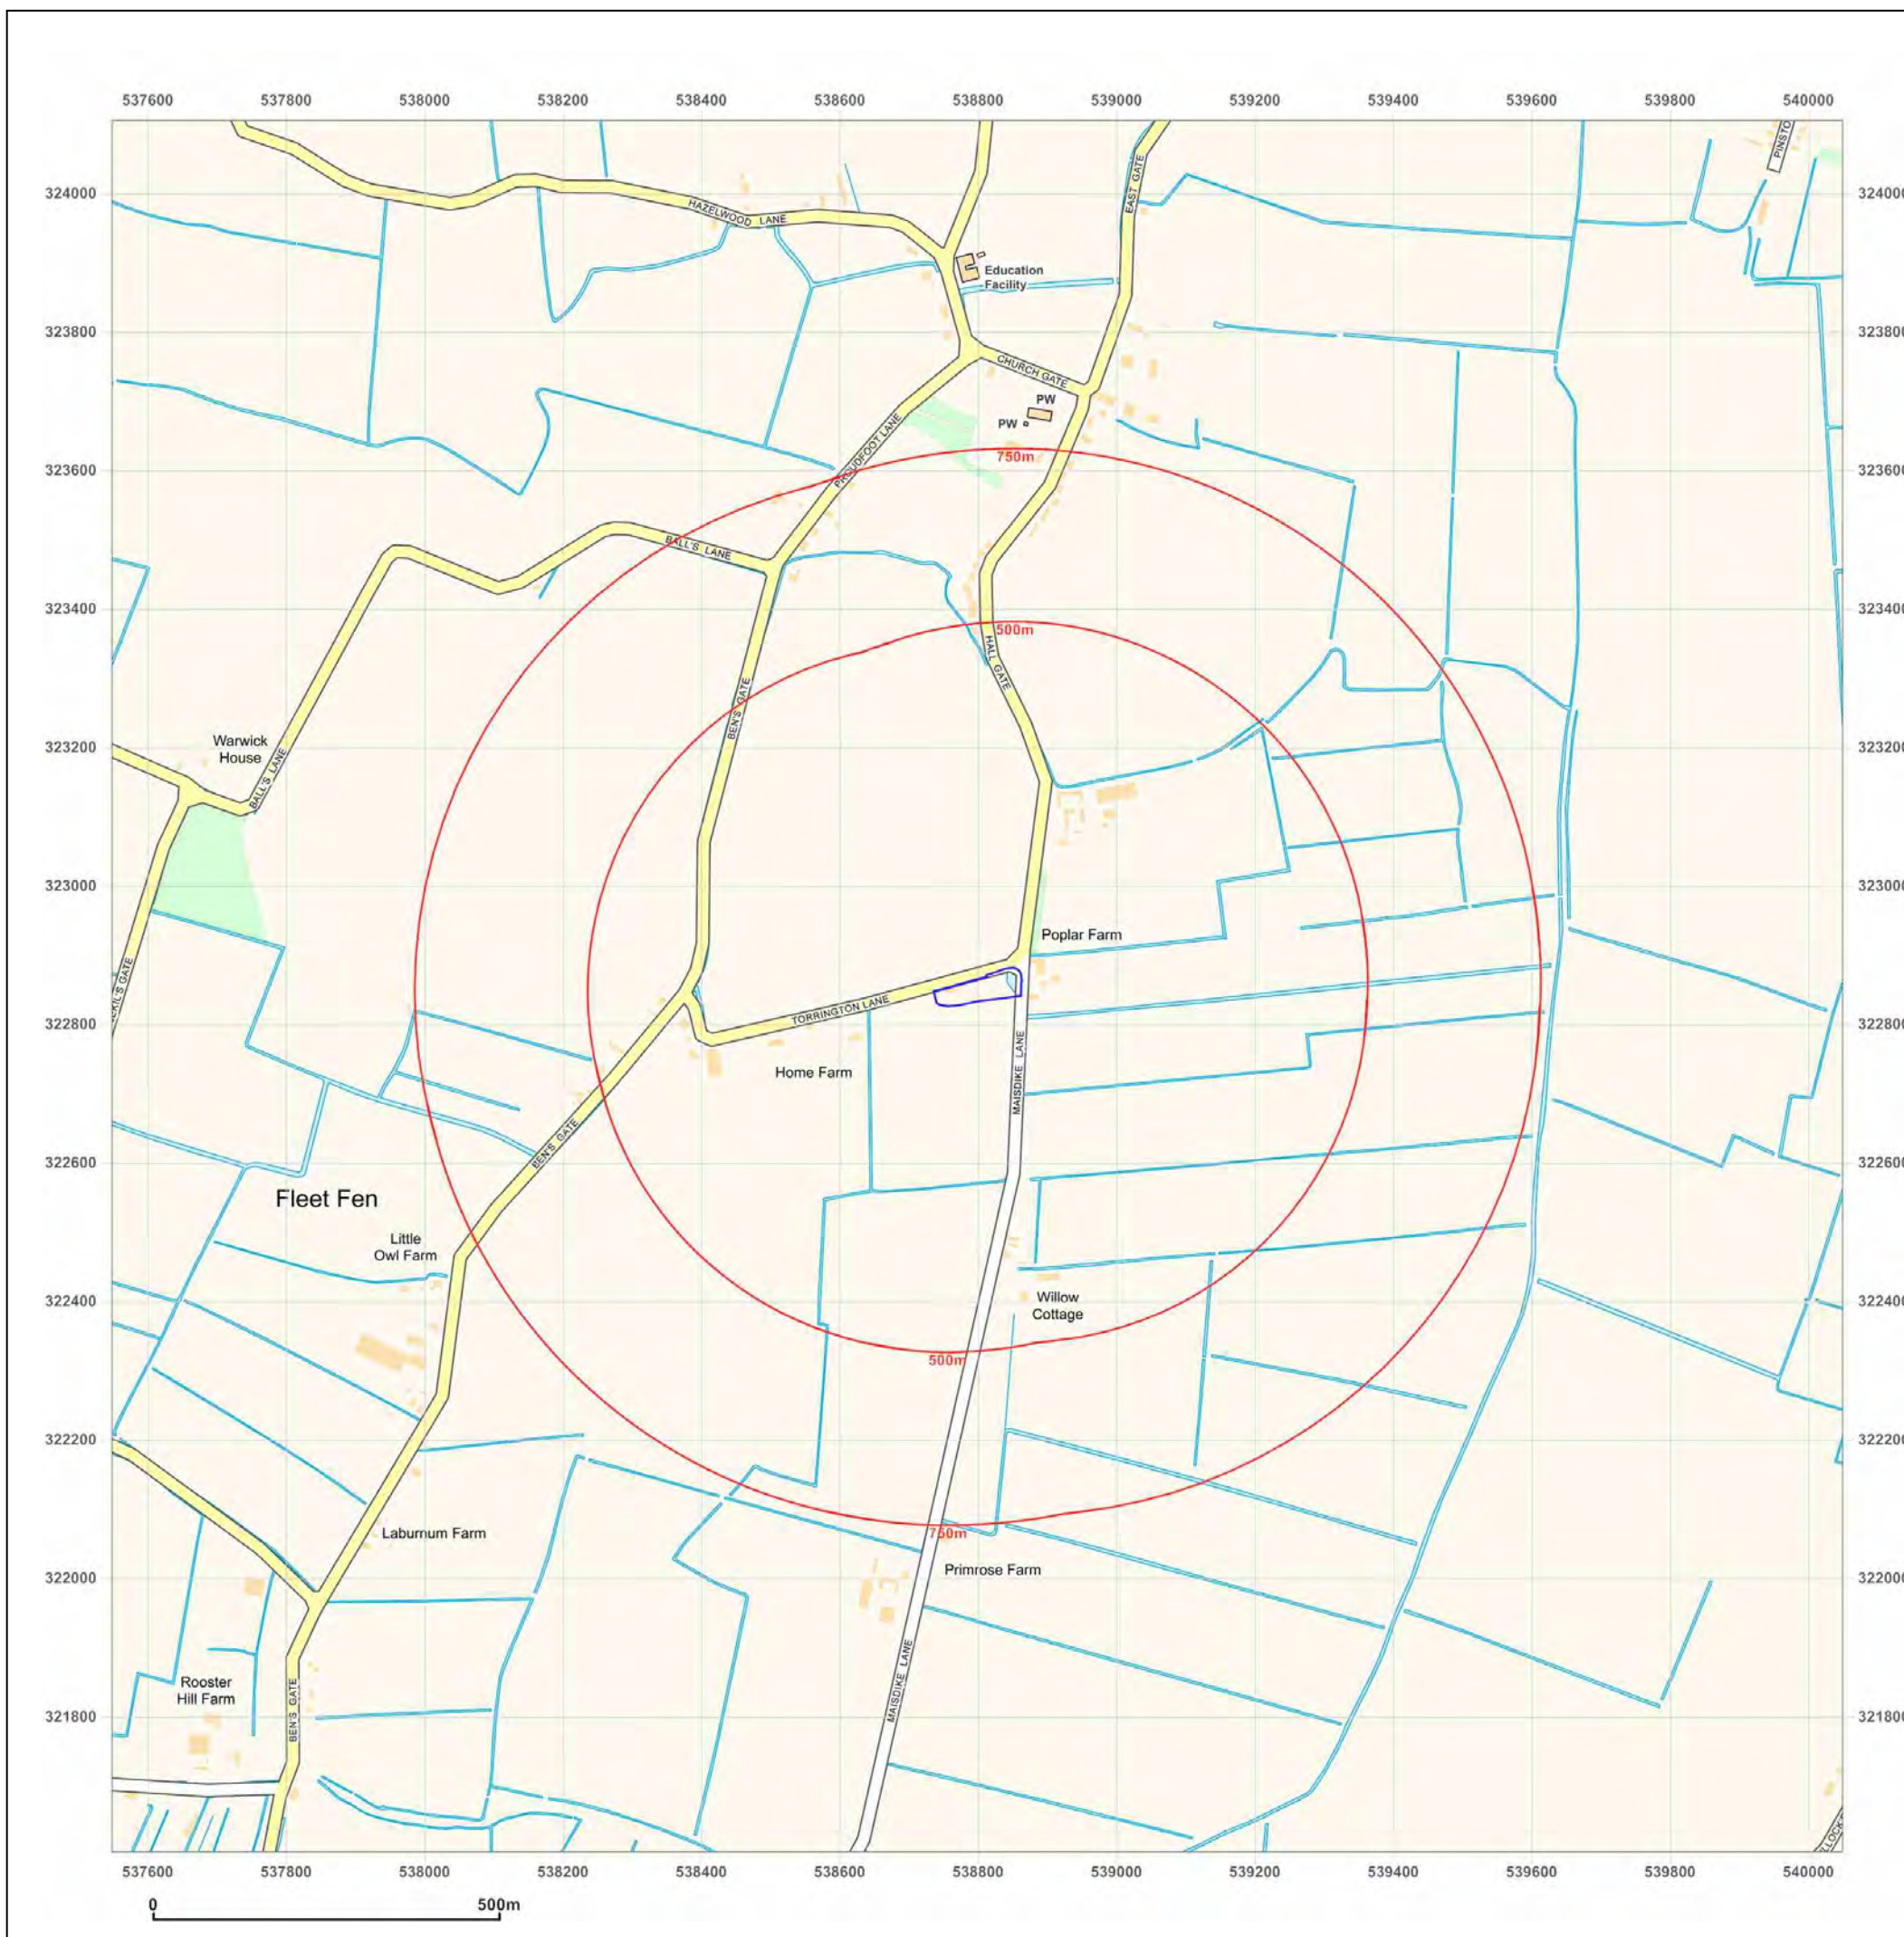

APPENDIX 3

REPORT LIMITATIONS

LIMITATIONS

This contract was completed by Earth Environmental & Geotechnical Ltd on the basis of a defined programme and scope of works and terms and conditions agreed with the client. This report was compiled with all reasonable skill, and care, bearing in mind the project objectives, the agreed scope of works, the prevailing site conditions, the budget and staff resources allocated to the project.

Other than that expressly contained in the above paragraph, Earth Environmental & Geotechnical Ltd provides no other representation or warranty whether express or implied, is made in relation to the services. Unless otherwise agreed this report has been prepared exclusively for the use and reliance of the client in accordance with generally accepted consulting practices and for the intended purposes as stated in the agreement under which this work was completed. This report may not be relied upon, or transferred to, by any other party without the written agreement of a Director of Earth Environmental & Geotechnical Ltd.

If a third party relies on this report, it does so wholly at its own and sole risk and Earth Environmental & Geotechnical Ltd disclaims any liability to such parties.

It is Earth Environmental & Geotechnical Ltd understanding that this report is to be used for the purpose described in the introduction to the report. That purpose was an important factor in determining the scope and level of the services. Should the purpose for which the report is used, or the proposed use of the site change, this report will no longer be valid and any further use of, or reliance upon the report in those circumstances by the client without Earth Environmental & Geotechnical Ltd review and advice shall be at the client's sole and own risk.

The report was written in 2019 and should be read in light of any subsequent changes in legislation, statutory requirements and industry best practices. Ground conditions can also change over time and further investigations or assessment should be made if there is any significant delay in acting on the findings of this report. The passage of time may result in changes in site conditions, regulatory or other legal provisions, technology or economic conditions which could render the report inaccurate or unreliable. The information and conclusions contained in this report should not be relied upon in the future without the written advice of Earth Environmental & Geotechnical Ltd. In the absence of such written advice of Earth Environmental & Geotechnical Ltd, reliance on the report in the future shall be at the client's own and sole risk. Should Earth Environmental & Geotechnical Ltd be requested to review the report in the future, Earth Environmental & Geotechnical Ltd shall be entitled to additional payment at the then existing rate or such other terms as may be agreed between Earth Environmental & Geotechnical Ltd and the client.

The observations and conclusions described in this report are based solely upon the services that were provided pursuant to the agreement between the client and Earth Environmental & Geotechnical Ltd. Earth Environmental & Geotechnical Ltd has not performed any observations, investigations, studies or testing not specifically set out or mentioned within this report.

Earth Environmental & Geotechnical Ltd is not liable for the existence of any condition, the discovery of which would require performance of services not otherwise contained in the services. For the avoidance

of doubt, unless otherwise expressly referred to in the introduction to this report, Earth Environmental & Geotechnical Ltd did not seek to evaluate the presence on or off the site of electromagnetic fields, lead paint, radon gas or other radioactive materials.

The services are based upon Earth Environmental & Geotechnical Ltd observations of existing physical conditions at the site gained from a walkover survey of the site together with Earth Environmental & Geotechnical Ltd interpretation of information including documentation, obtained from third parties and from the client on the history and usage of the site. The findings and recommendations contained in this report are based in part upon information provided by third parties, and whilst Earth Environmental & Geotechnical Ltd have no reason to doubt the accuracy and that it has been provided in full from those it was requested from, the items relied on have not been verified.

No responsibility can be accepted for errors within third party items presented in this report. Further Earth Environmental & Geotechnical Ltd was not authorised and did not attempt to independently verify the accuracy or completeness of information, documentation or materials received from the client or third parties, including laboratories and information services, during the performance of the services. Earth Environmental & Geotechnical Ltd is not liable for any inaccurate information, misrepresentation of data or conclusions, the discovery of which inaccuracies required the doing of any act including the gathering of any information which was not reasonably available to Earth Environmental & Geotechnical Ltd and including the doing of any independent investigation of the information provided to Earth Environmental & Geotechnical Ltd save as otherwise provided in the terms of the contract between the client and Earth Environmental & Geotechnical Ltd.

Where field investigations have been carried out these have been restricted to a level of detail required to achieve the stated objectives of the work. Ground conditions can also be variable and as investigation excavations only allow examination of the ground at discrete locations. The potential exists for ground conditions to be encountered which are different to those considered in this report. The extent of the limited area depends on the soil and groundwater conditions, together with the position of any current structures and underground facilities and natural and other activities on site. In addition, chemical analysis was carried out for a limited number of parameters [as stipulated in the contract between the client and Earth Environmental & Geotechnical Ltd] based on an understanding of the available operational and historical information, and it should not be inferred that other chemical species are not present.

The groundwater conditions entered on the exploratory hole records are those observed at the time of investigation. The normal speed of investigation usually does not permit the recording of an equilibrium water level for any one water strike. Moreover, groundwater levels are subject to seasonal variation or changes in local drainage conditions and higher groundwater levels may occur at other times of the year than were recorded during this investigation.

Any site drawing(s) provided in this report is (are) not meant to be an accurate base plan, but is (are) used to present the general relative locations of features on, and surrounding, the site.