

PERCOLATION TEST REPORT

UPON


LAND OFF

MILL LANE, GEDNEY HILL,

LINCOLNSHIRE, PE12 0PW

PROJECT No: SW 21-235

DOCUMENT REF: SW 21-235-REP-01 rev B

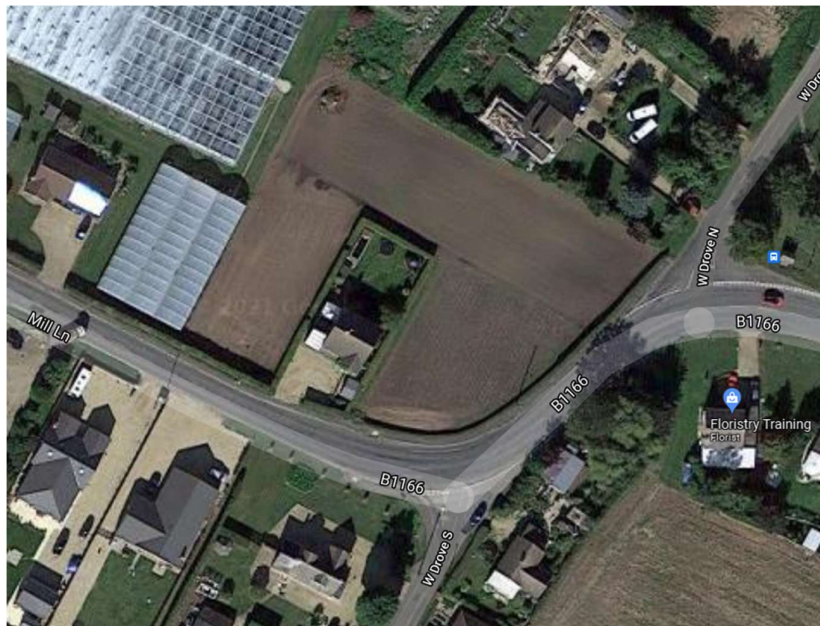

Mr Robert Spenceley
D&R Property Services Ltd.
Celey House
4A, The Wentworths
Long Sutton,
Lincs,
PE12 9RT



CONTENTS

1. INTRODUCTION	2
2. LOCATION & DESCRIPTION OF SITE.....	3
2.1. Site Location.....	3
2.2. Site Description	3
2.3. Geological Description.....	3
3. PERCOLATION TESTS	4
4. INFILTRATION TEST RESULTS.....	4
5. FURTHER PERCOLATION TESTS	4
6. INFILTRATION TEST RESULTS.....	4
7. DISCUSSIONS	5
APPENDIX A.....	6
APPENDIX B.....	8
APPENDIX C	10
APPENDIX D	15
APPENDIX E.....	18

1. INTRODUCTION

Acting upon the instruction of Mr Robert Spenceley, on behalf of D&R Properties, we attended site on 23rd November 2021, the purpose being to observe the underlying ground conditions and determine the percolation characteristics and infiltration rates of the soil strata.

Percolation tests were undertaken in accordance with the method described within BRE digest 365 (2007 edition)

The opinions and comments expressed within this report are based upon ground conditions encountered in the trial pits excavated at the time of our visit.

This report has been prepared for the named client above and should not be relied upon by any other parties, with the exception of the client's professional advisors, for any use without the express written permission of Shields Wilson Limited.

Revision B -

Following consultation with South Holland IDB further percolation testing has been undertaken to ensure 3 fills per test were established.

2. LOCATION & DESCRIPTION OF SITE

2.1. Site Location

The site is situated to the north of Mill Lane, Gedney Hill. Appropriate national grid reference TF 336 116.

A Location plan is contained with Appendix A.

2.2. Site Description

The site currently stands as flower beds for a local nursery.

The North of the site will be bound by existing properties off West Drove North.

The Eastern Boundary is boarded by the existing nursery.

The West & Southern boundaries of the site is boarded by the road Mill Lane, from which the proposed building plots will gain their access.

At the time of our visit the weather was dry and clear, however there had been some precipitation in the days leading up to the visit.

2.3. Geological Description

Desktop study of the area has been undertaken using the British Geological Society Maps.

The maps indicate the site to be underlain by superficial tidal flat deposits of Sand and Silt over the Ampthill Clay (Mudstone) formation.

This information is based upon publicly available records. An extract is contained with Appendix B.

3. PERCOLATION TESTS

Two No. percolation tests were undertaken on the proposed site.

The ground conditions are proven to be consistent across the site by the original ground investigation report and as such two test holes one either side of the site was deemed an appropriate test sample.

SA01 was Undertaken adjacent the Eastern Boundary of the site and SA02 was undertaken to the West of the site.

Logs of the test and subsequent result calculations are contained within Appendix C, Appendix D contains a photographic record.

4. INFILTRATION TEST RESULTS

Results are summarised and tabulated below

Test Pit	Test 1
Eastern Pit – SA01	1.12×10^{-5}
Western Pit –SA02	1.71×10^{-5}

The results are average for infiltration in the South Holland area and demonstrate that the underlying geology on the site is suitable for infiltration.

5. FURTHER PERCOLATION TESTS

Two No. additional percolation tests were undertaken on the proposed site, the pits were filled and tested 3 times. Tests took place during March 2022.

SA03 was Undertaken adjacent the Eastern Boundary of the site and SA04 was undertaken to the West of the site.

Logs of the test and subsequent result calculations are contained within Appendix E.

6. INFILTRATION TEST RESULTS

Results are summarised and tabulated below

Test Pit	Test 1	Test 2	Test 3
Eastern Pit – SA03	1.12×10^{-5}	1.12×10^{-5}	1.12×10^{-5}
Western Pit –SA04	1.71×10^{-5}	1.71×10^{-5}	1.71×10^{-5}

7. DISCUSSIONS

The ground conditions encountered on site, and percolation test results indicate that the site is suitable for the use of infiltration drainage techniques for disposal of run-off water.

The calculated infiltration rates are typical of South Lincolnshire sands and silts, and it is common for garden soakaways to have been successful utilised for residential roof water drainage in this area.

Designs of infiltration features and soakaways should be based upon the worst case calculated infiltration rate of 1.12×10^{-5} .

Revision B –

The Further testing subsequently undertaken has proven conclusively that the site is suitable for infiltration drainage methods.


As the additional results came back with slightly higher infiltration rates than previously calculated has justified the use of the recommend design infiltration rate and the drainage strategy provided within SW21-235-REP-02 and illustrated on drawing SW21-235/01.

For and on behalf of **SHIELDS WILSON LIMITED**


A.P.Wilson CEng MStructE

Rev B – 08th April 2022.


APPENDIX A

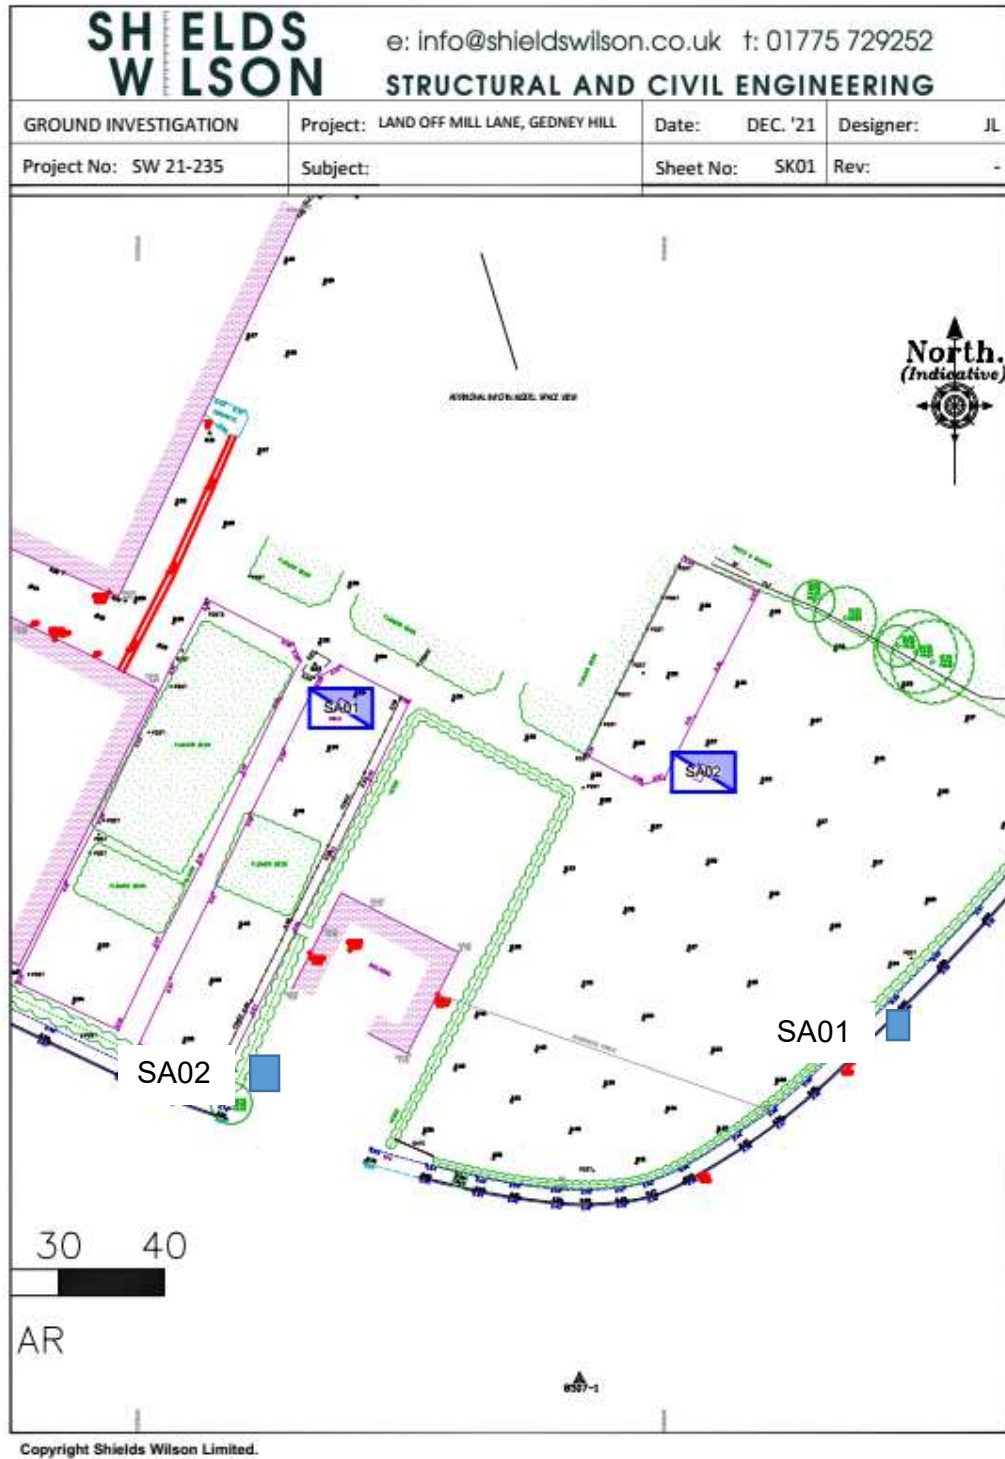

APPENDIX B

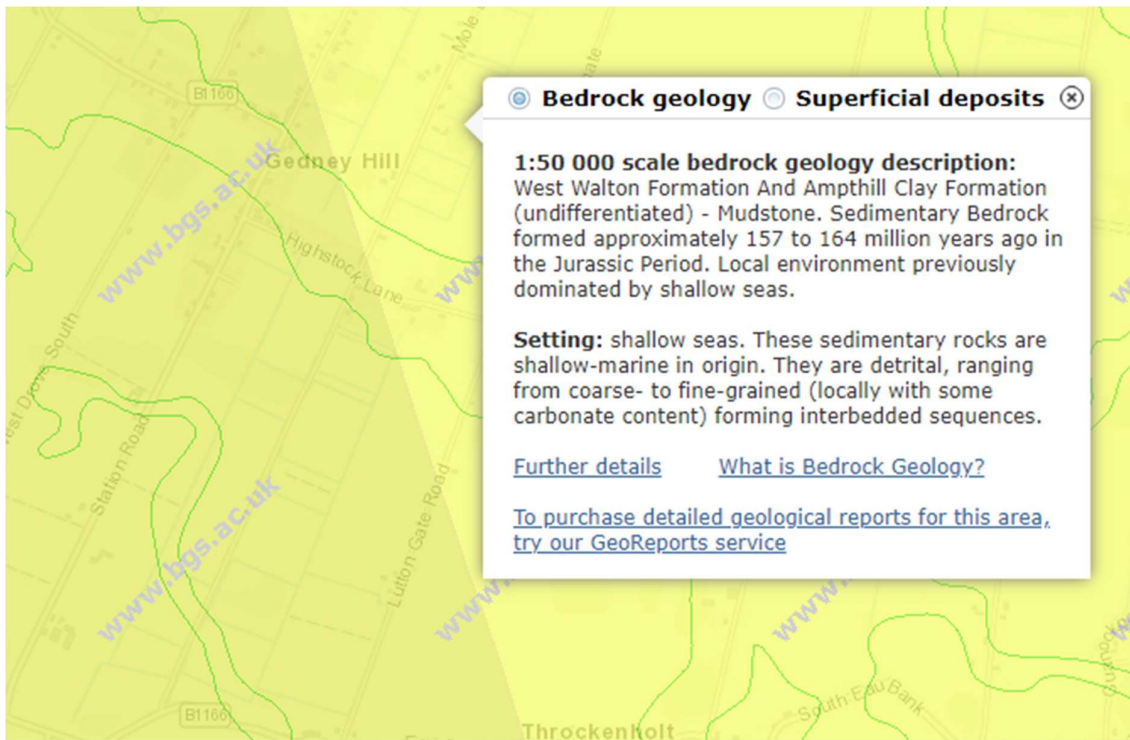

Extract British Geological Society Maps – Bedrock Geology

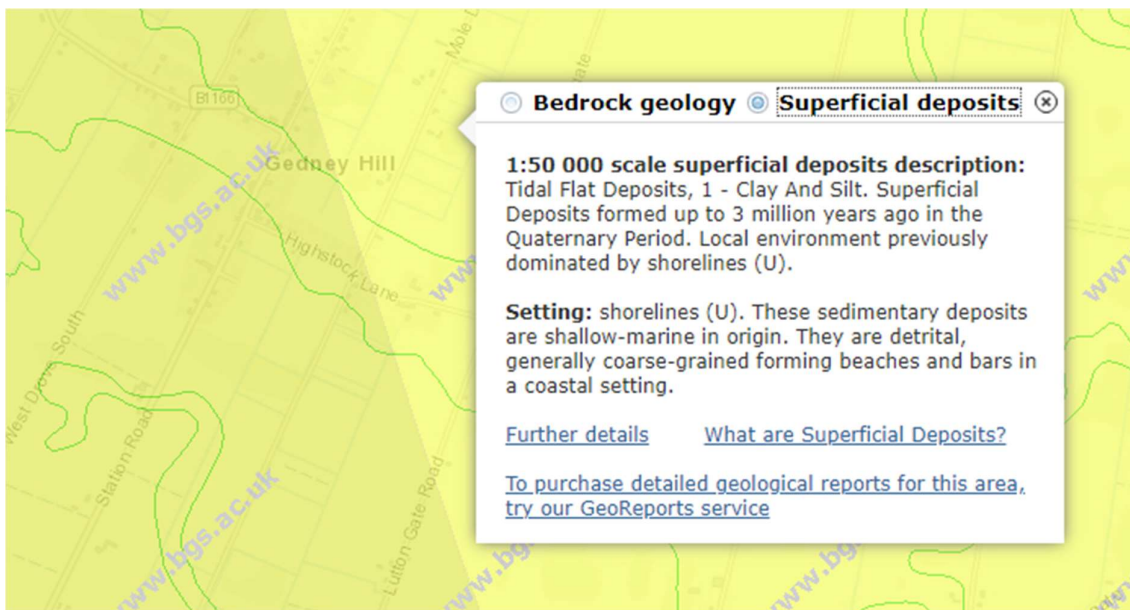

Extract British Geological Society Maps – Superficial Deposits

APPENDIX C

Soak-Away Test SA 01

TEST 1	
SA01	
TIME (Mins)	DEPTH mm (d)
0	880
15	820
30	790
45	770
60	750
90	710
120	680
150	660
165	640
195	620
225	600
255	580
285	550

Trial Pit Dimensions

A =	1.3 m
B =	1 m
C =	1.10 m

Plan Area of Trial Pit

SA01 =	1.3 m ²
Total Volume =	0.429 m ³
75% Volume =	0.322 m ³
25% Volume =	0.107 m ³

**Time Taken From 75%
Volume to 25% Volume**

155	Mins
-----	------

**Effective Depth From 75%
Volume to 25% Volume**

0.165 m

**50% Effective Internal Surface
Area Including Base Area**

2.059 m ²

Soil Infiltration Rate, f


1.12018E-05 m/s
0.040326497 m/h

Project Title


Proposed Residential Development
Mill Lane, Gedney Hill

Project No. 21-235

Site Visit Date 23/11/2021

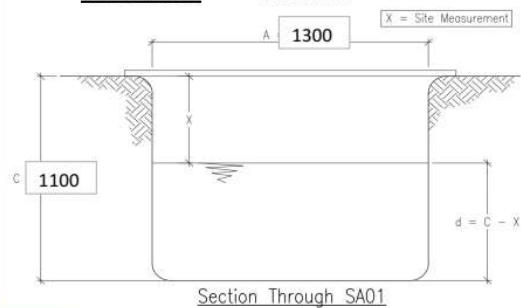

Proposed Residential Development,
Land Off Mill Lane, Gedney Hill.
Project No. 21-235 23/11/2021
Plot showing water level against time for SA01 - TEST 1

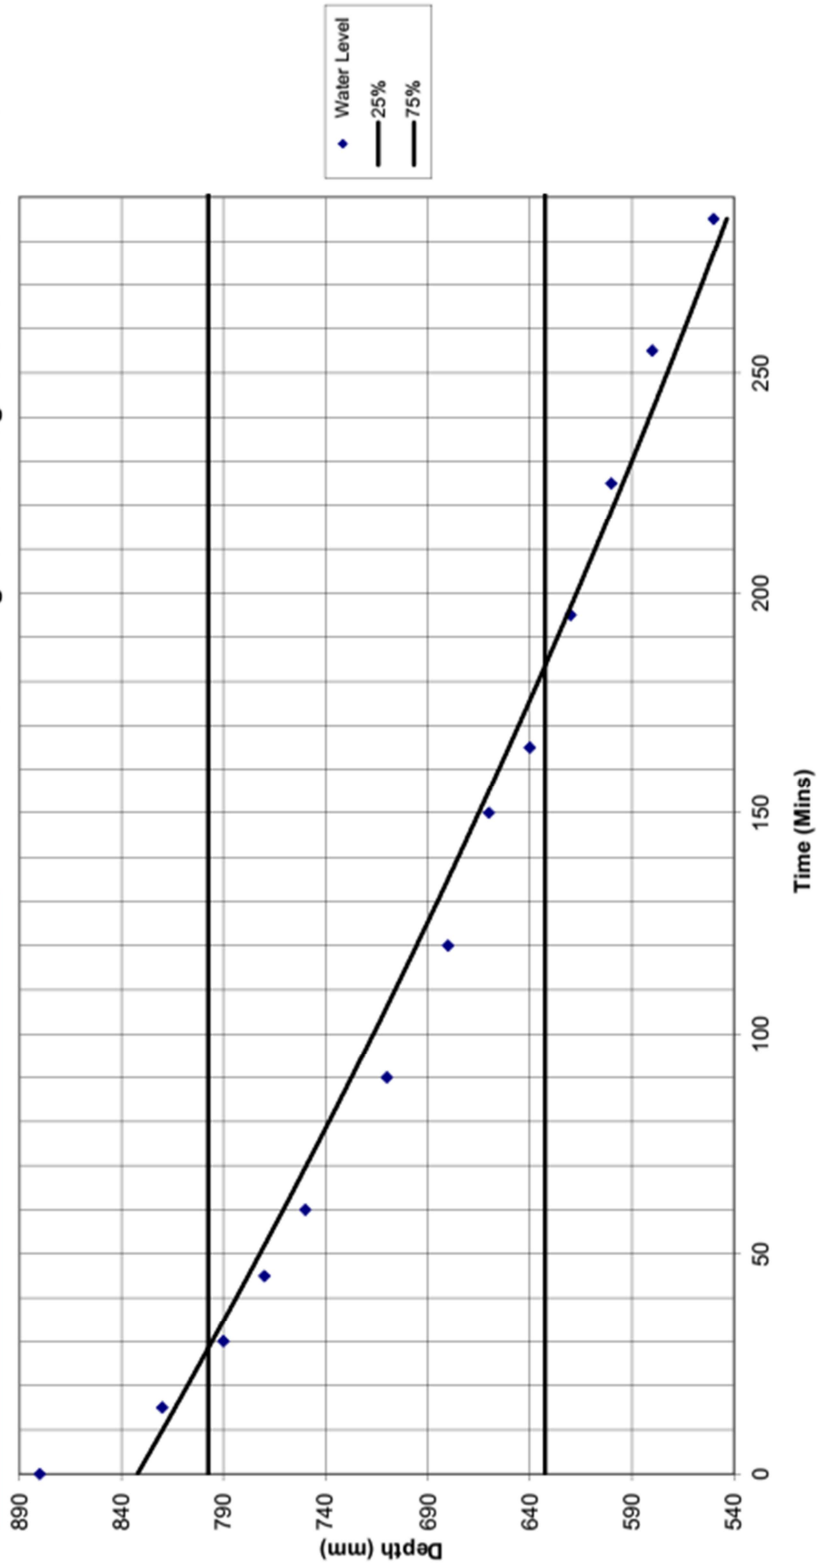

Soak-Away Test SA 02

TEST 1	
SA01	
TIME (Mins)	DEPTH mm (d)
0	780
15	720
30	680
45	610
60	560
90	520
120	470
150	440
180	400
210	380
240	350

Trial Pit Dimensions

A =	1.3 m
B =	1 m
C =	1.05 m

Plan Area of Trial Pit

SA01 =	1.3 m ²
Total Volume =	0.559 m ³
75% Volume =	0.419 m ³
25% Volume =	0.140 m ³

**Time Taken From 75%
Volume to 25% Volume**

119	Mins
-----	------

**Effective Depth From 75%
Volume to 25% Volume**


0.215 m

**50% Effective Internal Surface
Area Including Base Area**


2.289 m ²

Soil Infiltration Rate, f

1.71016E-05 m/s
0.061565911 m/h

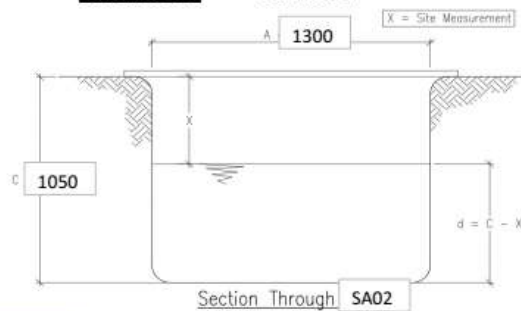Project TitleProposed Residential Development
Mill Lane, Gedney Hill**Project No.** 21-235**Site Visit Date** 23/11/2021

Proposed Residential Development,
Land Off Mill Lane, Gedney Hill.
Project No. 21-235 23/11/2021
Plot showing water level against time for SA02 - TEST 1

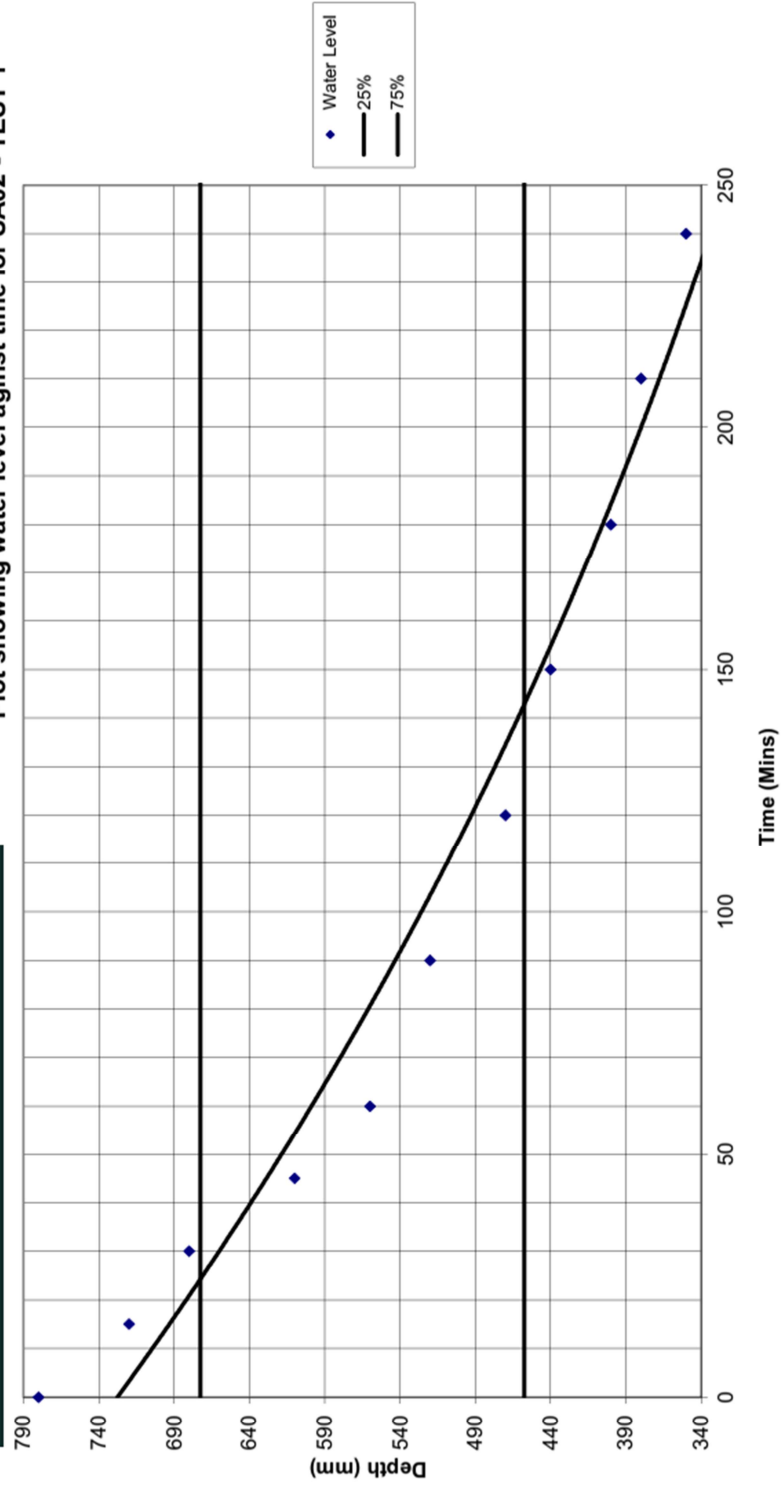

APPENDIX D





APPENDIX E

Soak-Away Test SA 03 - Fill 1

TEST 1	
SA01	
TIME (Mins)	DEPTH mm (d)
0	750
10	700
25	650
40	600
60	580
90	550
120	480
150	430
180	390

Trial Pit Dimensions

A =	1.6 m
B =	0.75 m
C =	1.00 m

Plan Area of Trial Pit

SA01 =	1.2 m ²
Total Volume =	0.432 m ³
75% Volume =	0.324 m ³
25% Volume =	0.108 m ³

Time Taken From 75% Volume to 25% Volume

93	Mins
----	------

Effective Depth From 75% Volume to 25% Volume

0.18 m

50% Effective Internal Surface Area Including Base Area

2.046 m ²

Soil Infiltration Rate, f


1.89197E-05 m/s
0.068110869 m/h

Project Title


Proposed Residential Development
Mill Lane, Gedney Hill

Project No. 21-235

Site Visit Date 24/03/2022

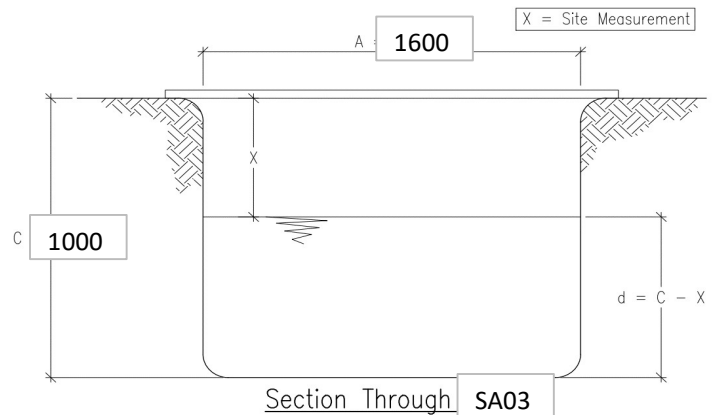

Proposed Residential Development,
Land Off Mill Lane, Gedney Hill.
Project No. 21-235 23/11/2021
Plot showing water level against time for SA03 - TEST 1

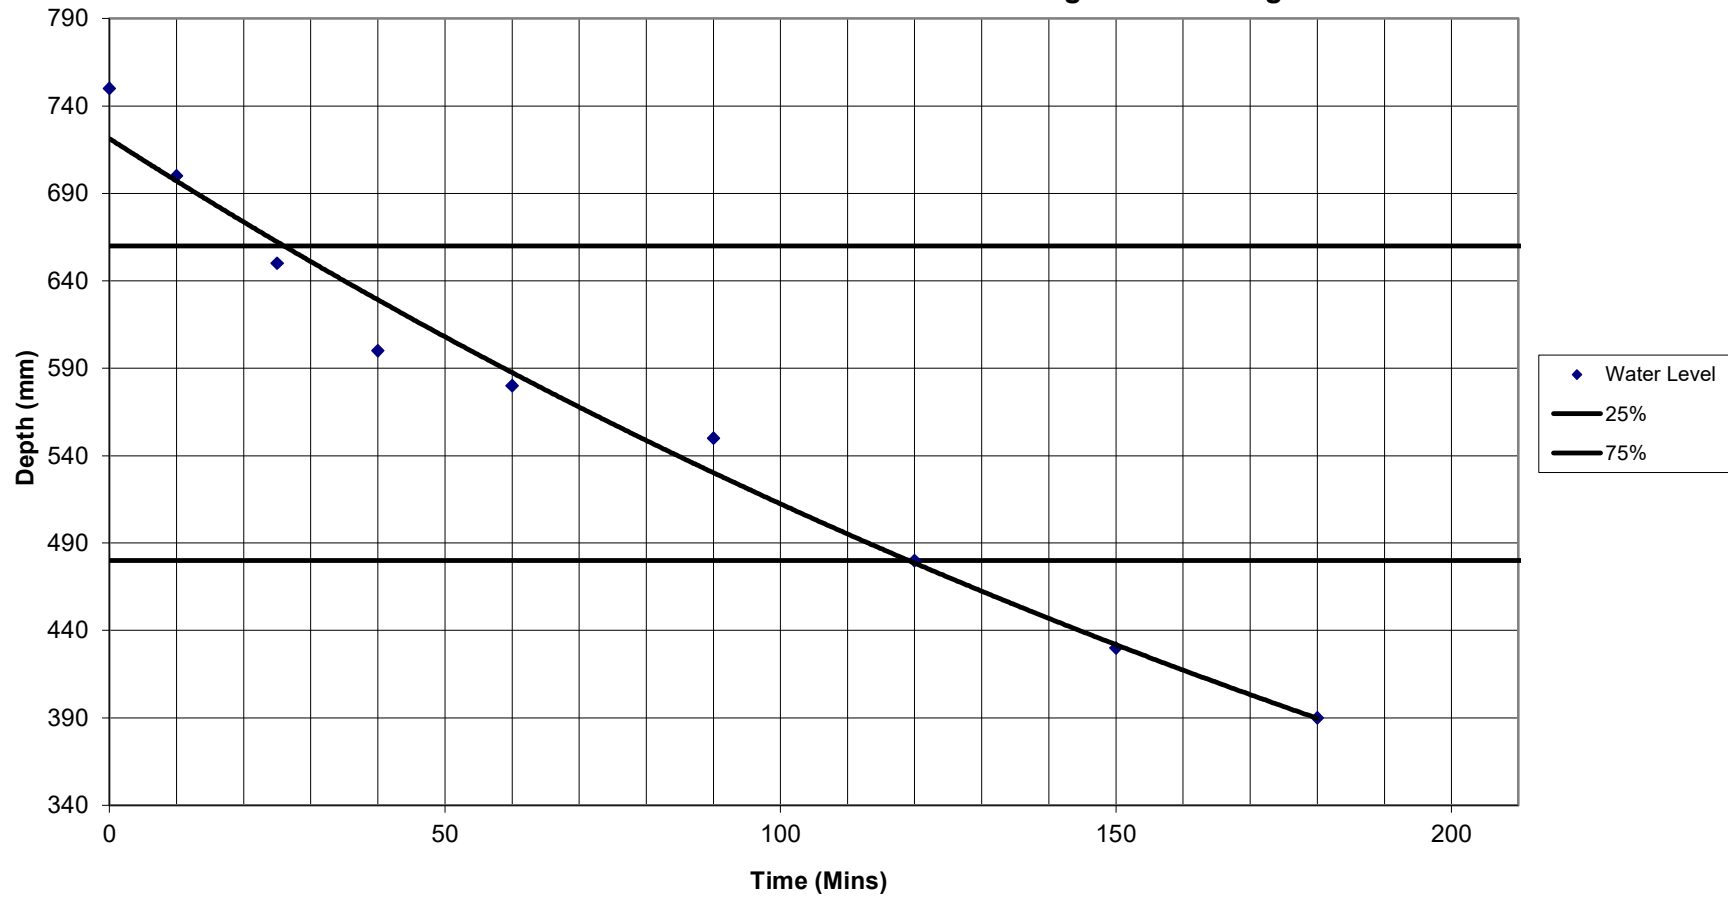

Soak-Away Test SA 03 - Fill 2

TEST 1	
SA01	
TIME (Mins)	DEPTH mm (d)
0	740
10	700
25	670
40	650
60	630
90	580
120	540
150	500
180	360

Trial Pit Dimensions

A =	1.6 m
B =	0.75 m
C =	1.00 m

Plan Area of Trial Pit

SA01 =	1.2 m ²
Total Volume =	0.456 m ³
75% Volume =	0.342 m ³
25% Volume =	0.114 m ³

Time Taken From 75%

Volume to 25% Volume

105	Mins
-----	------

Effective Depth From 75%

Volume to 25% Volume

0.19 m

50% Effective Internal Surface

Area Including Base Area

2.093 m ²

Soil Infiltration Rate, f

1.72912E-05 m/s
0.062248311 m/h

Project Title


Proposed Residential Development
Mill Lane, Gedney Hill

Project No.


21-235

Site Visit Date

24/03/2022

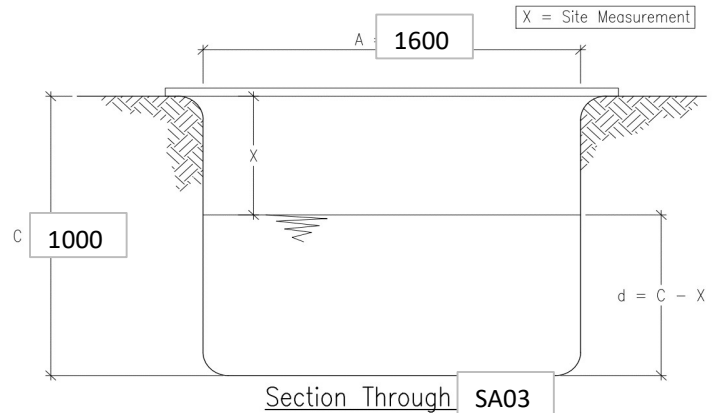

**Proposed Residential Development,
Land Off Mill Lane, Gedney Hill.
Project No. 21-235 23/11/2021
Plot showing water level against time for SA03 - TEST 2**

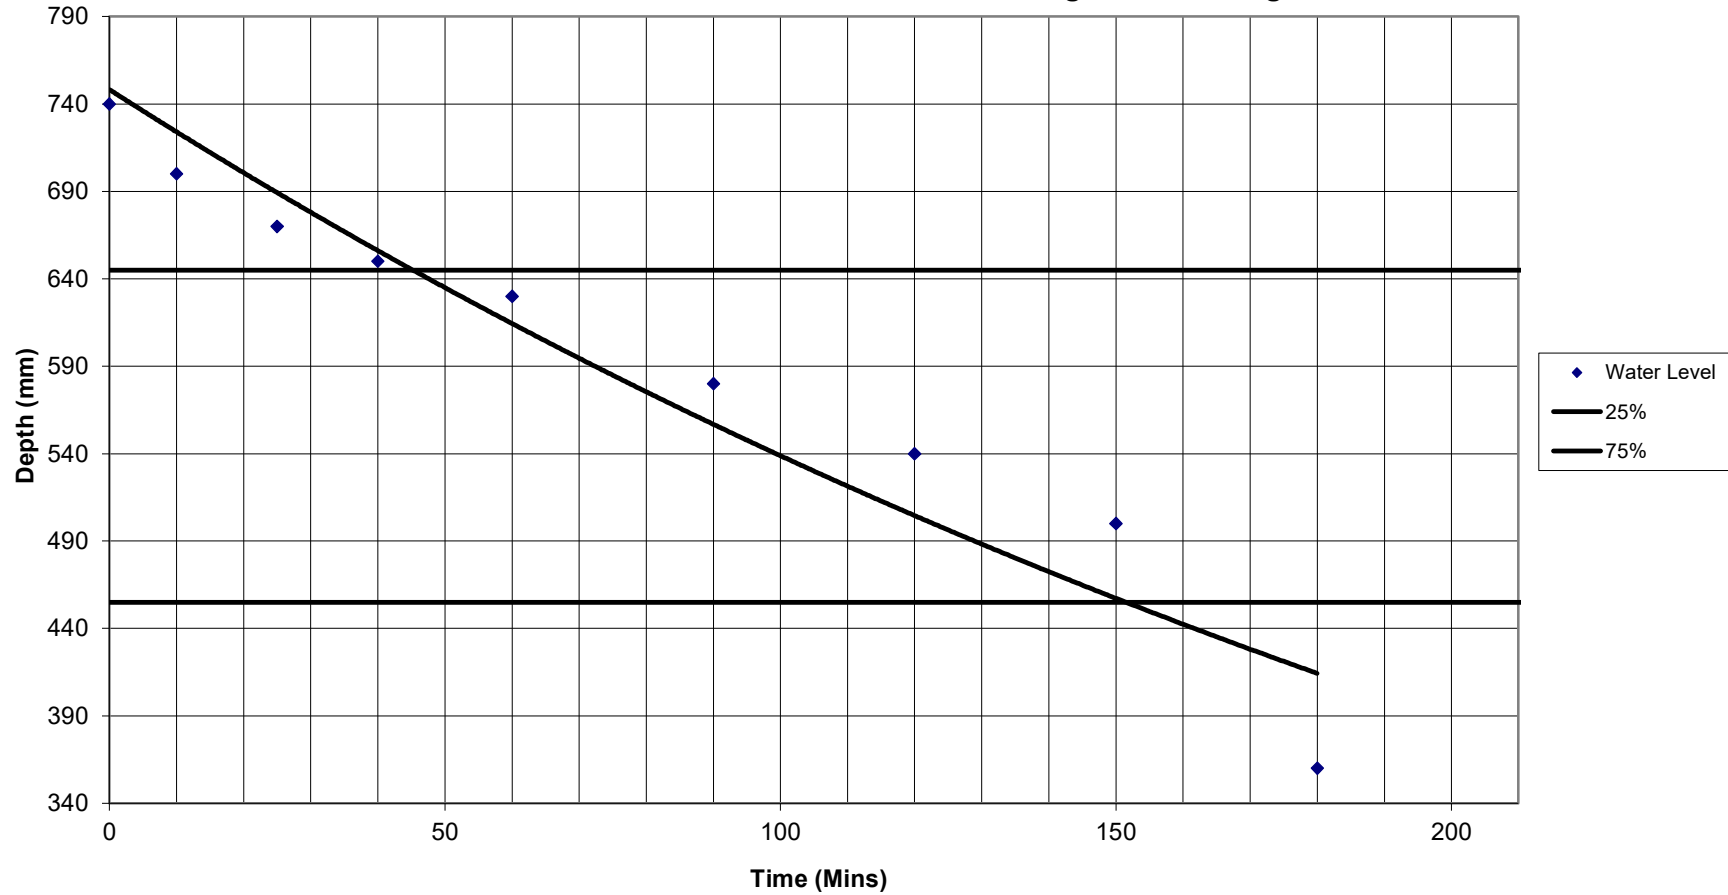

Soak-Away Test SA 03 - Fill 3

TEST 1	
SA01	
TIME (Mins)	DEPTH mm (d)
0	750
10	720
25	700
40	680
60	650
90	620
120	580
150	540
180	500

Trial Pit Dimensions

A =	1.6 m
B =	0.75 m
C =	1.00 m

Plan Area of Trial Pit

SA01 =	1.2 m ²
Total Volume =	0.300 m ³
75% Volume =	0.225 m ³
25% Volume =	0.075 m ³

Time Taken From 75% Volume to 25% Volume

60	Mins
----	------

Effective Depth From 75% Volume to 25% Volume

0.125 m

50% Effective Internal Surface Area Including Base Area

1.7875 m ²

Soil Infiltration Rate, f


2.331E-05 m/s
0.083916084 m/h


Project Title

Proposed Residential Development
Mill Lane, Gedney Hill

Project No. 21-235

Site Visit Date 24/03/2022

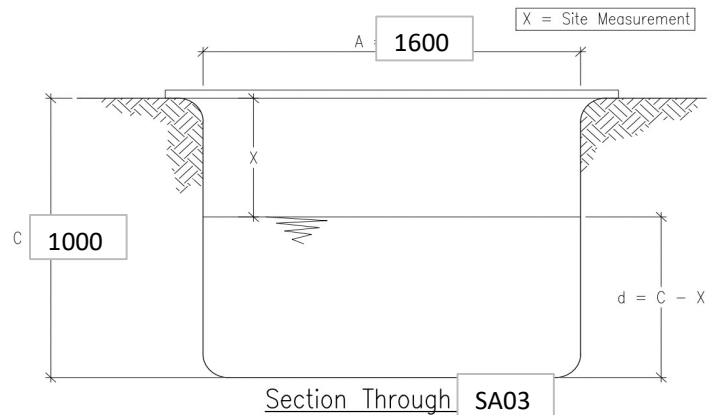

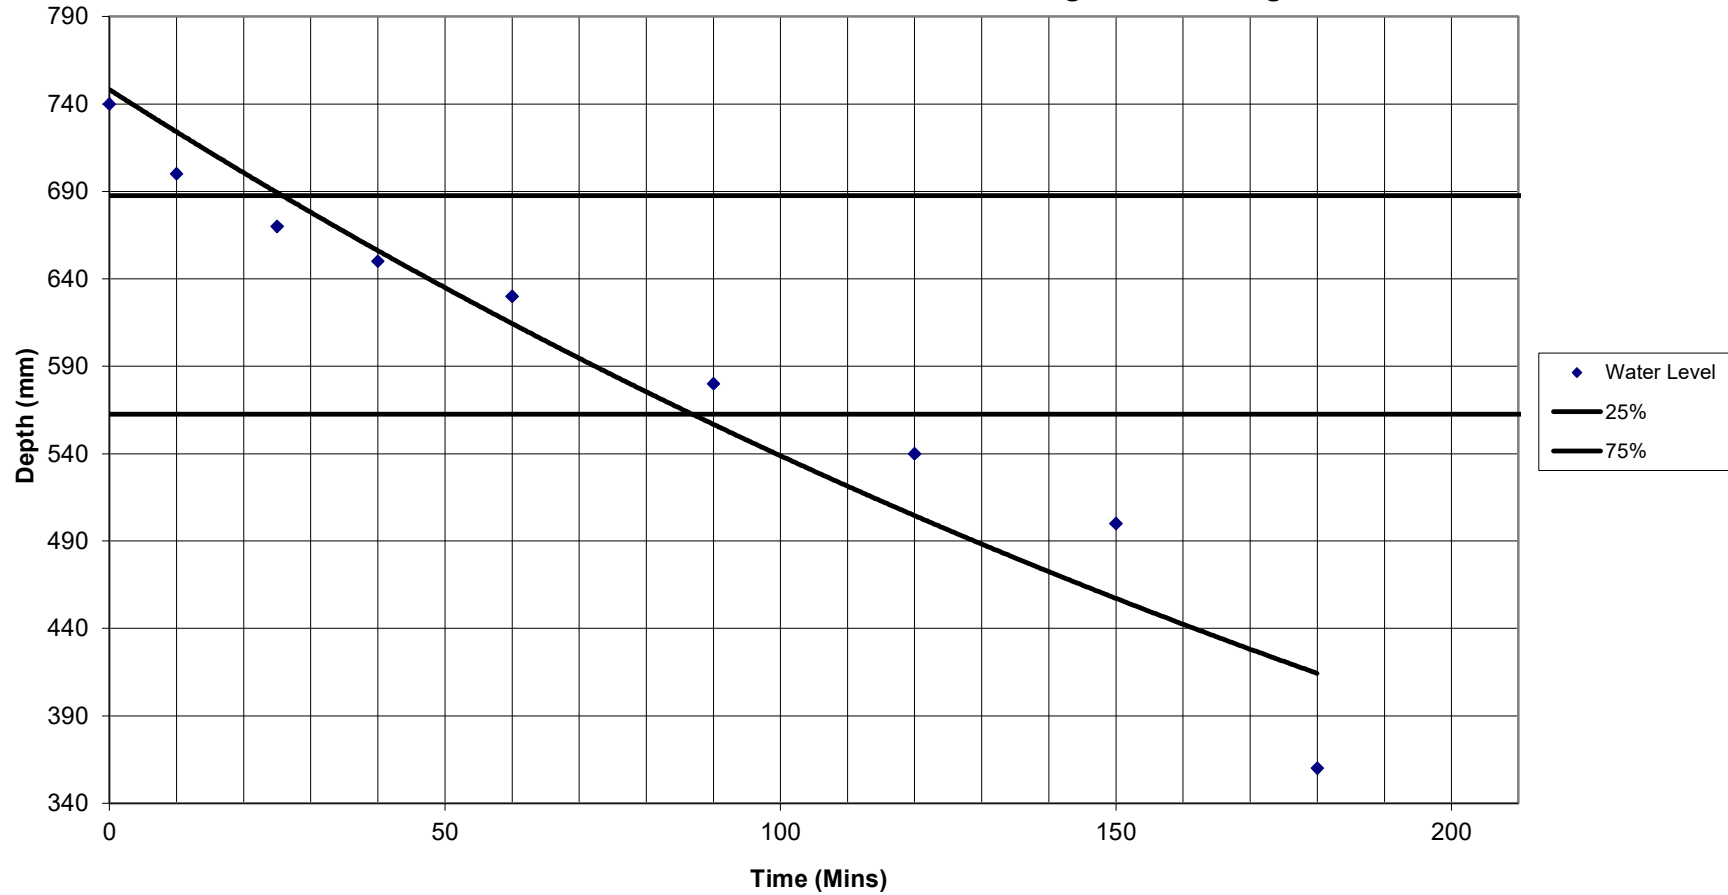

Soak-Away Test SA 04- Fill 1

TEST 1	
SA01	
TIME (Mins)	DEPTH mm (d)
0	750
15	710
30	650
45	630
60	620
90	570
120	520
150	490
180	450

Trial Pit Dimensions

A =	1.4	m
B =	0.6	m
C =	1.00	m

Plan Area of Trial Pit

SA01 =	0.84	m ²
Total Volume =	0.252	m ³
75% Volume =	0.189	m ³
25% Volume =	0.063	m ³

Time Taken From 75% Volume to 25% Volume

92	Mins
----	------

Effective Depth From 75% Volume to 25% Volume

0.15 m

50% Effective Internal Surface Area Including Base Area

1.44 m ²

Soil Infiltration Rate, f


1.58514E-05 m/s
0.057065217 m/h

Project Title


Proposed Residential Development
Mill Lane, Gedney Hill

Project No. 21-235

Site Visit Date 24/03/2022

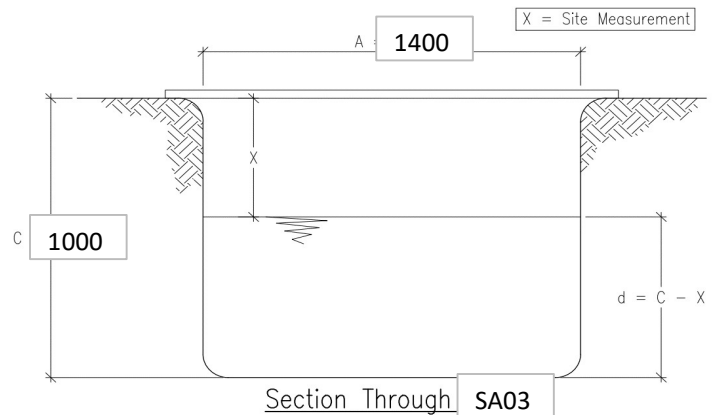

**Proposed Residential Development,
Land Off Mill Lane, Gedney Hill.
Project No. 21-235 23/11/2021
Plot showing water level against time for SA03 - TEST 1**

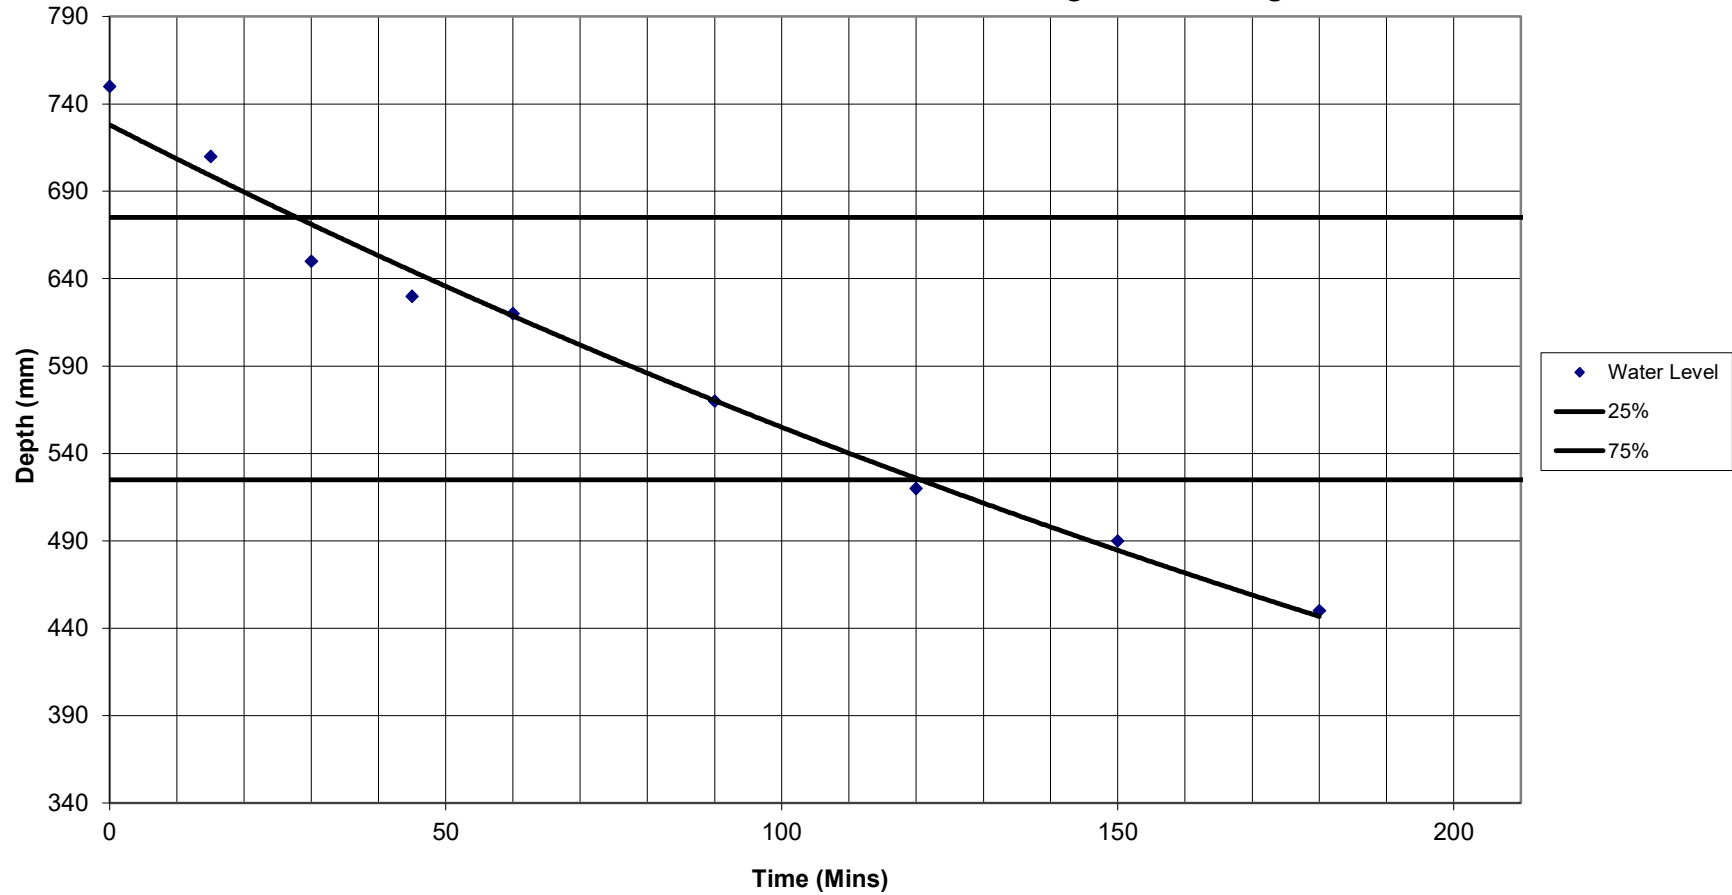

Soak-Away Test SA 04 - Fill 2

TEST 1	
SA01	
TIME (Mins)	DEPTH mm (d)
0	750
10	730
25	670
40	660
60	650
90	630
120	600
150	570
180	530

Trial Pit Dimensions

A =	1.4 m
B =	0.6 m
C =	1.00 m

Plan Area of Trial Pit

SA01 =	0.84 m ²
Total Volume =	0.185 m ³
75% Volume =	0.139 m ³
25% Volume =	0.046 m ³

Time Taken From 75% Volume to 25% Volume

101	Mins
-----	------

Effective Depth From 75% Volume to 25% Volume

0.11 m

50% Effective Internal Surface Area Including Base Area

1.28 m ²

Soil Infiltration Rate, f


1.19121E-05 m/s
0.042883663 m/h


Project Title

Proposed Residential Development
Mill Lane, Gedney Hill

Project No. 21-235

Site Visit Date 24/03/2022

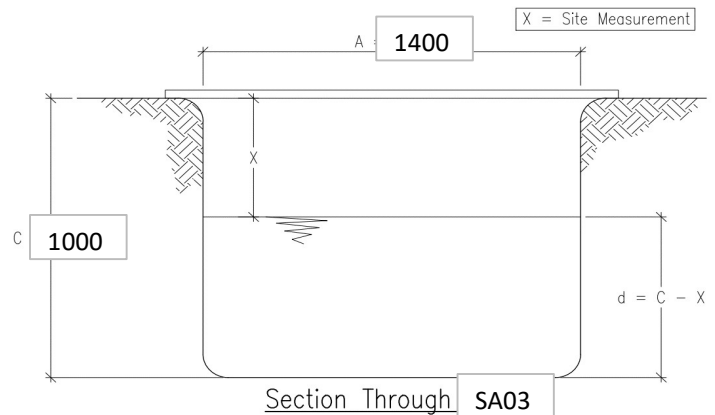

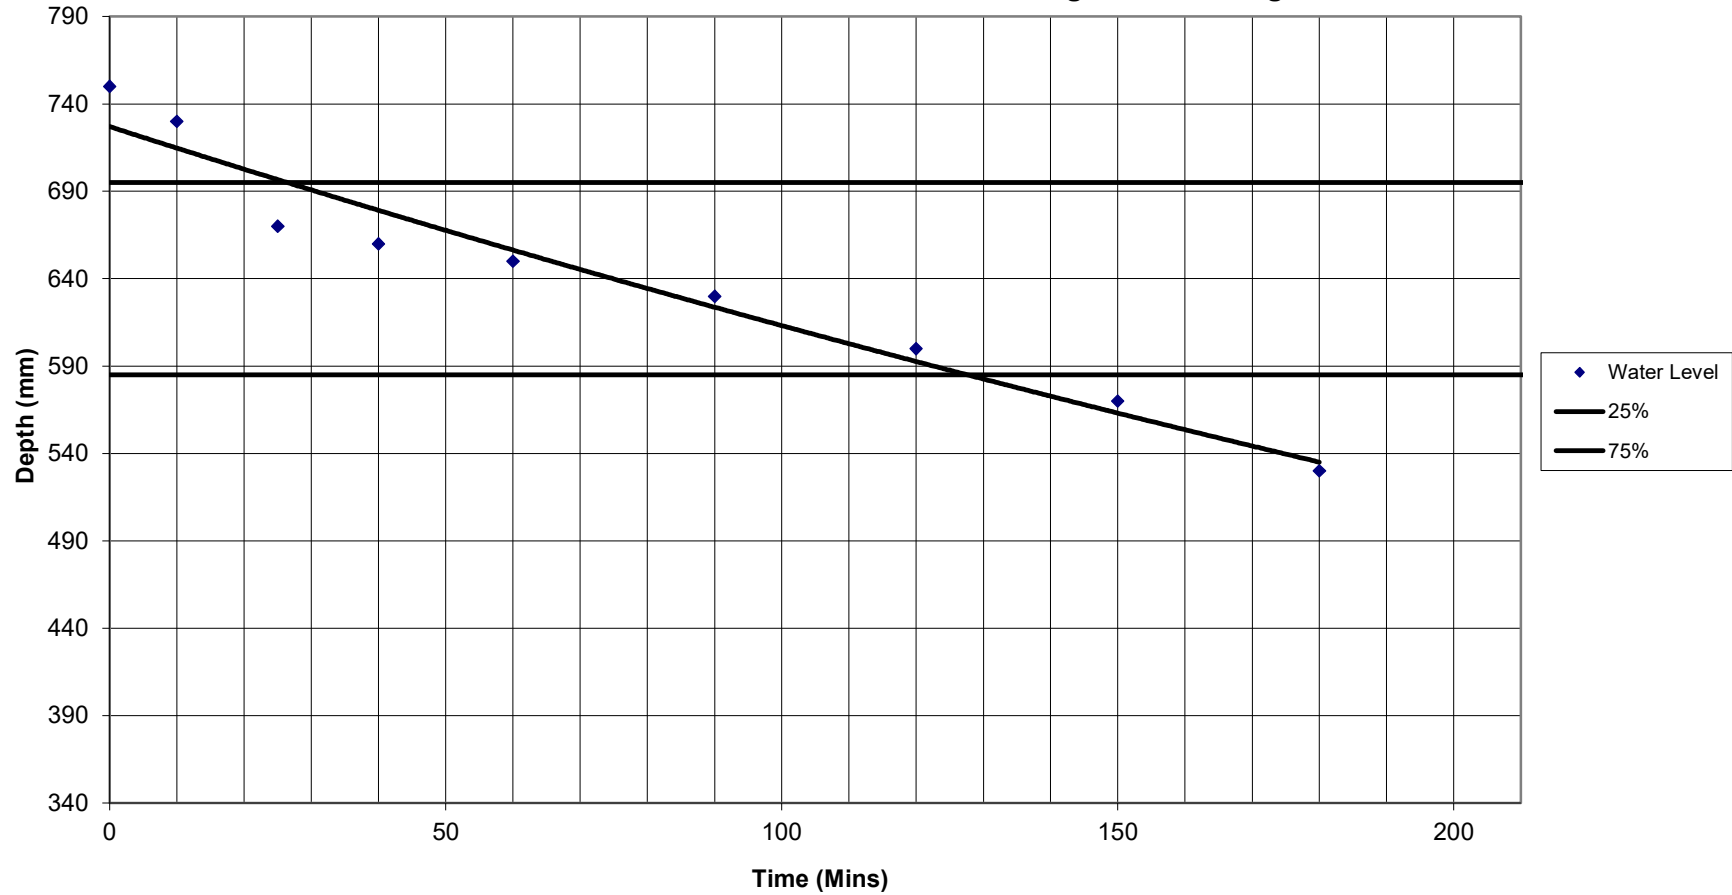

Soak-Away Test SA 04 - Fill 3

TEST 1	
SA01	
TIME (Mins)	DEPTH mm (d)
0	790
15	750
30	740
45	730
60	710
90	680
120	650
150	620
180	590

Trial Pit Dimensions

A =	1.4	m
B =	0.6	m
C =	1.00	m

Plan Area of Trial Pit

SA01 =	0.84	m ²
Total Volume =	0.168	m ³
75% Volume =	0.126	m ³
25% Volume =	0.042	m ³

Time Taken From 75%

Volume to 25% Volume

80	Mins
----	------

Effective Depth From 75%

Volume to 25% Volume

0.1	m
-----	---

50% Effective Internal Surface

Area Including Base Area

1.24	m ²
------	----------------

Soil Infiltration Rate, f

1.41129E-05	m/s
0.050806452	m/h

Project Title

Proposed Residential Development
Mill Lane, Gedney Hill

Project No.

21-235

Site Visit Date

24/03/2022

