



Goldfinch
ENVIRONMENTAL LTD

**PROPOSED RESIDENTIAL
DEVELOPMENT
LAND OFF LOW LANE
HOLBEACH
SPALDING
LINCS..**

**PROPOSED RESIDENTIAL
DEVELOPMENT
LAND OFF LOW LANE
HOLBEACH
SPALDING
Lincs..**

**GEOENVIRONMENTAL
DESK STUDY**

Report Ref.: 0575/1

Prepared by :

D Sargeant

D Sargeant
BSc FGS

Date:

November 2018

CONTENTS

1.	INTRODUCTION	3
2.	LIMITATIONS	4
3.	LEGISLATIVE AND REGULATORY SETTING	5
4.	SITE LOCATION AND DESCRIPTION	6
5.	SITE HISTORY	8
6.	PRELIMINARY QUALITATIVE RISK ASSESSMENT	14
7.	RECOMMENDATIONS FOLLOWING PRELIMINARY RISK ASSESSMENT	17
8.	CONCLUSIONS	18

FIGURES

- **Figure 1 Site Location Plan**
- **Figure 2 Proposed Layout Plan**

APPENDICES

- **Appendix 1 'Groundsure' Report**

PROPOSED RESIDENTIAL DEVELOPMENT

LAND OFF LOW LANE

HOLBEACH, SPALDING

LINCS.

1. INTRODUCTION.

1.1 General.

This report describes the findings of a geoenvironmental desk study undertaken by Goldfinch Environmental Limited on the instruction of Mr & Mrs R Kent (the Client), via the offices of G R Merchant Architects, at a site located off Low Lane, Holbeach, Spalding, Lincolnshire.

A site location plan has been included as Figure 1 with the proposed layout shown in Figure 2 towards the back of this report to assist the reader.

The Desk Study was required to support a planning application for the development of the site to a residential land use by establishment of a new residential dwelling.

2. LIMITATIONS.

This report is for the sole reliance and use of the Client. Any Third Party coming into possession of this report relies on it at their risk, unless written permission is expressly sought from, and provided by, Goldfinch Environmental Limited. The author owes them no duty of care and skill. Goldfinch Environmental Ltd accepts no responsibility or liability for the consequences of this document being used for purposes other than that for which it was commissioned and the assessments provided herein should not be relied on as a legal opinion.

The findings and opinions expressed are relevant to the time of the site visit and information review and should not be relied upon to represent conditions at substantially later dates. The assessments and opinions given in this report are based upon information available at the time of the report. Where additional information comes available which may affect or identify a need to review our conclusions or assessments we request the opportunity (and reserve the right), to review the information and where warranted, modify our assessment / opinion in part or wholly, accordingly.

The purpose of this desk study report was to determine the historical use of the site and adjacent areas from searches of Public Registers and a review of available historical maps and included a site reconnaissance ('walkover') survey together with brief internet searches. The outcome of these activities is described below and this information was used to construct a conceptual model for the site from which a risk assessment was completed in the context of the proposed residential development of the site.

The risk assessment was based on the source-pathway-receptor framework, with respect to the geoenvironmental condition of the site in the context of various sensitive receptors. Goldfinch Environmental Ltd have based this desk study upon the sources given in this report, and believes them to be reliable but cannot and does not guarantee the authenticity or reliability of the data it has relied upon.

This desk study does not include any geotechnical considerations pertaining to the site as these were outside the agreed brief.

The recommendations given in this report are based on guidance and best practice in place at the time of issue of the report, the information available at the time of the investigation, the nature of the indicated proposed development and associated end user behaviour patterns. Should any of the foregoing change at any time, then this report should be reviewed in the context of proposed changes.

The absence of indicators in search data, or from on site observations does not rule out their presence in other parts of the site. This desk study report has been based on information supplied in the 'GroundSure' report and its component parts included at Appendix 1 towards the back of this report, discussions with the Client and in-house searches.

3. LEGISLATIVE & REGULATORY SETTING.

The Environmental Protection Act of 1990 created the framework for the identification and remediation of contaminated land. The Act defines “contaminated land” as any land, which appears by the Local Authority to be “in such a condition, by reason of substances, in, on, or under the land that significant harm is being caused or there is significant possibility of such harm being caused, or, pollution of Controlled Waters is being, or is likely to be, caused”.

Land potentially affected by ‘contamination’ is a material consideration for planning purposes together with its relationship with ‘regulatory intervention’ (Part IIa), and ‘voluntary’ investigation (which includes redevelopment of sites which may be affected by contamination). The Model Procedures (CLR-11, Environment Agency 2004), provide a generic framework indicating key technical activities applicable in each of these contexts.

The management of land contamination broadly comprises three components that are identified as ‘Risk assessment’, ‘Options appraisal’ and ‘Implementation’. These, in turn, determine if any *unacceptable* risks exist, ascertain the most appropriate remediation strategy for the site and, finally, demonstrate that the strategy will be effective.

In accordance with this and other current guidance, where a ‘land quality’ risk assessment is required each ‘Relevant Pollutant Linkage’ (RPL, formerly referred to as “source-pathway-receptor” framework), is separately identified and a level of risk attached. This is documented in the form of a ‘Conceptual Model’.

The outcome of the assessment of established, plausible relevant pollutant linkages is used to determine qualitatively the need for further investigation, or remediation with ensuing mitigation of the determined unacceptable risk. (In accordance with the Model Procedures and Regulatory preference, detailed remedial measures should be provided in a separate phase).

The risk assessment takes account of the local environment, end user behaviour patterns, and the nature of the development in relation to proven ‘unacceptable’ risk. This is the approach advocated by current guidance (CLR-11 and BS10175 etc), and therefore has been adopted in the assessment of this site.

4. SITE LOCATION AND DESCRIPTION.

4.1 Introduction

A site visit was carried out during 28 November 2018 the purpose being to:-

- I. Collect additional/relevant information about the site its environs and any site-specific potential contaminants, pathways and receptors.
- II. Record any aspects of the site not revealed by documentary searches. (e.g. the presence of above- or belowground hydrocarbon storage tanks.).
- III. Collect any information that will assist in the planning of any subsequent phases of field investigation where the Desk Study deems this is necessary.

Approximate Grid Reference ⁵36540, ³25604 refers.

The site comprised a subtriangular plot of land on the northern side of Low Lane towards the northeast of Holbeach.

Topographic levels at the site, by visual inspection, appeared to change little across the site.

At the time of the site walkover survey the site was capped with soft cover of exposed soils and the footprint of two wooden buildings as can be seen in Photograph 1.



Photograph 1: View of The Site from the Southeastern Corner.



The western part of the site was being used to accommodate chickens and on the northern side (rear) of this part of the site was some external racking, which held lengths of plastic guttering and metal with, nearby some wire mesh and a small (empty) trailer.

The eastern part of the site was down to a cover of exposed soils (which had possibly been used for plant cultivation in the past) with some short grass between the eastern end of the building and the eastern boundary of the site.

At the time of the site walkover survey the buildings were being used to store logs/firewood, plastic crates, hay/straw and timber.

A small area of paving was noted in the western part of the site.

Following visual inspection of the site there were no notable features with regard to land contamination. In addition, although the site had been subject to previous 'development' there was no apparent evidence of:~

1. The presence of Made Ground other than hard surfaced areas and building footprint as referred above.
2. The presence or storage of potentially leachable materials/chemicals.
3. Demolition or dispersal of contaminated rubble or other materials.
4. Importation of potentially contaminated fill onto the site.

5. SITE HISTORY.

5.1 Historical Maps.

Where the attached maps are compiled from a composite of editions, the year of map upon which the majority of the site may be found is quoted below. These are reproduced at Appendix 1. Annotation, as it appears on the maps, is indicated by italics.

Land use in excess of 250m from the site is considered of potentially negligible to low risk to the application site and on that basis is generally excluded from the summary provided below (unless record review by this author suggests otherwise). However, should the reader require this additional detail, full disclosure records are included in Appendix 1 towards the back of this report.

(The reader should note at this point that occasionally on the older map editions the site boundaries can be slightly 'shifted' relative to more recent maps.).

1887 Edition {County Series - Scale 1:10 560}

The site was shown as an undeveloped plot of land to the northeast of Holbeach.

Surrounding land was sparsely developed.

1888 Edition {County Series - Scale 1:2 500}

There were no apparent changes to the site or its immediate environs at this scale of mapping.

1903 Editions {County Series - Scale 1:10 560}

There were no apparent changes to the site at this scale of mapping.

There were no apparent change to the immediate environs of the site at this scale of mapping.

1904 Edition {County Series - Scale 1:2 500}

There were no apparent further changes to the site at this scale of mapping.

1929 Edition {County Series - Scale 1:10 560}

There were no apparent changes to the site or its surroundings at this scale of mapping.

1931 Edition {County Series - Scale 1:10 560}

The site and its immediate environs were not shown on this map edition.

1931 Edition {County Series - Scale 1:2 500}

There were no apparent changes to the site or its immediate environs at this scale of mapping.

1938 Edition {County Series - Scale 1:10 560}

There were no apparent changes to the site or its immediate environs at this scale of mapping. However, more distant land to the south east of the site had now undergone some development.

1950 Edition {County Series - Scale 1:10 560}

There were no apparent changes to the site or its immediate environs at this scale of mapping. However, more distant land to the east of the site had now undergone some development.

1955-8 Edition {Provisional - Scale 1:10 560}

There were no apparent changes to the site or its immediate environs at this scale of mapping. However, more distant land to the south of the site had now undergone some development.

1968 Edition {National Grid - Scale 1:2 500}

There were no apparent changes to the site or most of its immediate environs at this scale of mapping. However, land to the southwest of the site had now undergone minor/sparse development.

1970 Edition {National Grid - Scale 1:10 000}

The site and its immediate environs were not shown on this map edition.

1977 Editions {National Grid - Scale 1:2 500 and 1:10 000}

There were no apparent changes to the site.

The immediate environs to the southeast of the site had possibly undergone further development at this scale of mapping.

1982 Edition {National Grid - Scale 1:2 500}

There were no apparent changes to the site or most of its immediate environs at this scale of mapping. However, land to the southwest of the site had now undergone minor/sparse development and a '*Pumping Station*' was established on land immediately to the east of the site.

1991 Edition {National Grid - Scale 1:2 500}

There were no apparent changes to the site or most of its immediate environs at this scale of mapping. However, land to the south of the site had now undergone further development.

1992 Edition {National Grid - Scale 1:10 000}

There were no apparent changes to the site or most of its immediate environs at this scale of mapping. However, land to the south of the site had now undergone further development.

1995 Editions {National Grid - Scale 1:2 500}

There were no apparent changes to the site or most of its immediate environs at this scale of mapping.

2002 Edition {Raster - Scale 1:10 000}

There were no apparent changes to the site.

There were possible changes to the southern environs of the site.

2010 Edition {National Grid - Scale 1:10 000}

There were no further changes to the site.

There were no apparent changes to the surrounding environs with respect to land contamination.

2014 Edition {National Grid - Scale 1:10 000}

There were no apparent changes to the site or surrounding environs with respect to land contamination.

5.2 Public Registers.

A search of public register information has been made using an Internet-based system. A disclosure report is reproduced at Appendix 1. The following commentary is restricted to entries within a 250m search radius of the site. Appendix 1 should be referred to for details on entries beyond of this range.

5.2.1 Historical Industrial Sites

There were no records for any of the categories within this dataset for the referred search radius.

5.2.2 Environmental Permits, Incidents and Registers.

There were three records for the category 'Records of Licensed Discharge Consents' within this dataset for the referred search radius. Supplied information indicated there were none for the site, none were within approximately 50m of the site and the remaining three were located between approximately 119 and 123m distant from the site. These were generally for '*Final/Treated Effluent*'.

5.2.3 Landfill and Other Wastes.

There was one record for the category 'Environment Agency/Natural Resources Wales Historic Landfill Sites' within this dataset. Supplied information indicated this was located approximately 215m distant from the site and was given as '*Licence Surrendered*'.

5.2.4 Current Land Uses.

There was one record within this category. Supplied information indicated none were for the site, one was within 50m of the site and there were none beyond this distance and was given as '*Pumping Station*' which was located approximately 40m distant from the site.

5.2.4.i Petrol & Fuel Sites.

There were no records within this dataset for the referred search radius.

5.2.5 Geology.

There were no records for the site within the category 'Artificial Ground and Made Ground'.

There were records '*Identified*' within the category 'Superficial Ground and Drift Geology present beneath the site'. Supplied information indicated Tidal Flat Deposits (Clay and Silt).

The Bedrock & Solid Geology was given as West Walton Formation (Mudstone and Siltstone).

5.2.6 Hydrogeology and Hydrology.

For the category 'Are there any records of Strata Classification in the Superficial Geology within 500m of the site' an '*Identified*' response was provided. Supplied information indicated the site was underlain by a 'Unproductive' aquifer.

For the category 'Are there any records of Strata Classification in the Bedrock geology within 500m of the site' an '*Identified*' response was provided. Supplied records showed that the site was underlain by an 'Unproductive' Aquifer.

There were no records for the category 'Groundwater Abstraction Licences' within the referred search radius for the site.

There were no records for the category 'Surface Water Abstraction Licences' within the referred search radius for the site.

There were no records for the category 'Potable Water Abstraction Licences' within the referred search radius for the site.

There were no records for the category 'Source Protection Zones' within the search radius for the site.

There were no records for the category 'Groundwater Vulnerability and Soil Leaching Potential' for the site.

There were no records of Environment Agency information on River Quality available within 1500m of the site.

There were sixteen records for the category 'Ordnance Survey MasterMap Water Networks' within the search radius for the site. The reader is referred to Section 6.10 of the Enviroinsight report for further information towards the back of this Desk Study.

There were four 'Surface Water Features' reportedly within 250m of the study site that were not represented on mapping.

5.2.7 Flooding.

There were Environment Agency Flood Zone 2 floodplains within 250m of the site.

There were Environment Agency Flood Zone 3 floodplains within 250m of the site.

There was a 'Low' risk of flooding from Rivers and Sea for the site.

There were no Flood Defence areas within the search radius of 250m for the site.

There were no areas benefitting from Flood Defences within 250m of the site.

There were no areas used for Flood Storage within 250m of the site.

For the category 'What is the maximum BGS Groundwater Flooding Susceptibility within 50m of the study site'. The response 'Not Prone' was given in the supplied information.

For the category 'What is the BGS confidence rating for the Groundwater Flooding susceptibility areas' the provided response was 'Not Applicable'.

5.2.8 Designated Environmentally Sensitive Sites.

There were no records for the site within this dataset except that the site was within a Nitrate Vulnerable Zone.

5.2.9 Natural Hazards.

Search records indicated there was a 'Moderate' maximum risk of natural ground subsidence.

5.2.10 Mining.

Searches indicated there were no coal mining areas within 75m of the site.

There were no 'Non-Coal Mining areas' within 50m of the study site.

There are no brine affected areas within 75m of the site.

5.2.11 Radon.

Searches indicated that the site is in an area where less than 1% of properties are above the 'Action Level' therefore radon protection measures are not necessary in extensions and new dwellings.

6. PRELIMINARY QUALITATIVE RISK ASSESSMENT.

6.1 Introduction.

There are three factors that are taken into account whilst undertaking a qualitative risk assessment. These have been described in Section 3 of this document. At the time of this report, the site had been proposed for residential development.

6.2 Conceptual Model.

Source (s) (Potential)	Pathway	Target	Risk
Soil: The site had existed as 'undeveloped' plot of land and had no documented history of development up to and including the time of the site walkover survey carried out by this Author during 28 November 2018. There were no site-specific indicators of potential soil-borne contamination. Visual and olfactory indicators of potential contamination immediately nearby off site were not noted.	❖ Dermal contact, ingestion and inhalation	• Present users • End users • Construction workers • General public	• Low • Low • Low • Low
	❖ Wind erosion and atmospheric dispersion	• Adjacent properties • General public • Ecological Systems • Archaeological Sites & Monuments	• Low • Low • Low • n/a
	❖ Leaching	• Adjacent properties • Shallow groundwater • Services/construction materials • Plant life • Surface water • Ecological Systems • Arch. & Monuments	• Low • Low • Low • Low • Low • Low • Low
Shallow groundwater: The site overlies 'Unproductive' aquifers, which were not considered to be pollution sources.	❖ Groundwater migration	• Adjacent properties • Deep groundwater • Services/construction materials • Plant life • Ecological Systems • Archaeological Sites & Monuments	• Low • Low • Low • n/a • Low • Low
	❖ Dermal contact, ingestion and inhalation	• Present users • End users • Construction workers • General public	• Low • Low • Low • Neg-Low
Gas: Measurable (background) concentrations of ground gas would not (reasonably) be anticipated to be present as a result of historical site use or the underlying natural geology.	❖ Direct inhalation ❖ Soil migration ❖ Services migration	• End users • Construction workers • Buildings • Ecological Systems • Arch. Sites & Monuments	• Low • Low • Low • Low • Neg
Negligible Risk Defined as the site should be considered suitable for present or future use and environmental setting. Contaminants unlikely to be present, which might have unacceptable impact on key targets. Low Risk Defined as the site should be considered suitable for present or future use and environmental setting. Contaminants may be present but unlikely to have unacceptable impact on key targets. Medium Risk Defined as the site may not be suitable for present or future use and environmental setting. Contaminants are probably present and might have unacceptable impact on key targets. High Risk Defined as the site is probably or certainly not suitable for present or future use and environmental setting. Contaminants probably or certainly present and likely to have an unacceptable impact on key targets.			
Notes: n/a = not applicable			

The risk assessment follows below:-

6.3 Targets.

Potential targets, in the context of the risk assessment (based on the relevant pollutant linkage), where a plausible pathway can be proven, are discussed as follows.

At the time of this report, the proposed scheme comprised residential development.

6.3.1 Human Health (Site Users & Construction Workers)

The site had a limited documented development history as described, which included its establishment. There is the potential for the presence of limited thicknesses of Made Ground in the form of concrete hardstanding within former building footprint(s), which would have provided a physical barrier between any potential sources of contamination resulting from on site activities thus protecting the underlying soils.

It is further reasonably considered that the Made Ground would be 'inert' and therefore not a source of contamination itself.

Based upon the foregoing and the final paragraph of this report, regarding 'unanticipated contamination:-

A Low risk has been identified until proven otherwise.

6.3.2 Services and Construction Materials

6.3.2.1 Concrete & Potable water supplies.

Adverse effects on services and construction materials may be anticipated where soils are impacted by localised raised/lowered pH values, PAH's, TPHs and metals contamination and where these are present in Made Ground materials. However, in this instance and based on the absence of Made Ground and the foregoing:-

A Low risk has been identified.

6.4 Landscaping & Planting

Based on the foregoing a 'Low' risk is presented to this receptor from the Made Ground present at the site.

6.5 Groundwater (Controlled Waters)

The site is underlain by 'Unproductive' Aquifers. However, there remains the potential for small quantities of perched groundwater in any superficial fills (or Made Ground), where these are present. However, searches indicated in this instance that the presence of significant thicknesses of Made Ground would not be reasonably anticipated given the documented history of the site.

A Low risk to deeper groundwater has been identified.

6.6 Ground Gas

Measurable concentrations of soil gases (predominantly carbon dioxide) would not be reasonably anticipated to be present as a function of any made ground present. However, where present, any granular overburden would mitigate the risk of ground gas buildup via natural ventilation of ground gas to atmosphere.

On the basis of the foregoing:~

A Low risk has been identified.

7. RECOMMENDATIONS FOLLOWING PRELIMINARY RISK ASSESSMENT.

7.1 Overview.

The desk study information (including the outcome of the walkover survey), showed the site had a limited documented developmental history since its establishment.

The site walkover survey and the searches carried out as part of this Desk Study indicated that there were no readily identifiable sources of contamination.

Made Ground was present in the form of a small number of paving slabs which are considered to be 'inert' and therefore (reasonably) are considered unlikely to pose an 'unacceptable' risk to the End User of the completed development.

On that basis, and subject to the final paragraph in this report (in blue text), the need for a Phase 2 intrusive investigation is considered *unwarranted*.

The opinions and recommendations in this report are subject to the agreement of the Regulators.

8. CONCLUSIONS.

This geoenvironmental desk study prepared by Goldfinch Environmental Limited was undertaken on the instruction of Mr & Mrs R Kent (the Client), via the offices of G R Merchant Architects, at a site located off Low Lane, Holbeach, Spalding, Lincolnshire.

The site was proposed for residential development.

There were no notable features present in the context of land contamination other than inert Made Ground as described above.

Desk Study searches have shown that the site rests on Tidal Flat Deposits underlain by Mudstone.

An *overall Low* risk is associated with the site *subject to the final paragraph in this report.*

Recommendations for the need for further work (or otherwise) have been discussed in Section 7 of this report.

Also, at all times especially once any necessary groundworks have commenced, the final paragraph below applies regarding 'unanticipated' contamination.

The reader should note that the opinions, recommendations and conclusions in this report are subject to the agreement of the Local Authority who are the final arbiters in these matters.

Based on the foregoing, a *Low* risk to construction workers and services installations has been associated with the site until proven otherwise. Site personnel, particularly groundworkers, should follow sound health and safety welfare practices that will further mitigate this level of risk.

Should unanticipated contamination be suspected, or revealed during any groundworks, then the area should be temporarily isolated and further advice sought by a suitably independent qualified person and a management strategy for these occurrences should be submitted to the Local Authority for their approval prior to proceeding, as required by Regulatory Offices.

FIGURES

Approximate Site Location

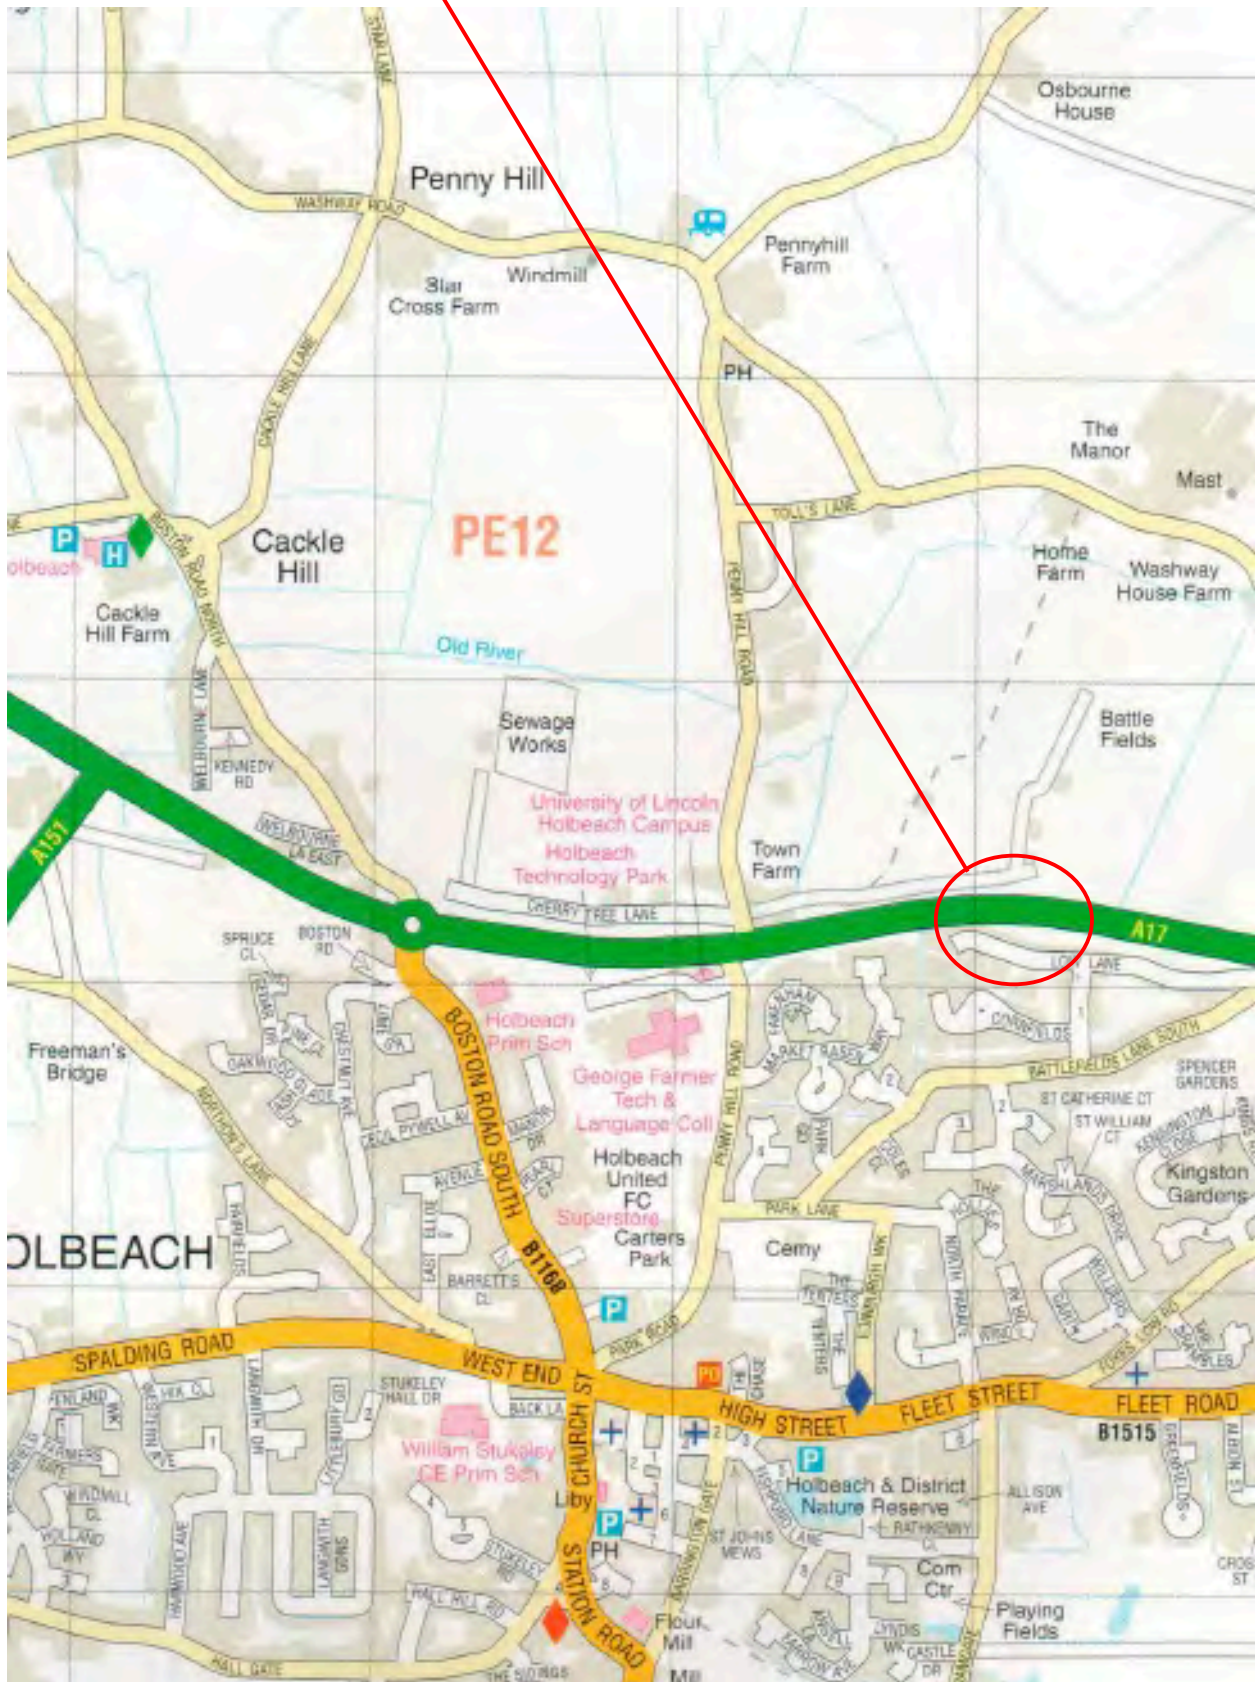


Figure 1

Site Location Plan

Ref: 0575/1

Goldfinch
Environmental
Ltd

SITE AREA - 0.03 Hectares,

INDICATIVE DWELLING :-

3 BEDROOM HOUSE & PARKING SPACE,

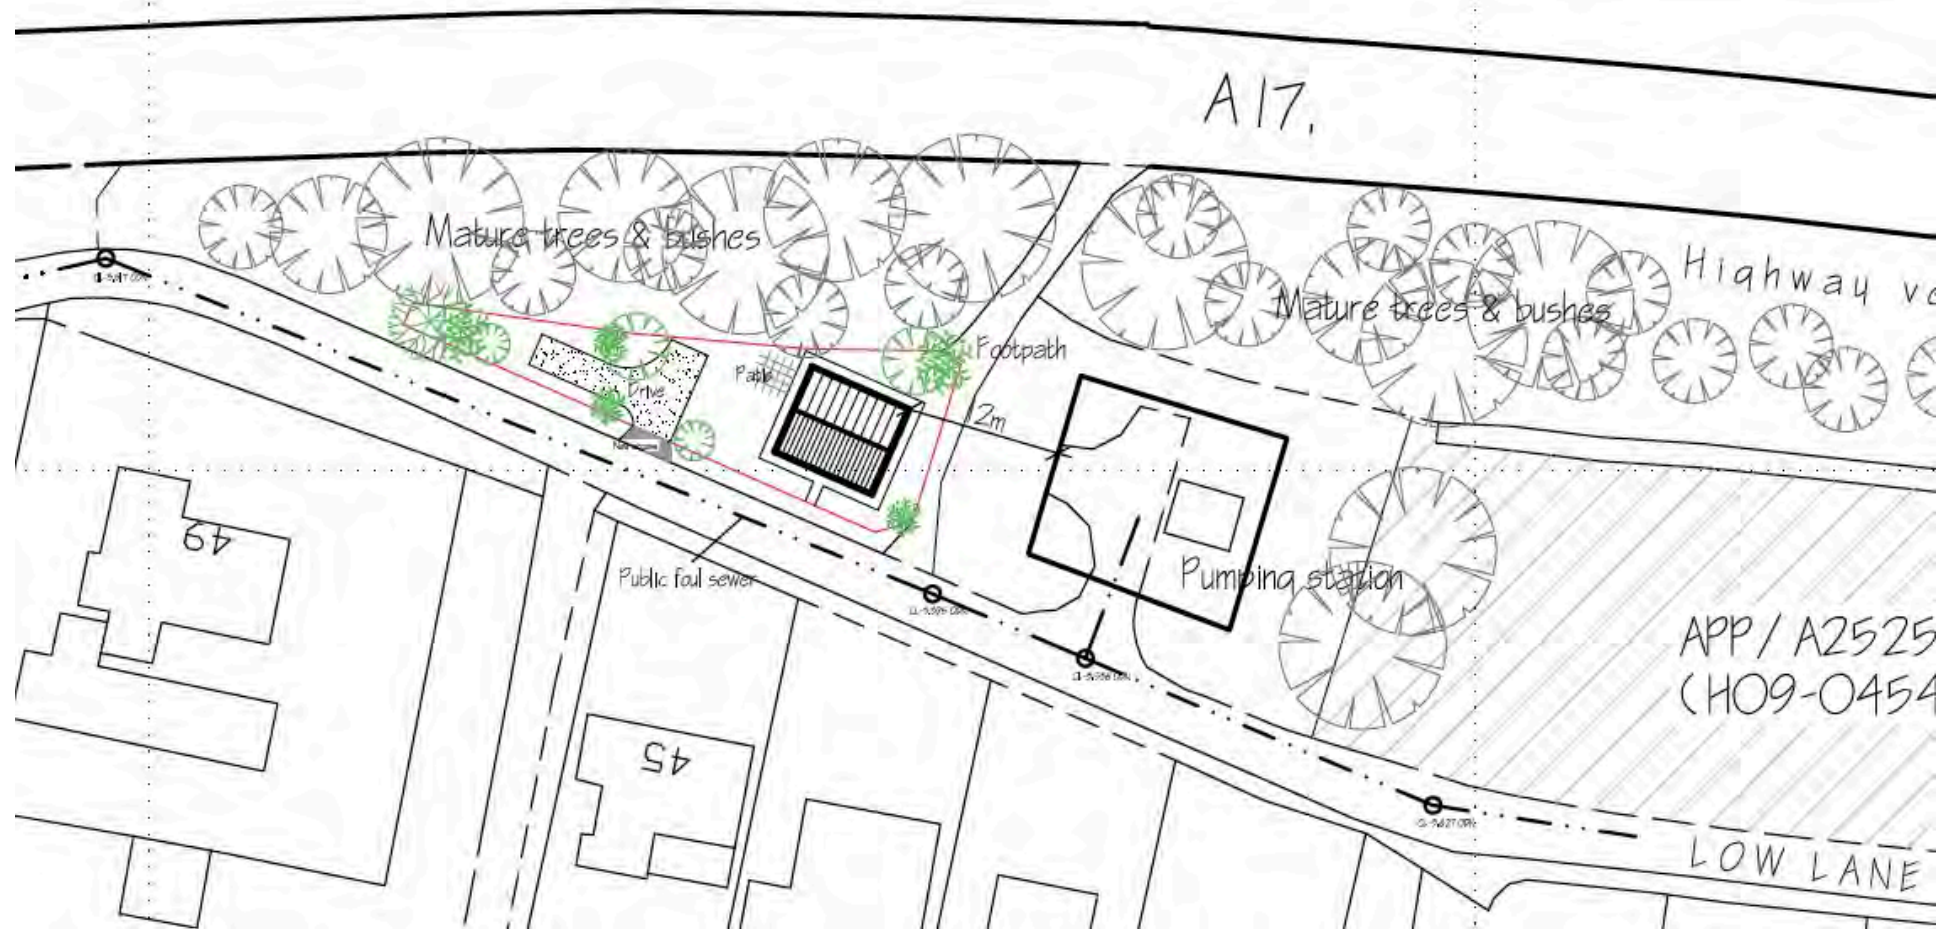


Figure 2

Proposed Layout Plan

Ref: 0575/1

Goldfinch
Environmental
Limited

APPENDIX 1

‘Groundsure’ Report

Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW

Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: County Series

Map date: 1887

Scale: 1:10,560

Printed at: 1:10,560



Surveyed 1887
Revised 1887
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1887
Revised 1887
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1887
Revised 1887
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1887
Revised 1887
Edition N/A
Copyright N/A
Levelled N/A



Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf



Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW


Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: County Series

Map date: 1888

Scale: 1:2,500

Printed at: 1:2,500

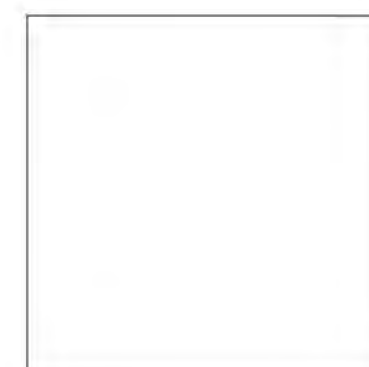

Surveyed 1888
Revised 1888
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

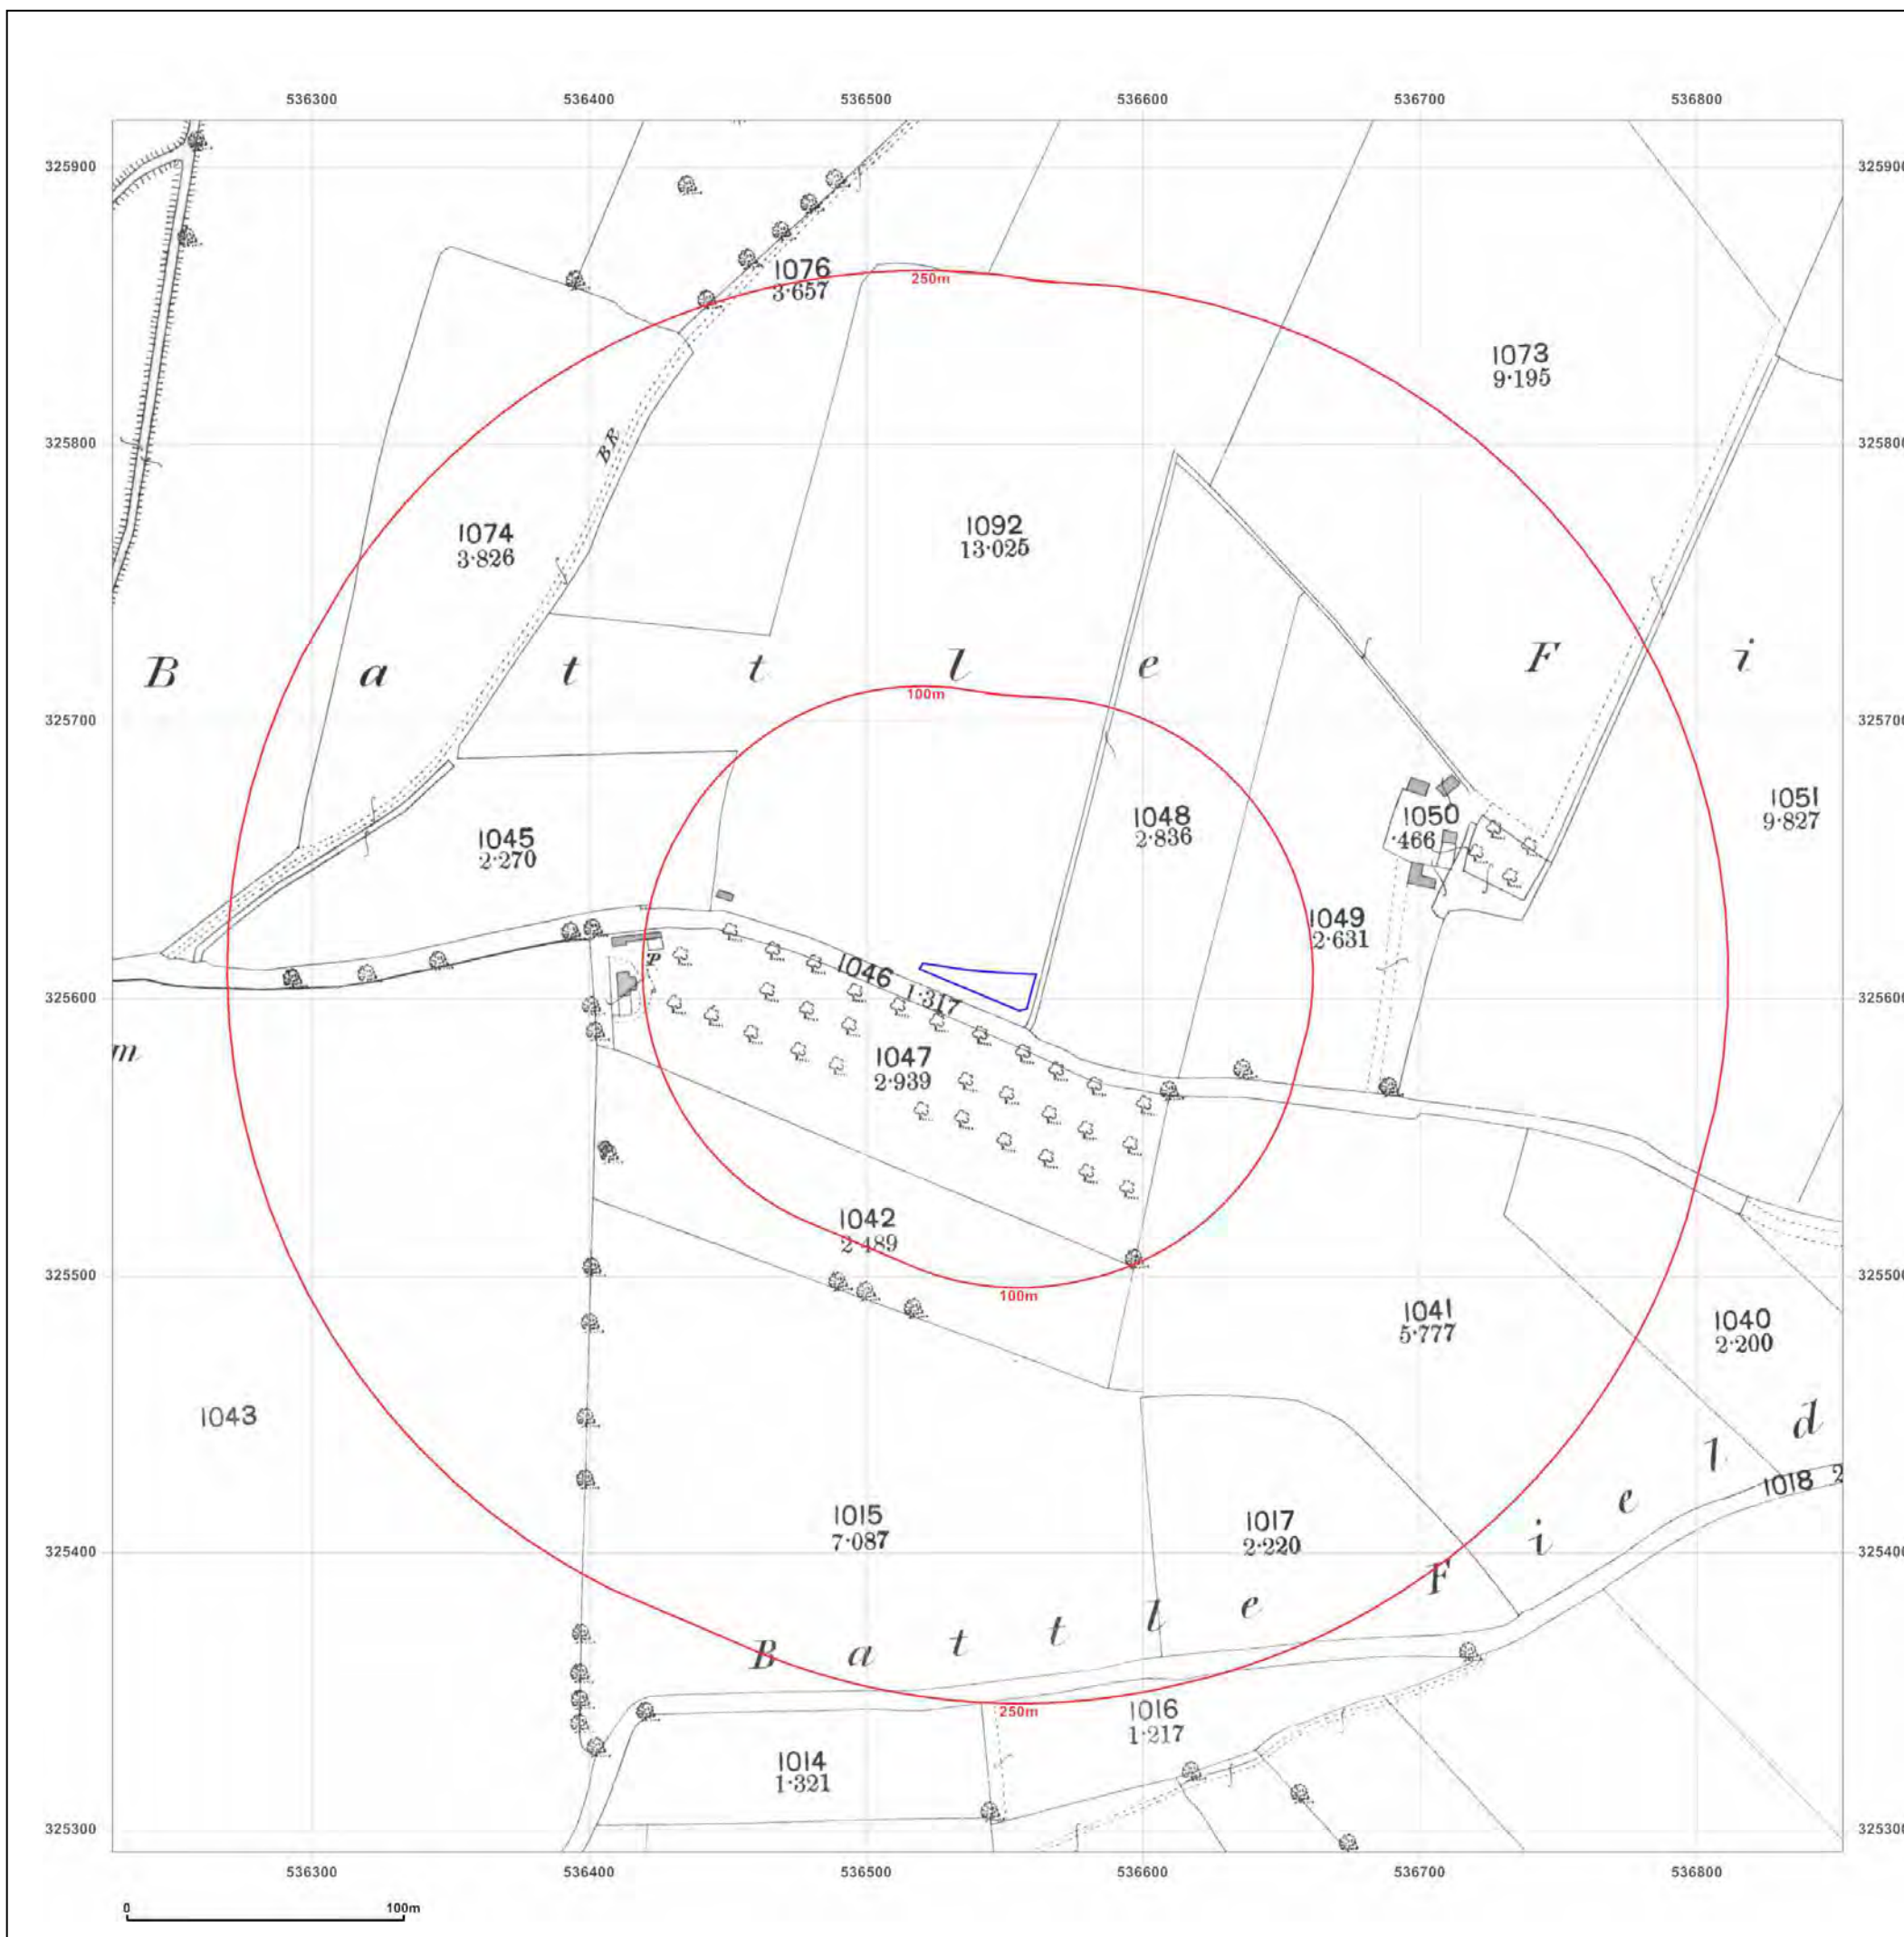

Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW

Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: County Series

Map date: 1903

Scale: 1:10,560

Printed at: 1:10,560



Surveyed 1886
Revised 1903
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1886
Revised 1903
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1886
Revised 1903
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1886
Revised 1903
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

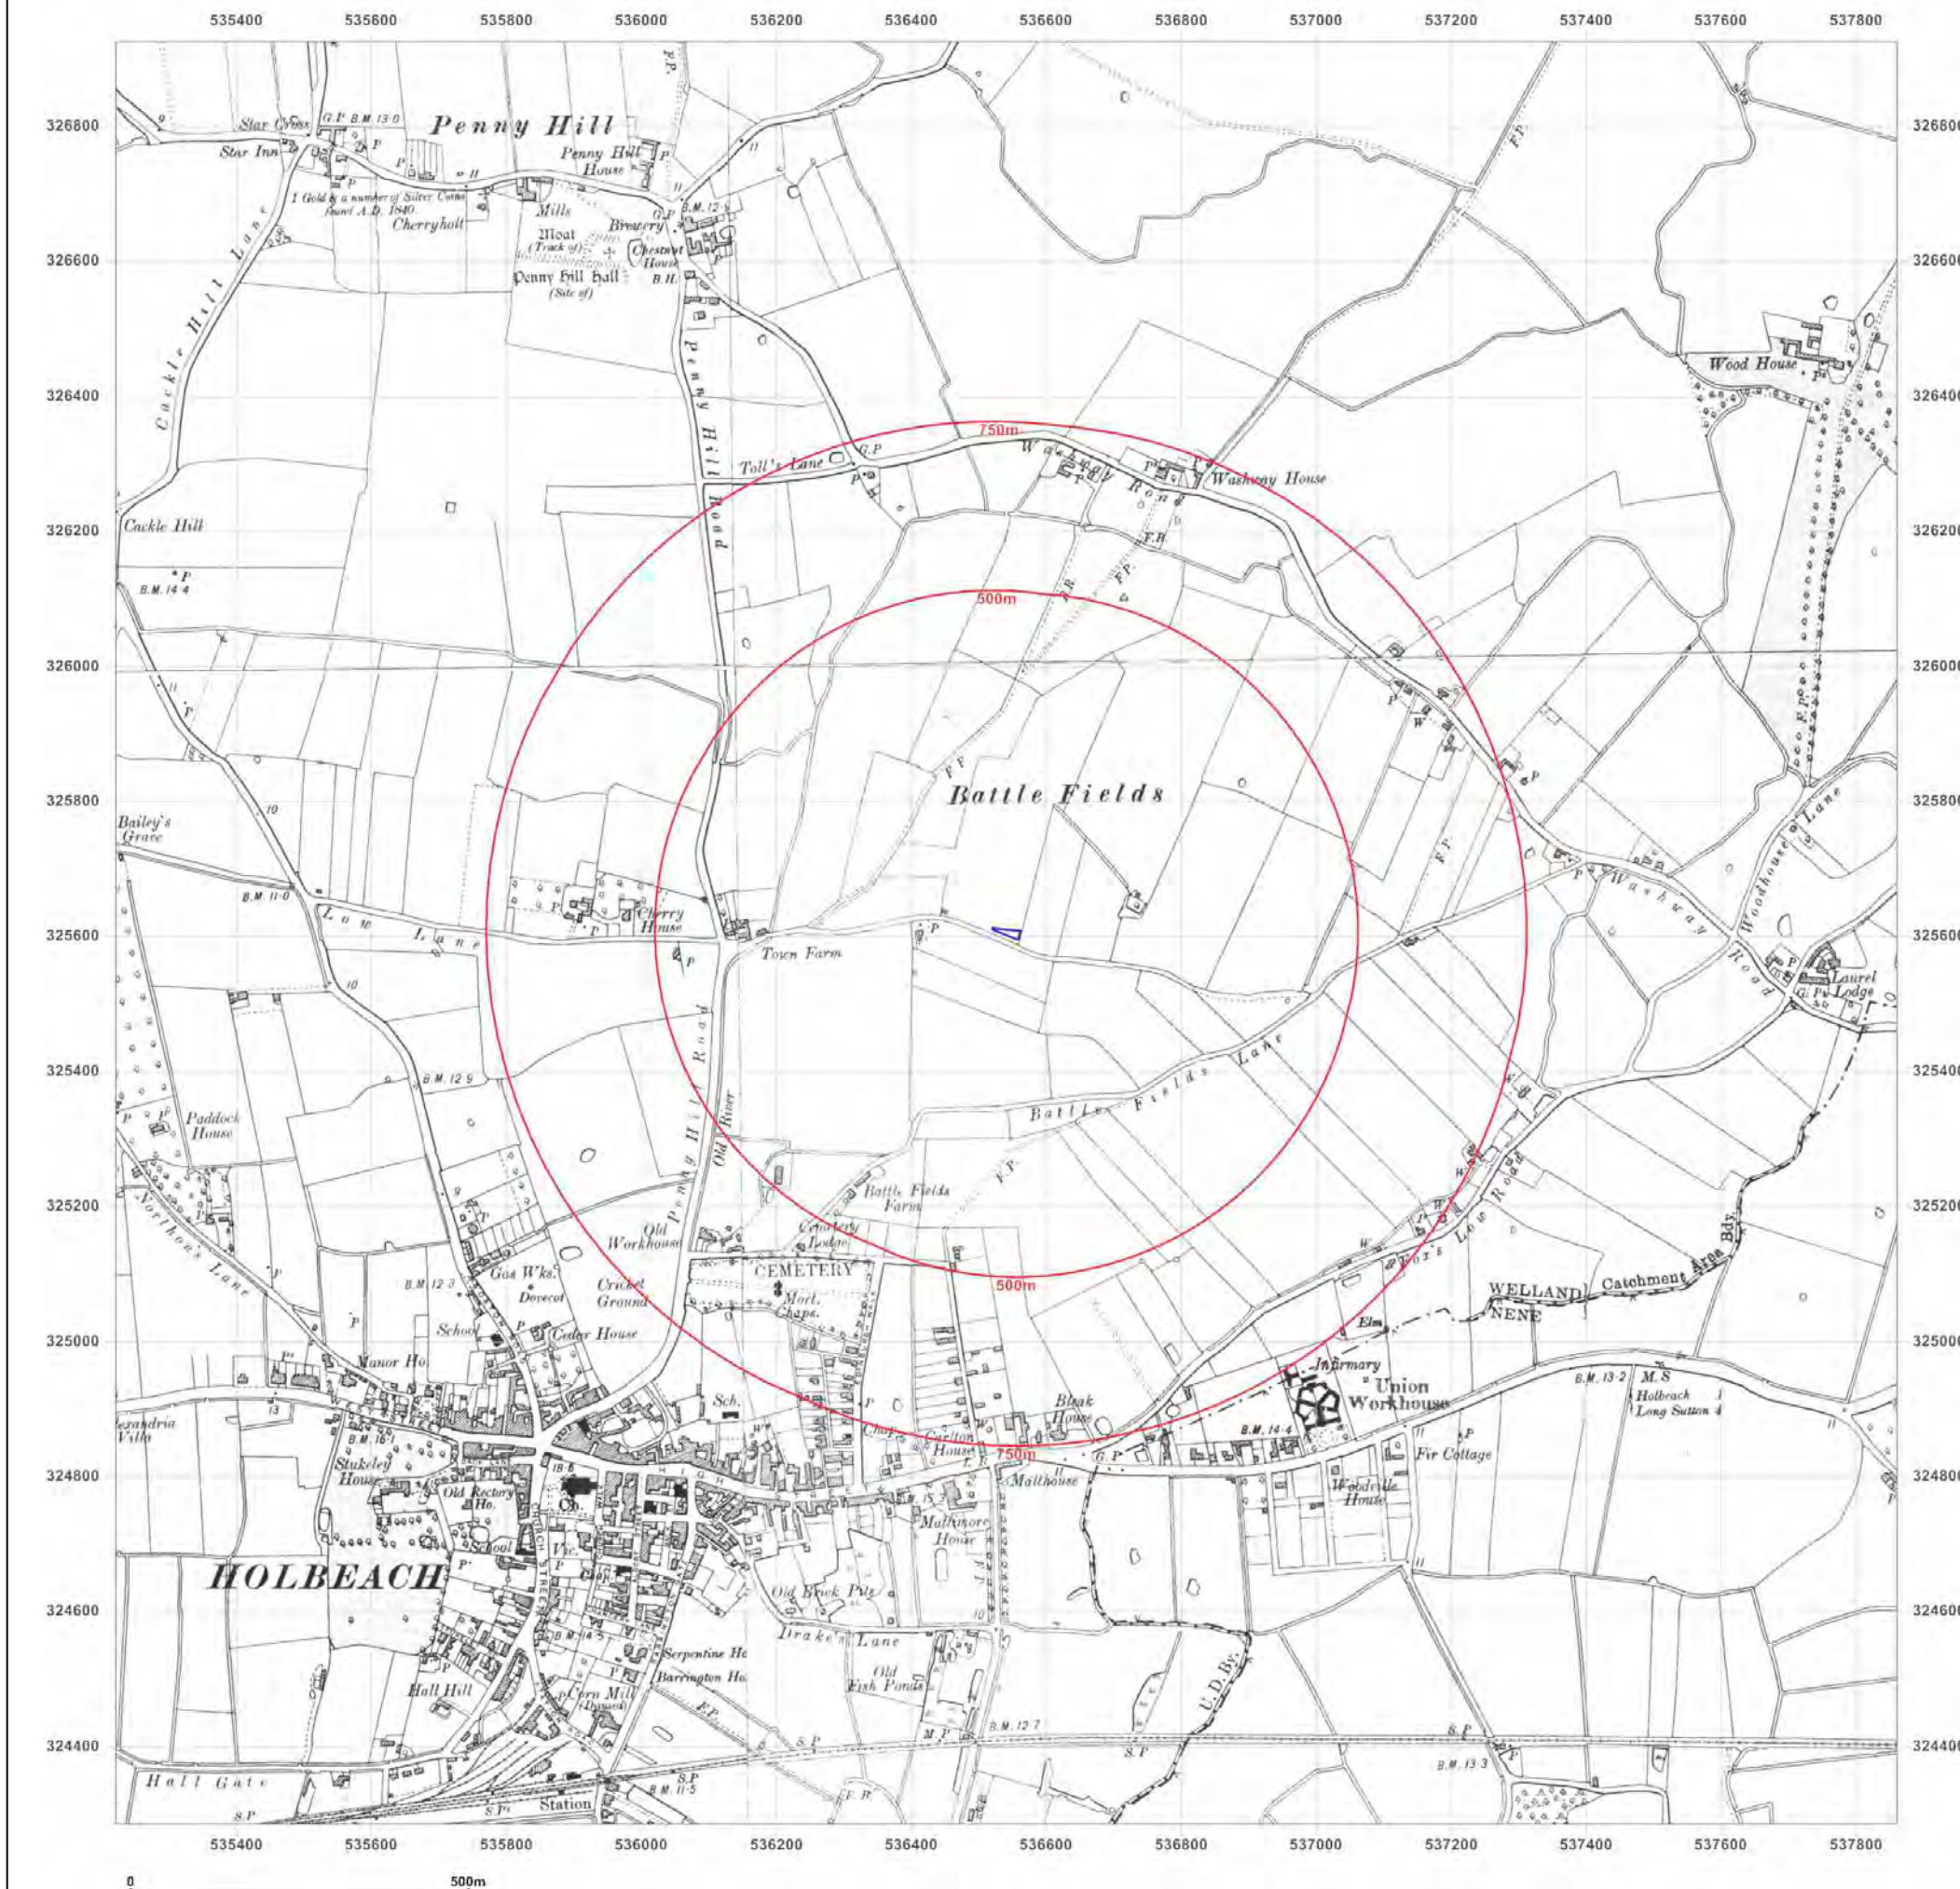

Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW


Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: County Series

Map date: 1903

Scale: 1:10,560

Printed at: 1:10,560

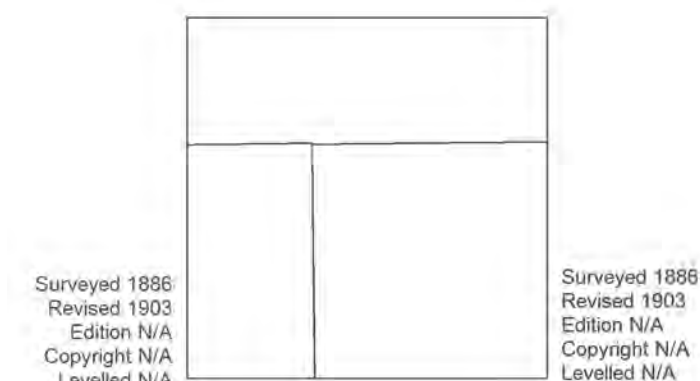


Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

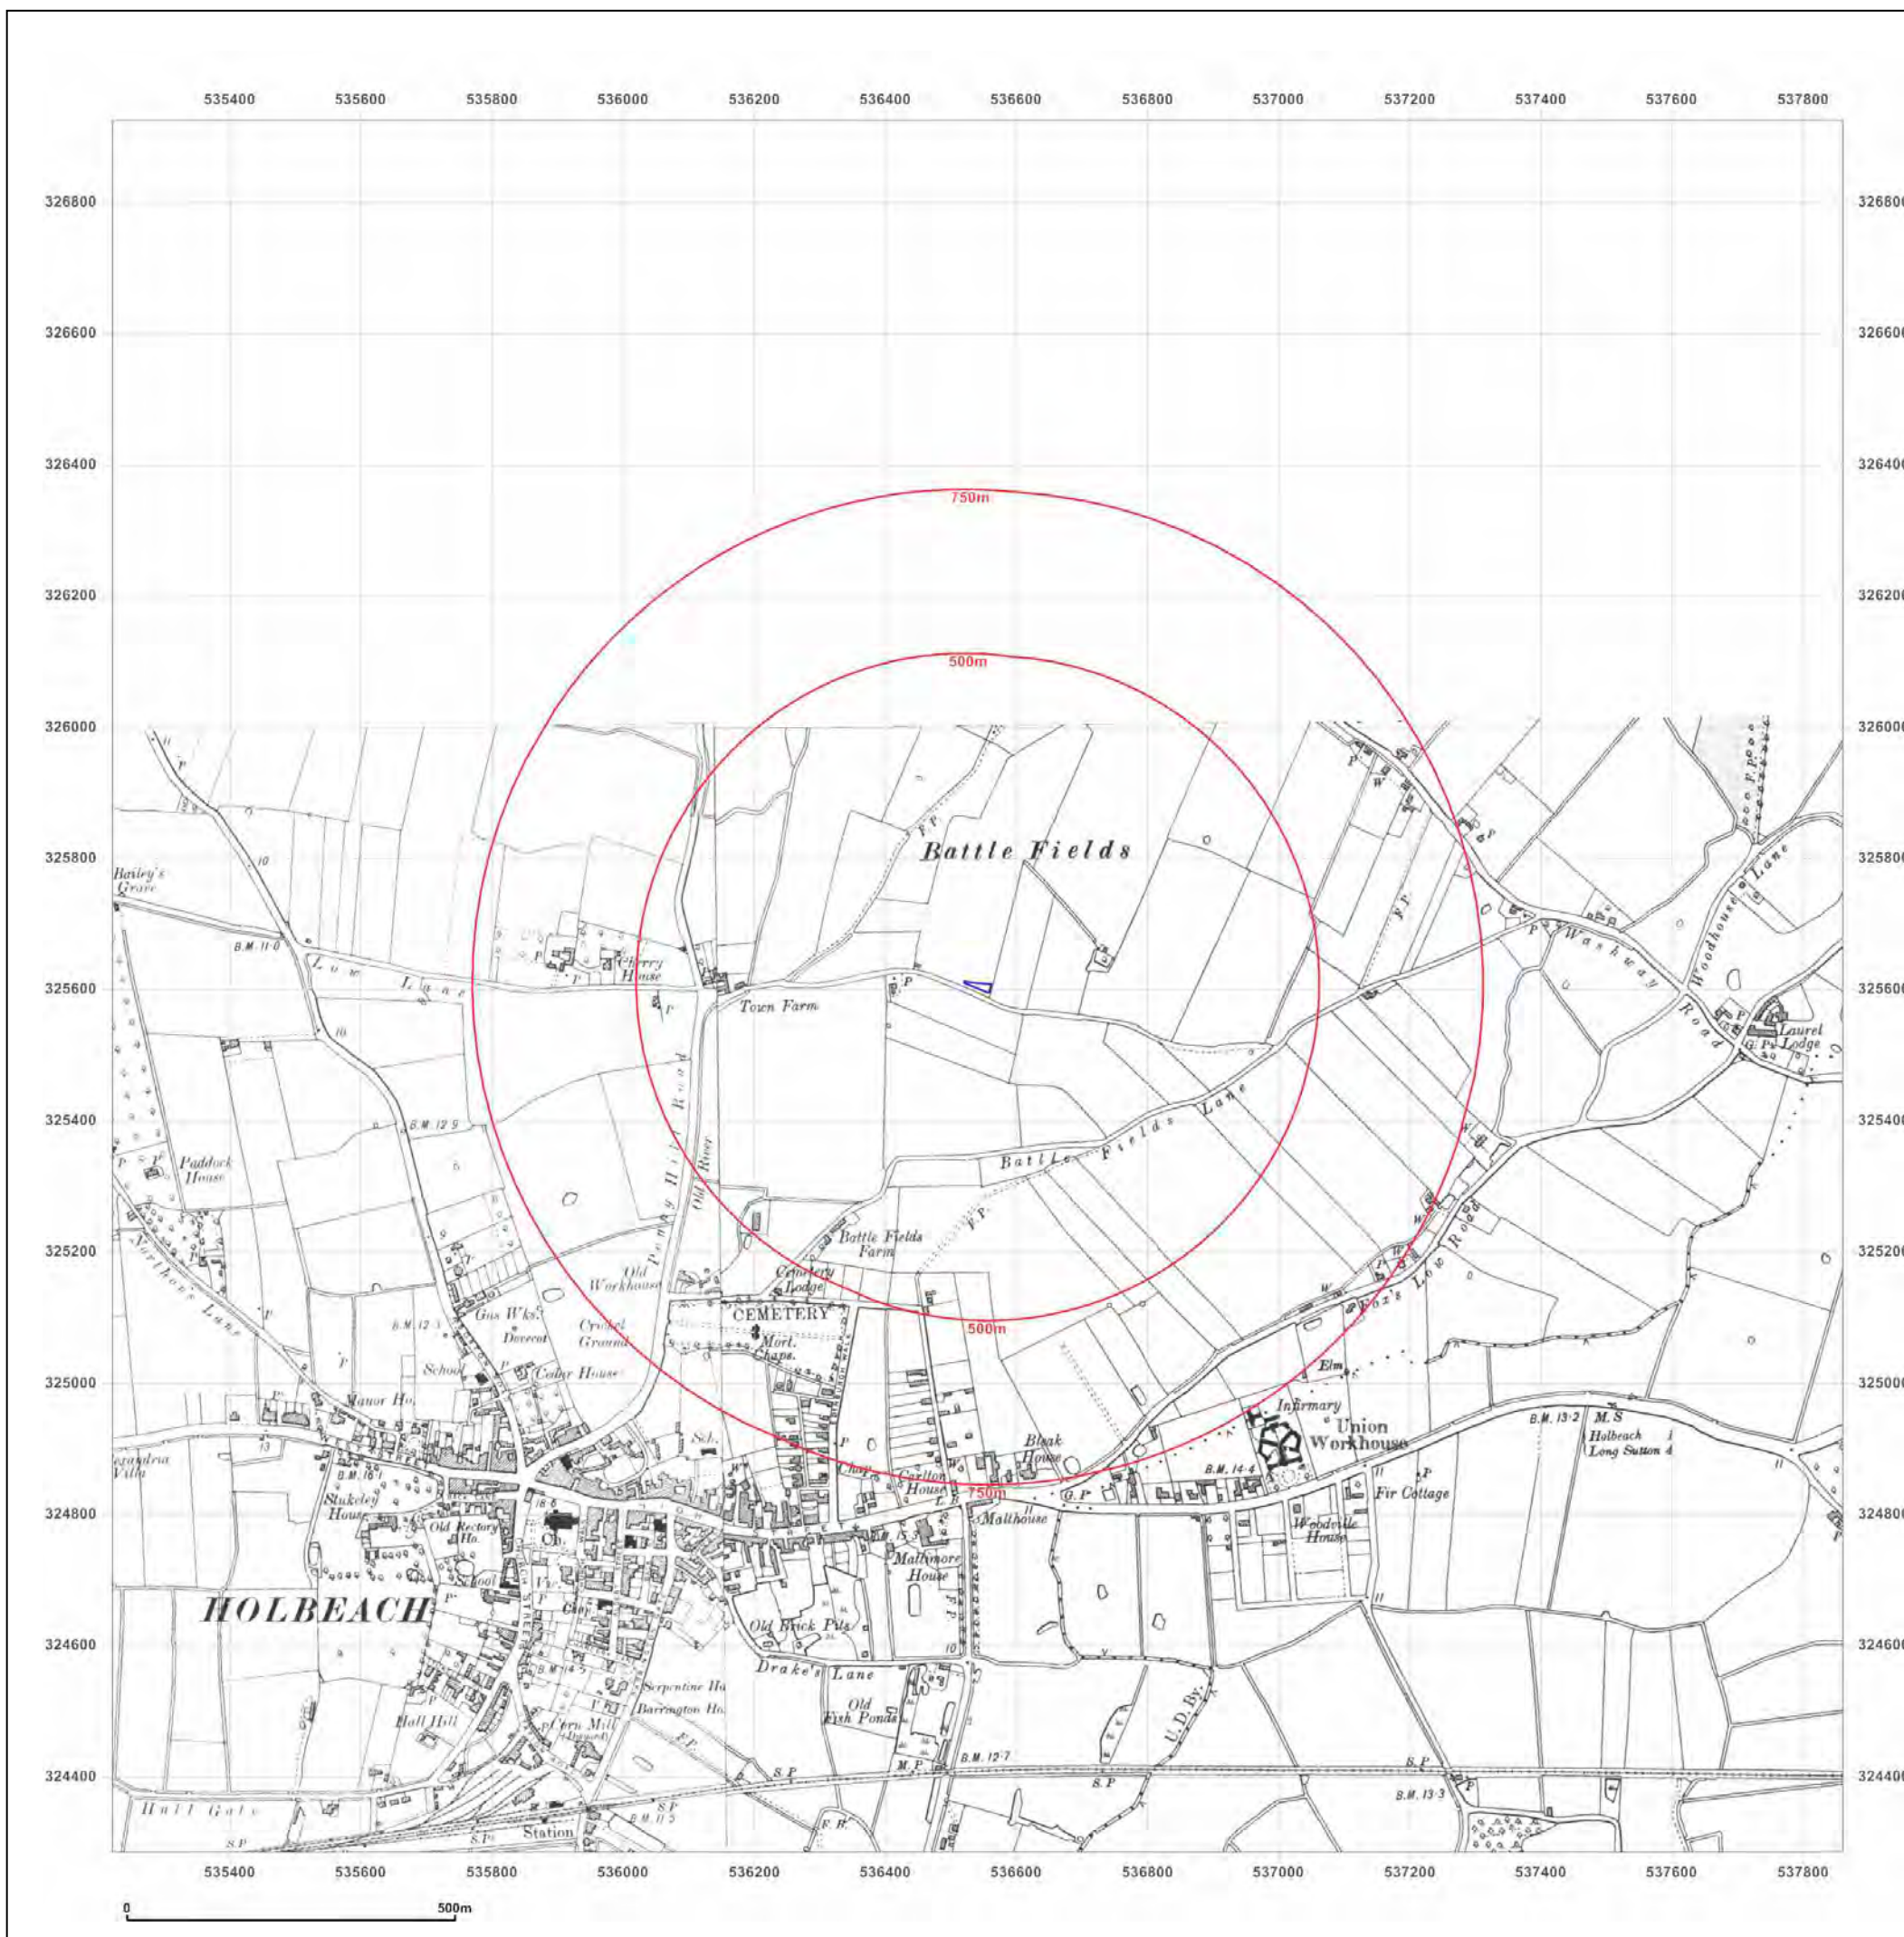

Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW


Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: County Series

Map date: 1904

Scale: 1:2,500

Printed at: 1:2,500

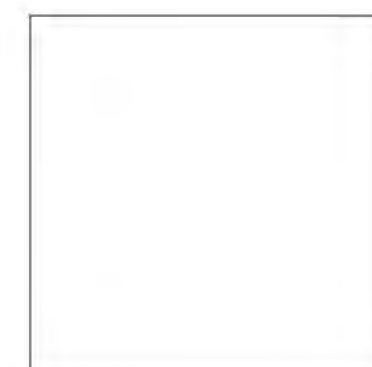

Surveyed 1904
Revised 1904
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

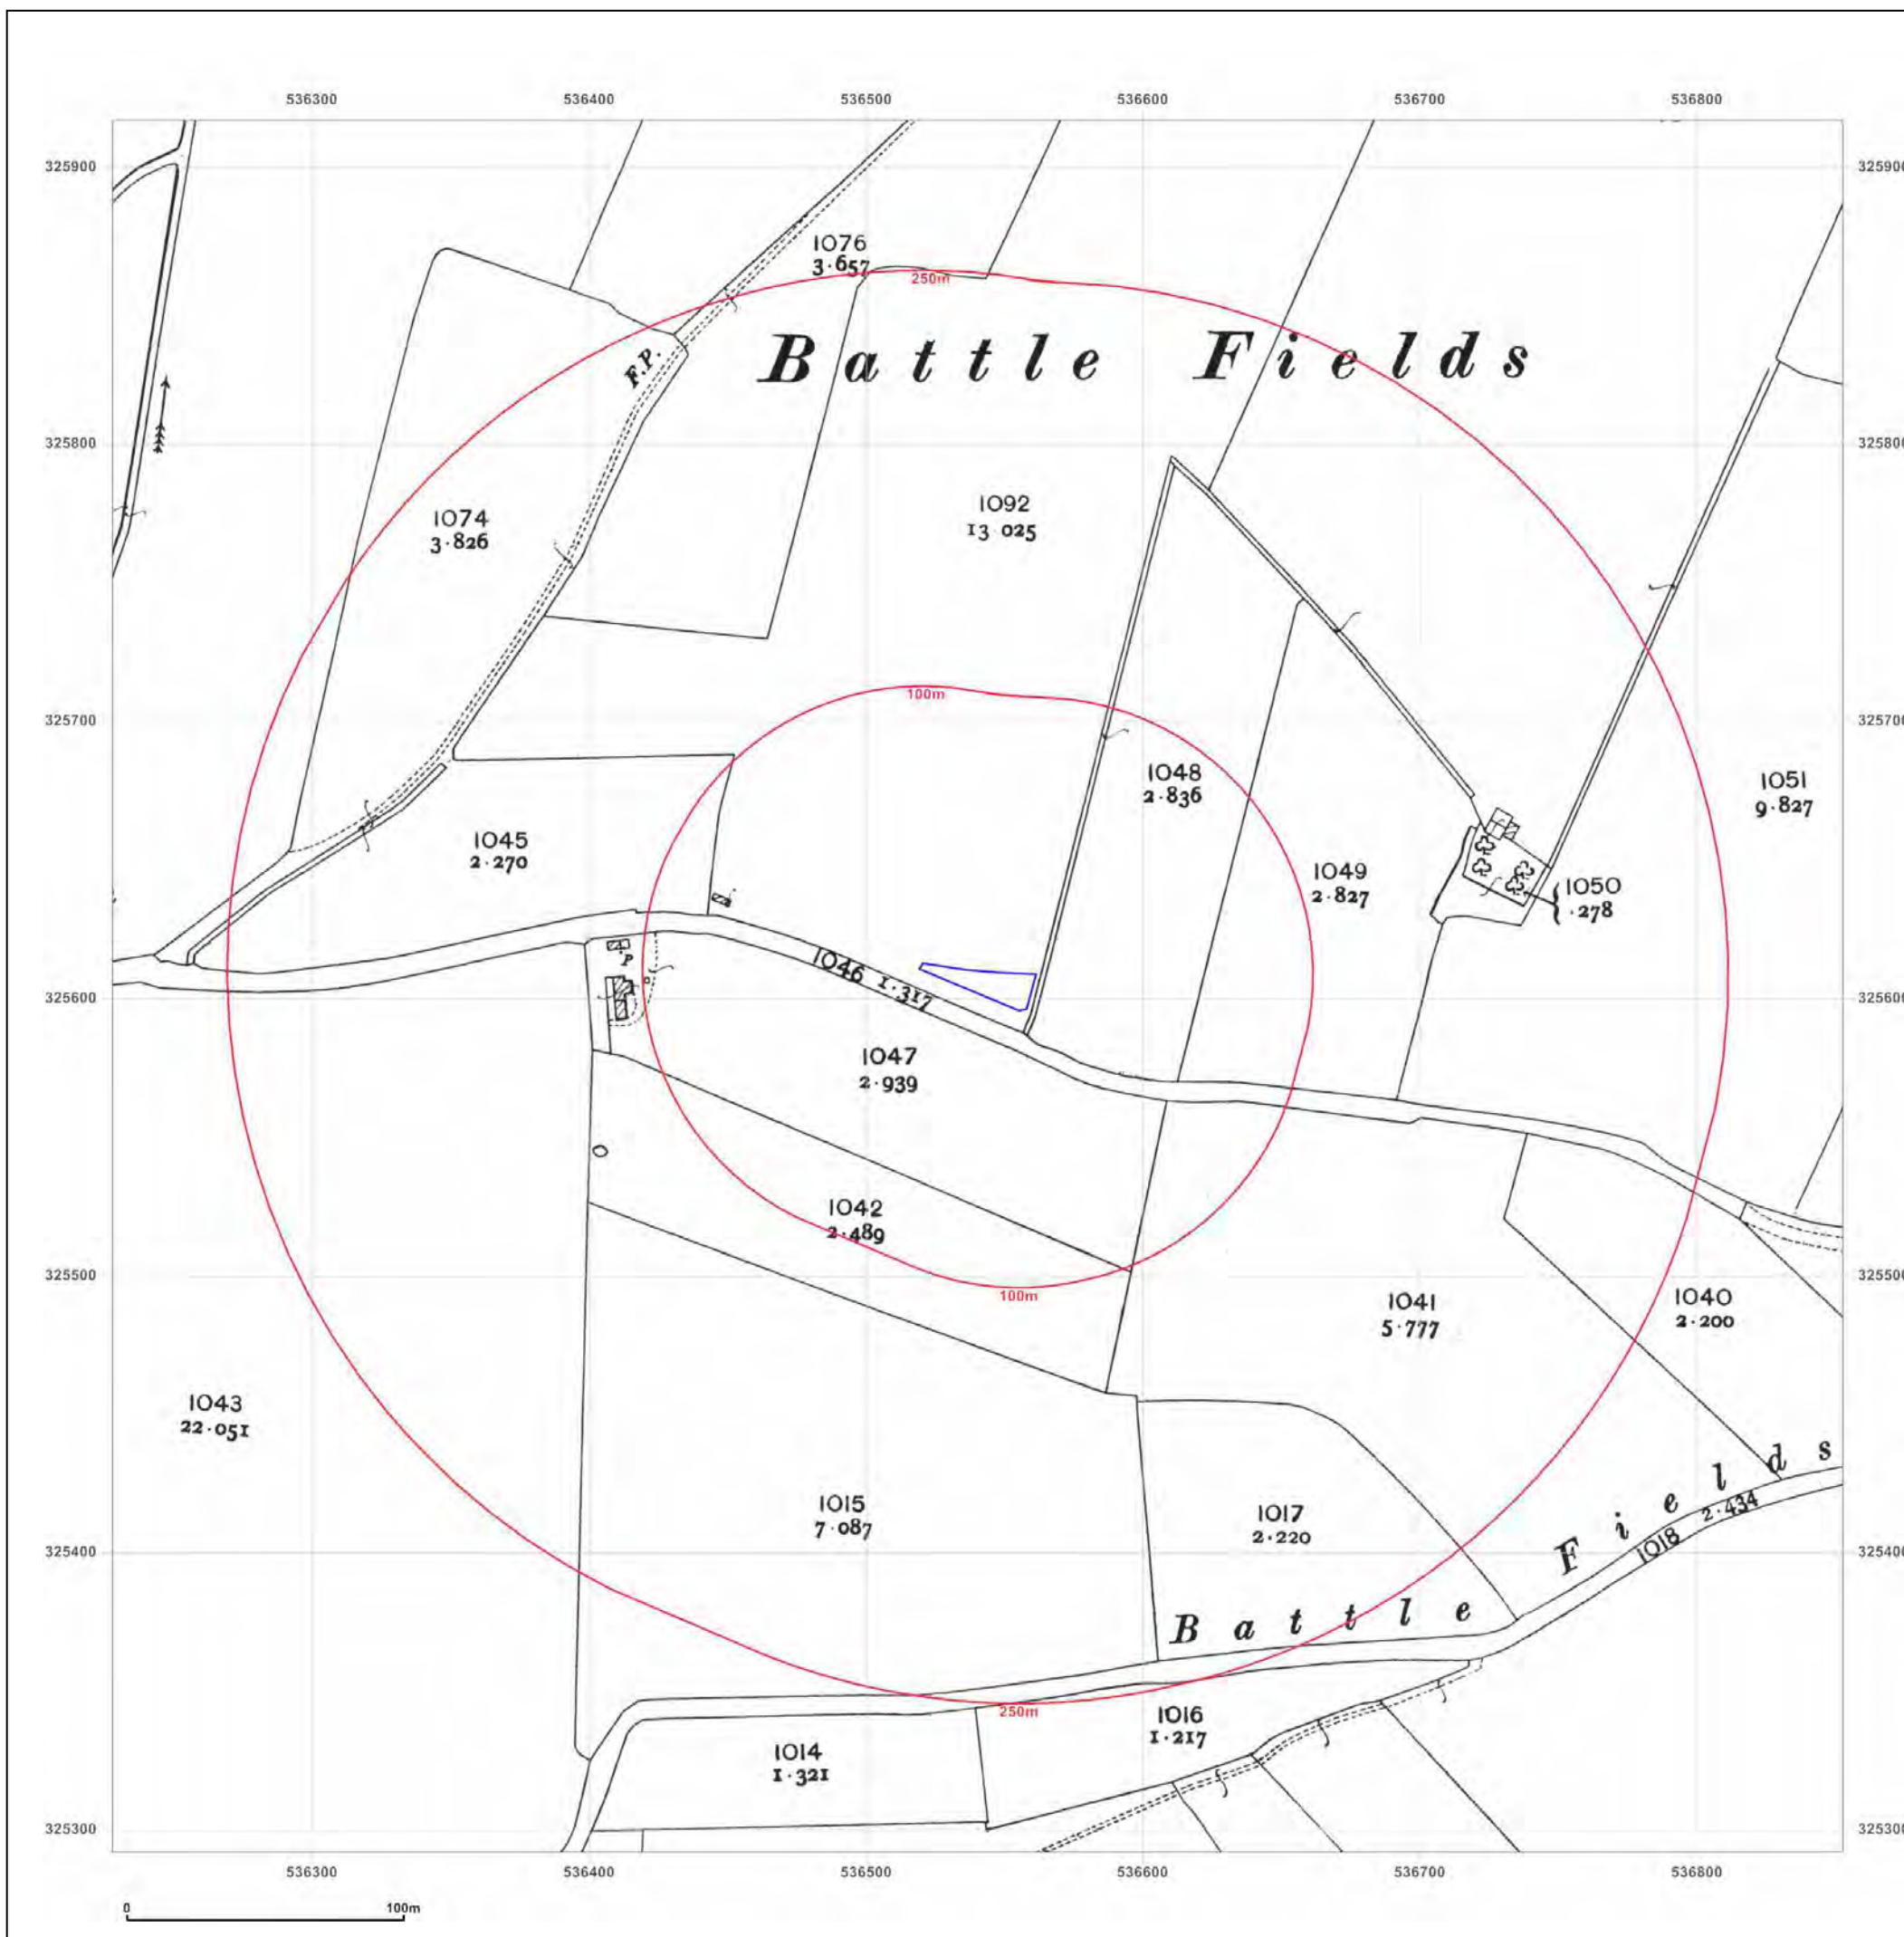

Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW

Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: County Series

Map date: 1929

Scale: 1:10,560

Printed at: 1:10,560



Surveyed 1886
Revised 1929
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1886
Revised 1929
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1886
Revised 1929
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1886
Revised 1929
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

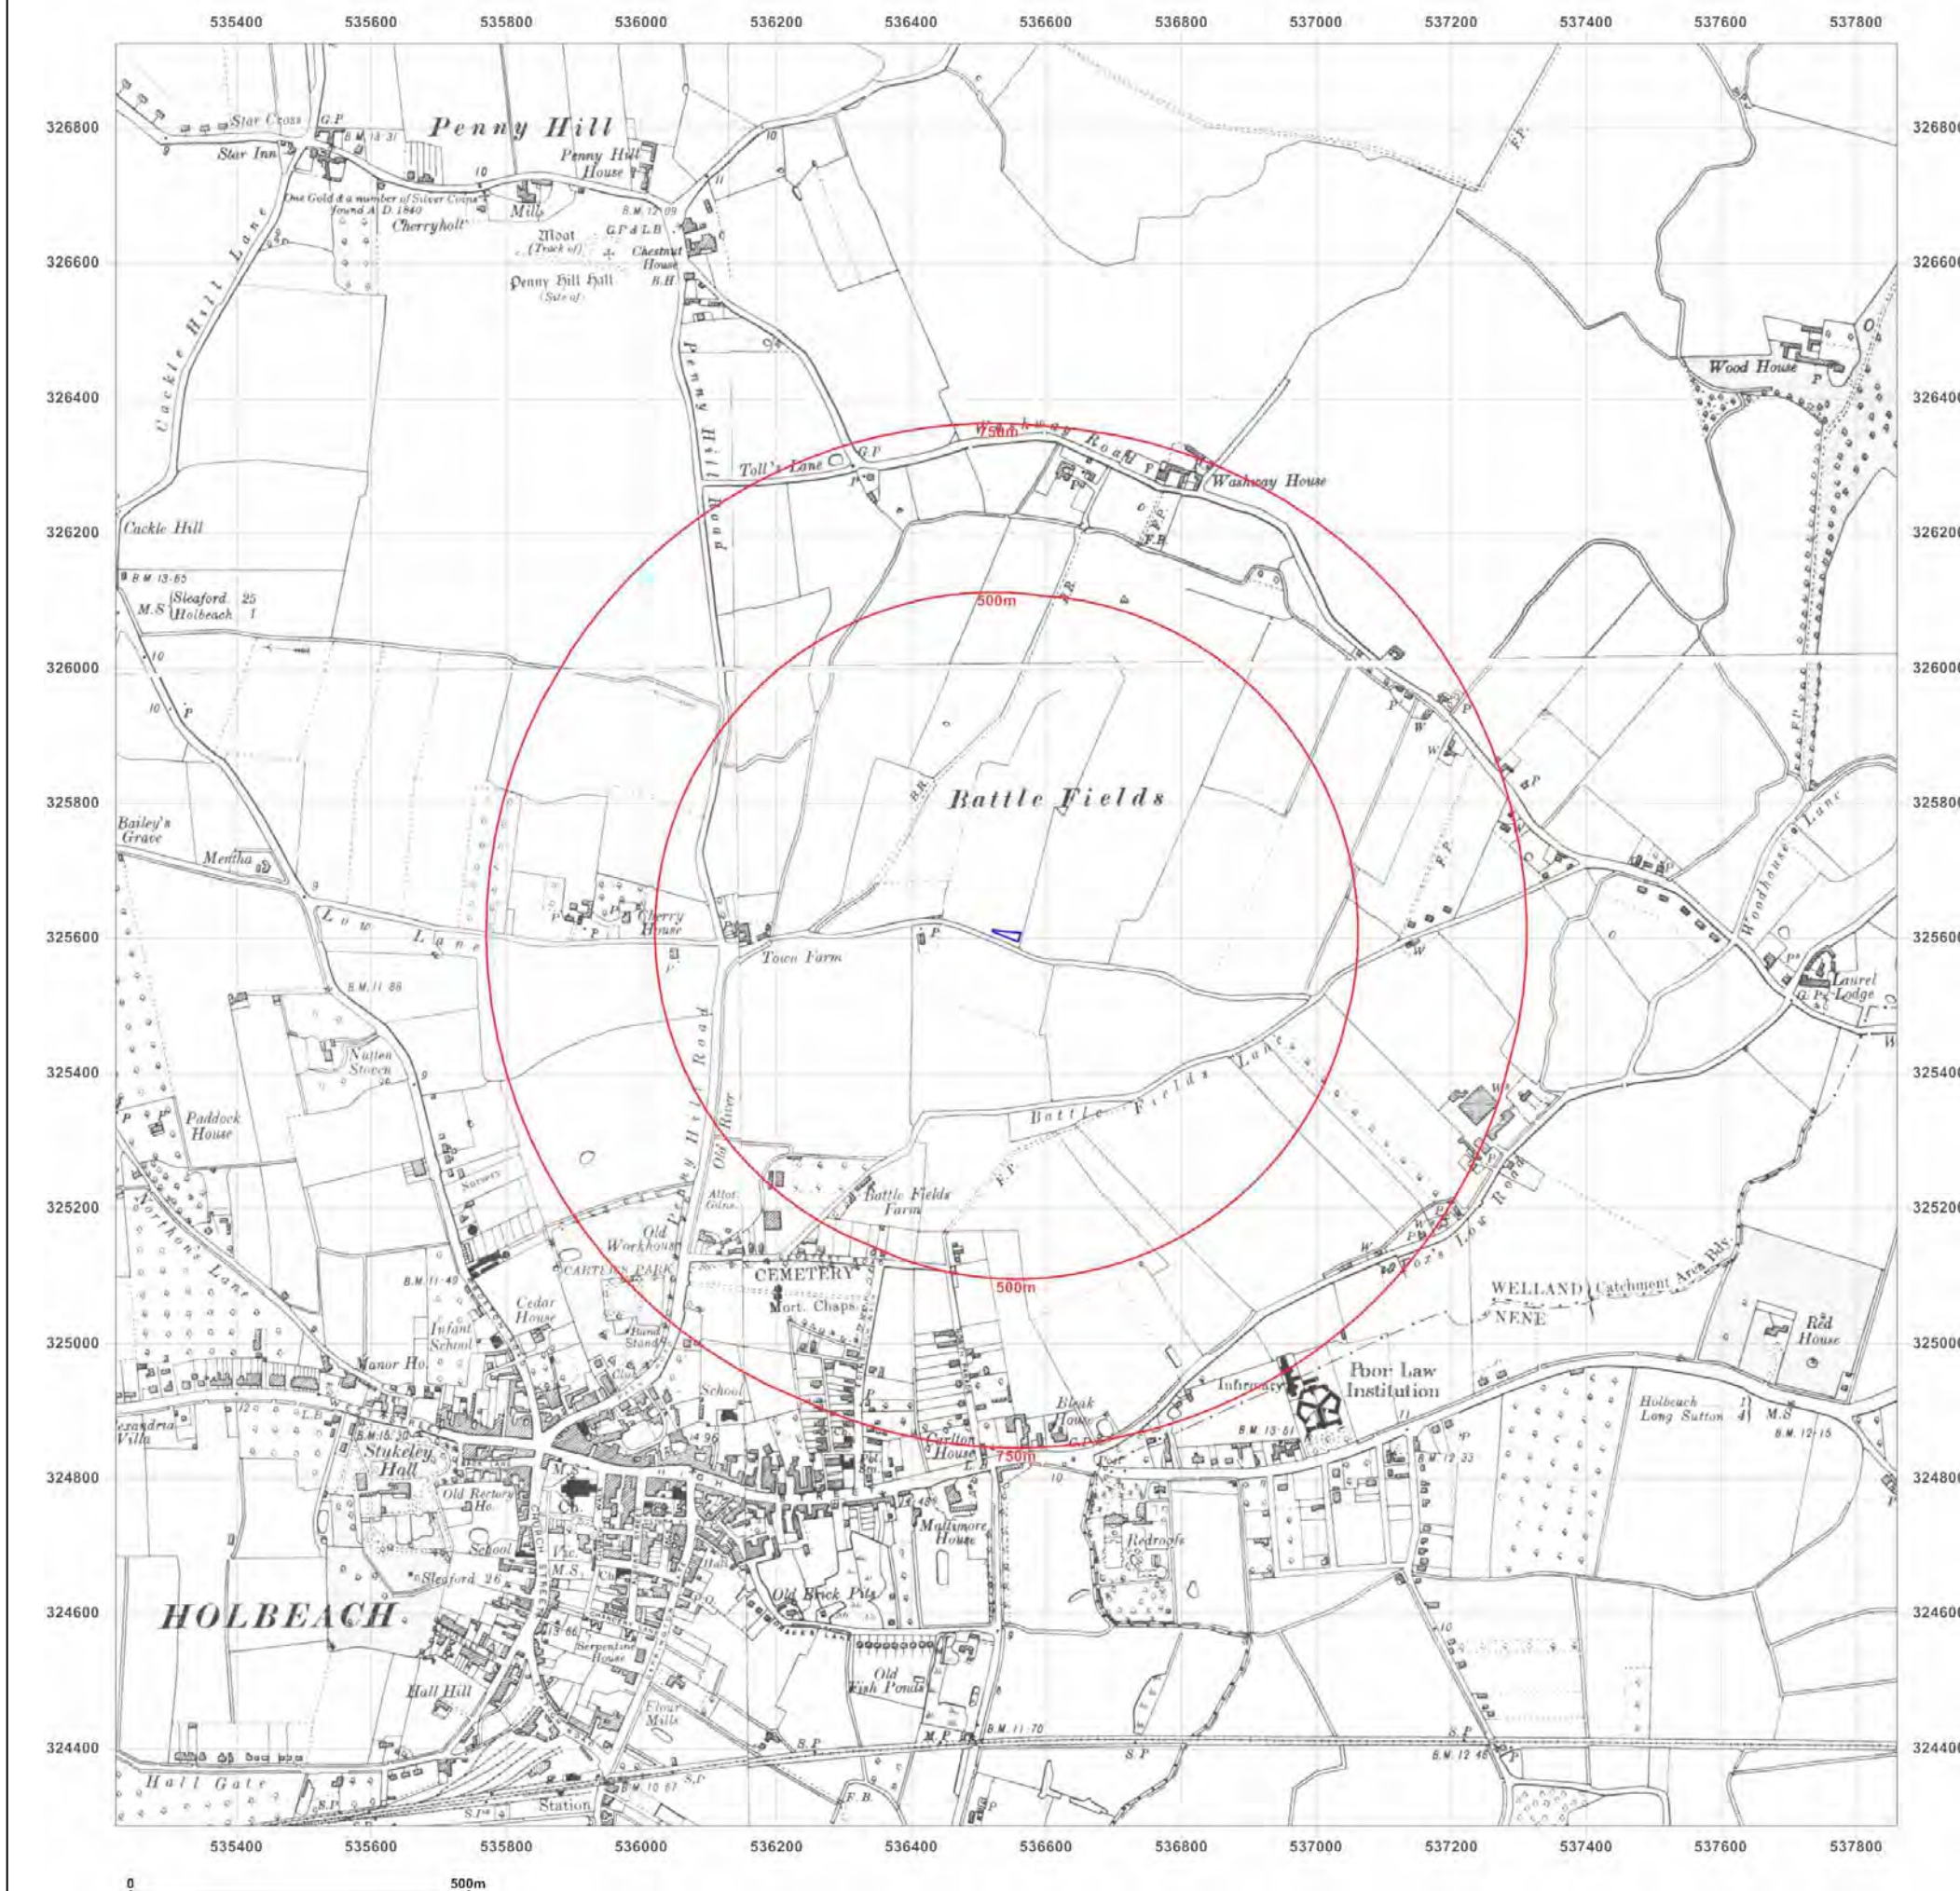

Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW

Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: County Series

Map date: 1931


Scale: 1:10,560

Printed at: 1:10,560



Surveyed 1886
Revised 1931
Edition 1931
Copyright N/A
Levelled N/A

Surveyed 1886
Revised 1931
Edition 1931
Copyright N/A
Levelled N/A

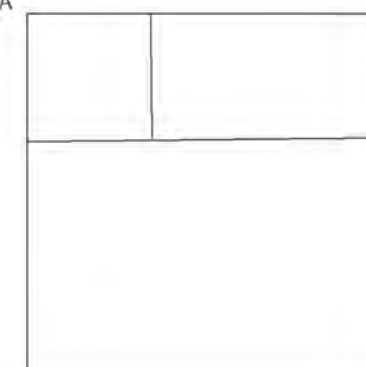


Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

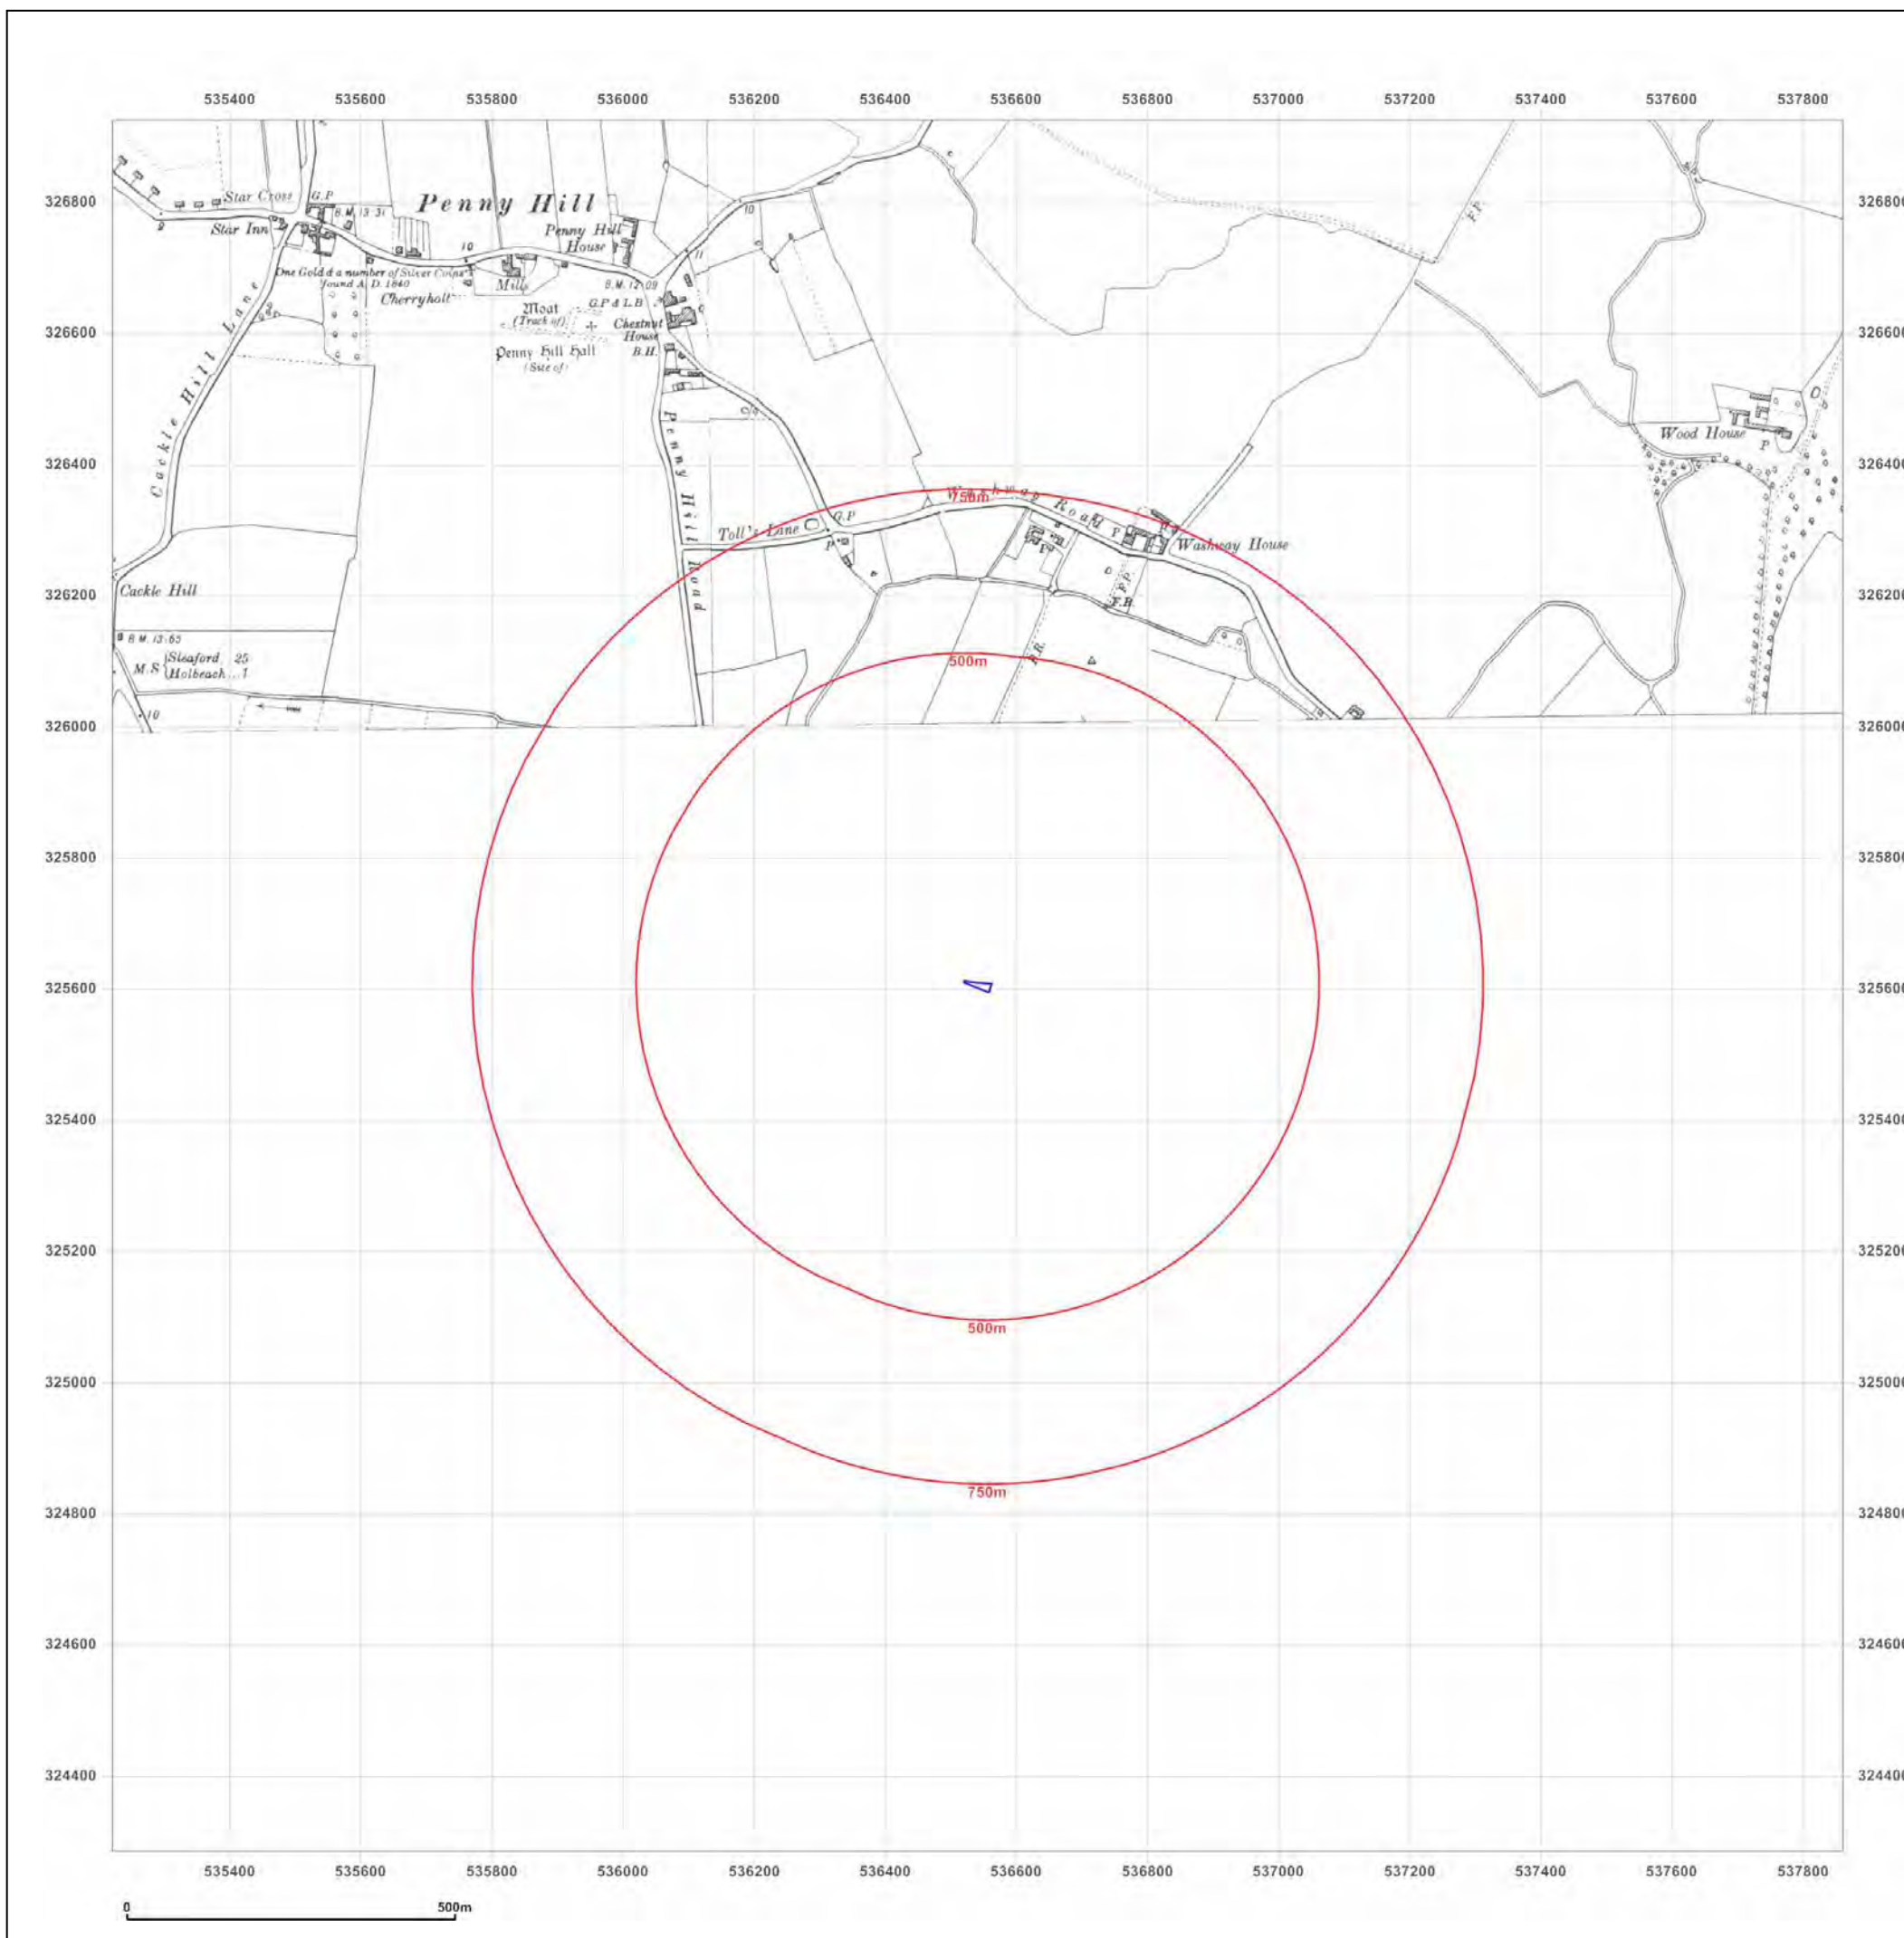

Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW

Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: County Series

Map date: 1938

Scale: 1:10,560

Printed at: 1:10,560



Surveyed 1886
Revised 1938
Edition 1938
Copyright N/A
Levelled N/A

Surveyed 1886
Revised 1938
Edition 1938
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

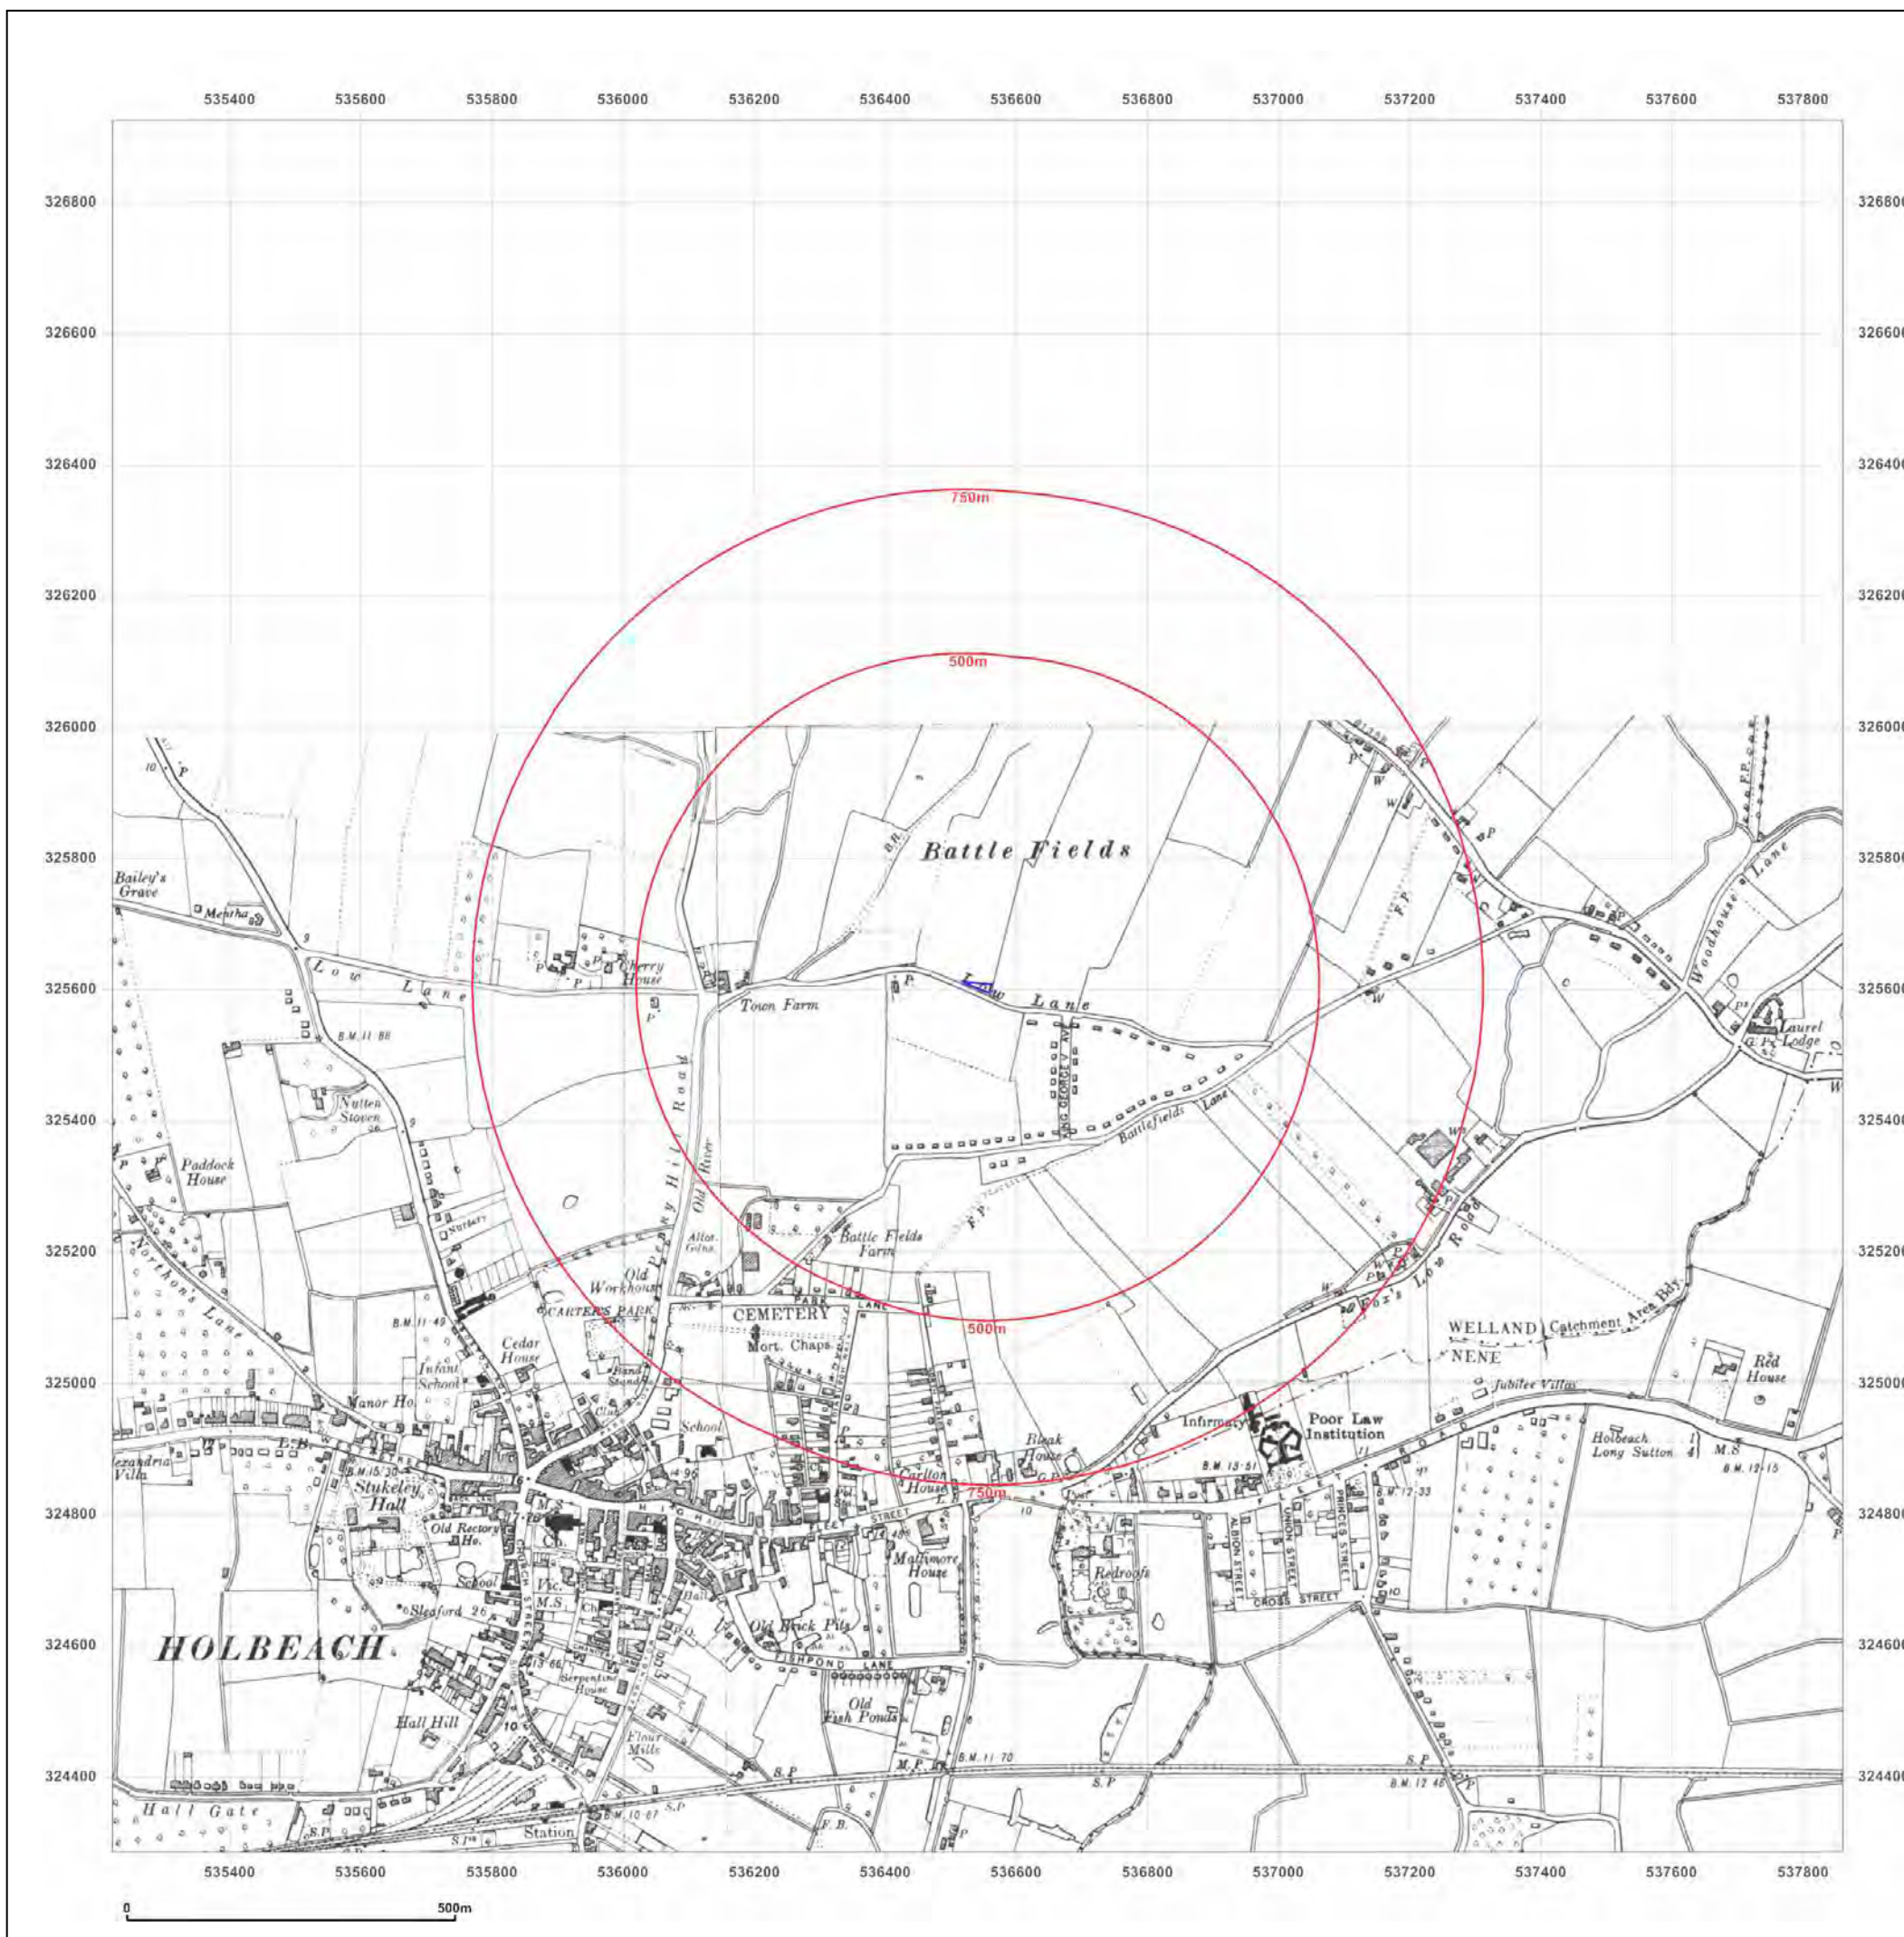

Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW

Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: County Series

Map date: 1950

Scale: 1:10,560

Printed at: 1:10,560



Surveyed 1886
Revised 1950
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1886
Revised 1950
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1886
Revised 1950
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1886
Revised 1950
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

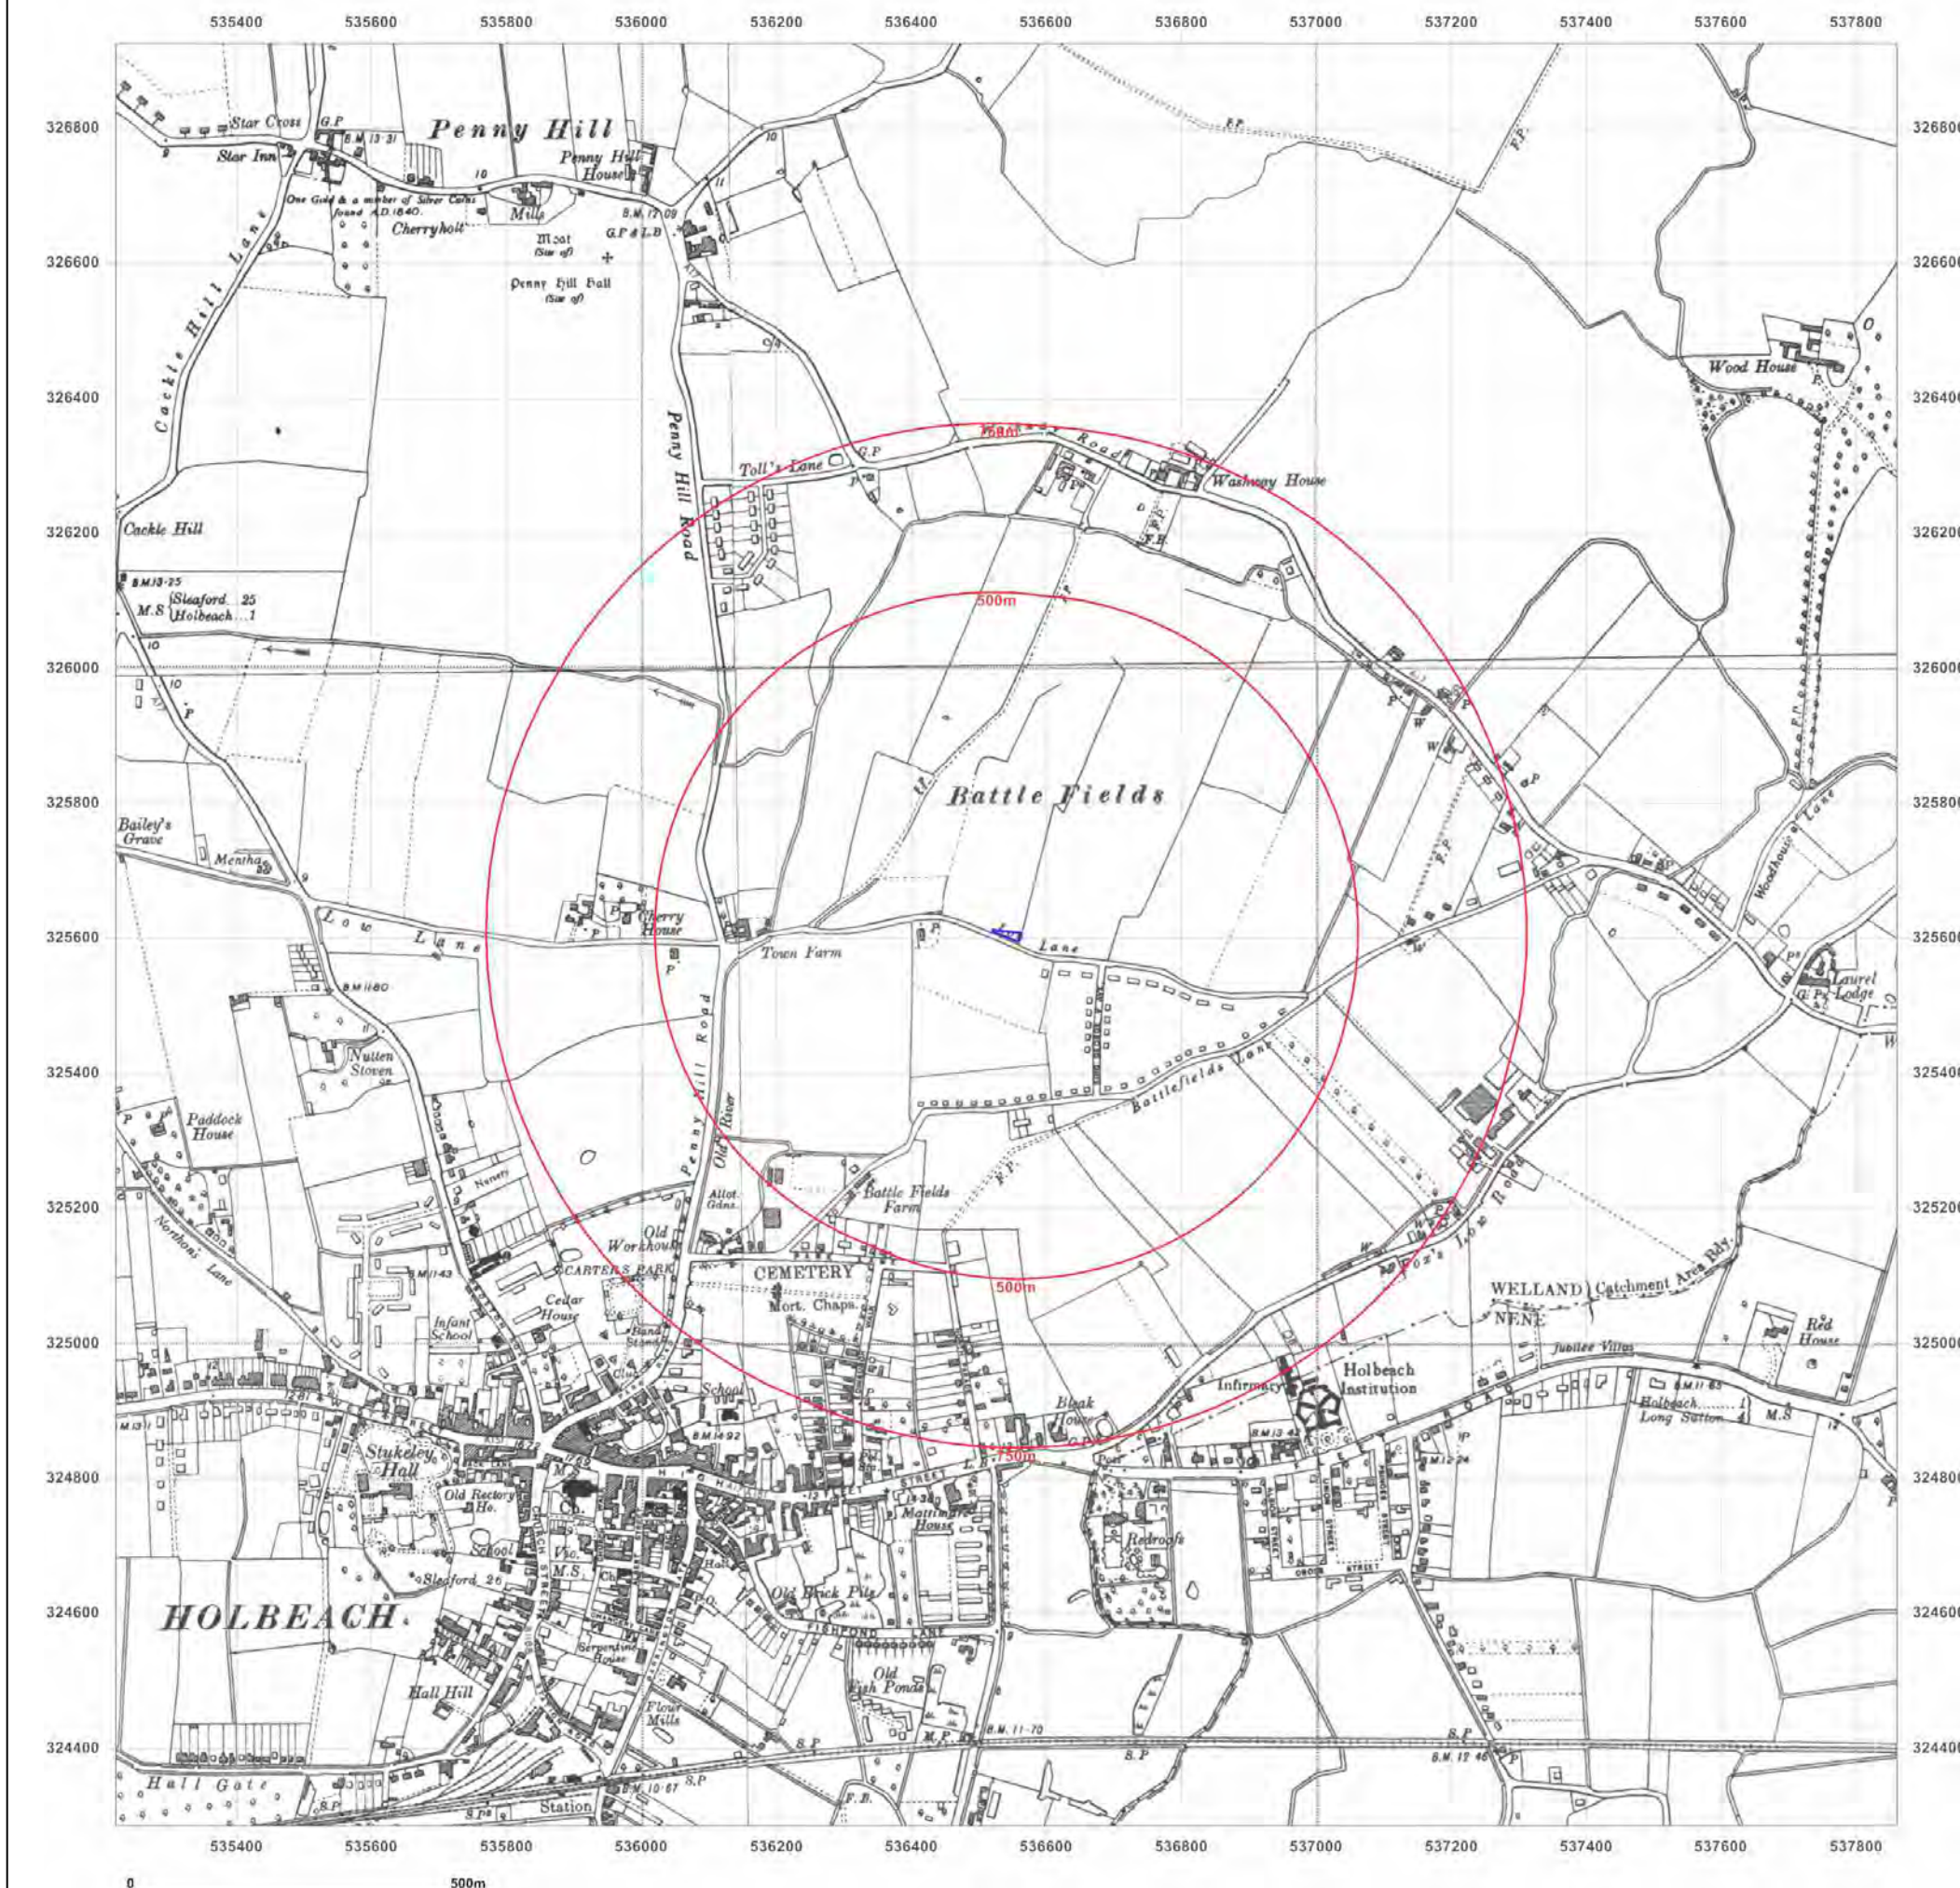

Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW

Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: Provisional

Map date: 1955-1958

Scale: 1:10,560

Printed at: 1:10,560



Surveyed N/A
Revised 1955
Edition N/A
Copyright N/A
Levelled N/A

Surveyed N/A
Revised 1958
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

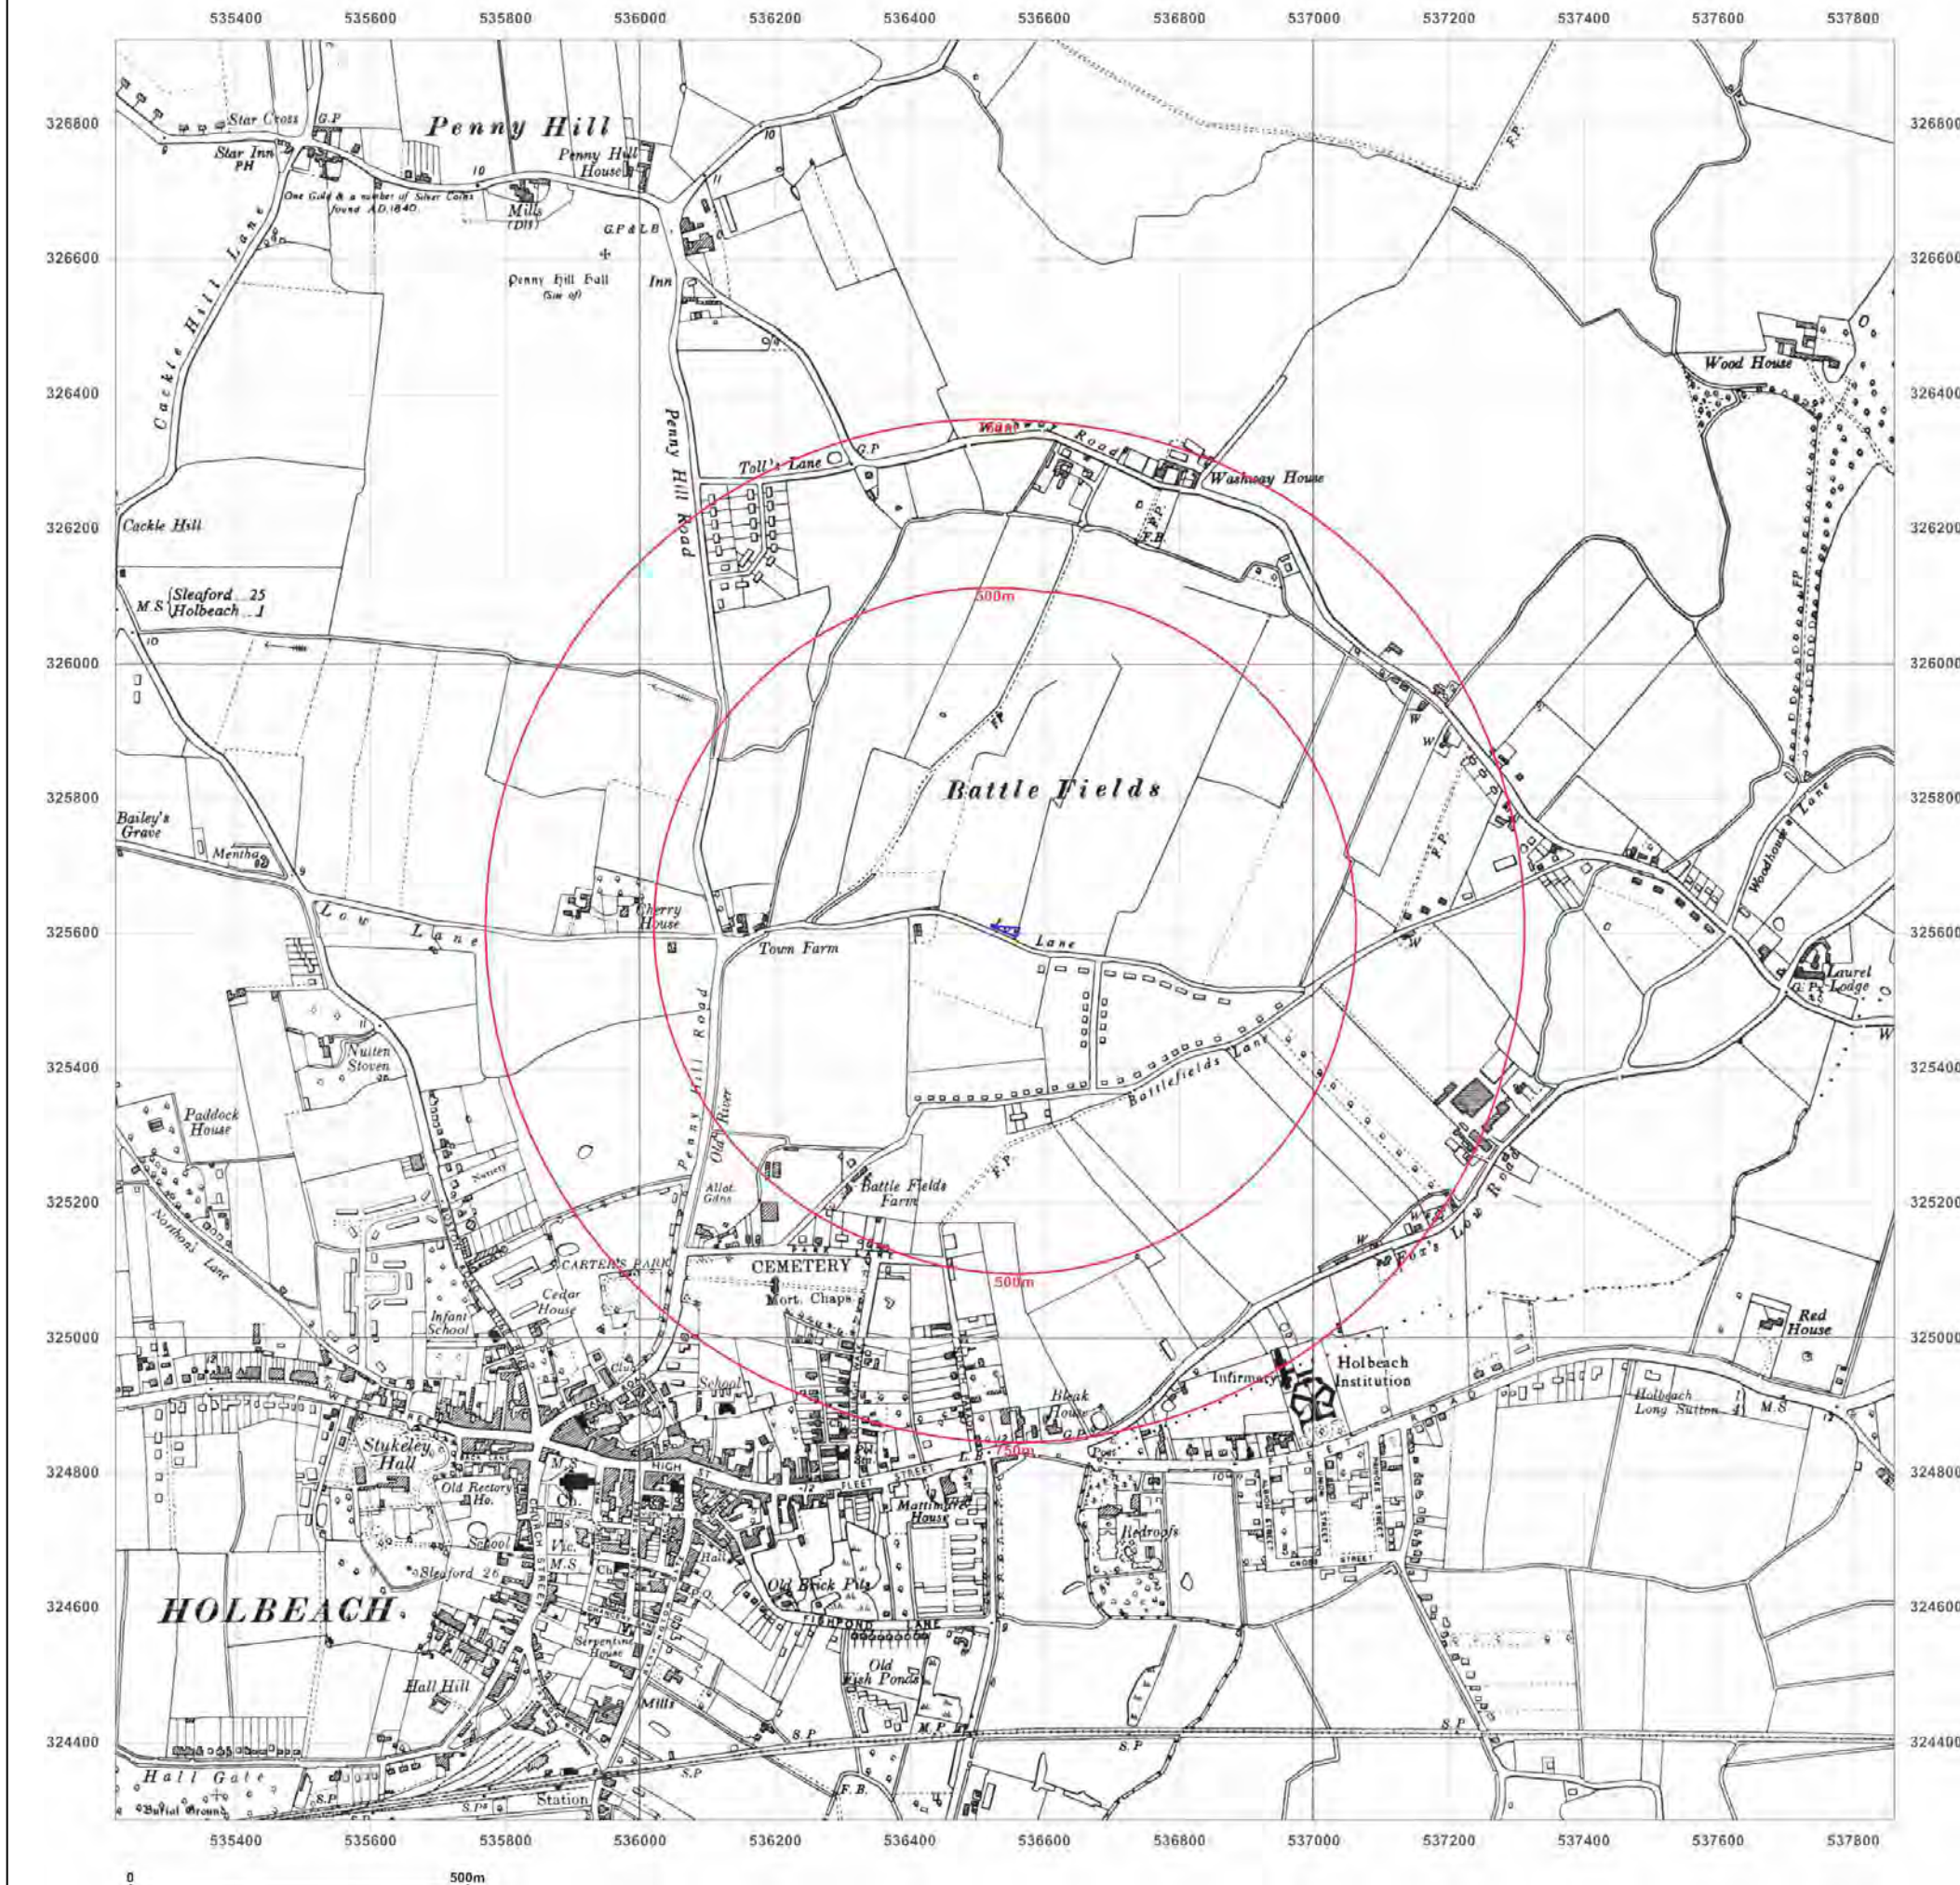

Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW

Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: National Grid

Map date: 1968

Scale: 1:2,500

Printed at: 1:2,500



Surveyed 1968
Revised 1968
Edition N/A
Copyright 1969
Levelled 1964




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

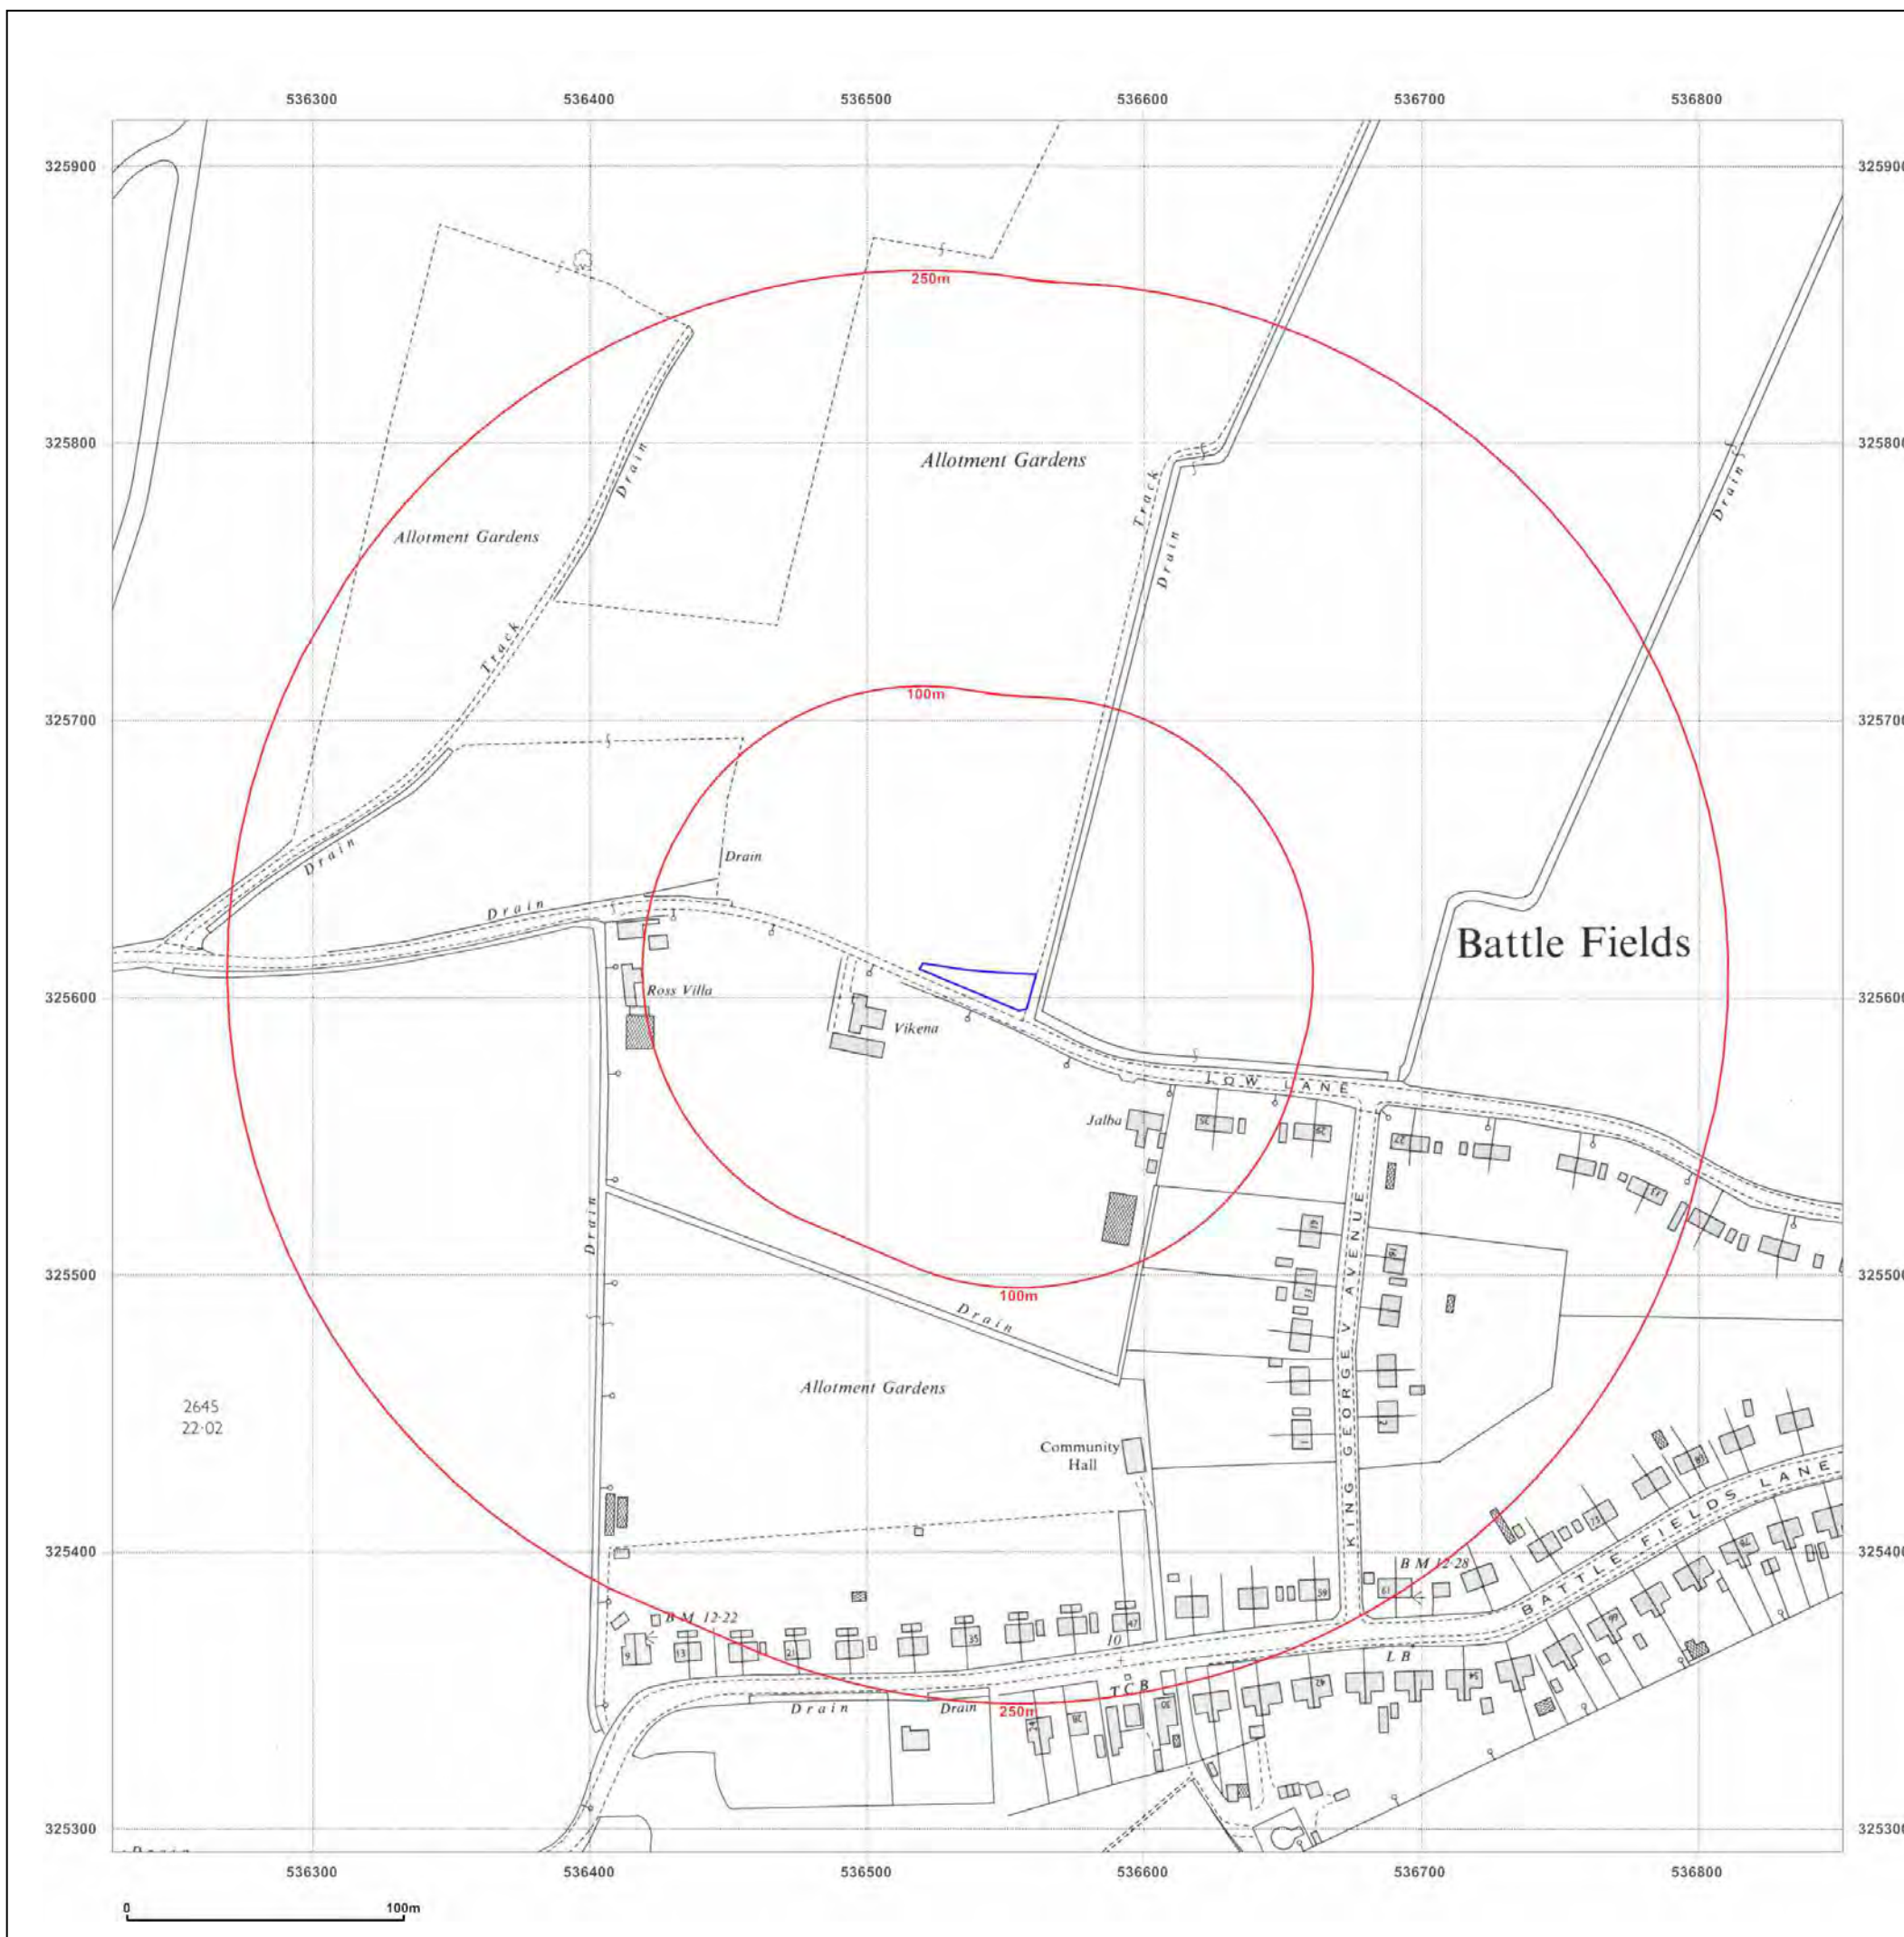

Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW

Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: National Grid

Map date: 1977

Scale: 1:2,500

Printed at: 1:2,500



Surveyed N/A
Revised N/A
Edition N/A
Copyright 1977
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

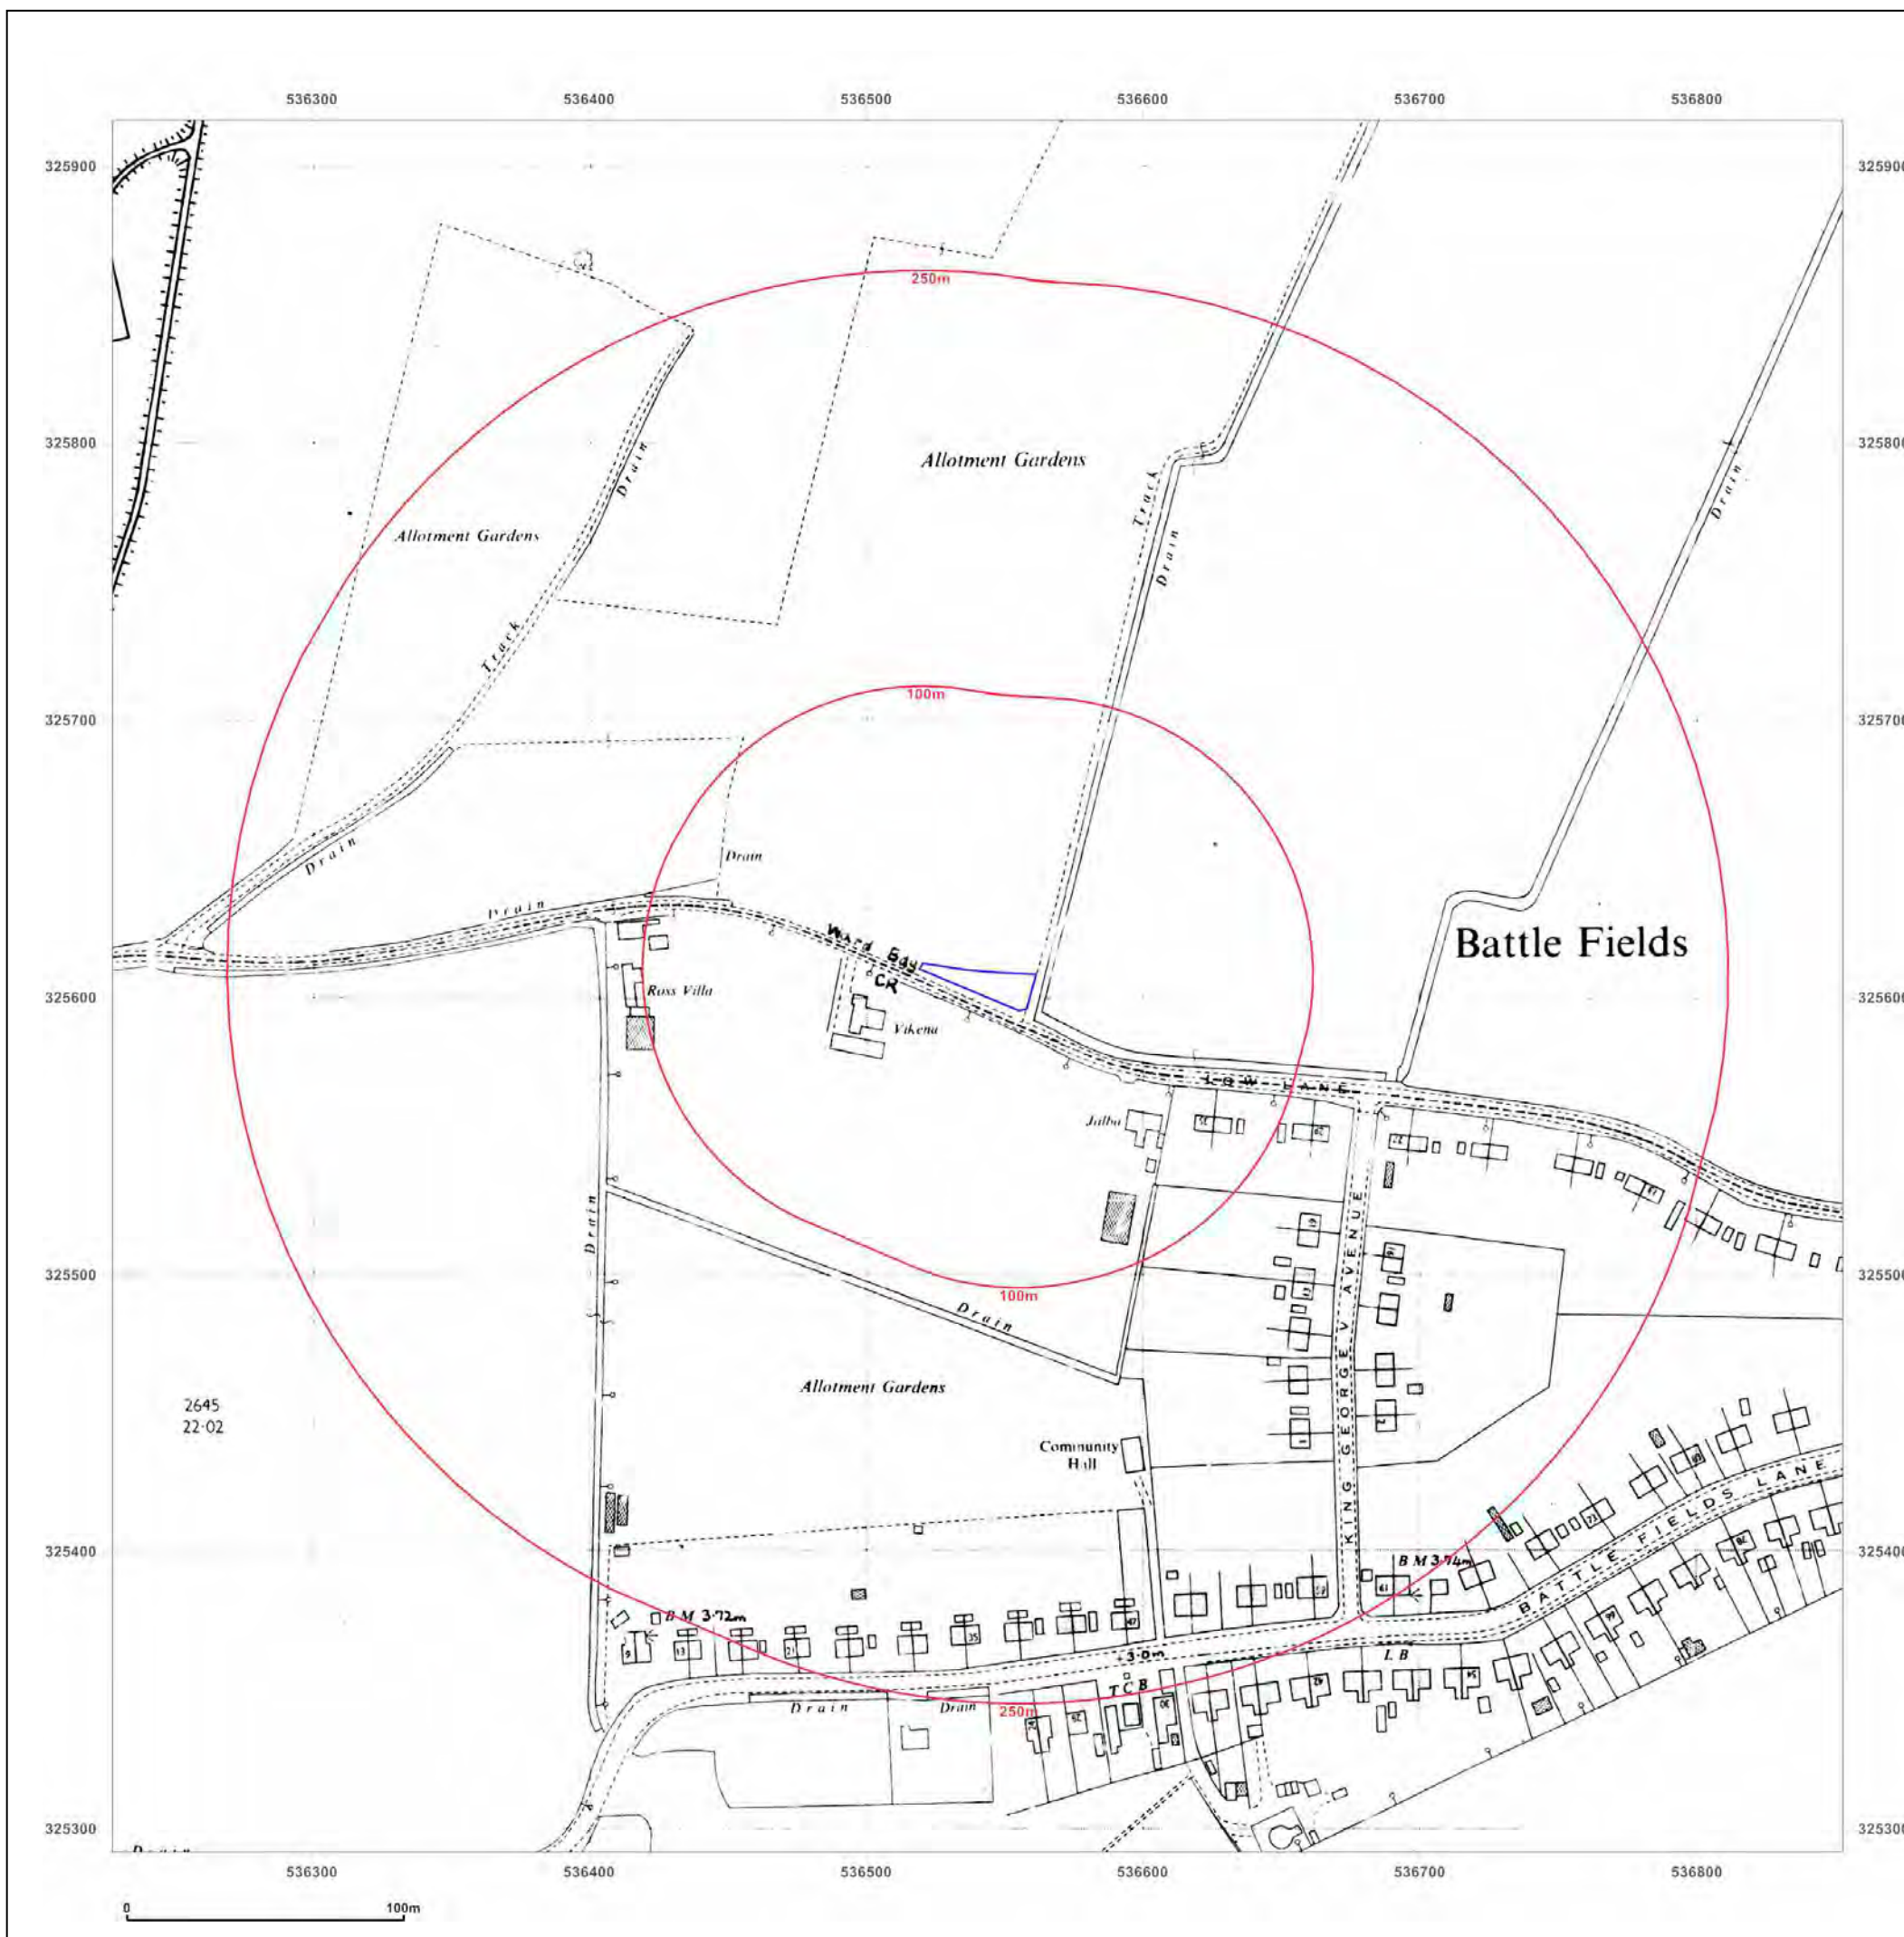

Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW

Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: National Grid

Map date: 1977

Scale: 1:10,000

Printed at: 1:10,000



Surveyed 1973
Revised 1977
Edition N/A
Copyright 1977
Levelled 1973




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

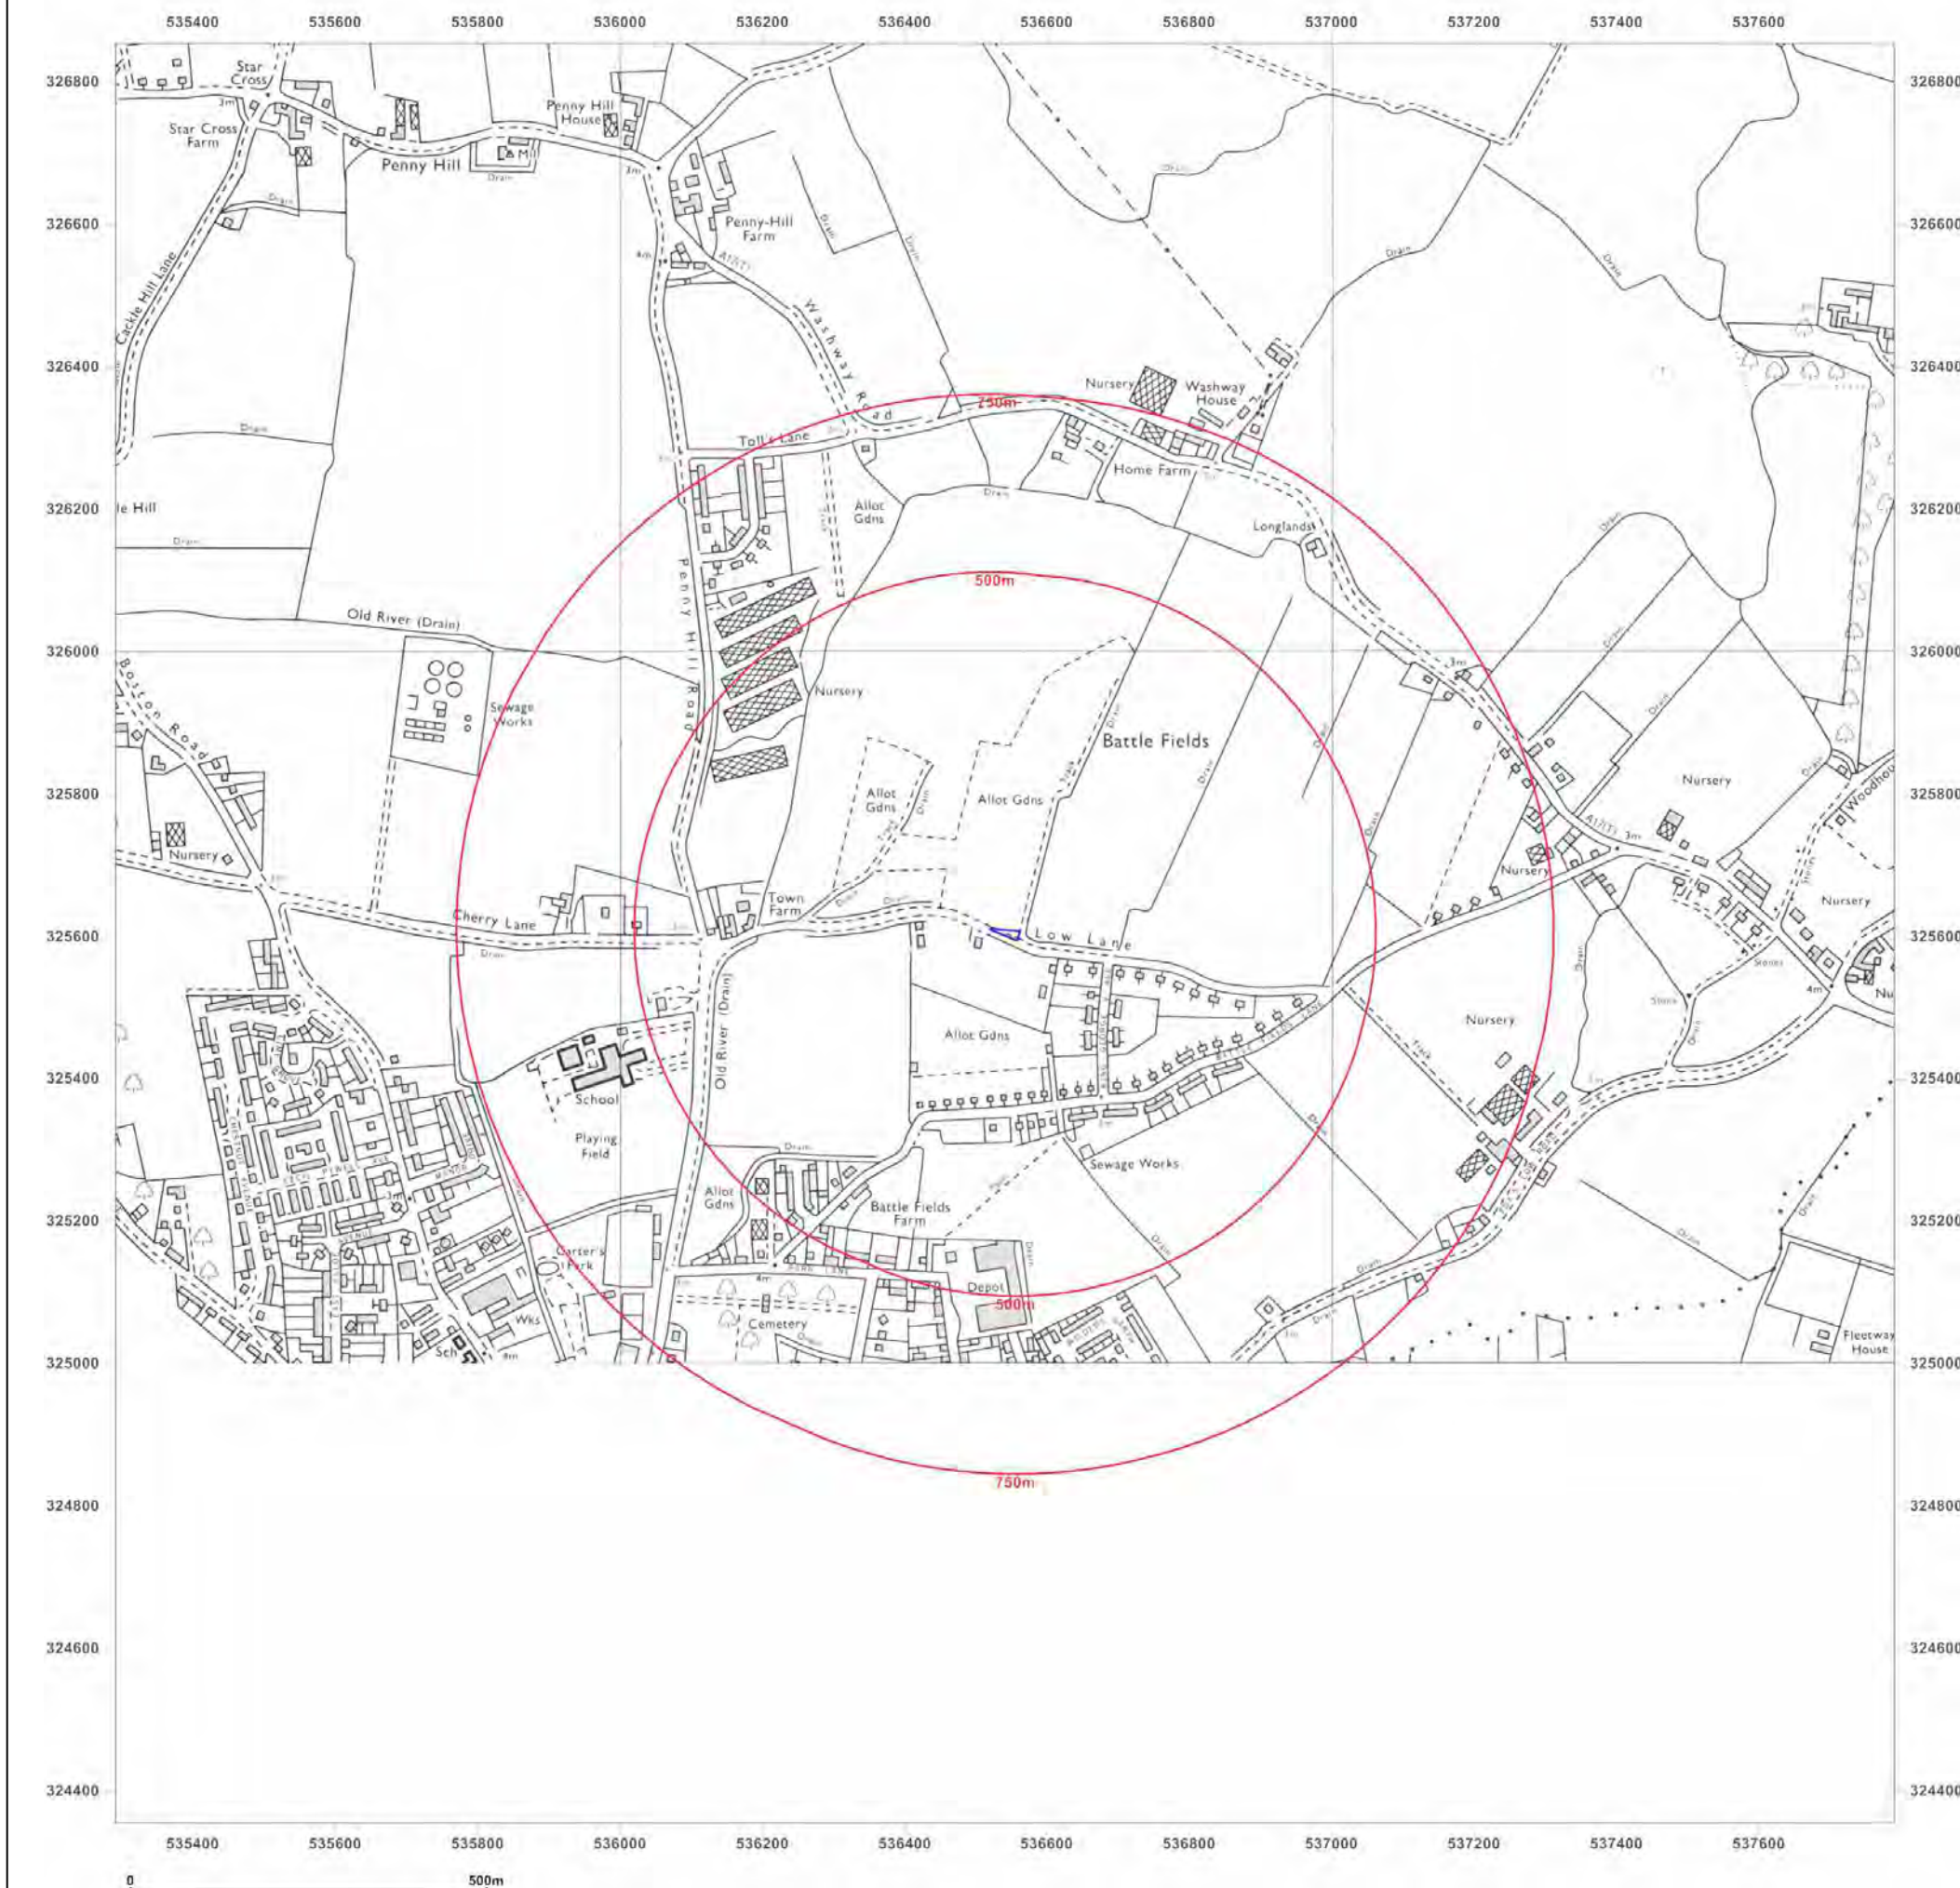

Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW

Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: National Grid

Map date: 1982

Scale: 1:2,500

Printed at: 1:2,500



Surveyed 1964
Revised 1982
Edition N/A
Copyright 1982
Levelled 1964




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

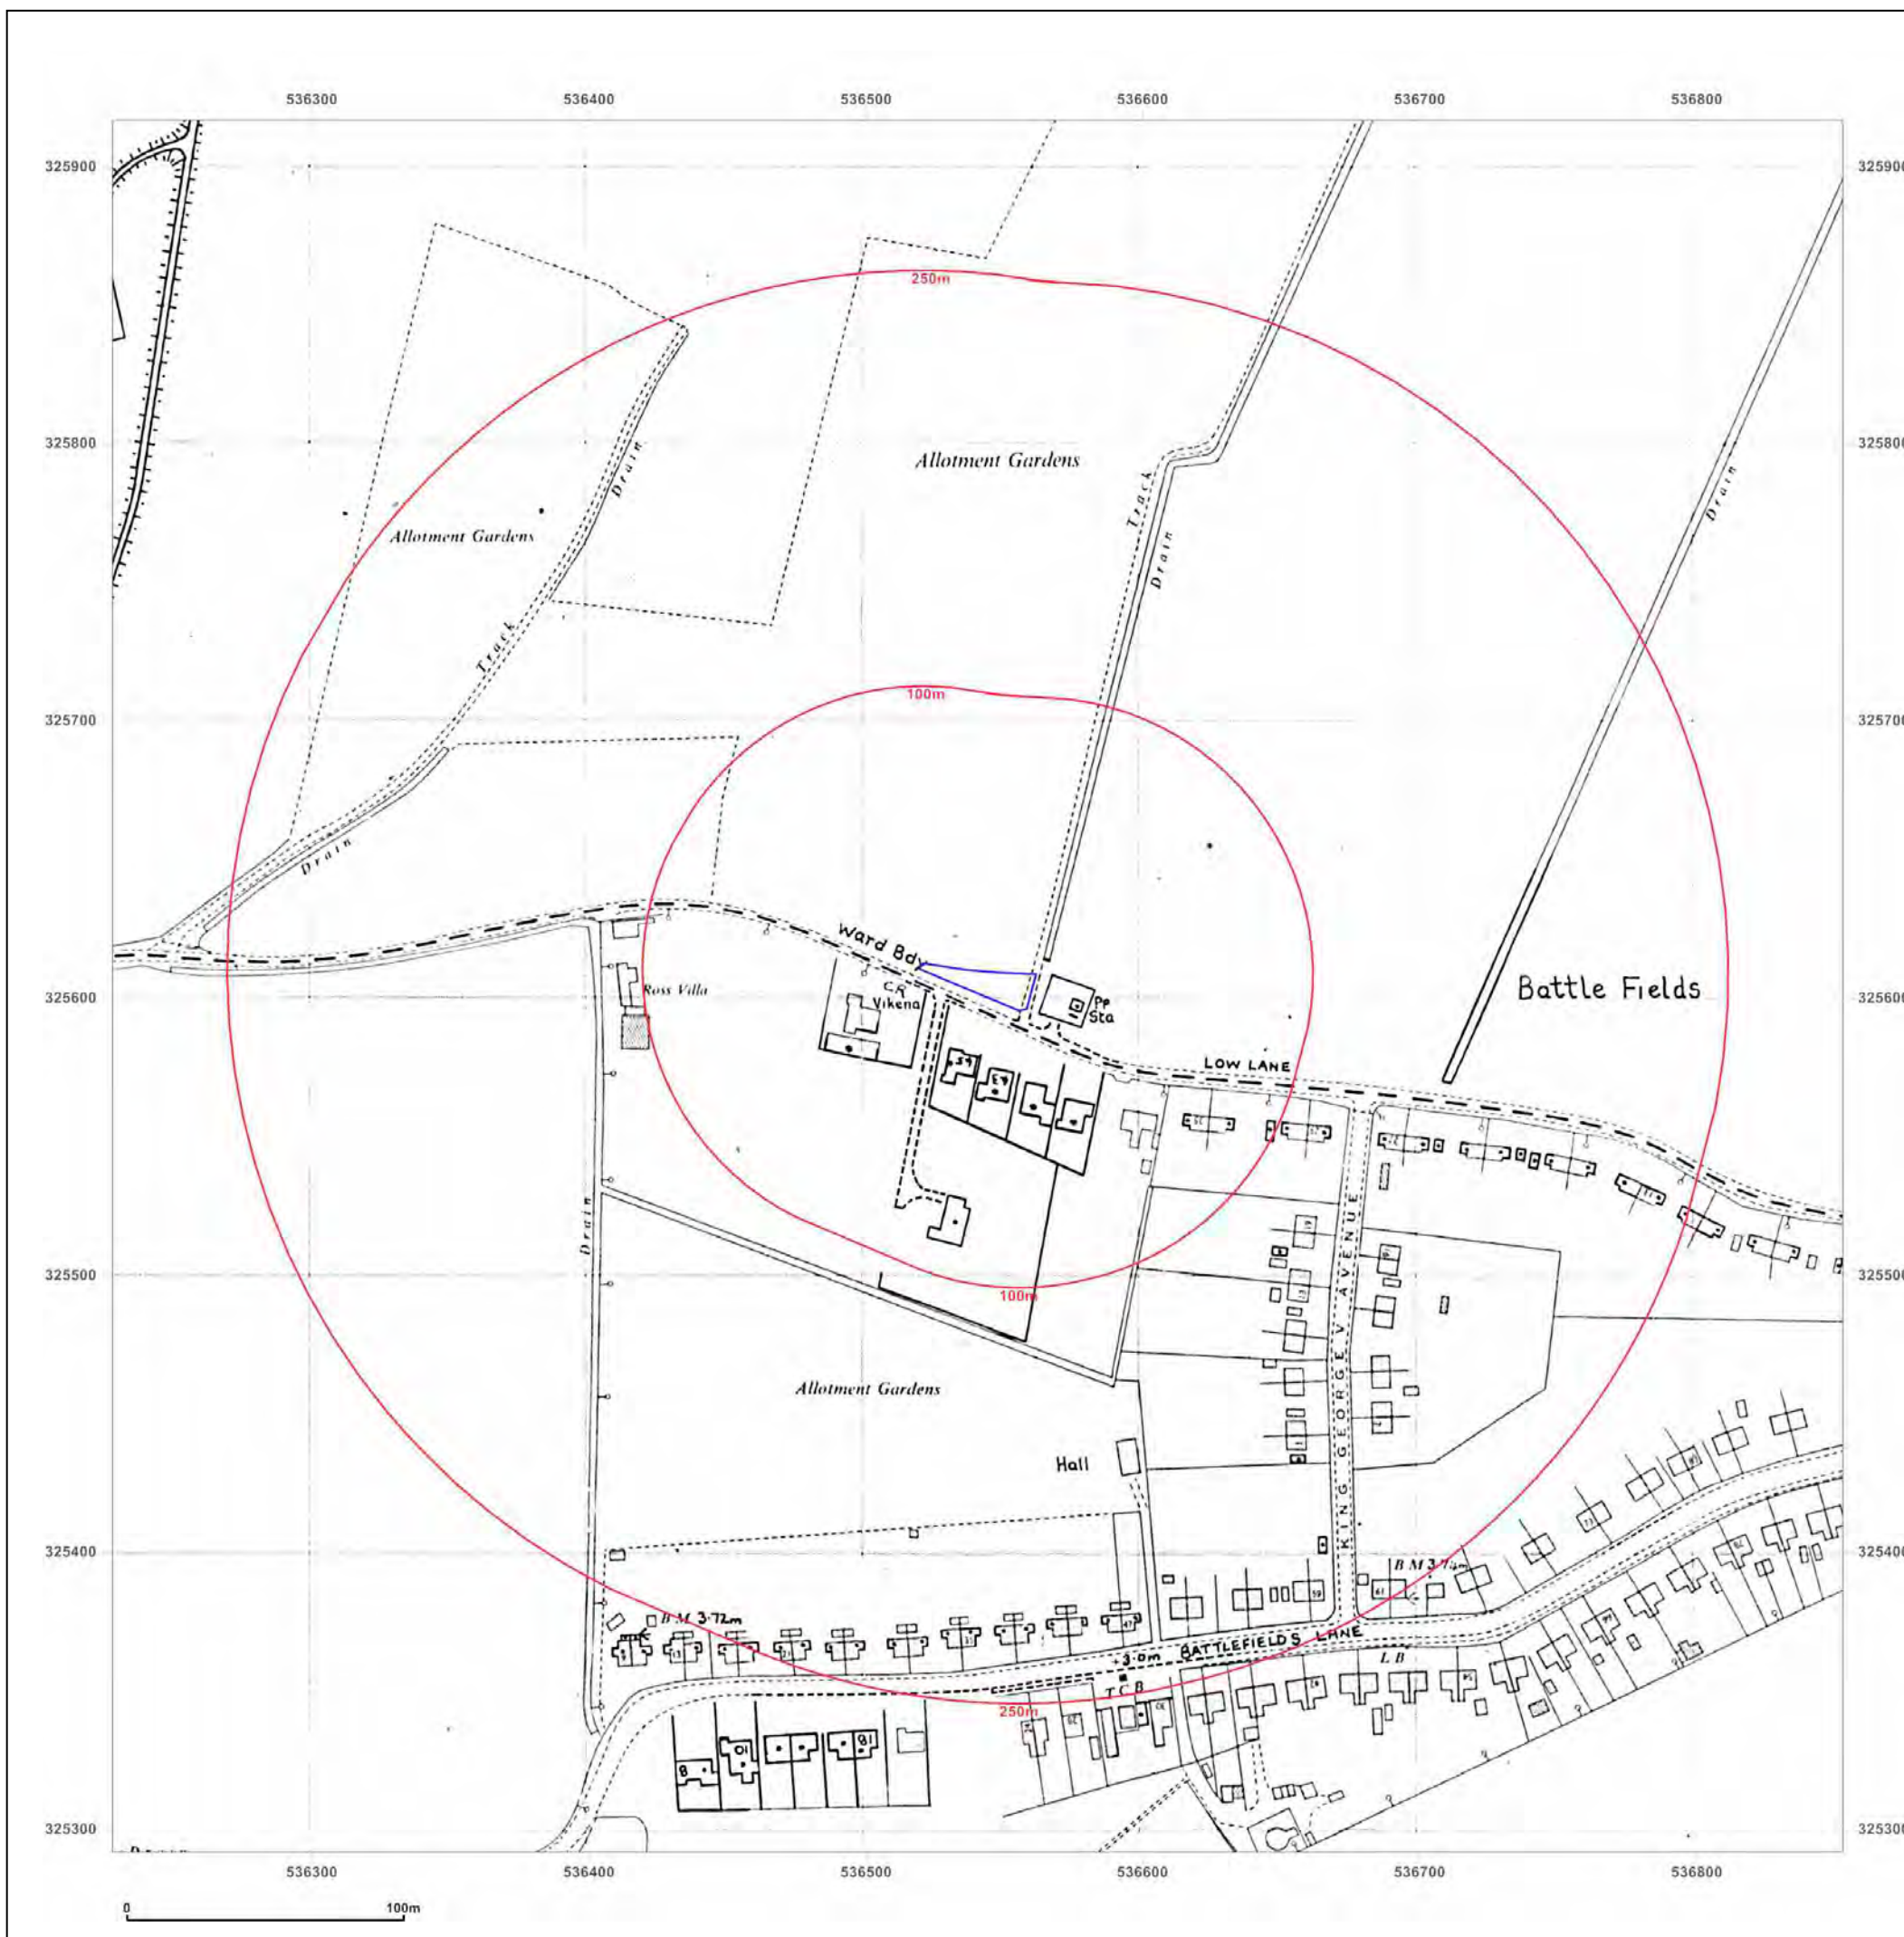

Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW

Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: National Grid

Map date: 1991

Scale: 1:2,500

Printed at: 1:2,500



Surveyed N/A
Revised N/A
Edition N/A
Copyright 1991
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

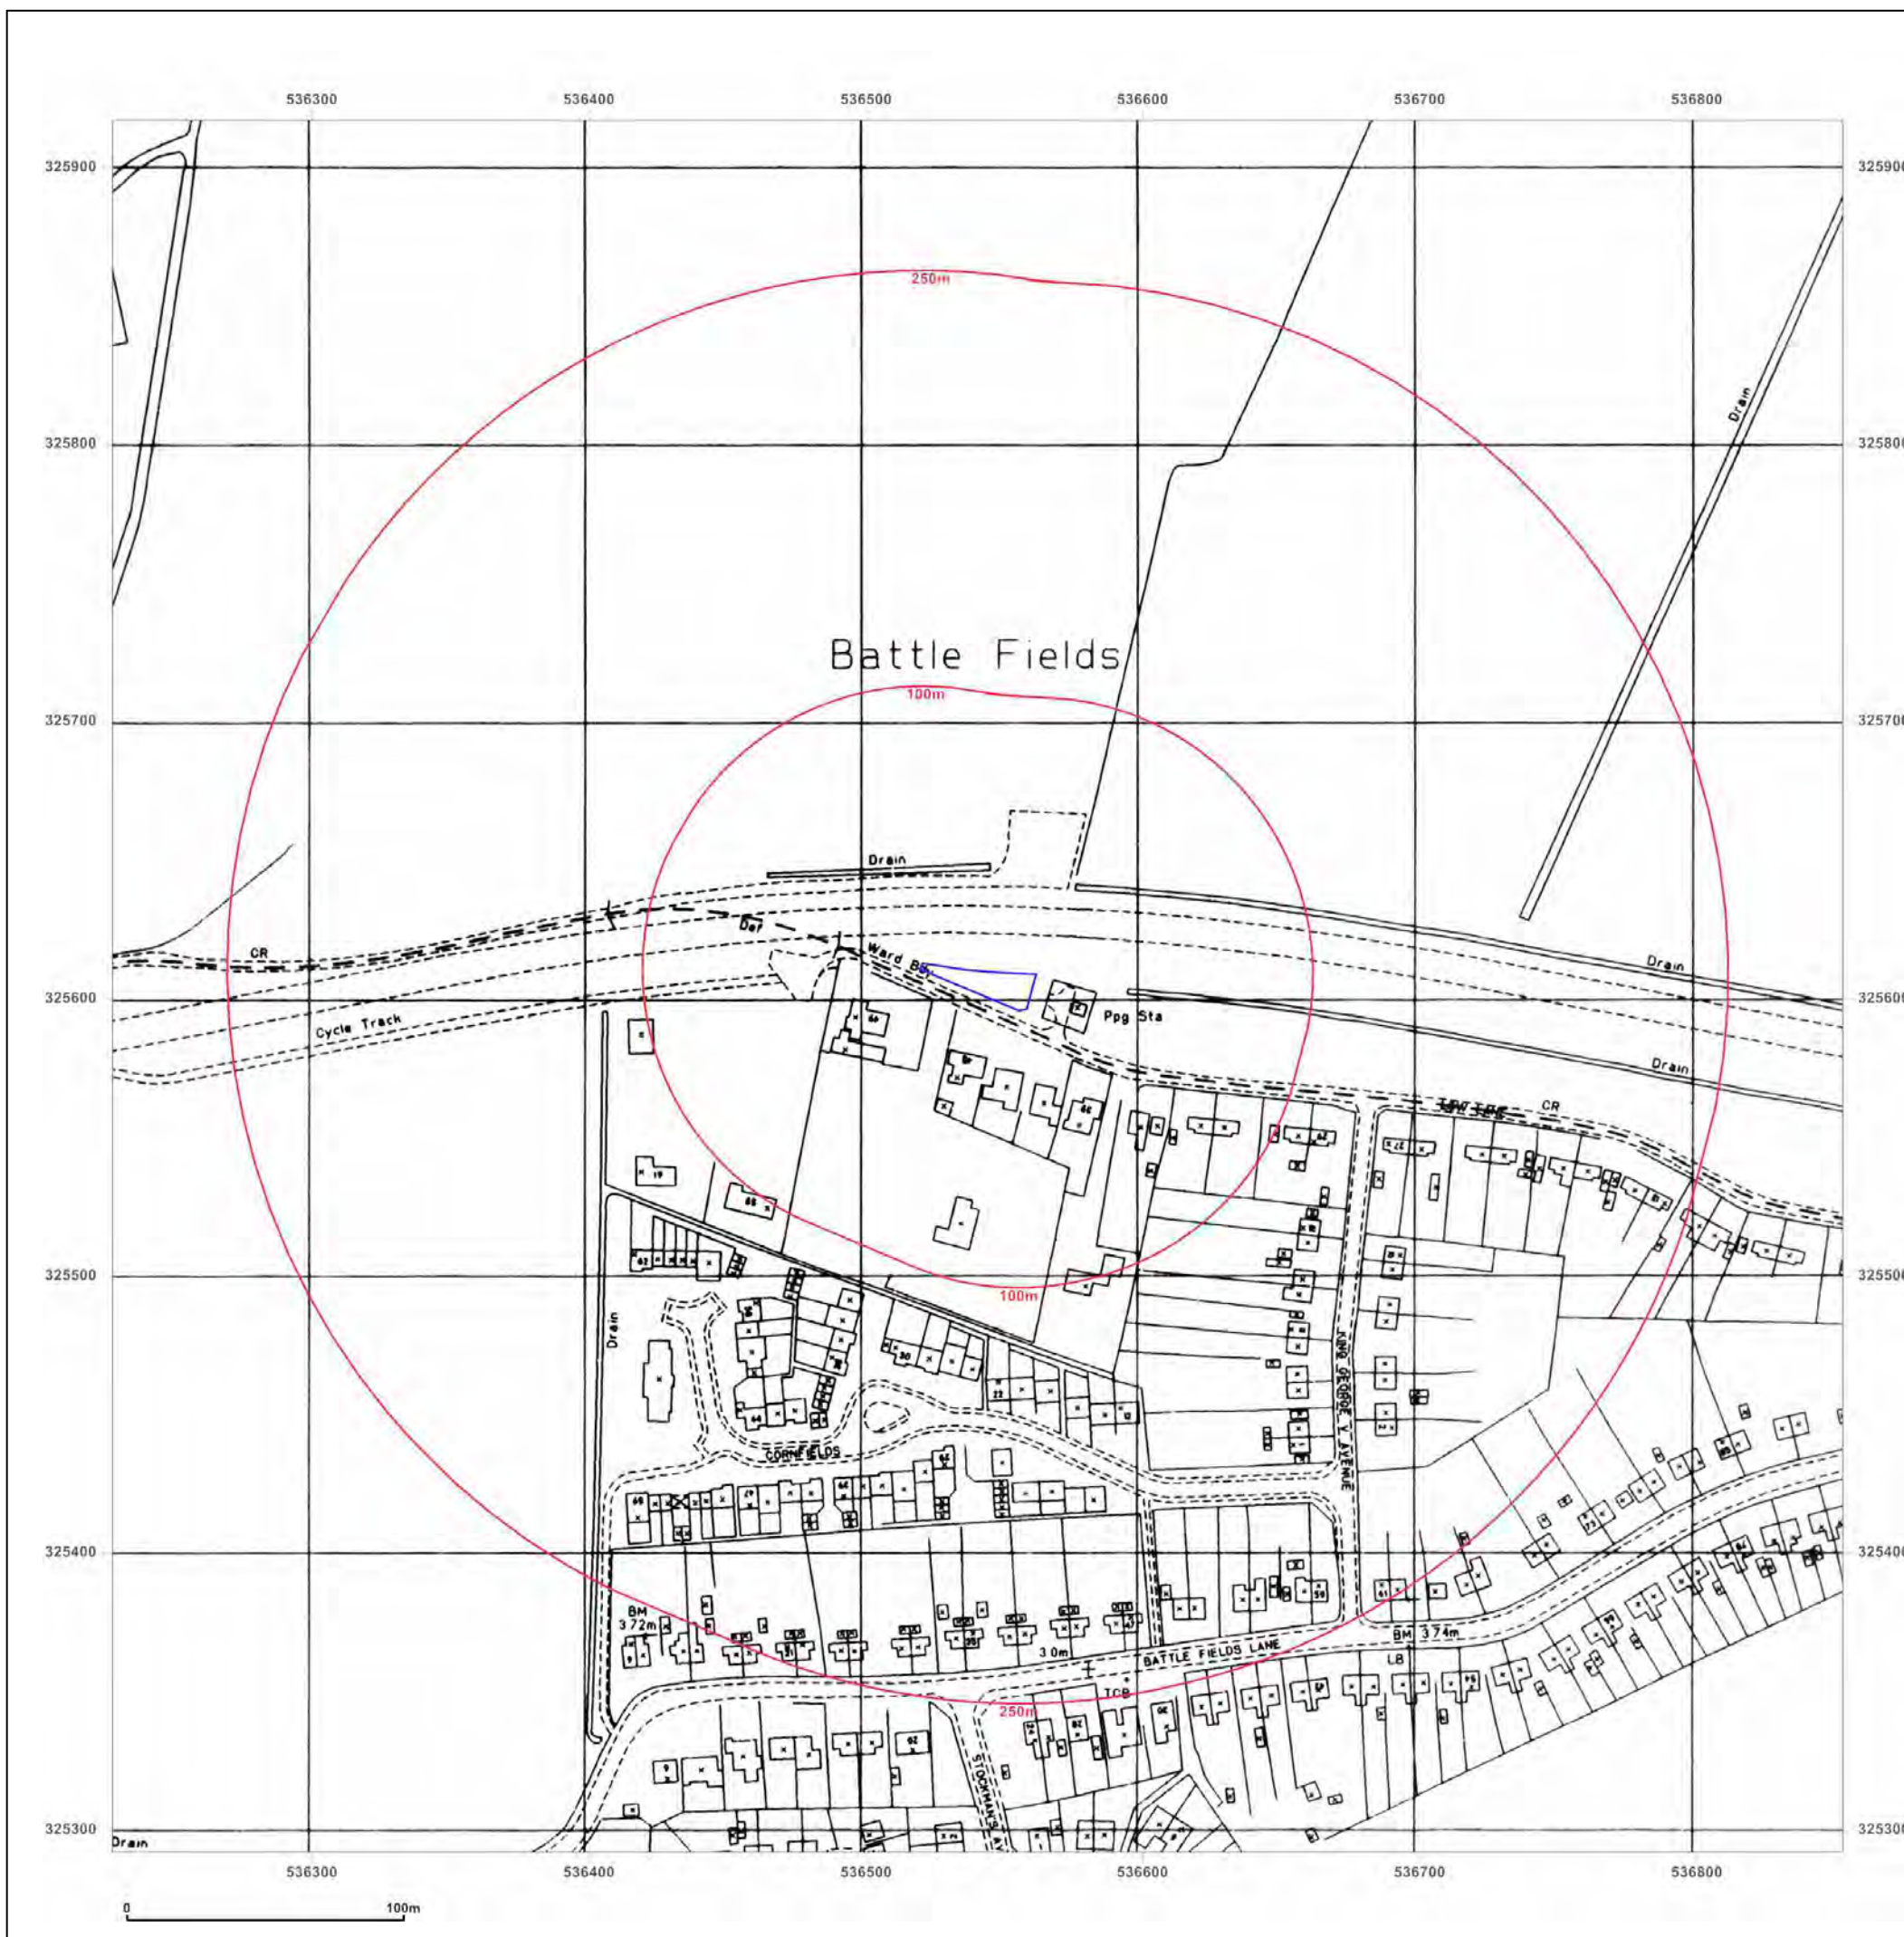

Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW

Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: National Grid

Map date: 1992

Scale: 1:10,000

Printed at: 1:10,000



Surveyed 1991
Revised 1992
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1991
Revised 1992
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

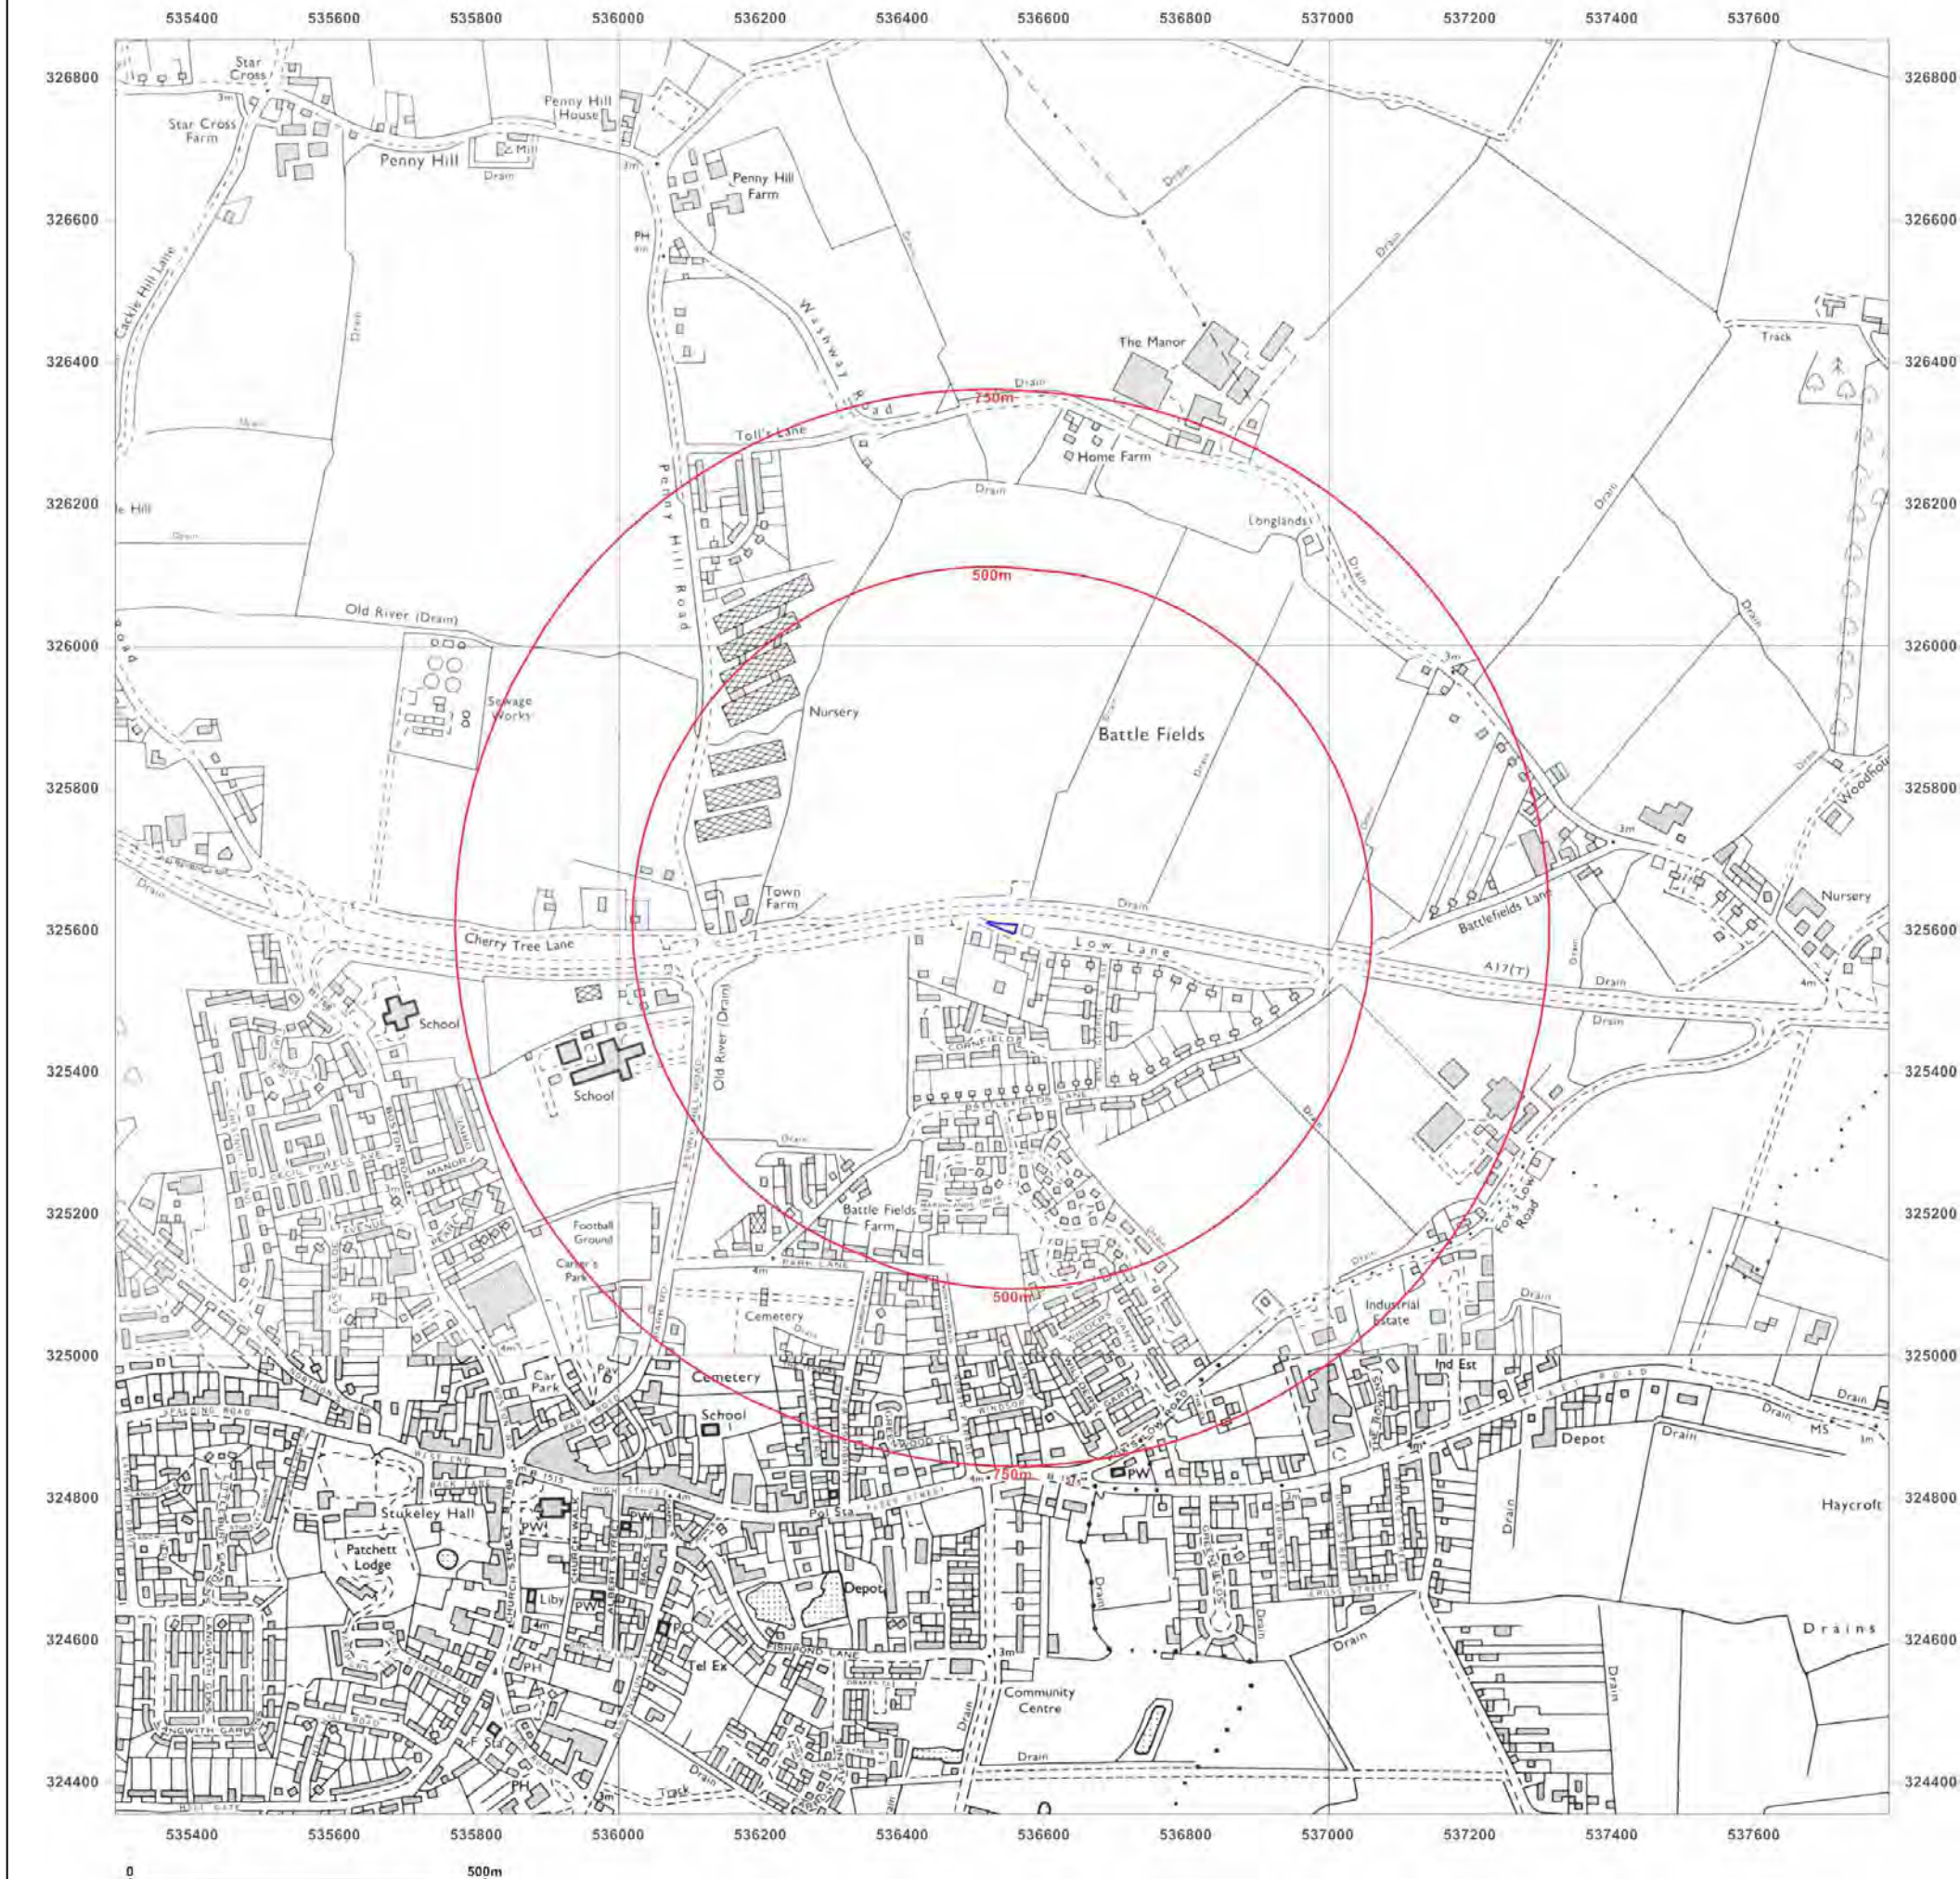

Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW

Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: National Grid

Map date: 1995

Scale: 1:2,500

Printed at: 1:2,500



Surveyed N/A
Revised N/A
Edition N/A
Copyright 1995
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

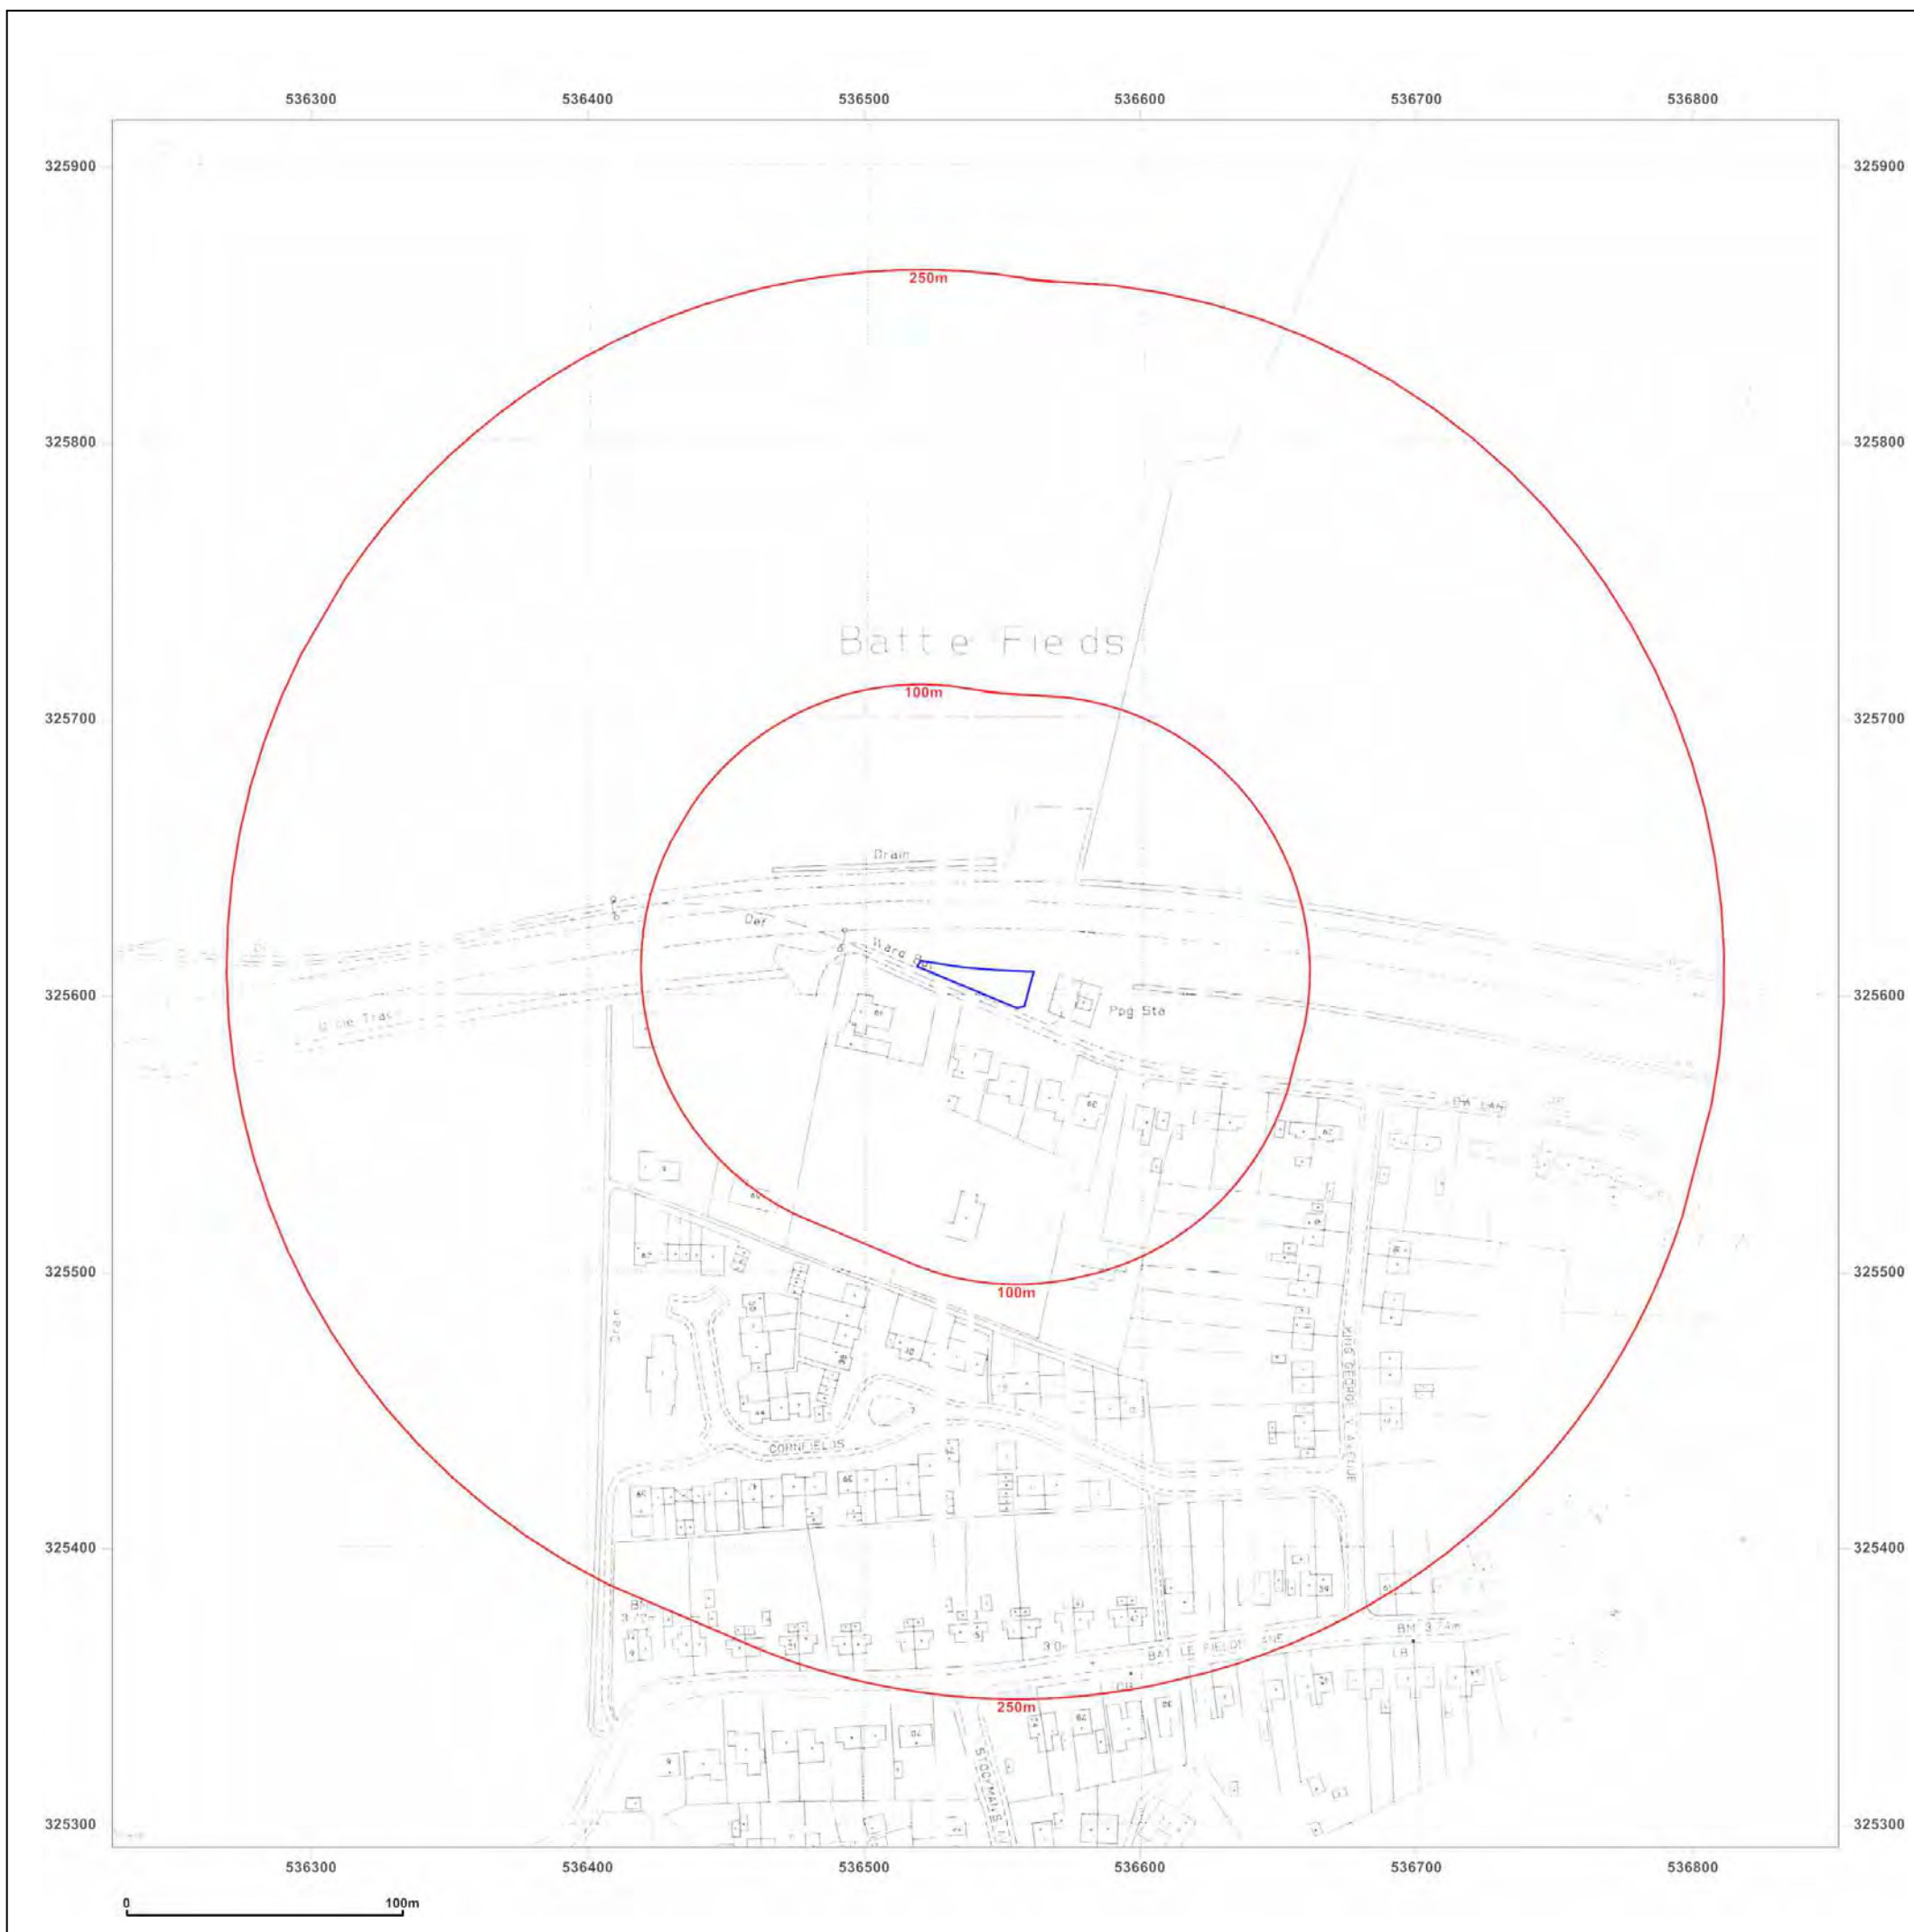

Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW

Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: National Grid

Map date: 1995

Scale: 1:2,500

Printed at: 1:2,500



Surveyed N/A
Revised N/A
Edition N/A
Copyright 1995
Levelled N/A



Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf



Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW

Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: National Grid

Map date: 1995

Scale: 1:2,500

Printed at: 1:2,500



Surveyed 1995
Revised 1995
Edition N/A
Copyright 1995
Levelled N/A



Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf



Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW

Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: 1:10,000 Raster

Map date: 2002

Scale: 1:10,000

Printed at: 1:10,000




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

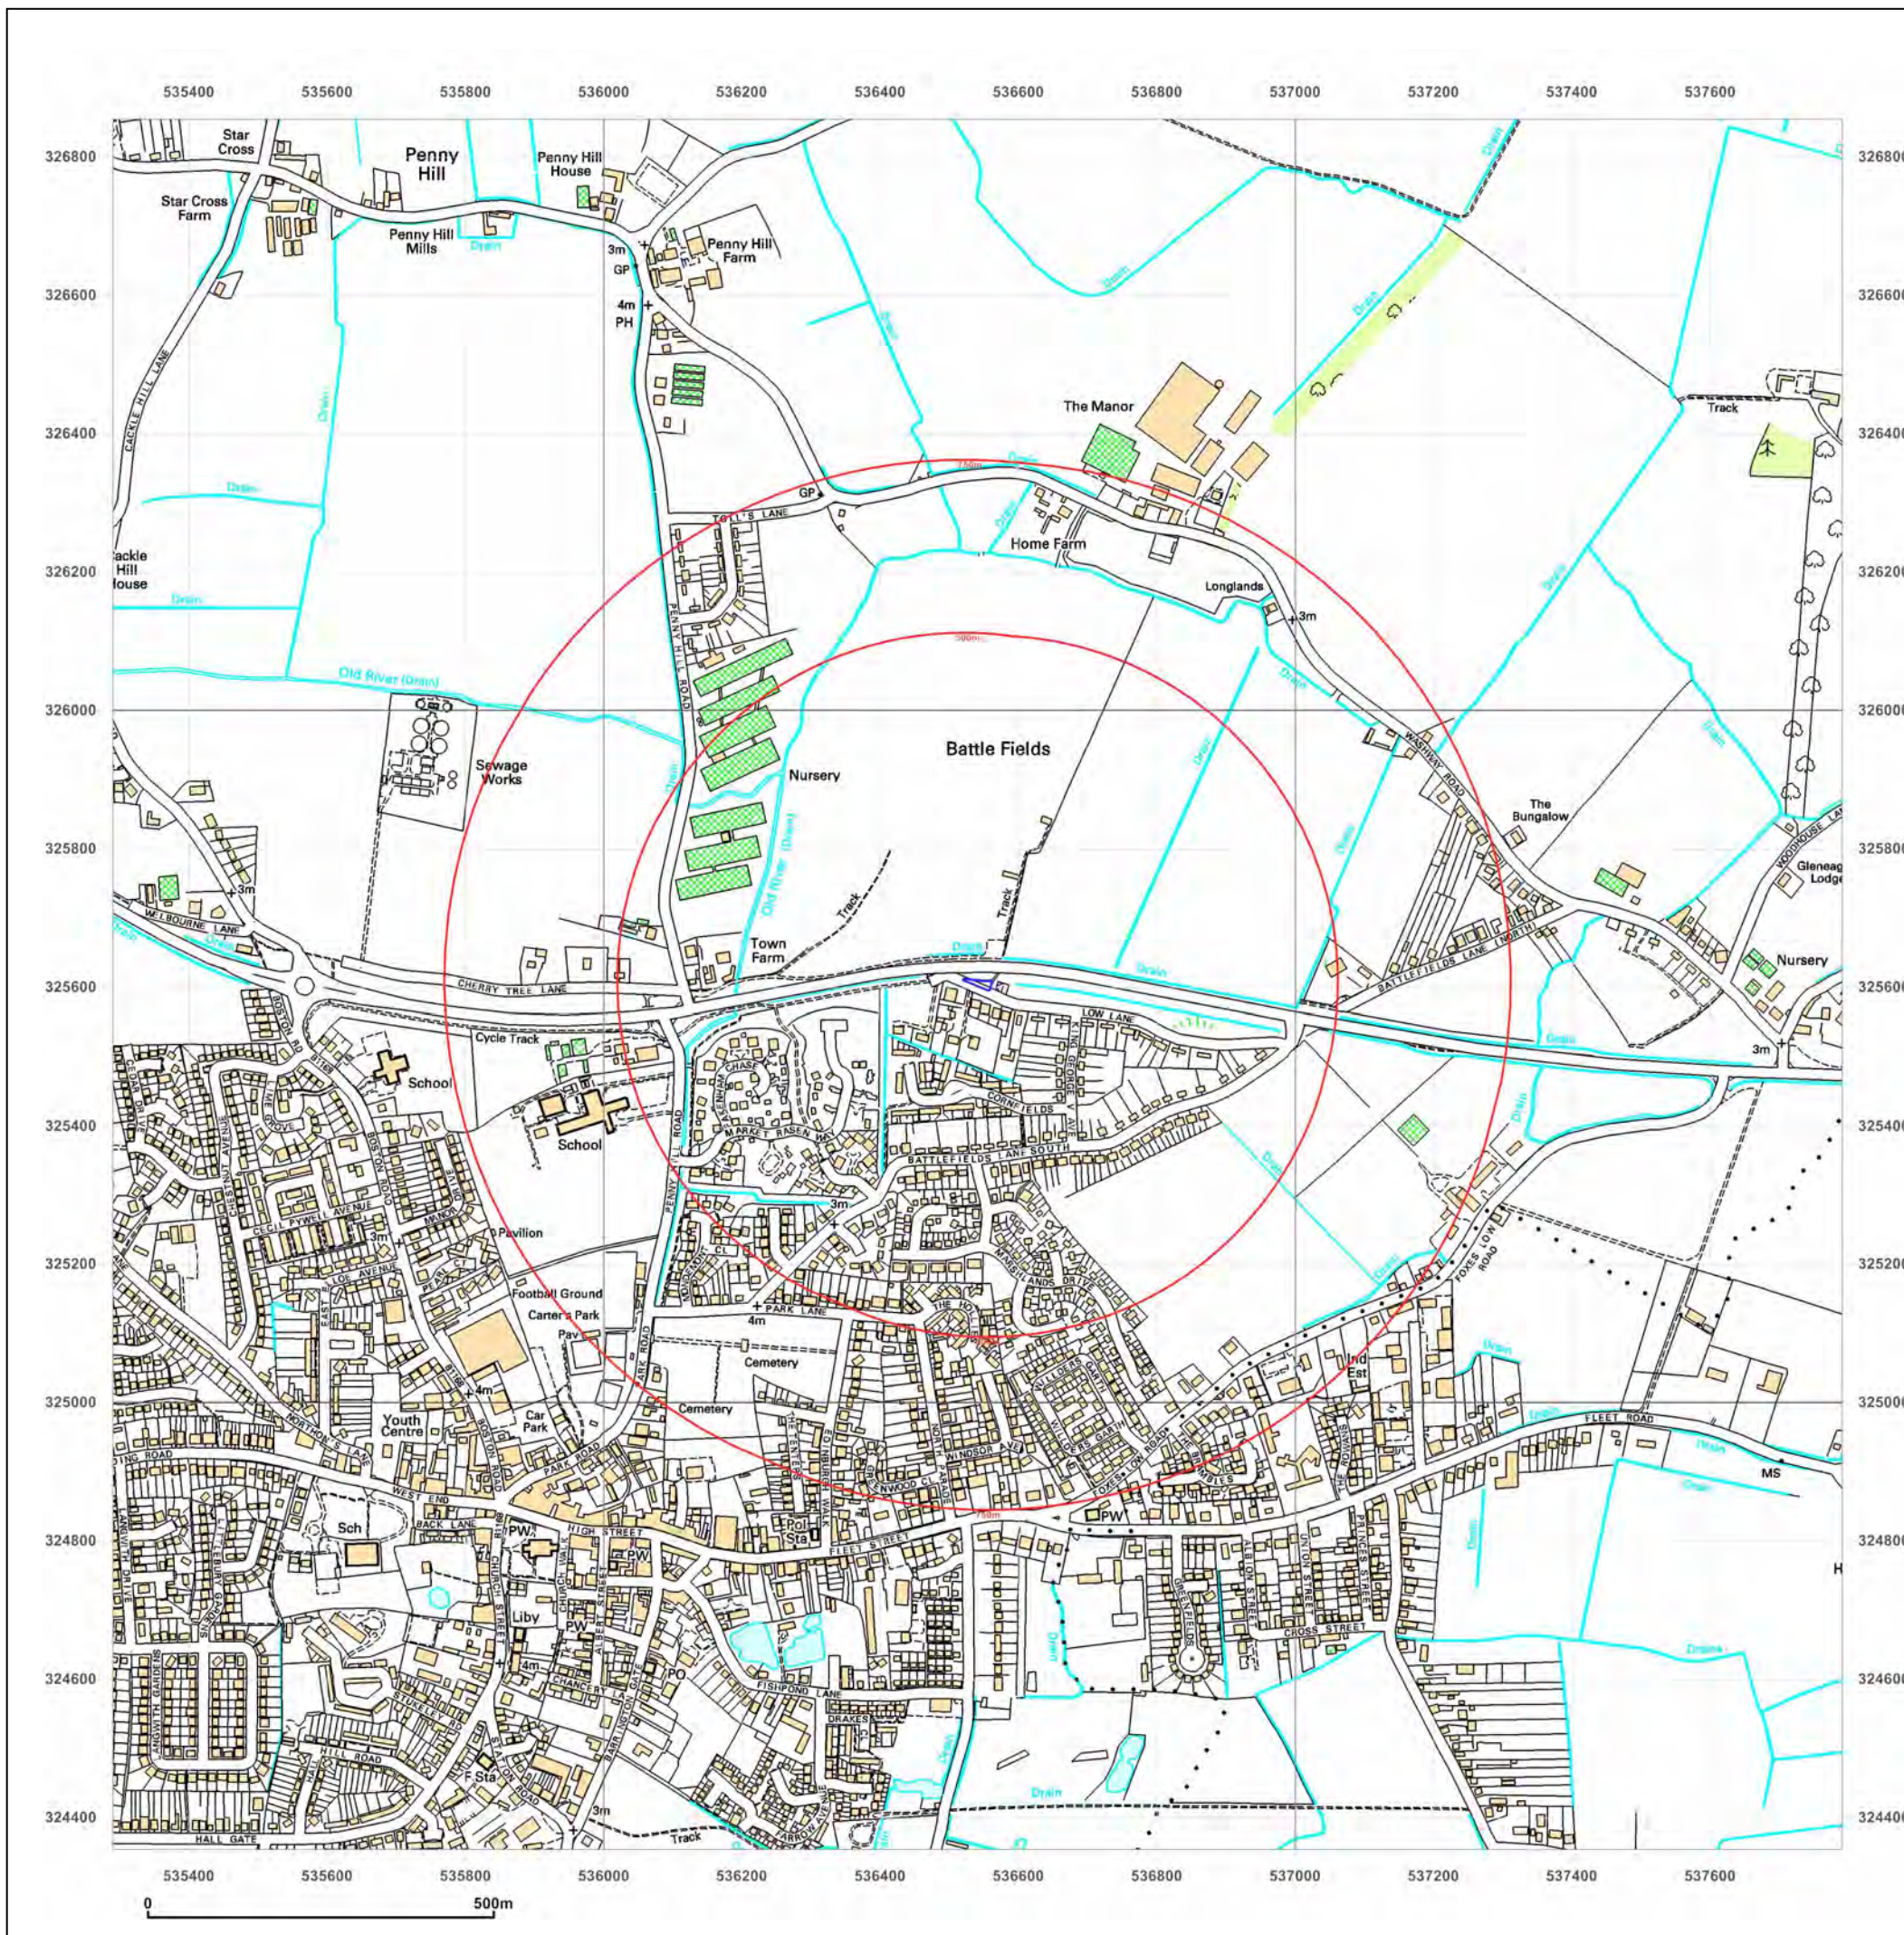

Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW

Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: National Grid

Map date: 2010

Scale: 1:10,000

Printed at: 1:10,000




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

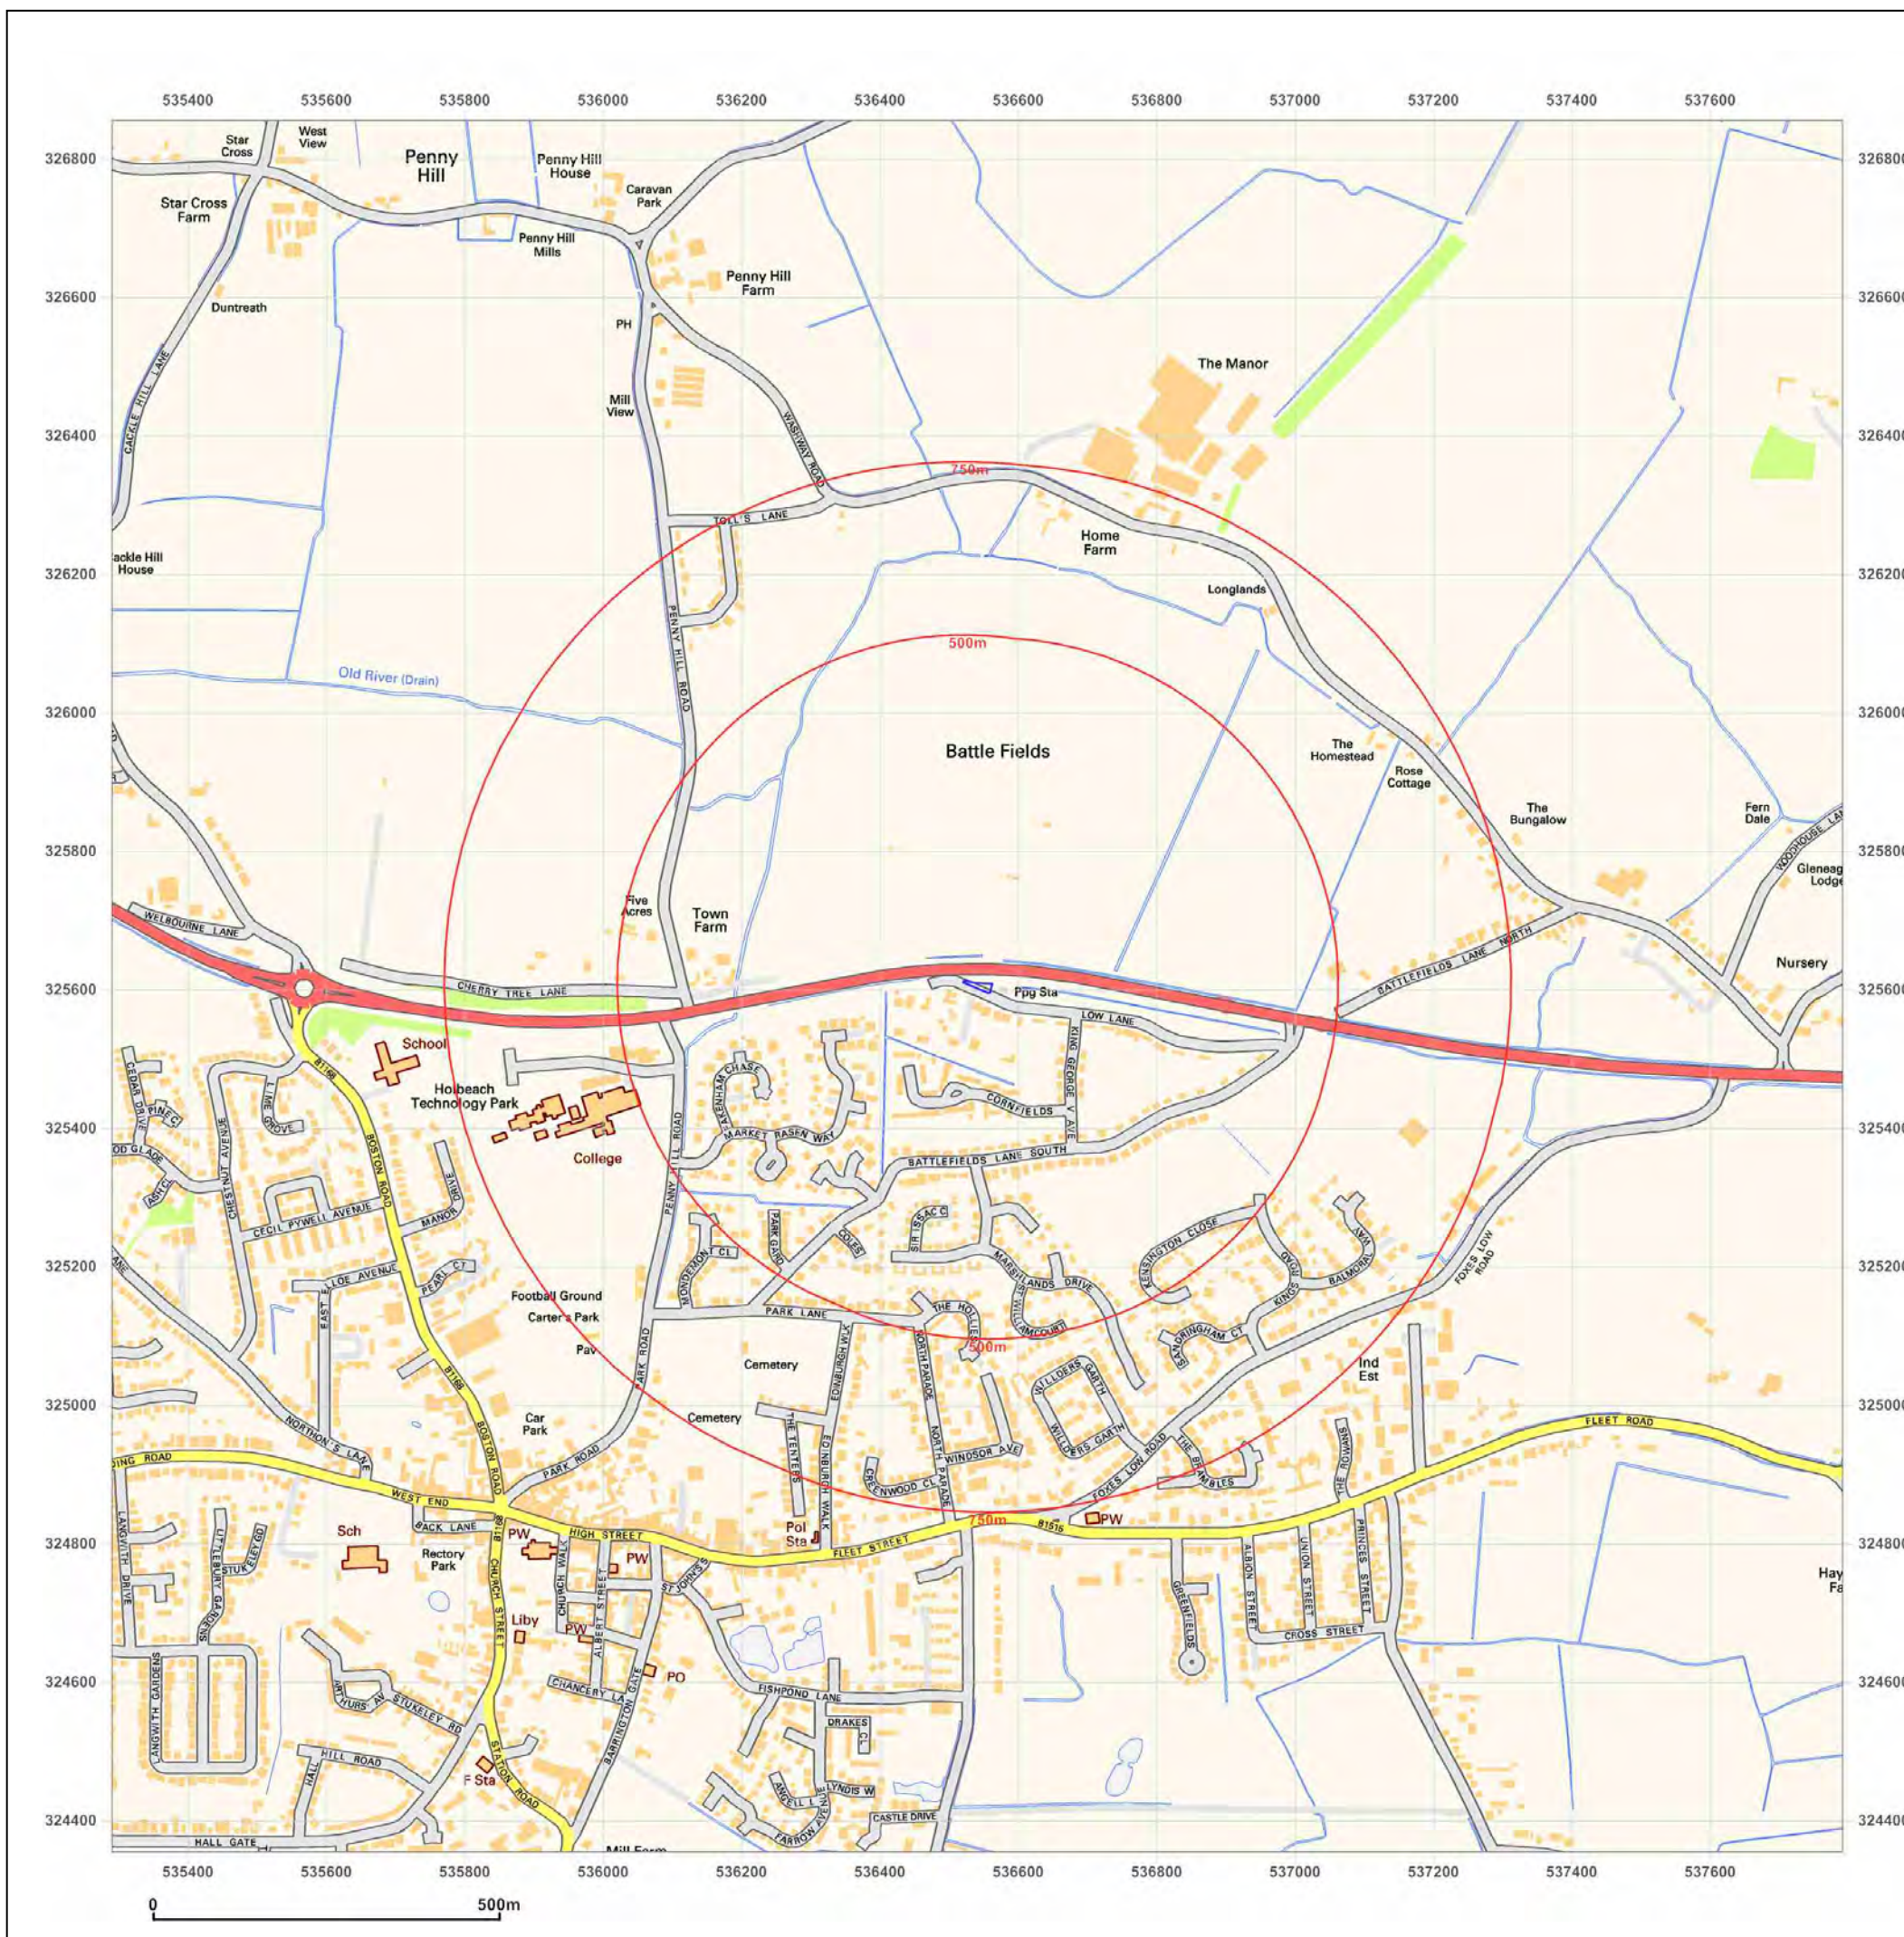

Site Details:

LAND OFF LOW LANE,
HOLBEACH, SPALDING, PE12
7PW

Client Ref: 0575-ds
Report Ref: GS-2391-5578647
Grid Ref: 536540, 325604

Map Name: National Grid

Map date: 2014

Scale: 1:10,000

Printed at: 1:10,000




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 31 October 2018

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

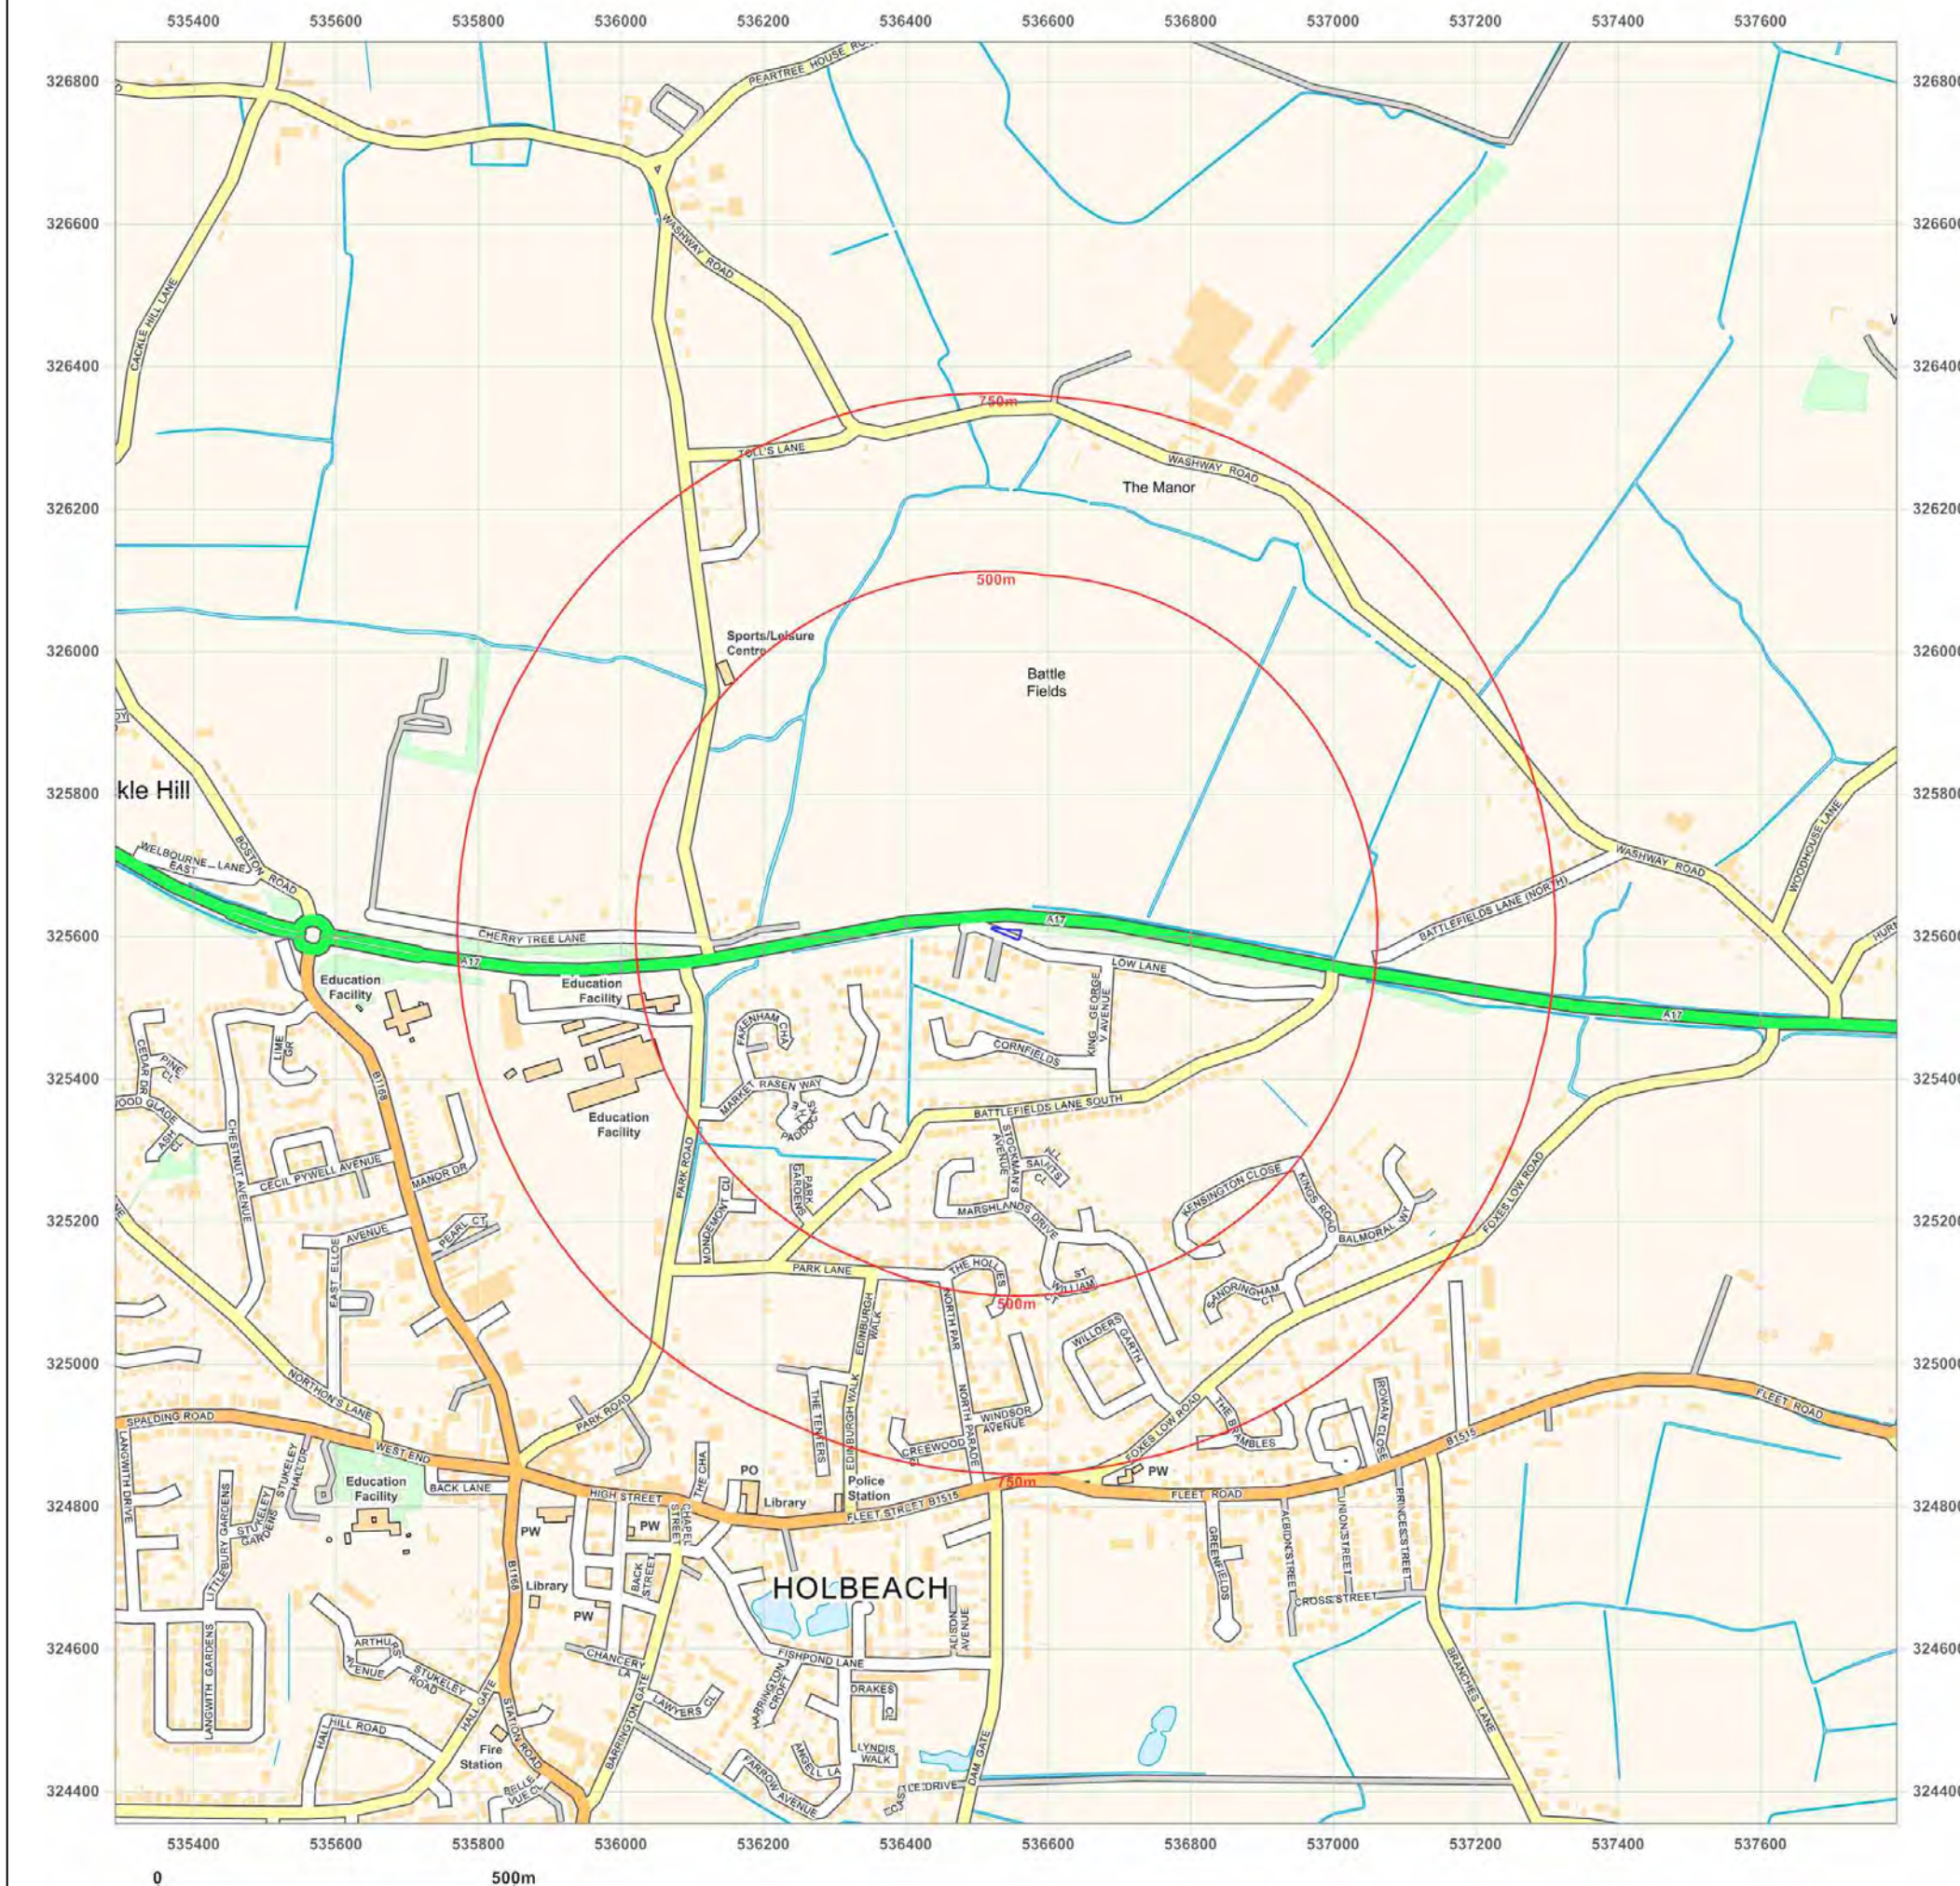



Goldfinch Environmental Limited
19, Palmer Street,
Bury St Edmunds,
Suffolk, IP31 3BZ

Groundsure Reference: GS-2391-5578645

Your Reference: 0575-ds

Report Date 31 Oct 2018

Report Delivery Method: Email - pdf

Enviro Insight

Address: LAND OFF LOW LANE, HOLBEACH, SPALDING, PE12 7PW

Dear Sir/ Madam,

Thank you for placing your order with Groundsure. Please find enclosed the **Groundsure Enviro Insight** as requested.

If you need any further assistance, please do not hesitate to contact our helpline on 08444 159000 quoting the above Groundsure reference number.

Yours faithfully,

Managing Director
Groundsure Limited

Enc.
Groundsure Enviroinsight

Address: LAND OFF LOW LANE, HOLBEACH, SPALDING, PE12 7PW
Date: 31 Oct 2018
Reference: GS-2391-5578645
Client: Goldfinch Environmental Limited

NW

N

NE

W

E



SW

S

SE

Aerial Photograph Capture date: 18-Jul-2015
Grid Reference: 536548,325605
Site Size: 0.03ha

Report Reference: GS-2391-5578645
Client Reference: 0575-ds

Contents Page

Contents Page	3
Overview of Findings	6
Using this report	10
1. Historical Land Use	11
1. Historical Industrial Sites	12
1.1 Potentially Contaminative Uses identified from 1:10,000 scale Mapping	12
1.2 Additional Information – Historical Tank Database	12
1.3 Additional Information – Historical Energy Features Database	12
1.4 Additional Information – Historical Petrol and Fuel Site Database	12
1.5 Additional Information – Historical Garage and Motor Vehicle Repair Database	13
1.6 Historical military sites	13
1.7 Potentially Infilled Land	13
2. Environmental Permits, Incidents and Registers Map	14
2. Environmental Permits, Incidents and Registers	15
2.1 Industrial Sites Holding Licences and/or Authorisations	15
2.1.1 Records of historic IPC Authorisations within 500m of the study site	15
2.1.2 Records of Part A(1) and IPPC Authorised Activities within 500m of the study site	15
2.1.3 Records of Red List Discharge Consents (potentially harmful discharges to controlled waters) within 500m of the study site	15
2.1.4 Records of List 1 Dangerous Substances Inventory Sites within 500m of the study site	15
2.1.5 Records of List 2 Dangerous Substance Inventory Sites within 500m of the study site	15
2.1.6 Records of Part A(2) and Part B Activities and Enforcements within 500m of the study site	16
2.1.7 Records of Category 3 or 4 Radioactive Substances Authorisations	16
2.1.8 Records of Licensed Discharge Consents within 500m of the study site	16
2.1.9 Records of Water Industry Referrals (potentially harmful discharges to the public sewer) within 500m of the study site	17
2.1.10 Records of Planning Hazardous Substance Consents and Enforcements within 500m of the study site	17
2.2 Dangerous or Hazardous Sites	17
2.3 Environment Agency/Natural Resources Wales Recorded Pollution Incidents	17
2.3.1 Records of National Incidents Recording System, List 2 within 500m of the study site	17
2.3.2 Records of National Incidents Recording System, List 1 within 500m of the study site	17
2.4 Sites Determined as Contaminated Land under Part 2A EPA 1990	18
3. Landfill and Other Waste Sites Map	19
3. Landfill and Other Waste Sites	20
3.1 Landfill Sites	20
3.1.1 Records from Environment Agency/Natural Resources Wales landfill data within 1000m of the study site	20
3.1.2 Records of Environment Agency/Natural Resources Wales historic landfill sites within 1500m of the study site	20
3.1.3 Records of BGS/DoE non-operational landfill sites within 1500m of the study site	21
3.1.4 Records of Landfills from Local Authority and Historical Mapping Records within 1500m of the study site	21
3.2 Other Waste Sites	21
3.2.1 Records of waste treatment, transfer or disposal sites within 500m of the study site	21
3.2.2 Records of Environment Agency/Natural Resources Wales licensed waste sites within 1500m of the study site	21
4. Current Land Use Map	23
4. Current Land Uses	24
4.1 Current Industrial Data	24
4.2 Petrol and Fuel Sites	24
4.3 National Grid High Voltage Underground Electricity Transmission Cables	24
4.4 National Grid High Pressure Gas Transmission Pipelines	25

5. Geology	26
5.1 Artificial Ground and Made Ground.....	26
5.2 Superficial Ground and Drift Geology	26
5.3 Bedrock and Solid Geology	26
6 Hydrogeology and Hydrology	27
6a. Aquifer Within Superficial Geology	27
6b. Aquifer Within Bedrock Geology and Abstraction Licences	28
6c. Hydrogeology – Source Protection Zones and Potable Water Abstraction Licences	29
6d. Hydrogeology – Source Protection Zones within confined aquifer	30
6e. Hydrology – Watercourse Network and River Quality	31
6.Hydrogeology and Hydrology	32
6.1 Aquifer within Superficial Deposits.....	32
6.2 Aquifer within Bedrock Deposits.....	32
6.3 Groundwater Abstraction Licences.....	32
6.4 Surface Water Abstraction Licences.....	32
6.5 Potable Water Abstraction Licences.....	33
6.6 Source Protection Zones.....	33
6.7 Source Protection Zones within Confined Aquifer.....	33
6.8 Groundwater Vulnerability and Soil Leaching Potential.....	33
6.9 River Quality.....	33
6.9.1 Biological Quality:.....	33
6.9.2 Chemical Quality:.....	34
6.10 Ordnance Survey MasterMap Water Network.....	34
6.11 Surface Water Features.....	38
7a. Environment Agency/Natural Resources Wales Flood Map for Planning (from rivers and the sea)	39
7b. Environment Agency/Natural Resources Wales Risk of Flooding from Rivers and the Sea (RoFRaS)	40
Map	40
7 Flooding	41
7.1 River and Coastal Zone 2 Flooding.....	41
7.2 River and Coastal Zone 3 Flooding.....	41
7.3 Risk of Flooding from Rivers and the Sea (RoFRaS) Flood Rating.....	42
7.4 Flood Defences.....	42
7.5 Areas benefiting from Flood Defences.....	42
7.6 Areas benefiting from Flood Storage.....	42
7.7 Groundwater Flooding Susceptibility Areas.....	43
7.8 Groundwater Flooding Confidence Areas.....	43
8. Designated Environmentally Sensitive Sites Map	44
8. Designated Environmentally Sensitive Sites	45
8.1 Records of Sites of Special Scientific Interest (SSSI) within 2000m of the study site:.....	45
8.2 Records of National Nature Reserves (NNR) within 2000m of the study site:.....	45
8.3 Records of Special Areas of Conservation (SAC) within 2000m of the study site:.....	45
8.4 Records of Special Protection Areas (SPA) within 2000m of the study site:.....	45
8.5 Records of Ramsar sites within 2000m of the study site:.....	45
8.6 Records of Ancient Woodland within 2000m of the study site:	46
8.7 Records of Local Nature Reserves (LNR) within 2000m of the study site:.....	46
8.8 Records of World Heritage Sites within 2000m of the study site:.....	46
8.9 Records of Environmentally Sensitive Areas within 2000m of the study site:	46
8.10 Records of Areas of Outstanding Natural Beauty (AONB) within 2000m of the study site:	46
8.11 Records of National Parks (NP) within 2000m of the study site:	46
8.12 Records of Nitrate Sensitive Areas within 2000m of the study site:.....	46
8.13 Records of Nitrate Vulnerable Zones within 2000m of the study site:.....	47

8.14 Records of Green Belt land within 2000m of the study site:.....	47
9. Natural Hazards Findings.....	48
9.1 Detailed BGS GeoSure Data.....	48
9.1.1 Shrink Swell.....	48
9.1.2 Landslides.....	48
9.1.3 Soluble Rocks.....	48
9.1.4 Compressible Ground.....	49
9.1.5 Collapsible Rocks.....	49
9.1.6 Running Sand.....	49
9.2 Radon.....	50
9.2.1 Radon Affected Areas.....	50
9.2.2 Radon Protection.....	50
10. Mining.....	51
10.1 Coal Mining.....	51
10.2 Non-Coal Mining.....	51
10.3 Brine Affected Areas	51
Contact Details.....	52
Standard Terms and Conditions.....	54

Overview of Findings

For further details on each dataset, please refer to each individual section in the main report as listed. Where the database has been searched a numerical result will be recorded. Where the database has not been searched '-' will be recorded.

Section 1: Historical Industrial Sites	On-site	0-50	51-250	251-500
1.1 Potentially Contaminative Uses identified from 1:10,000 scale mapping	0	0	0	5
1.2 Additional Information – Historical Tank Database	0	0	0	2
1.3 Additional Information – Historical Energy Features Database	0	0	0	1
1.4 Additional Information – Historical Petrol and Fuel Site Database	0	0	0	0
1.5 Additional Information – Historical Garage and Motor Vehicle Repair Database	0	0	0	0
1.6 Historical military sites	0	0	0	0
1.7 Potentially Infilled Land	0	0	0	1
Section 2: Environmental Permits, Incidents and Registers	On-site	0-50m	51-250	251-500
2.1 Industrial Sites Holding Environmental Permits and/or Authorisations				
2.1.1 Records of historic IPC Authorisations	0	0	0	0
2.1.2 Records of Part A(1) and IPPC Authorised Activities	0	0	0	0
2.1.3 Records of Red List Discharge Consents	0	0	0	0
2.1.4 Records of List 1 Dangerous Substances Inventory sites	0	0	0	0
2.1.5 Records of List 2 Dangerous Substances Inventory sites	0	0	0	2
2.1.6 Records of Part A(2) and Part B Activities and Enforcements	0	0	0	0
2.1.7 Records of Category 3 or 4 Radioactive Substances Authorisations	0	0	0	0
2.1.8 Records of Licensed Discharge Consents	0	0	3	1
2.1.9 Records of Water Industry Referrals	0	0	0	0
2.1.10 Records of Planning Hazardous Substance Consents and Enforcements within 500m of the study site	0	0	0	0
2.2 Records of COMAH and NIHHS sites	0	0	0	0
2.3 Environment Agency/Natural Resources Wales Recorded Pollution Incidents				
2.3.1 National Incidents Recording System, List 2	0	0	0	0
2.3.2 National Incidents Recording System, List 1	0	0	0	0
2.4 Sites Determined as Contaminated Land under Part 2A EPA 1990	0	0	0	0

Section 3: Landfill and Other Waste Sites	On-site	0-50m	51-250	251-500	501-1000	1000-1500
3.1 Landfill Sites						
3.1.1 Environment Agency/Natural Resources Wales Registered Landfill Sites	0	0	0	0	0	Not searched
3.1.2 Environment Agency/Natural Resources Wales Historic Landfill Sites	0	0	1	0	1	2
3.1.3 BGS/DoE Landfill Site Survey	0	0	0	0	0	0
3.1.4 Records of Landfills in Local Authority and Historical Mapping Records	0	0	0	0	0	0
3.2 Landfill and Other Waste Sites Findings						
3.2.1 Operational and Non-Operational Waste Treatment, Transfer and Disposal Sites	0	0	0	0	Not searched	Not searched
3.2.2 Environment Agency/Natural Resources Wales Licensed Waste Sites	0	0	0	0	0	3

Section 4: Current Land Use	On-site	0-50m	51-250	251-500
4.1 Current Industrial Sites Data	0	1	0	Not searched
4.2 Records of Petrol and Fuel Sites	0	0	0	0
4.3 National Grid Underground Electricity Cables	0	0	0	0
4.4 National Grid Gas Transmission Pipelines	0	0	0	0

Section 5: Geology	
5.1 Records of Artificial Ground and Made Ground present beneath the study site	None identified
5.2 Records of Superficial Ground and Drift Geology present beneath the study site	Identified
5.3 For records of Bedrock and Solid Geology beneath the study site see the detailed findings section.	

Section 6: Hydrogeology and Hydrology				0-500m		
6.1 Records of Strata Classification in the Superficial Geology within 500m of the study site				Identified		
6.2 Records of Strata Classification in the Bedrock Geology within 500m of the study site				Identified		
	On-site	0-50m	51-250	251-500	501-1000	1000-2000
6.3 Groundwater Abstraction Licences (within 2000m of the study site)	0	0	0	0	0	0
6.4 Surface Water Abstraction Licences (within 2000m of the study site)	0	0	0	0	0	0
6.5 Potable Water Abstraction Licences (within 2000m of the study site)	0	0	0	0	0	0
6.6 Source Protection Zones (within 500m of the study site)	0	0	0	0	Not searched	Not searched
6.7 Source Protection Zones within Confined Aquifer	0	0	0	0	Not searched	Not searched
6.8 Groundwater Vulnerability and Soil Leaching Potential (within 500m of the study site)	0	0	#250GWV #	#500GWV #	Not searched	Not searched

Section 6: Hydrogeology and Hydrology

0-500m

	On-site	0-50m	51-250	251-500	501-1000	1000-1500
6.9 Environment Agency/Natural Resources Wales information on river quality within 1500m of the study site	No	No	No	No	No	No
6.10 Ordnance Survey MasterMap Water Network entries within 500m of the site	0	6	10	34	Not searched	Not searched
6.11 Surface water features within 250m of the study site	No	Yes	Yes	Not searched	Not searched	Not searched

Section 7: Flooding

7.1 Environment Agency Zone 2 floodplains within 250m of the study site	Identified					
7.2 Environment Agency/Natural Resources Wales Zone 3 floodplains within 250m of the study site	Identified					
7.3 Risk of flooding from Rivers and the Sea (RoFRaS) rating for the study site	Low					
7.4 Flood Defences within 250m of the study site	None identified					
7.5 Areas benefiting from Flood Defences within 250m of the study site	None identified					
7.6 Areas used for Flood Storage within 250m of the study site	None identified					
7.7 Maximum BGS Groundwater Flooding susceptibility within 50m of the study site	Not Prone					
7.8 BGS confidence rating for the Groundwater Flooding susceptibility areas	Not Applicable					

Section 8: Designated Environmentally Sensitive Sites

	On-site	0-50m	51-250	251-500	501-1000	1000-2000
8.1 Records of Sites of Special Scientific Interest (SSSI)	0	0	0	0	0	0
8.2 Records of National Nature Reserves (NNR)	0	0	0	0	0	0
8.3 Records of Special Areas of Conservation (SAC)	0	0	0	0	0	0
8.4 Records of Special Protection Areas (SPA)	0	0	0	0	0	0
8.5 Records of Ramsar sites	0	0	0	0	0	0
8.6 Records of Ancient Woodlands	0	0	0	0	0	0
8.7 Records of Local Nature Reserves (LNR)	0	0	0	0	0	0
8.8 Records of World Heritage Sites	0	0	0	0	0	0
8.9 Records of Environmentally Sensitive Areas	0	0	0	0	0	0

Section 8: Designated Environmentally Sensitive Sites	On-site	0-50m	51-250	251-500	501-1000	1000-2000
8.10 Records of Areas of Outstanding Natural Beauty (AONB)	0	0	0	0	0	0
8.11 Records of National Parks	0	0	0	0	0	0
8.12 Records of Nitrate Sensitive Areas	0	0	0	0	0	0
8.13 Records of Nitrate Vulnerable Zones	1	0	0	0	0	0
8.14 Records of Green Belt land	0	0	0	0	0	0

Section 9: Natural Hazards	
9.1 Maximum risk of natural ground subsidence	Moderate
9.1.1 Maximum Shrink-Swell hazard rating identified on the study site	Low
9.1.2 Maximum Landslides hazard rating identified on the study site	Very Low
9.1.3 Maximum Soluble Rocks hazard rating identified on the study site	Negligible
9.1.4 Maximum Compressible Ground hazard rating identified on the study site	Moderate
9.1.5 Maximum Collapsible Rocks hazard rating identified on the study site	Negligible
9.1.6 Maximum Running Sand hazard rating identified on the study site	Moderate
9.2 Radon	
9.2.1 Is the property in a Radon Affected Area as defined by the Health Protection Agency (HPA) and if so what percentage of homes are above the Action Level?	The site is not in a Radon Affected Area, as less than 1% of properties are above the Action Level.
9.2.2 Is the property in an area where Radon Protection are required for new properties or extensions to existing ones as described in publication BR211 by the Building Research Establishment?	No radon protective measures are necessary.

Section 10: Mining	
10.1 Coal mining areas within 75m of the study site	None identified
10.2 Non-Coal Mining areas within 50m of the study site boundary	None identified
10.3 Brine affected areas within 75m of the study site	None identified

Using this report

The following report is designed by Environmental Consultants for Environmental Professionals bringing together the most up-to-date market leading environmental data. This report is provided under and subject to the Terms & Conditions agreed between Groundsure and the Client. The document contains the following sections:

1. Historical Industrial Sites

Provides information on past land uses that may pose a risk to the study site in terms of potential contamination from activities or processes. Potentially Infilled Land features are also included. This search is conducted using radii of up to 500m.

2. Environmental Permits, Incidents and Registers

Provides information on Regulated Industrial Activities and Pollution Incidents as recorded by Regulatory Authorities, and sites determined as Contaminated Land. This search is conducted using radii up to 500m.

3. Landfills and Other Waste Sites

Provides information on landfills and other waste sites that may pose a risk to the study site. This search is conducted using radii up to 1500m.

4. Current Land Uses

Provides information on current land uses that may pose a risk to the study site in terms of potential contamination from activities or processes. These searches are conducted using radii of up to 500m. This includes information on potentially contaminative industrial sites, petrol stations and fuel sites as well as high pressure gas pipelines and underground electricity transmission lines.

5. Geology

Provides information on artificial and superficial deposits and bedrock beneath the study site.

6. Hydrogeology and Hydrology

Provides information on productive strata within the bedrock and superficial geological layers, abstraction licences, Source Protection Zones (SPZs) and river quality. These searches are conducted using radii of up to 2000m.

7. Flooding

Provides information on river and coastal flooding, flood defences, flood storage areas and groundwater flood areas. This search is conducted using radii of up to 250m.

8. Designated Environmentally Sensitive Sites

Provides information on the Sites of Special Scientific Interest (SSSI), National Nature Reserves (NNR), Special Areas of Conservation (SAC), Special Protection Areas (SPA), Ramsar sites, Local Nature Reserves (LNR), Areas of Outstanding Natural Beauty (AONB), National Parks (NP), Environmentally Sensitive Areas, Nitrate Sensitive Areas, Nitrate Vulnerable Zones and World Heritage Sites and Scheduled Ancient Woodland. These searches are conducted using radii of up to 2000m.

9. Natural Hazards

Provides information on a range of natural hazards that may pose a risk to the study site. These factors include natural ground subsidence and radon..

10. Mining

Provides information on areas of coal and non-coal mining and brine affected areas.

11. Contacts

This section of the report provides contact points for statutory bodies and data providers that may be able to provide further information on issues raised within this report. Alternatively, Groundsure provide a free Technical Helpline (08444 159000) for further information and guidance.


Note: Maps

Only certain features are placed on the maps within the report. All features represented on maps found within this search are given an identification number. This number identifies the feature on the mapping and correlates it to the additional information provided below. This identification number precedes all other information and takes the following format -Id: 1, Id: 2, etc. Where numerous features on the same map are in such close proximity that the numbers would obscure each other a letter identifier is used instead to represent the features. (e.g. Three features which overlap may be given the identifier "A" on the map and would be identified separately as features 1A, 3A, 10A on the data tables provided).


Where a feature is reported in the data tables to a distance greater than the map area, it is noted in the data table as "Not Shown".

All distances given in this report are in Metres (m). Directions are given as compass headings such as N: North, E: East, NE: North East from the nearest point of the study site boundary.

1. Historical Land Use

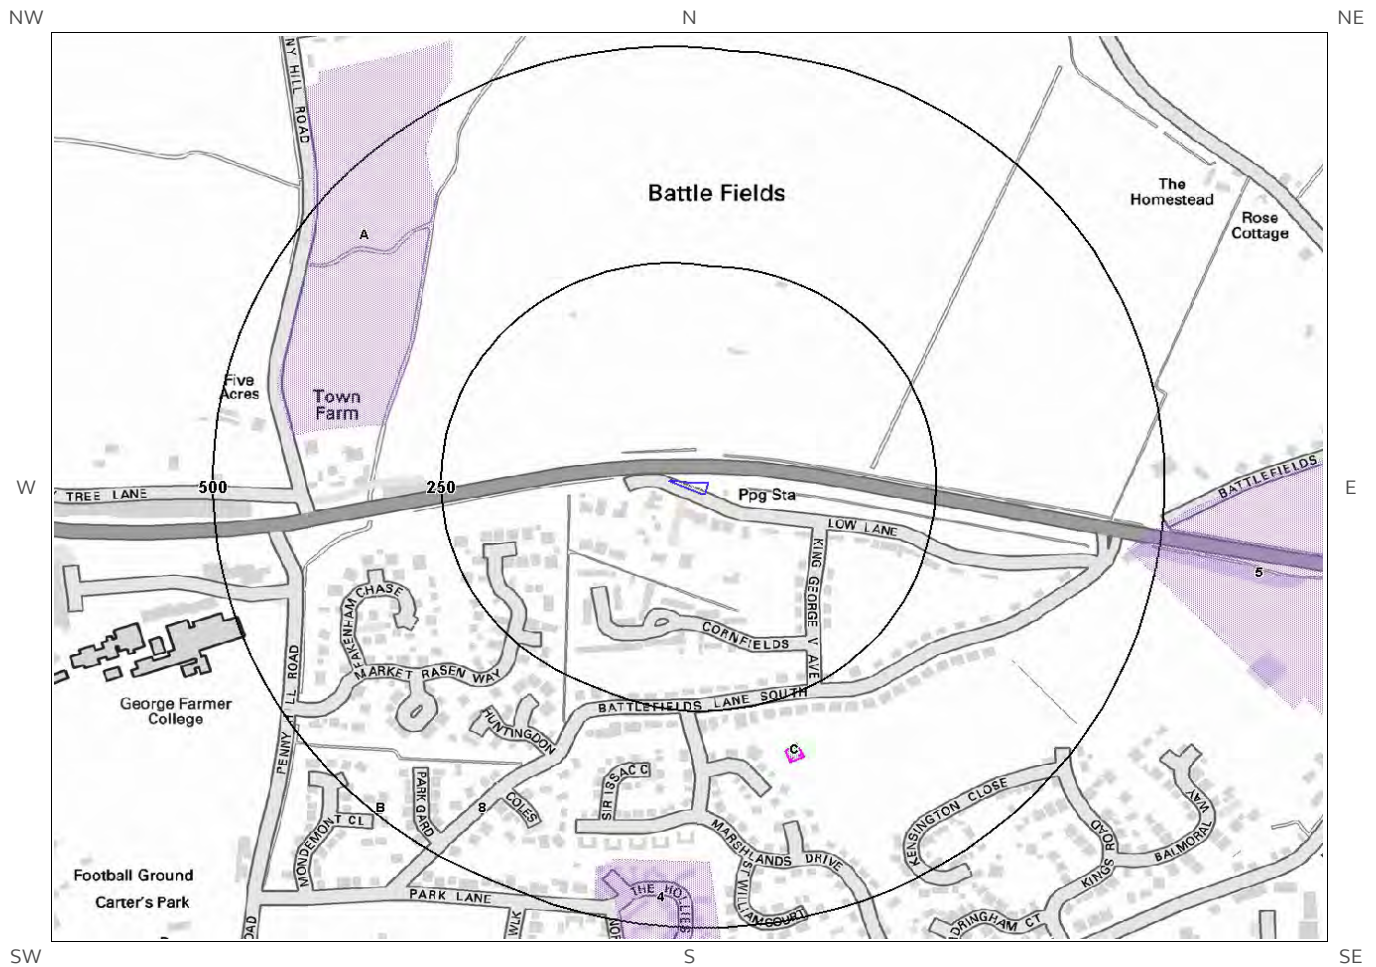

© Crown copyright and database rights 2018.
Ordnance Survey licence 100035207.

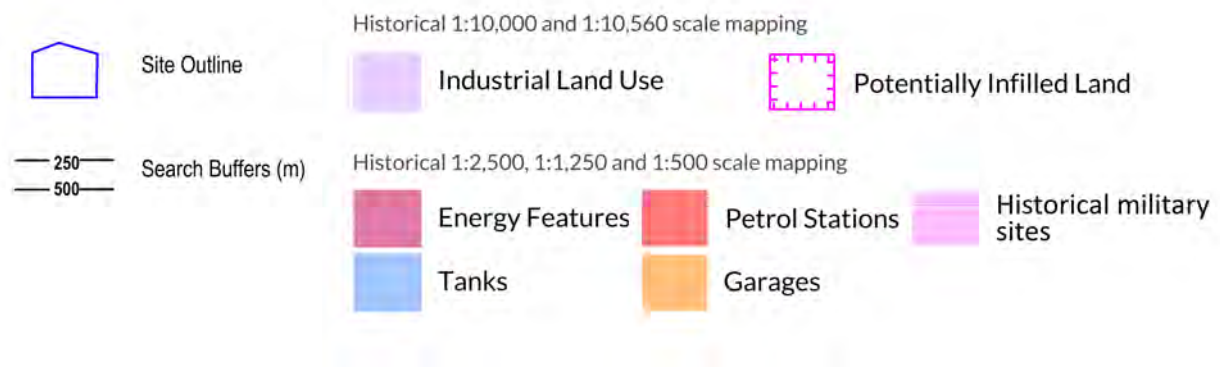

1. Historical Industrial Sites

1.1 Potentially Contaminative Uses identified from 1:10,000 scale Mapping

The systematic analysis of data extracted from standard 1:10,560 and 1:10,000 scale historical maps provides the following information:

Records of sites with a potentially contaminative past land use within 500m of the search boundary: 5

ID	Distance [m]	Direction	Use	Date
1C	305	S	Sewage Works	1976
2A	316	W	Nursery	1976
3A	316	W	Nursery	1992
4	424	S	Unspecified Depot	1976
5	465	E	Nursery	1976

1.2 Additional Information – Historical Tank Database

The systematic analysis of data extracted from High Detailed 1:1,250 and 1:2,500 scale historical maps provides the following information.

Records of historical tanks within 500m of the search boundary: 2

ID	Distance (m)	Direction	Use	Date
6B	492	SW	Unspecified Tank	1968
7B	493	SW	Unspecified Tank	1982

1.3 Additional Information – Historical Energy Features Database

The systematic analysis of data extracted from High Detailed 1:1,250 and 1:2,500 scale historical maps provides the following information.

Records of historical energy features within 500m of the search boundary: 1

ID	Distance (m)	Direction	Use	Date
8	431	SW	Electricity Substation	1999

1.4 Additional Information – Historical Petrol and Fuel Site Database

The systematic analysis of data extracted from High Detailed 1:1,250 and 1:2,500 scale historical maps provides the following information.

Records of historical petrol stations and fuel sites within 500m of the search boundary: 0

Database searched and no data found.

1.5 Additional Information – Historical Garage and Motor Vehicle Repair Database

The systematic analysis of data extracted from High Detailed 1:1,250 and 1:2,500 scale historical maps provides the following information.

Records of historical garage and motor vehicle repair sites within 500m of the search boundary: 0

Database searched and no data found.

1.6 Historical military sites

Certain military installations were not noted on historic mapping for security reasons. Whilst not all military land is necessarily of concern, Groundsure has researched and digitised a number of Ordnance Factories and other military industrial features (e.g. Ordnance Depots, Munitions Testing Grounds) which may be of contaminative concern. This research was drawn from a number of different sources, and should not be regarded as a definitive or exhaustive database of potentially contaminative military installations. The boundaries of sites within this database have been estimated from the best evidence available to Groundsure at the time of compilation.

Records of historical military sites within 500m of the search boundary: 0

Database searched and no data found.


1.7 Potentially Infilled Land

Records of Potentially Infilled Features from 1:10,000 scale mapping within 500m of the study site: 1

The following Historical Potentially Infilled Features derived from the Historical Mapping information is provided by Groundsure:

ID	Distance(m)	Direction	Use	Date
9C	305	S	Sewage Works	1976

2. Environmental Permits, Incidents and Registers Map

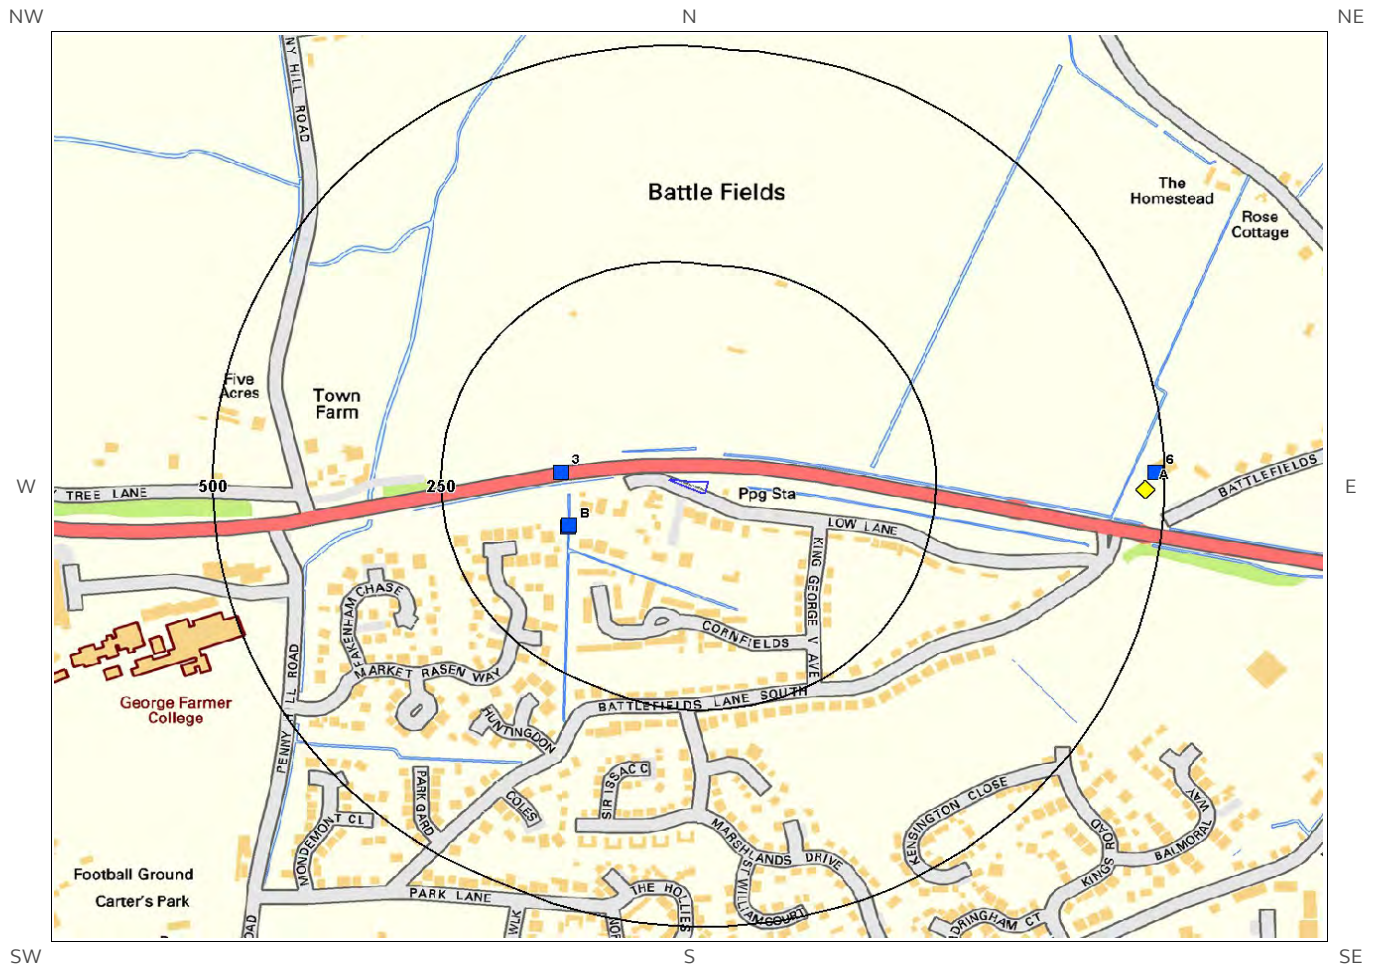

© Crown copyright and database rights 2018.
Ordnance Survey licence 100035207.



2. Environmental Permits, Incidents and Registers

2.1 Industrial Sites Holding Licences and/or Authorisations

Searches of information provided by the Environment Agency/Natural Resources Wales and Local Authorities reveal the following information:

2.1.1 Records of historic IPC Authorisations within 500m of the study site:

0

Database searched and no data found.

2.1.2 Records of Part A(1) and IPPC Authorised Activities within 500m of the study site:

0

Database searched and no data found.

2.1.3 Records of Red List Discharge Consents (potentially harmful discharges to controlled waters) within 500m of the study site:

0

Database searched and no data found.

2.1.4 Records of List 1 Dangerous Substances Inventory Sites within 500m of the study site:

0

Database searched and no data found.

2.1.5 Records of List 2 Dangerous Substance Inventory Sites within 500m of the study site:

2

The following List 2 Dangerous Substance Inventory Site records are represented as points on the Environmental Permits, Incidents and Registers Map:

ID	Distance (m)	Direction	NGR	Details	
1A	479	E	537040	Name: Swepstone Butchers	Authorised Substances: pH

ID	Distance (m)	Direction	NGR	Details
			325600	Status: Not Active Receiving Water: Na
2A	479	E	537040 325600	Name: Swepstone Butchers Status: Not Active Receiving Water: Na Authorised Substances: pH

2.1.6 Records of Part A(2) and Part B Activities and Enforcements within 500m of the study site:

0

Database searched and no data found.

2.1.7 Records of Category 3 or 4 Radioactive Substances Authorisations:

0

Database searched and no data found.

2.1.8 Records of Licensed Discharge Consents within 500m of the study site:

4

The following Licensed Discharge Consents records are represented as points on the Environmental Permits, Incidents and Registers Map:

ID	Distance (m)	Direction	NGR	Details
3	119	W	536400 325620	Address: LOW LANE NO.67, HOLBEACH, SPALDING, LINCOLNSHIRE, ., PE12 7PW Effluent Type: SEWAGE DISCHARGES - FINAL/TREATED EFFLUENT - NOT WATER COMPANY Permit Number: PRNNF12482 Permit Version: 1 Receiving Water: BATTLEFIELDS DYKE Status: NEW CONSENT (WRA 91, S88 & SCHED 10 AS AMENDED BY ENV ACT 1995) Issue date: 30/05/2000 Effective Date: 27-Sep-2000 Revocation Date:
4B	122	SW	536409 325559	Address: NEW BUNGALOW, 59A LOW LANE, HOLBEACH, SPALDING, LINCOLNSHIRE, PE12 7PW Effluent Type: SEWAGE DISCHARGES - FINAL/TREATED EFFLUENT - NOT WATER COMPANY Permit Number: NPSWQD008865 Permit Version: 1 Receiving Water: DRAIN TO OLD RIVER (DRAIN) Status: NEW CONSENT (WRA 91, S88 & SCHED 10 AS AMENDED BY ENV ACT 1995) Issue date: 17/08/2009 Effective Date: 17-Aug-2009 Revocation Date:
5B	123	SW	536408 325557	Address: 61 LOW LANE, HOLBEACH, SPALDING, ., LINCOLNSHIRE, PE12 7PW Effluent Type: SEWAGE DISCHARGES - FINAL/TREATED EFFLUENT - NOT WATER COMPANY Permit Number: NPSWQD001878 Permit Version: 1 Receiving Water: TRIBUTARY OF THE RIVER WELLAND Status: NEW CONSENT (WRA 91, S88 & SCHED 10 AS AMENDED BY ENV ACT 1995) Issue date: 30/06/2008 Effective Date: 30-Jun-2008 Revocation Date:
6	489	E	537050 325620	Address: THE HIGHWAYS DEPOT, BATTLEFIELDS LANE NORTH, HOLBEACH, LINCOLNSHIRE, PE12 7PF Receiving Water: - Status: POST NRA LEGISLATION WHERE ISSUE DATE > 31-AUG-89 (HISTORIC

ID	Distance (m)	Direction	NGR	Details
				Effluent Type: SEWAGE DISCHARGES - FINAL/TREATED EFFLUENT - NOT WATER COMPANY Permit Number: PRNLF03005 Permit Version: 1 ONLY) Issue date: 20/07/1990 Effective Date: 20-Jul-1990 Revocation Date: 01/10/1996

2.1.9 Records of Water Industry Referrals (potentially harmful discharges to the public sewer) within 500m of the study site:

0

Database searched and no data found.

2.1.10 Records of Planning Hazardous Substance Consents and Enforcements within 500m of the study site:

0

Database searched and no data found.

2.2 Dangerous or Hazardous Sites

Records of COMAH & NIHHS sites within 500m of the study site:

0

Database searched and no data found.

2.3 Environment Agency/Natural Resources Wales Recorded Pollution Incidents

2.3.1 Records of National Incidents Recording System, List 2 within 500m of the study site:

0

Database searched and no data found.

2.3.2 Records of National Incidents Recording System, List 1 within 500m of the study site:

0



Database searched and no data found.

2.4 Sites Determined as Contaminated Land under Part 2A EPA 1990

Records of sites determined as contaminated land under Section 78R of the Environmental Protection Act 1990 are there within 500m of the study site 0

Database searched and no data found.

3. Landfill and Other Waste Sites Map

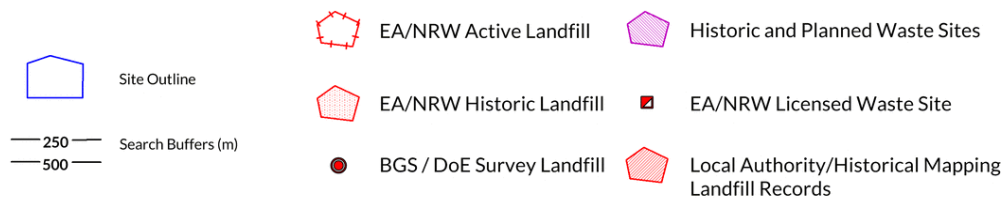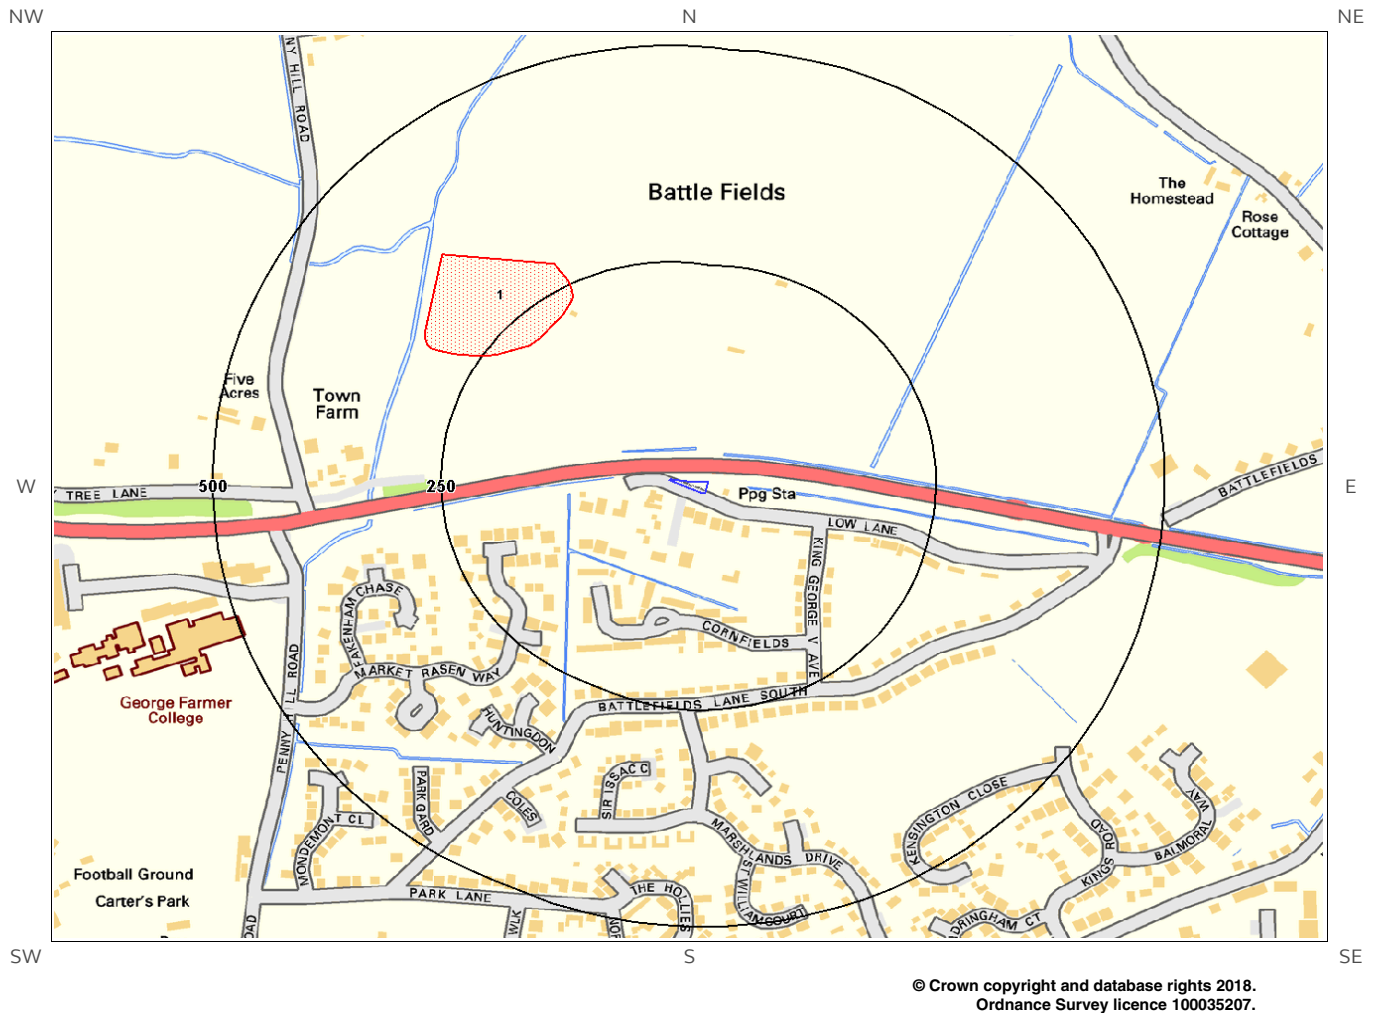

3. Landfill and Other Waste Sites

3.1 Landfill Sites

3.1.1 Records from Environment Agency/Natural Resources Wales landfill data within 1000m of the study site:

0

Database searched and no data found.

3.1.2 Records of Environment Agency/Natural Resources Wales historic landfill sites within 1500m of the study site:

4

The following landfill records are represented as either points or polygons on the Landfill and Other Waste Sites map:

ID	Distance (m)	Direction	NGR	Details
1	215	NW		Site Address: Battle Field, Penny Hill Road, Holbeach, Lincolnshire Waste Licence: - Site Reference: RD7-56-01/89, SH-56-01/89, 2500/5044 Waste Type: Household Environmental Permitting Regulations (Waste) Reference: - Licence Issue: Licence Surrendered: Licence Holder Address: - Operator: - Licence Holder: - First Recorded: - Last Recorded: -
Not shown	877	S		Site Address: Allison Avenue, Holbeach, Lincolnshire Waste Licence: - Site Reference: SH-54-01/89, RD7-54-01/89, RD7-55-01/89, 2500/5263 Waste Type: Household Environmental Permitting Regulations (Waste) Reference: - Licence Issue: Licence Surrendered: Licence Holder Address: - Operator: - Licence Holder: - First Recorded: - Last Recorded: -
Not shown	1162	S		Site Address: Barrington Gate, Holbeach, Lincolnshire Waste Licence: - Site Reference: RD7-52-01/89, SH-52-01/89, 0500/5053 Waste Type: Household Environmental Permitting Regulations (Waste) Reference: - Licence Issue: Licence Surrendered: Licence Holder Address: - Operator: - Licence Holder: - First Recorded: - Last Recorded: -
Not shown	1187	S		Site Address: Holbeach Fen, Dam Gate, Holbeach, Lincolnshire Waste Licence: - Site Reference: RD7-53-01/89, SH-53-01/89, 2500/5036 Waste Type: Household Environmental Permitting Regulations Licence Issue: Licence Surrendered: Licence Holder Address: - Operator: - Licence Holder: - First Recorded: - Last Recorded: -

ID	Distance (m)	Direction	NGR	Details
(Waste) Reference: -				

3.1.3 Records of BGS/DoE non-operational landfill sites within 1500m of the study site:

0

Database searched and no data found.

3.1.4 Records of Landfills from Local Authority and Historical Mapping Records within 1500m of the study site:

0

Database searched and no data found.

3.2 Other Waste Sites

3.2.1 Records of waste treatment, transfer or disposal sites within 500m of the study site:

0

Database searched and no data found.

3.2.2 Records of Environment Agency/Natural Resources Wales licensed waste sites within 1500m of the study site:


3

The following waste treatment, transfer or disposal sites records are represented as points on the Landfill and Other Waste Sites map:

ID	Distance (m)	Direction	NGR	Details
Not shown	1373	S	536100 324300	Site Address: Ladbrook Mr E., 5a, Fen Road, Holbeach, Lincolnshire, PE12 8QA Type: Metal Recycling Site (mixed MRS's) Size: >= 25000 tonnes < 75000 tonnes Environmental Permitting Regulations (Waste) Licence Number: NMR003 EPR reference: EA/EPR/LB3135RD/V002 Operator: Nationwide Metal Recycling Ltd Waste Management licence No: 71024 Annual Tonnage: 30000.0 Issue Date: 13/05/1992 Effective Date: 26/10/2012 Modified: 05/11/2012 Surrendered Date: - Expiry Date: - Cancelled Date: - Status: Modified Site Name: Nationwide Metal Recycling Ltd Correspondence Address: -
Not shown	1373	S	536100 324300	Site Address: Ladbrook Mr E., 5a, Fen Road, Holbeach, Lincolnshire, PE12 8QA Type: Metal Recycling Site (mixed MRS's) Size: < 25000 tonnes Environmental Permitting Regulations (Waste) Licence Number: LAD001 EPR reference: EA/EPR/TP3498NJ/A001 Issue Date: 13/05/1992 Effective Date: - Modified: - Surrendered Date: - Expiry Date: - Cancelled Date: - Status: Issued

ID	Distance (m)	Direction	NGR	Details	
Not shown	1373	S	536100 324300	Operator: Ladbrooke Mr E Waste Management licence No: 71024 Annual Tonnage: 30000.0	Site Name: Eric Ladbrooke Ltd Correspondence Address: -
				Site Address: Ladbrook Mr E., 5a, Fen Road, Holbeach, Lincolnshire, PE12 8QA Type: Metal Recycling Site (mixed MRS's) Size: < 25000 tonnes Environmental Permitting Regulations (Waste) Licence Number: LAD001 EPR reference: - Operator: Ladbrook Mr E Waste Management licence No: 71024 Annual Tonnage: 30000.0	Issue Date: 13/05/1992 Effective Date: - Modified: - Surrendered Date: - Expiry Date: - Cancelled Date: - Status: Issued Site Name: Eric Ladbrooke Ltd Correspondence Address: Ladbrook Mr E., 5a, Fen Road, Holbeach, Lincolnshire, PE12 8QA

4. Current Land Use Map

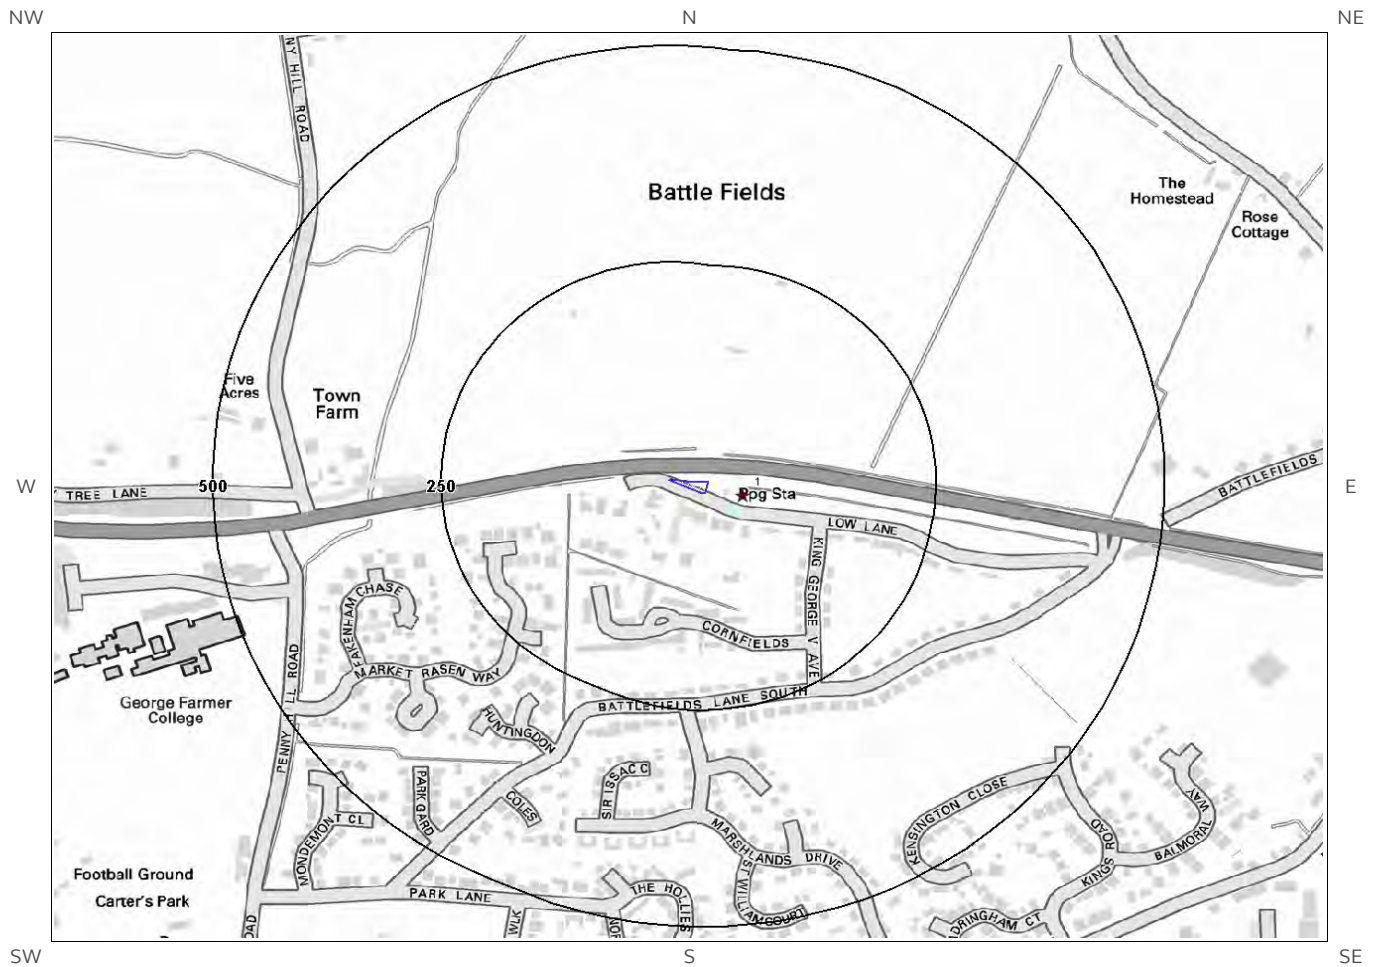

© Crown copyright and database rights 2018.
Ordnance Survey licence 100035207.



4. Current Land Uses

4.1 Current Industrial Data

Records of potentially contaminative industrial sites within 250m of the study site: 1

The following records are represented as points on the Current Land Uses map.

ID	Distance (m)	Direction	Company	NGR	Address	Activity	Category
1	40	E	Pumping Station	536599 325594	PE12	Water Pumping Stations	Industrial Features

4.2 Petrol and Fuel Sites

Records of petrol or fuel sites within 500m of the study site: 0

Database searched and no data found.

4.3 National Grid High Voltage Underground Electricity Transmission Cables

This dataset identifies the high voltage electricity transmission lines running between generating power plants and electricity substations. The dataset does not include the electricity distribution network (smaller, lower voltage cables distributing power from substations to the local user network). This information has been extracted from databases held by National Grid and is provided for information only with no guarantee as to its completeness or accuracy. National Grid do not offer any warranty as to the accuracy of the available data and are excluded from any liability for any such inaccuracies or errors.

Records of National Grid high voltage underground electricity transmission cables within 500m of the study site: 0

Database searched and no data found.

4.4 National Grid High Pressure Gas Transmission Pipelines

This dataset identifies high-pressure, large diameter pipelines which carry gas between gas terminals, power stations, compressors and storage facilities. The dataset does not include the Local Transmission System (LTS) which supplies gas directly into homes and businesses. This information has been extracted from databases held by National Grid and is provided for information only with no guarantee as to its completeness or accuracy. National Grid do not offer any warranty as to the accuracy of the available data and are excluded from any liability for any such inaccuracies or errors.

Records of National Grid high pressure gas transmission pipelines within 500m of the study site: 0

Database searched and no data found.

5. Geology

5.1 Artificial Ground and Made Ground

Database searched and no data found.

The database has been searched on site, including a 50m buffer.

5.2 Superficial Ground and Drift Geology

The database has been searched on site, including a 50m buffer.

Lex Code	Description	Rock Type
TFD-XCZ	TIDAL FLAT DEPOSITS	CLAY AND SILT

5.3 Bedrock and Solid Geology

The database has been searched on site, including a 50m buffer.

Lex Code	Description	Rock Type
WWB-MDSI	WEST WALTON FORMATION	MUDSTONE AND SILTSTONE


(Derived from the BGS 1:50,000 Digital Geological Map of Great Britain)

6 Hydrogeology and Hydrology

6a. Aquifer Within Superficial Geology




© Crown copyright and database rights 2018
Ordnance Survey licence 100035207.

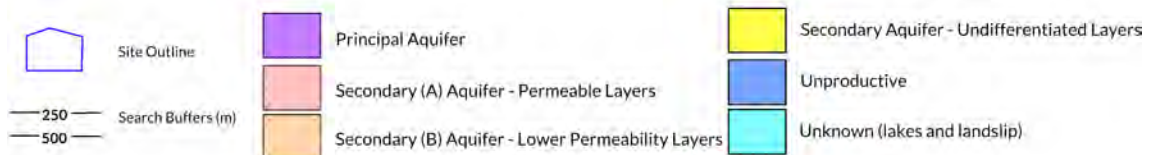


6b. Aquifer Within Bedrock Geology and Abstraction Licences




© Crown copyright and database rights 2018
Ordnance Survey licence 100035207.

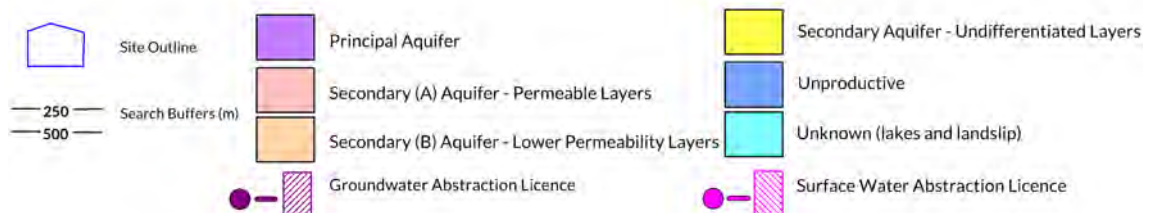


6c. Hydrogeology – Source Protection Zones and Potable Water Abstraction Licences

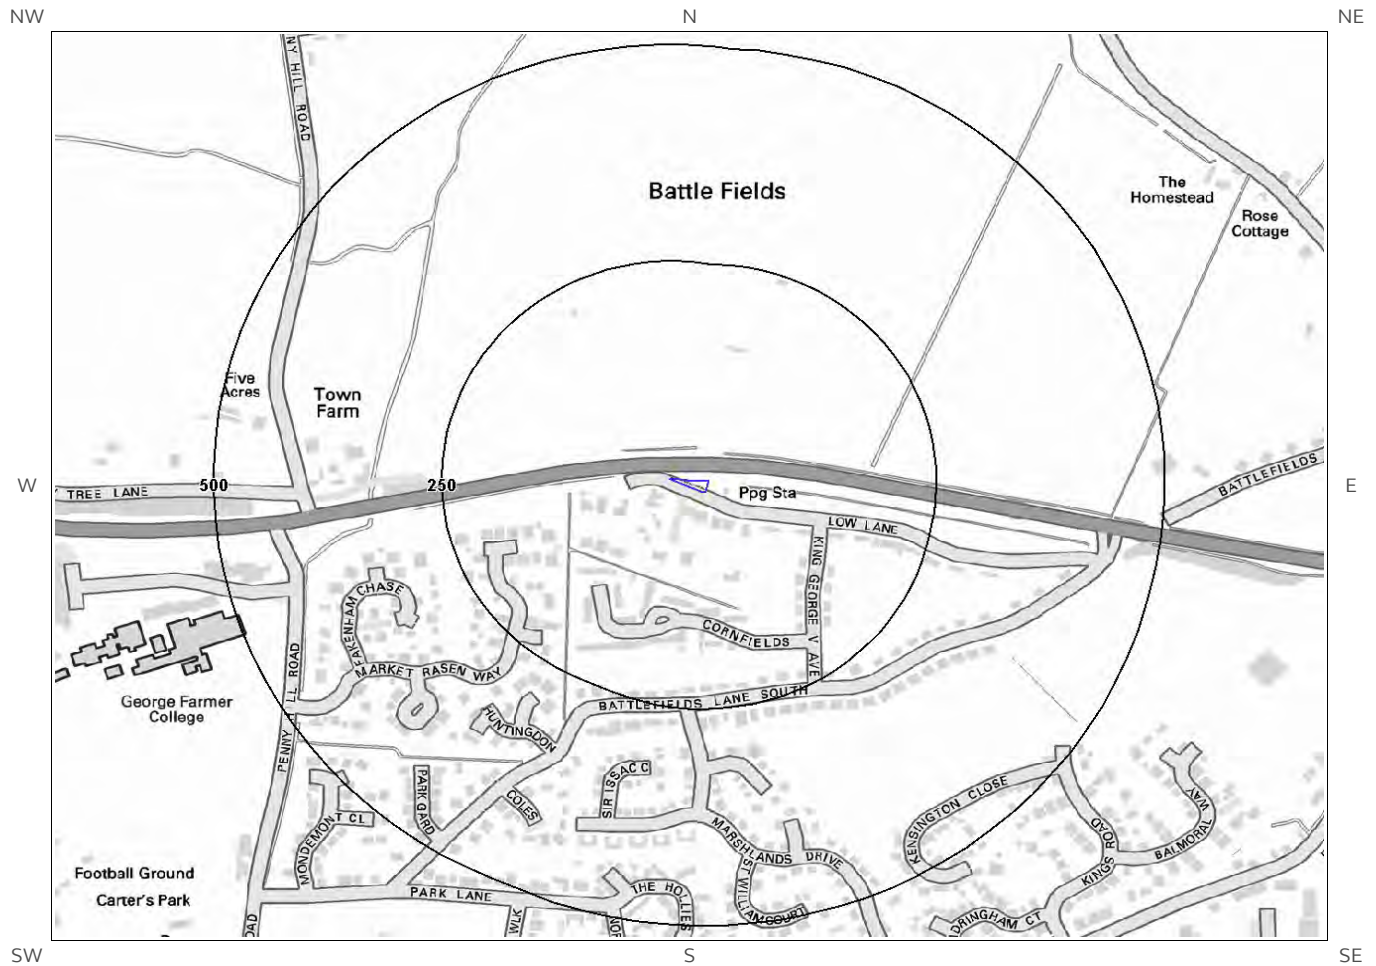


© Crown copyright and database rights 2018
Ordnance Survey licence 100035207.

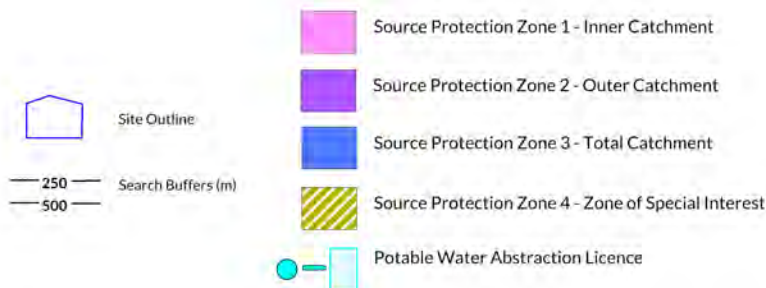


6d. Hydrogeology – Source Protection Zones within confined aquifer

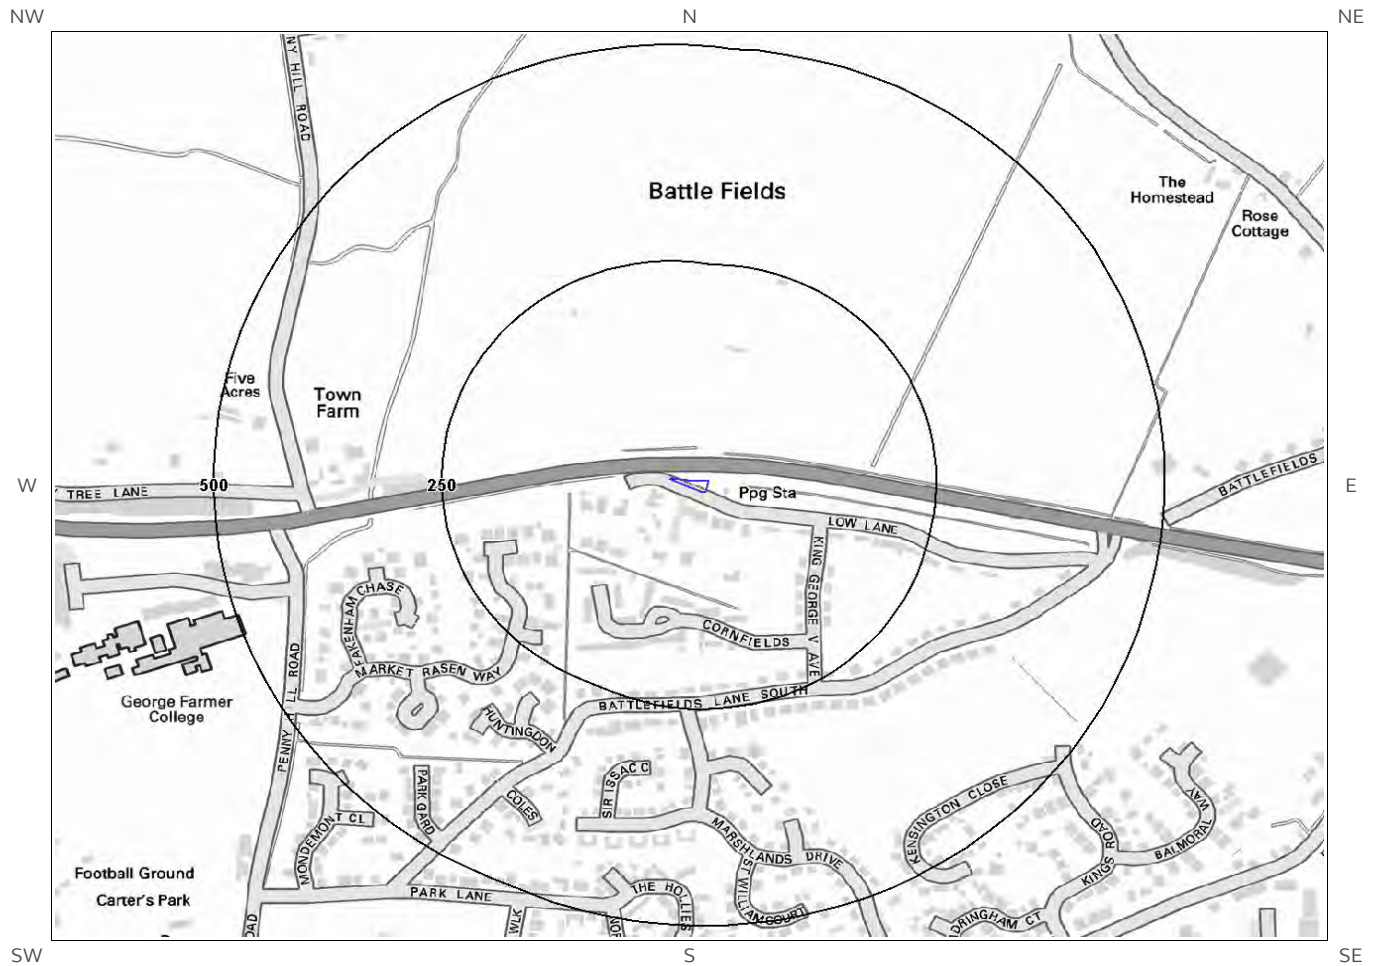

© Crown copyright and database rights 2018
Ordnance Survey licence 100035207.

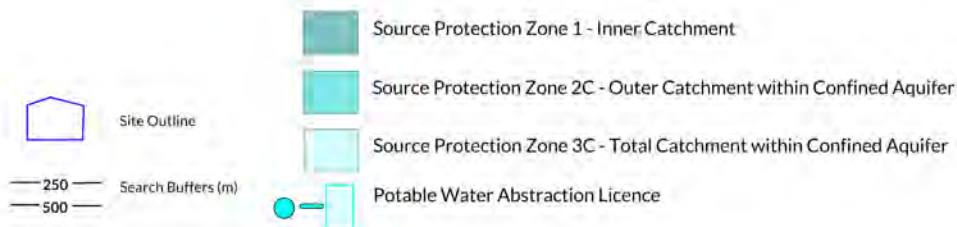

6e. Hydrology – Watercourse Network and River Quality

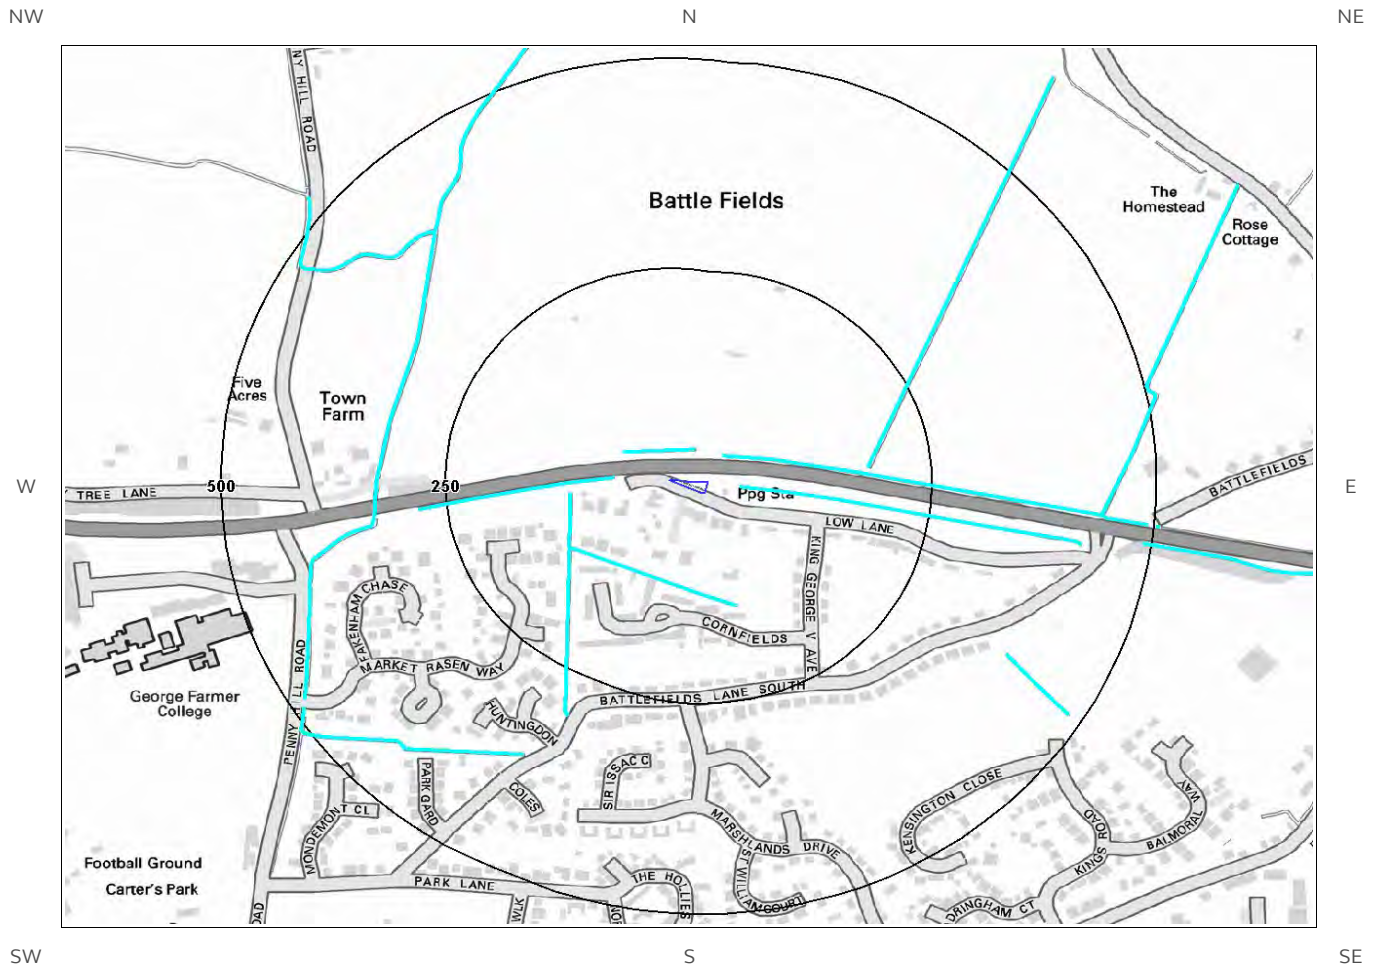

© Crown copyright and database rights 2018.
Ordnance Survey licence 100035207.



6. Hydrogeology and Hydrology

6.1 Aquifer within Superficial Deposits

Records of strata classification within the superficial geology at or in proximity to the property Yes

From 1 April 2010, the Environment Agency/Natural Resources Wales's Groundwater Protection Policy has been using aquifer designations consistent with the Water Framework Directive. For further details on the designation and interpretation of this information, please refer to the Groundsure Enviro Insight User Guide.

The following aquifer records are shown on the Aquifer within Superficial Geology Map (6a):

ID	Distance (m)	Direction	Designation	Description
1	0	On Site	Unproductive	These are rock layers or drift deposits with low permeability that have negligible significance for water supply or river base flow

6.2 Aquifer within Bedrock Deposits

Records of strata classification within the bedrock geology at or in proximity to the property Yes

From 1 April 2010, the Environment Agency/Natural Resources Wales's Groundwater Protection Policy has been using aquifer designations consistent with the Water Framework Directive. For further details on the designation and interpretation of this information, please refer to the Groundsure Enviro Insight User Guide.

The following aquifer records are shown on the Aquifer within Bedrock Geology Map (6b):

ID	Distance (m)	Direction	Designation	Description
1	0	On Site	Unproductive	These are rock layers or drift deposits with low permeability that have negligible significance for water supply or river base flow

6.3 Groundwater Abstraction Licences

Groundwater Abstraction Licences within 2000m of the study site None identified

Database searched and no data found.

6.4 Surface Water Abstraction Licences

Surface Water Abstraction Licences within 2000m of the study site None identified

Database searched and no data found.

6.5 Potable Water Abstraction Licences

Potable Water Abstraction Licences within 2000m of the study site

None identified

Database searched and no data found.

6.6 Source Protection Zones

Source Protection Zones within 500m of the study site

None identified

Database searched and no data found.

6.7 Source Protection Zones within Confined Aquifer

Source Protection Zones within the Confined Aquifer within 500m of the study site

None identified

Historically, Source Protection Zone maps have been focused on regulation of activities which occur at or near the ground surface, such as prevention of point source pollution and bacterial contamination of water supplies. Sources in confined aquifers were often considered to be protected from these surface pressures due to the presence of a low permeability confining layer (e.g. glacial till, clay). The increased interest in subsurface activities such as onshore oil and gas exploration, ground source heating and cooling requires protection zones for confined sources to be marked on SPZ maps where this has not already been done.

Database searched and no data found.

6.8 Groundwater Vulnerability and Soil Leaching Potential

Environment Agency/Natural Resources Wales information on groundwater vulnerability and soil leaching potential within 500m of the study site

None identified

Database searched and no data found.

6.9 River Quality

Environment Agency/Natural Resources Wales information on river quality within 1500m of the study site

None identified

6.9.1 Biological Quality:

Database searched and no data found.

6.9.2 Chemical Quality:

Database searched and no data found.

6.10 Ordnance Survey MasterMap Water Network

Ordnance Survey MasterMap Water Network entries within 500m of the study site

This watercourse information is provided by Ordnance Survey MasterMap Water Network. The data provides a detailed centre line following the curve of the waterway precisely, so all distances provided in the report should be understood as measurements to the centreline rather than a measurement to the nearest point of the watercourse. Underground watercourses are inferred from entry and exit points so caution is advised in using these to indicate precise locations of underground watercourses when planning site investigation and development.

The following Ordnance Survey MasterMap Water Network records are represented on the Hydrology Map (6e):

ID	Distance/ Direction	Name	Type of Watercourse	Additional Details
1	34 N	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 1.9
19	34 N	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 1.9
2	36 NE	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.0
20	36 NE	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.0
3	37 E	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 1.8
21	37 E	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 1.8
4	62 W	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): Not Provided
22	62 W	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal

ID	Distance/ Direction	Name	Type of Watercourse	Additional Details
				conditions) Average Width in Watercourse Section (m): Not Provided
5	112 W	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 1.7
6	112 S	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 1.8
23	112 W	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 1.7
24	112 S	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 1.8
7	137 SW	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 1.9
25	137 SW	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 1.9
8	180 E	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.1
26	180 E	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.1
9	319 W	Old River	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.3
27	319 W	Old River	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.3
10	332 W	Old River	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.8
28	332 W	Old River	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.8

ID	Distance/ Direction	Name	Type of Watercourse	Additional Details
11	363 SW	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.3
Not shown	363 SW	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.3
12	386 SE	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): Not Provided
30	386 SE	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): Not Provided
13	395 NW	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.8
14	395 NW	Old River	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.3
Not shown	395 NW	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.8
Not shown	395 NW	Old River	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.3
15	420 W	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.7
Not shown	420 W	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 3.7
16	441 E	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.0
17	441 E	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.0
Not shown	441	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface

ID	Distance/ Direction	Name	Type of Watercourse	Additional Details
	E			Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.0
Not shown	441 E	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.0
18	442 E	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: Underground Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): Not Provided
Not shown	442 E	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: Underground Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): Not Provided
19	445 E	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): Not Provided
Not shown	445 E	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): Not Provided
20	471 NW	Old River	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: Underground Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): Not Provided
Not shown	471 NW	Old River	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: Underground Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): Not Provided
21	472 SW	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: Underground Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): Not Provided
Not shown	472 SW	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: Underground Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): Not Provided
22	476 E	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: Underground Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): Not Provided
Not shown	476 E	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: Underground Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): Not Provided
23	480 NW	Old River	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions)

ID	Distance/ Direction	Name	Type of Watercourse	Additional Details
				Average Width in Watercourse Section (m): 2.7
Not shown	480 NW	Old River	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.7
24	490 E	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.2
Not shown	490 E	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.2
25	495 SW	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.7
Not shown	495 SW	Not specified	Inland river not influenced by normal tidal action.	Catchment Area: Welland Relationship to Ground Level: On ground surface Permanence: Watercourse contains water year round (in normal conditions) Average Width in Watercourse Section (m): 2.7

6.11 Surface Water Features


Surface water features within 250m of the study site

Identified

The following surface water records are not represented on mapping:

Distance (m)	Direction
35	NE
62	W
111	W
178	E


7a. Environment Agency/Natural Resources Wales Flood Map for Planning (from rivers and the sea)

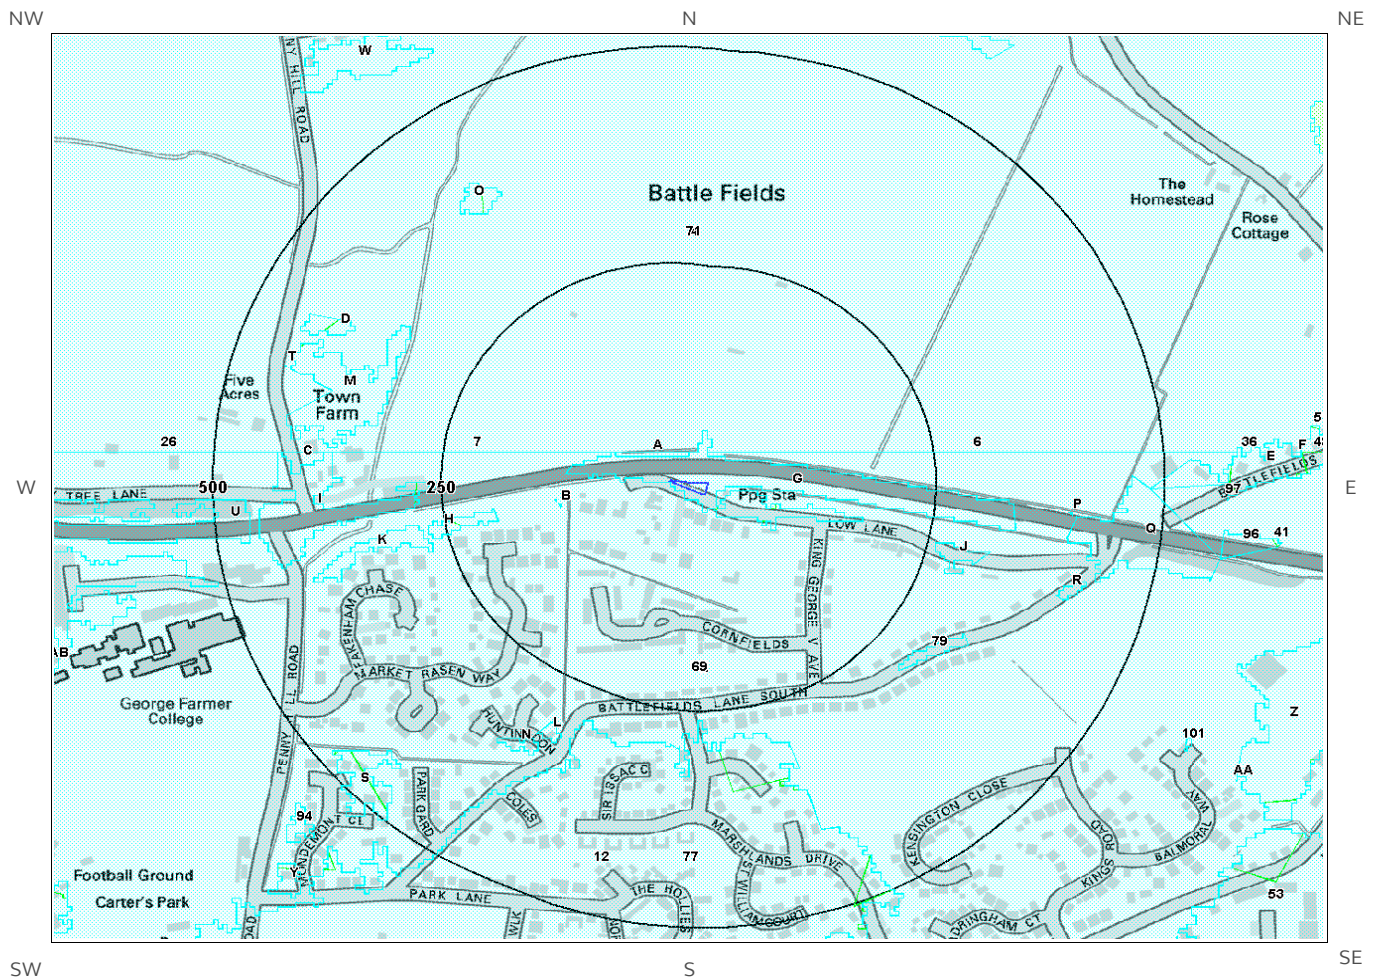


© Crown copyright and database rights 2018.
Ordnance Survey licence 100035207.



7b. Environment Agency/Natural Resources Wales Risk of Flooding from Rivers and the Sea (RoFRaS) Map

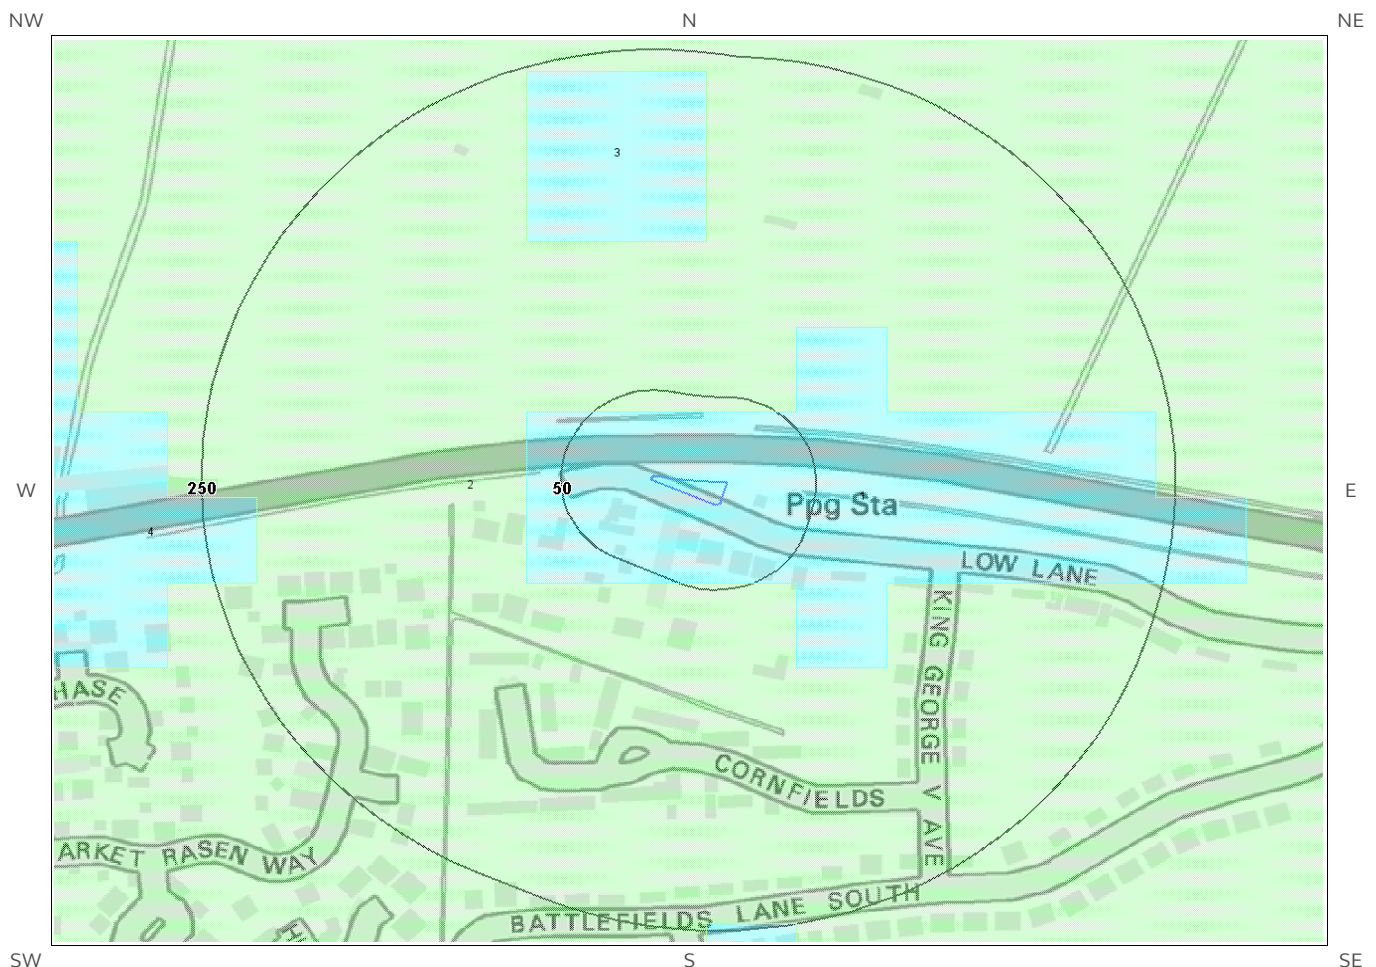

© Crown copyright and database rights 2018.
Ordnance Survey licence 100035207.

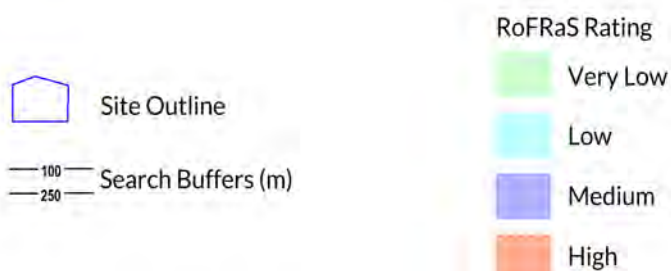

7 Flooding

7.1 River and Coastal Zone 2 Flooding

Environment Agency/Natural Resources Wales Zone 2 floodplain within 250m

Identified

Environment Agency/Natural Resources Wales Zone 2 floodplains estimate the annual probability of flooding as between 1 in 1000 (0.1%) and 1 in 100 (1%) from rivers and between 1 in 1000 (0.1%) and 1 in 200 (0.5%) from the sea. Any relevant data is represented on Map 7a – Flood Map for Planning:

ID	Distance (m)	Direction	Update	Type
1G	0	On Site	15-Oct-2018	Zone 2 - (Fluvial /Tidal Models)
2	0	On Site	15-Oct-2018	Zone 2 - (Fluvial /Tidal Models)
3A	27	N	15-Oct-2018	Zone 2 - (Fluvial /Tidal Models)
4	32	N	15-Oct-2018	Zone 2 - (Fluvial /Tidal Models)
5A	32	N	15-Oct-2018	Zone 2 - (Fluvial /Tidal Models)
6	36	N	15-Oct-2018	Zone 2 - (Fluvial /Tidal Models)
7	72	NW	15-Oct-2018	Zone 2 - (Fluvial /Tidal Models)
8B	122	W	15-Oct-2018	Zone 2 - (Fluvial /Tidal Models)
9B	126	W	15-Oct-2018	Zone 2 - (Fluvial /Tidal Models)
10H	233	W	15-Oct-2018	Zone 2 - (Fluvial /Tidal Models)

7.2 River and Coastal Zone 3 Flooding

Environment Agency/Natural Resources Wales Zone 3 floodplain within 250m

Identified

Zone 3 shows the extent of a river flood with a 1 in 100 (1%) or greater chance of occurring in any year or a sea flood with a 1 in 200 (0.5%) or greater chance of occurring in any year. Any relevant data is represented on Map 7a – Flood Map for Planning.

ID	Distance (m)	Direction	Update	Type
1G	0	On Site	15-Oct-2018	Zone 3 - (Fluvial Models)
2	0	On Site	15-Oct-2018	Zone 3 - (Fluvial Models)
3A	27	N	15-Oct-2018	Zone 3 - (Fluvial Models)

4	32	N	15-Oct-2018	Zone 3 - (Fluvial Models)
5A	122	W	15-Oct-2018	Zone 3 - (Fluvial Models)
6	126	W	15-Oct-2018	Zone 3 - (Fluvial Models)
7	193	W	15-Oct-2018	Zone 3 - (Fluvial Models)
8B	249	W	15-Oct-2018	Zone 3 - (Fluvial Models)

7.3 Risk of Flooding from Rivers and the Sea (RoFRaS) Flood Rating

Highest risk of flooding onsite Low

The Environment Agency/Natural Resources Wales RoFRaS database provides an indication of river and coastal flood risk at a national level on a 50m grid with the flood rating at the centre of the grid calculated and given above. The data considers the probability that the flood defences will overtop or breach by considering their location, type, condition and standard of protection.

RoFRaS data for the study site indicates the property is in an area with a Low (greater than 1 in 1000 but less than 1 in 100) chance of flooding in any given year.

Any relevant data within 250m is represented on the RoFRaS Flood map. Data to 50m is reported in the table below.

ID	Distance (m)	Direction	RoFRaS flood Risk
1	0.0	On Site	Low
2	37.0	N	Very Low

7.4 Flood Defences

Flood Defences within 250m of the study site None identified
Database searched and no data found.

7.5 Areas benefiting from Flood Defences

Areas benefiting from Flood Defences within 250m of the study site None identified

7.6 Areas benefiting from Flood Storage

Areas used for Flood Storage within 250m of the study site None identified

7.7 Groundwater Flooding Susceptibility Areas

7.7.1 British Geological Survey groundwater flooding susceptibility areas within 50m of the boundary of the study site None identified

Notes: Groundwater flooding may either be associated with shallow unconsolidated sedimentary aquifers which overlie unproductive aquifers (Superficial Deposits Flooding), or with unconfined aquifers (Clearwater Flooding).

7.7.2 Highest susceptibility to groundwater flooding in the search area based on the underlying geological conditions

Not Prone

The area is not considered to be prone to groundwater flooding based on rock type.


7.8 Groundwater Flooding Confidence Areas

British Geological Survey confidence rating in this result Not Applicable


Notes: Groundwater flooding is defined as the emergence of groundwater at the ground surface or the rising of groundwater into man-made ground under conditions where the normal range of groundwater levels is exceeded.

The confidence rating is on a threefold scale - Low, Moderate and High. This provides a relative indication of the BGS confidence in the accuracy of the susceptibility result for groundwater flooding. This is based on the amount and precision of the information used in the assessment. In areas with a relatively lower level of confidence the susceptibility result should be treated with more caution. In other areas with higher levels of confidence the susceptibility result can be used with more confidence.

8. Designated Environmentally Sensitive Sites Map

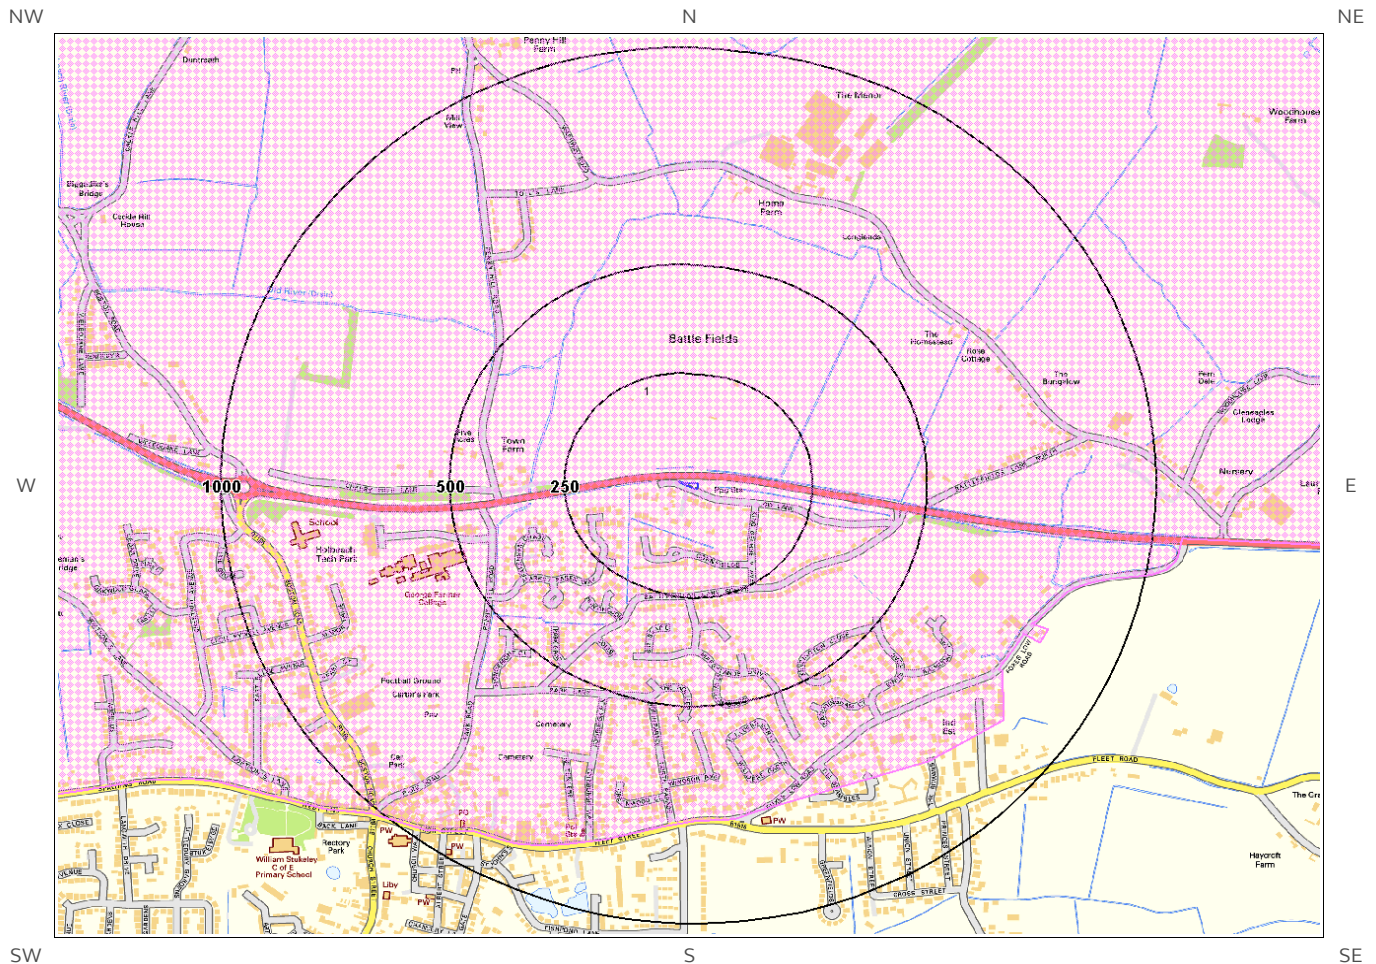

© Crown copyright and database rights 2018.
Ordnance Survey licence 100035207.

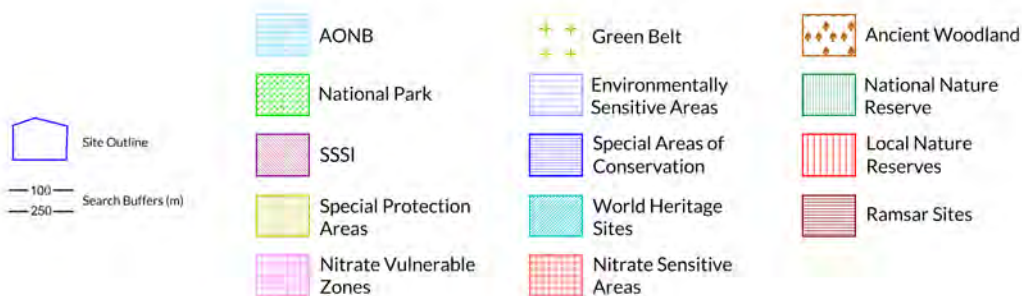

8. Designated Environmentally Sensitive Sites

Designated Environmentally Sensitive Sites within 2000m of the study site	Identified
---	------------

8.1 Records of Sites of Special Scientific Interest (SSSI) within 2000m of the study site:

0

Database searched and no data found.

8.2 Records of National Nature Reserves (NNR) within 2000m of the study site:

0

Database searched and no data found.

8.3 Records of Special Areas of Conservation (SAC) within 2000m of the study site:

0

Database searched and no data found.

8.4 Records of Special Protection Areas (SPA) within 2000m of the study site:

0

Database searched and no data found.

8.5 Records of Ramsar sites within 2000m of the study site:

0

Database searched and no data found.

8.6 Records of Ancient Woodland within 2000m of the study site:

0

Database searched and no data found.

8.7 Records of Local Nature Reserves (LNR) within 2000m of the study site:

0

Database searched and no data found.

8.8 Records of World Heritage Sites within 2000m of the study site:

0

Database searched and no data found.

8.9 Records of Environmentally Sensitive Areas within 2000m of the study site:

0

Database searched and no data found.

8.10 Records of Areas of Outstanding Natural Beauty (AONB) within 2000m of the study site:

0

Database searched and no data found.

8.11 Records of National Parks (NP) within 2000m of the study site:

0

Database searched and no data found.

8.12 Records of Nitrate Sensitive Areas within 2000m of the study site:

0

Database searched and no data found.

8.13 Records of Nitrate Vulnerable Zones within 2000m of the study site:

1

The following Nitrate Vulnerable Zone records produced by DEFRA are represented as polygons on the Designated Environmentally Sensitive Sites Map:

ID	Distance (m)	Direction	NVZ Name	Data Source
1	0	On Site	New	DEFRA

8.14 Records of Green Belt land within 2000m of the study site:

0

Database searched and no data found.

9. Natural Hazards Findings

9.1 Detailed BGS GeoSure Data

BGS GeoSure Data has been searched to 50m. The data is included in tabular format. If you require further information on geology and ground stability, please obtain a **Groundsure Geo Insight**, available from our **website**. The following information has been found:

9.1.1 Shrink Swell

Maximum Shrink-Swell** hazard rating identified on the study site Low

The following natural subsidence information provided by the British Geological Survey is not represented on mapping:

Hazard
Ground conditions predominantly medium plasticity. Do not plant trees with high soil moisture demands near to buildings. For new build, consideration should be given to advice published by the National House Building Council (NHBC) and the Building Research Establishment (BRE). There is a possible increase in construction cost to reduce potential shrink-swell problems. For existing property, there is a possible increase in insurance risk, especially during droughts or where vegetation with high moisture demands is present.

9.1.2 Landslides

Maximum Landslide* hazard rating identified on the study site Very Low

The following natural subsidence information provided by the British Geological Survey is not represented on mapping:

Hazard
Slope instability problems are unlikely to be present. No special actions required to avoid problems due to landslides. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with landslides.

9.1.3 Soluble Rocks

Maximum Soluble Rocks* hazard rating identified on the study site Negligible

The following natural subsidence information provided by the British Geological Survey is not represented on mapping:

Hazard
Soluble rocks are present, but unlikely to cause problems except under exceptional conditions. No special actions required to avoid problems due to soluble rocks. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with soluble rocks.

* This indicates an automatically generated 50m buffer and site.

9.1.4 Compressible Ground

Maximum Compressible Ground* hazard rating identified on the study site

Moderate

The following natural subsidence information provided by the British Geological Survey is not represented on mapping:

Hazard
Significant potential for compressibility problems. Avoid large differential loadings of ground. Do not drain or de-water ground near the property without technical advice. For new build consider possibility of compressible ground in ground investigation, construction and building design. Consider effects of groundwater changes. Extra construction costs are likely. For existing property possible increase in insurance risk from compressibility, especially if water conditions or loading of the ground change significantly.

9.1.5 Collapsible Rocks

Maximum Collapsible Rocks* hazard rating identified on the study site

Negligible

The following natural subsidence information provided by the British Geological Survey is not represented on mapping:

Hazard
No indicators for collapsible deposits identified. No actions required to avoid problems due to collapsible deposits. No special ground investigation required, or increased construction costs or increased financial risk due to potential problems with collapsible deposits.

9.1.6 Running Sand

Maximum Running Sand** hazard rating identified on the study site

Moderate

The following natural subsidence information provided by the British Geological Survey is not represented on mapping:

Hazard
Significant potential for running sand problems with relatively small changes in ground conditions. Avoid large amounts of water entering the ground (for example through pipe leakage or soak-aways). Do not dig (deep) holes into saturated ground near the property without technical advice. For new build consider the consequences of soil and groundwater conditions during and after construction. For existing property possible increase in insurance risk from running sand, for example, due to water leakage, high rainfall events or flooding.

* This indicates an automatically generated 50m buffer and site.

9.2 Radon

9.2.1 Radon Affected Areas

Is the property in a Radon Affected Area as defined by the Health Protection Agency (HPA) and if so what percentage of homes are above the Action Level? The site is not in a Radon Affected Area, as less than 1% of properties are above the Action Level.

The radon data in this report is supplied by the BGS/Public Health England and is the definitive map of Radon Affected Areas in Great Britain and Northern Ireland. The dataset was created using long-term radon measurements in over 479,000 homes across Great Britain and 23,000 homes across Northern Ireland, combined with geological data. The dataset is considered accurate to 50m to allow for the margin of error in geological lines, and the findings of this report supercede any answer given in the less accurate Indicative Atlas of Radon in Great Britain, which simplifies the data to give the highest risk within any given 1km grid square. As such, the radon atlas is considered indicative, whereas the data given in this report is considered definitive.

9.2.2 Radon Protection

Is the property in an area where Radon Protection are required for new properties or extensions to existing ones as described in publication BR211 by the Building Research Establishment? No radon protective measures are necessary.

10. Mining

10.1 Coal Mining

Coal mining areas within 75m of the study site

None identified

Database searched and no data found.

10.2 Non-Coal Mining

Non-Coal Mining areas within 50m of the study site boundary

None identified

Database searched and no data found.

10.3 Brine Affected Areas

Brine affected areas within 75m of the study site

None identified

Guidance: No Guidance Required.

Contact Details

Groundsure Helpline
Telephone: 08444 159 000
info@groundsure.com

British Geological Survey Enquiries
Kingsley Dunham Centre
Keyworth, Nottingham NG12 5GG
Tel: 0115 936 3143.
Fax: 0115 936 3276.
Email:
Web: www.bgs.ac.uk

BGS Geological Hazards Reports and general geological enquiries:
enquiries@bgs.ac.uk

Environment Agency
National Customer Contact Centre, PO Box 544
Rotherham, S60 1BY
Tel: 03708 506 506
Web: www.environment-agency.gov.uk
Email: enquiries@environment-agency.gov.uk

Public Health England
Public information access office
Public Health England, Wellington House
133-155 Waterloo Road, London, SE1 8UG
www.gov.uk/phe
Email: enquiries@phe.gov.uk
Main switchboard: 020 7654 8000

The Coal Authority
200 Lichfield Lane
Mansfield
Notts NG18 4RG
Tel: 0345 7626 848
DX 716176 Mansfield 5
www.coal.gov.uk

Ordnance Survey
Adanac Drive, Southampton
SO16 0AS
Tel: 08456 050505

Local Authority
Authority: South Holland District Council
Phone: 01775 761 161
Web: <http://www.sholland.gov.uk/>
Address: Council Offices, Priory Road, Spalding, Lincolnshire, PE11

Gemapping PLC
Virginia Villas, High Street, Hartley Witney,
Hampshire RG27 8NW
Tel: 01252 845444



Acknowledgements: Site of Special Scientific Interest, National Nature Reserve, Ramsar Site, Special Protection Area, Special Area of Conservation data is provided by, and used with the permission of, Natural England/Natural Resources Wales who retain the Copyright and Intellectual Property Rights for the data.

PointX © Database Right/Copyright, Thomson Directories Limited © Copyright Link Interchange Network Limited © Database Right/Copyright and Ordnance Survey © Crown Copyright and/or Database Right. All Rights Reserved. Licence Number [03421028].

This report has been prepared in accordance with the Groundsure Ltd standard Terms and Conditions of business for work of this nature.

Standard Terms and Conditions

Groundsure's Terms and Conditions can be viewed online at this link:

<https://www.groundsure.com/terms-and-conditions-may25-2018>

Goldfinch Environmental Limited
19, Palmer Street,
Bury St Edmunds,
Suffolk, IP31 3BZ

Groundsure Reference: GS-2391-5578646

Your Reference: 0575-ds

Report Date 31 Oct 2018

Report Delivery Method: Email - pdf

Geo Insight


Address: LAND OFF LOW LANE, HOLBEACH, SPALDING, PE12 7PW

Dear Sir/ Madam,

Thank you for placing your order with Groundsure. Please find enclosed the **Groundsure Geo Insight** as requested.

If you need any further assistance, please do not hesitate to contact our helpline on 08444 159000 quoting the above Groundsure reference number.

Yours faithfully,

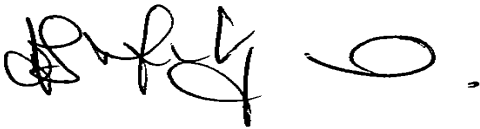

Managing Director
Groundsure Limited

Enc.
Groundsure Geo Insight

Address: LAND OFF LOW LANE, HOLBEACH, SPALDING, PE12 7PW
Date: 31 Oct 2018
Reference: GS-2391-5578646
Client: Goldfinch Environmental Limited



Aerial Photograph Capture date: 18-Jul-2015
Grid Reference: 536548,325605
Site Size: 0.03ha

Contents Page

Contents Page.....	3
Overview of Findings.....	5
1:10,000 Scale Availability.....	8
Availability of 1:10,000 Scale Geology Mapping.....	9
1 Geology (1:10,000 scale).....	10
1.1 Artificial Ground map (1:10,000 scale).....	10
1. Geology 1:10,000 scale.....	11
1.1 Artificial Ground.....	11
1.2 Superficial Deposits and Landslips map (1:10,000 scale).....	12
1.2 Superficial Deposits and Landslips.....	13
1.2.1 Superficial Deposits/ Drift Geology.....	13
1.2.2 Landslip.....	13
1.3 Bedrock and linear features map (1:10,000 scale).....	14
1.3 Bedrock and linear features.....	15
1.3.1 Bedrock/ Solid Geology.....	15
1.3.2 Linear features.....	15
2 Geology 1:50,000 Scale.....	16
2.1 Artificial Ground map.....	16
2. Geology 1:50,000 scale.....	17
2.1 Artificial Ground.....	17
2.1.1 Artificial/ Made Ground	17
2.1.2 Permeability of Artificial Ground.....	17
2.2 Superficial Deposits and Landslips map (1:50,000 scale).....	18
2.2 Superficial Deposits and Landslips.....	19
2.2.1 Superficial Deposits/ Drift Geology.....	19
2.2.2 Permeability of Superficial Ground	19
2.2.3 Landslip.....	19
2.2.4 Landslip Permeability.....	19
2.3 Bedrock and linear features map (1:50,000 scale).....	20
2.3 Bedrock, Solid Geology & linear features.....	21
2.3.1 Bedrock/Solid Geology.....	21
2.3.2 Permeability of Bedrock Ground.....	21
2.3.3 Linear features.....	21
3 Radon Data.....	22
3.1 Radon Affected Areas.....	22
3.2 Radon Protection.....	22
4 Ground Workings map.....	23
4 Ground Workings.....	24
4.1 Historical Surface Ground Working Features derived from Historical Mapping.....	24
4.2 Historical Underground Working Features derived from Historical Mapping.....	24
4.3 Current Ground Workings.....	24
5 Mining, Extraction & Natural Cavities.....	26
5.1 Historical Mining.....	26
5.2 Coal Mining.....	26
5.3 Johnson Poole and Bloomer.....	26
5.4 Non-Coal Mining.....	26
5.5 Non-Coal Mining Cavities.....	27
5.6 Natural Cavities.....	27
5.7 Brine Extraction.....	27
5.8 Gypsum Extraction.....	27
5.9 Tin Mining.....	27
5.10 Clay Mining.....	28
6 Natural Ground Subsidence.....	29
6.1 Shrink-Swell Clay map.....	29
6.2 Landslides map.....	30
6.3 Ground Dissolution of Soluble Rocks map.....	31
6.4 Compressible Deposits map.....	32
6.5 Collapsible Deposits map.....	33
6.6 Running Sand map.....	34

6 Natural Ground Subsidence.....	35
6.1 Shrink-Swell Clays.....	35
6.2 Landslides.....	35
6.3 Ground Dissolution of Soluble Rocks.....	36
6.4 Compressible Deposits.....	36
6.5 Collapsible Deposits.....	36
6.6 Running Sands.....	36
7 Borehole Records.....	38
8 Estimated Background Soil Chemistry.....	39
9 Railways and Tunnels map.....	40
9 Railways and Tunnels.....	41
9.1 Tunnels	41
9.2 Historical Railway and Tunnel Features	41
9.3 Historical Railways.....	42
9.4 Active Railways.....	42
9.5 Railway Projects.....	42

Overview of Findings

The Groundsure Geo Insight provides high quality geo-environmental information that allows geo-environmental professionals and their clients to make informed decisions and be forewarned of potential ground instability problems that may affect the ground investigation, foundation design and possibly remediation options that could lead to possible additional costs.

The report is based on the BGS 1:50,000 and 1:10,000 Digital Geological Map of Great Britain, BGS Geosure data; BRITPITS database; Non-coal mining data and Borehole Records, Coal Authority data including brine extraction areas, PBA non-coal mining and natural cavities database, Johnson Poole and Bloomer mining data and Groundsure's unique database including historical surface ground and underground workings.

For further details on each dataset, please refer to each individual section in the report as listed. Where the database has been searched a numerical result will be recorded. Where the database has not been searched '-' will be recorded.

Section 1: Geology 1:10,000 Scale

1.1 Artificial Ground	1.1 Is there any Artificial Ground/ Made Ground present beneath the study site at 1:10,000 scale?	No
1.2 Superficial Geology and Landslips	1.2.1 Is there any Superficial Ground/Drift Geology present beneath the study site at 1:10,000 scale?*	No
	1.2.2 Are there any records of landslide within 500m of the study site boundary at 1:10,000 scale?	No
1.3 Bedrock, Solid Geology and linear features	1.3.1 For records of Bedrock and Solid Geology beneath the study site* see the detailed findings section.	
	1.3.2 Are there any records of linear features within 500m of the study site boundary at 1:10,000 scale?	No

Section 2: Geology 1:50,000 Scale

2.1 Artificial Ground	2.1.1 Is there any Artificial Ground/ Made Ground present beneath the study site?	No
	2.1.2 Are there any records relating to permeability of artificial ground within the study site*boundary?	No
2.2 Superficial Geology and Landslips	2.2.1 Is there any Superficial Ground/Drift Geology present beneath the study site?*	Yes
	2.2.2 Are there any records of permeability of superficial ground within 500m of the study site?	Yes
	2.2.3 Are there any records of landslide within 500m of the study site boundary?	No
	2.2.4 Are there any records relating to permeability of landslips within the study site* boundary?	No

Section 2: Geology 1:50,000 Scale

2.3 Bedrock, Solid Geology and linear features

2.3.1 For records of Bedrock and Solid Geology beneath the study site* see the detailed findings section.

2.3.2 Are there any records relating to permeability of bedrock ground within the study site boundary?

Yes

2.3.3 Are there any records of linear features within 500m of the study site boundary?

No

Section 3: Radon

3. Radon

3.1 Is the property in a Radon Affected Area as defined by the Health Protection Agency (HPA) and if so what percentage of homes are above the Action Level?

The property is not in a Radon Affected Area, as less than 1% of properties are above the Action Level.

3.2 Radon Protection

No radon protective measures are necessary.

Section 4: Ground Workings


	On-site	0-50m	51-250	251-500	501-1000
4.1 Historical Surface Ground Working Features from Small Scale Mapping	0	0	0	Not Searched	Not Searched
4.2 Historical Underground Workings from Small Scale Mapping	0	0	0	0	0
4.3 Current Ground Workings	0	0	0	0	1

Section 5: Mining, Extraction & Natural Cavities

	On-site	0-50m	51-250	251-500	501-1000
5.1 Historical Mining	0	0	0	0	0
5.2 Coal Mining	0	0	0	0	0
5.3 Johnson Poole and Bloomer Mining Area	0	0	0	0	0
5.4 Non-Coal Mining*	0	0	0	0	0
5.5 Non-Coal Mining Cavities	0	0	0	0	0
5.5 Natural Cavities	0	0	0	0	0


Section 5: Mining, Extraction & Natural Cavities	On-site	0-50m	51-250	251-500	501-1000
5.6 Brine Extraction	0	0	0	0	0
5.7 Gypsum Extraction	0	0	0	0	0
5.8 Tin Mining	0	0	0	0	0
5.9 Clay Mining	0	0	0	0	0
Section 6: Natural Ground Subsidence	On-site				
6.1 Shrink-Swell Clay	Low				
6.2 Landslides	Very Low				
6.3 Ground Dissolution of Soluble Rocks	Negligible				
6.4 Compressible Deposits	Moderate				
6.5 Collapsible Deposits	Negligible				
6.5 Running Sand	Moderate				
Section 7: Borehole Records	On-site	0-50m	51-250		
7 BGS Recorded Boreholes	0	0	0		
Section 8: Estimated Background Soil Chemistry	On-site	0-50m	51-250		
8 Records of Background Soil Chemistry	1	1	0		
Section 9: Railways and Tunnels	On-site	0-50m	51-250	250-500	
9.1 Tunnels	0	0	0	Not Searched	
9.2 Historical Railway and Tunnel Features	0	0	0	Not Searched	
9.3 Historical Railways	0	0	0	Not Searched	
9.4 Active Railways	0	0	0	Not Searched	
9.5 Railway Projects	0	0	0	0	

1:10,000 Scale Availability

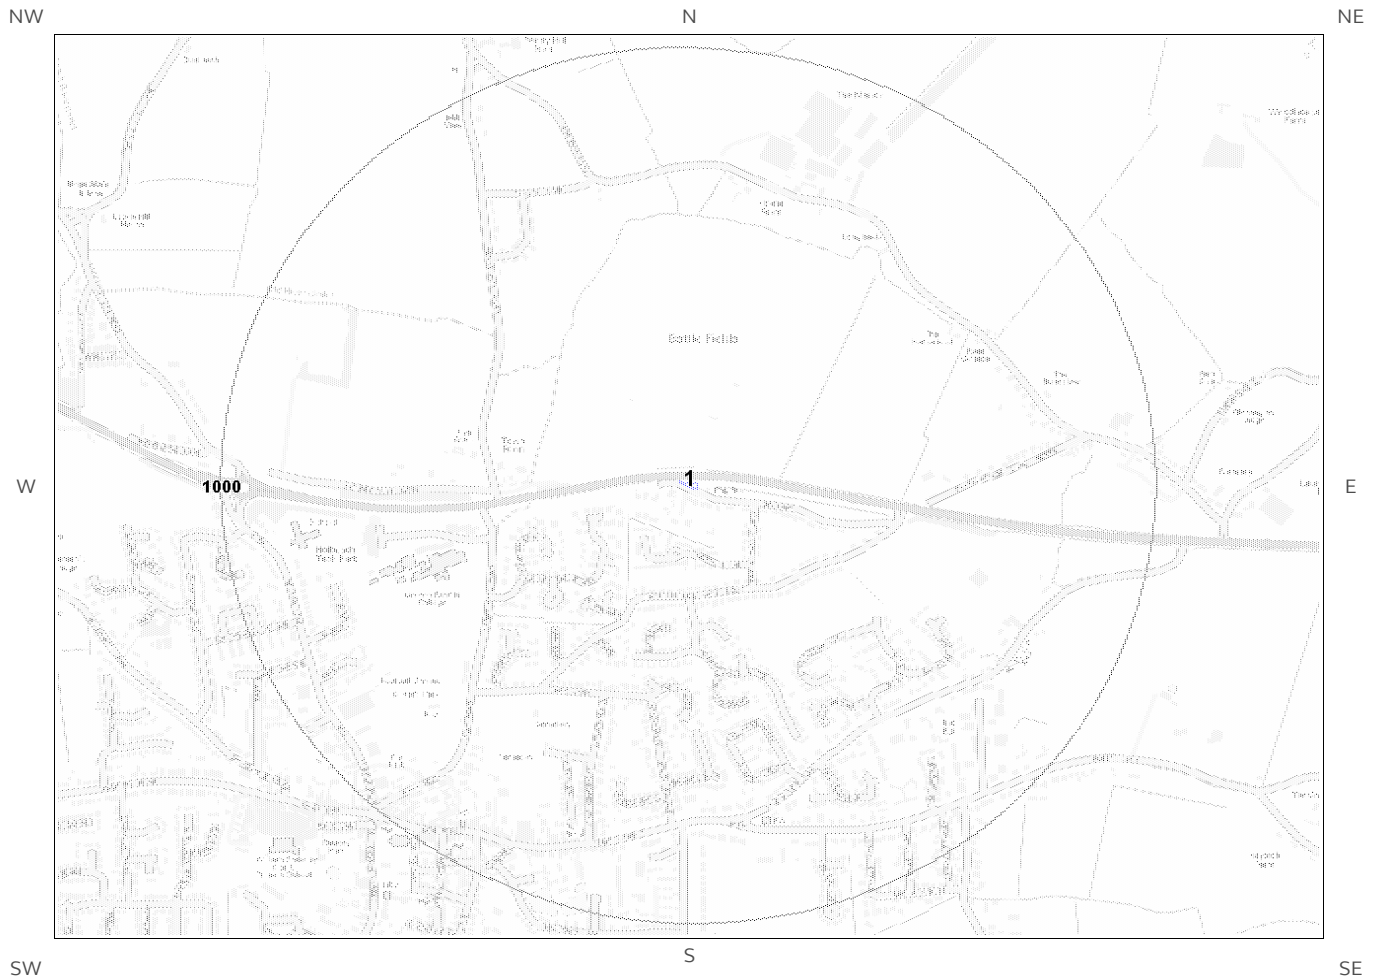

1_10,000 Availability Legend

© Crown copyright and database rights 2018.
Ordnance Survey licence 100035207.

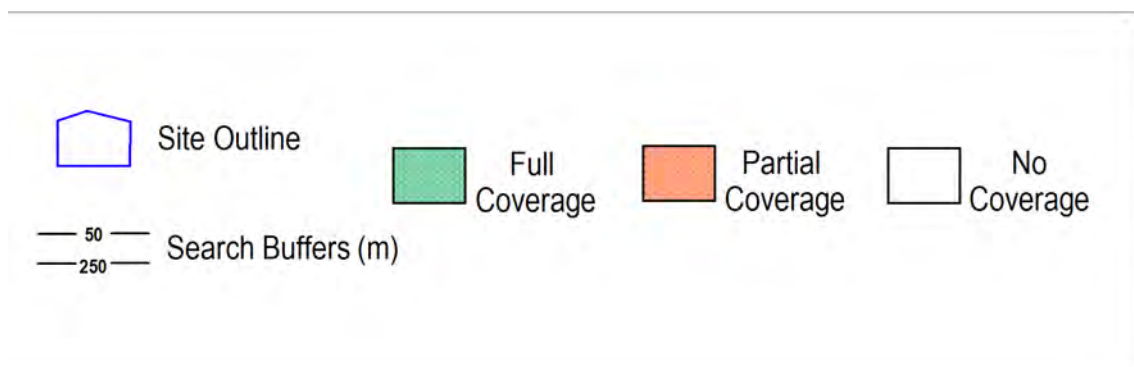

Availability of 1:10,000 Scale Geology Mapping

The following information represents the availability of the key components of the 1:10,000 scale geological data.

ID	Distance	Artificial Coverage	Superficial Coverage	Bedrock Coverage	Mass Movement Coverage
1	0.0	No deposits are mapped	No coverage	No coverage	No coverage


Guidance: The 1:10,000 scale geological interpretation is the most detailed generally available from BGS and is the scale at which most geological surveying is carried out in the field. The database is presented as four types of geology (artificial, mass movement, superficial and bedrock), although not all themes are mapped or available on every map sheet. Therefore a coverage layer showing the availability of the four themes is presented above.

The definitions of coverage are as follows:

Geology	Full Coverage	Partial Coverage	No Coverage
Bedrock	The whole tile has been mapped	Some but not all the tile has been mapped	No coverage
Superficial	The whole tile has been mapped	Some but not all of the tile has been mapped	No coverage
Artificial	Some deposits are mapped on this tile	-	No deposits are mapped
Mass Movement	Some deposits are mapped on this tile	-	No coverage

1 Geology (1:10,000 scale).

1.1 Artificial Ground map (1:10,000 scale)

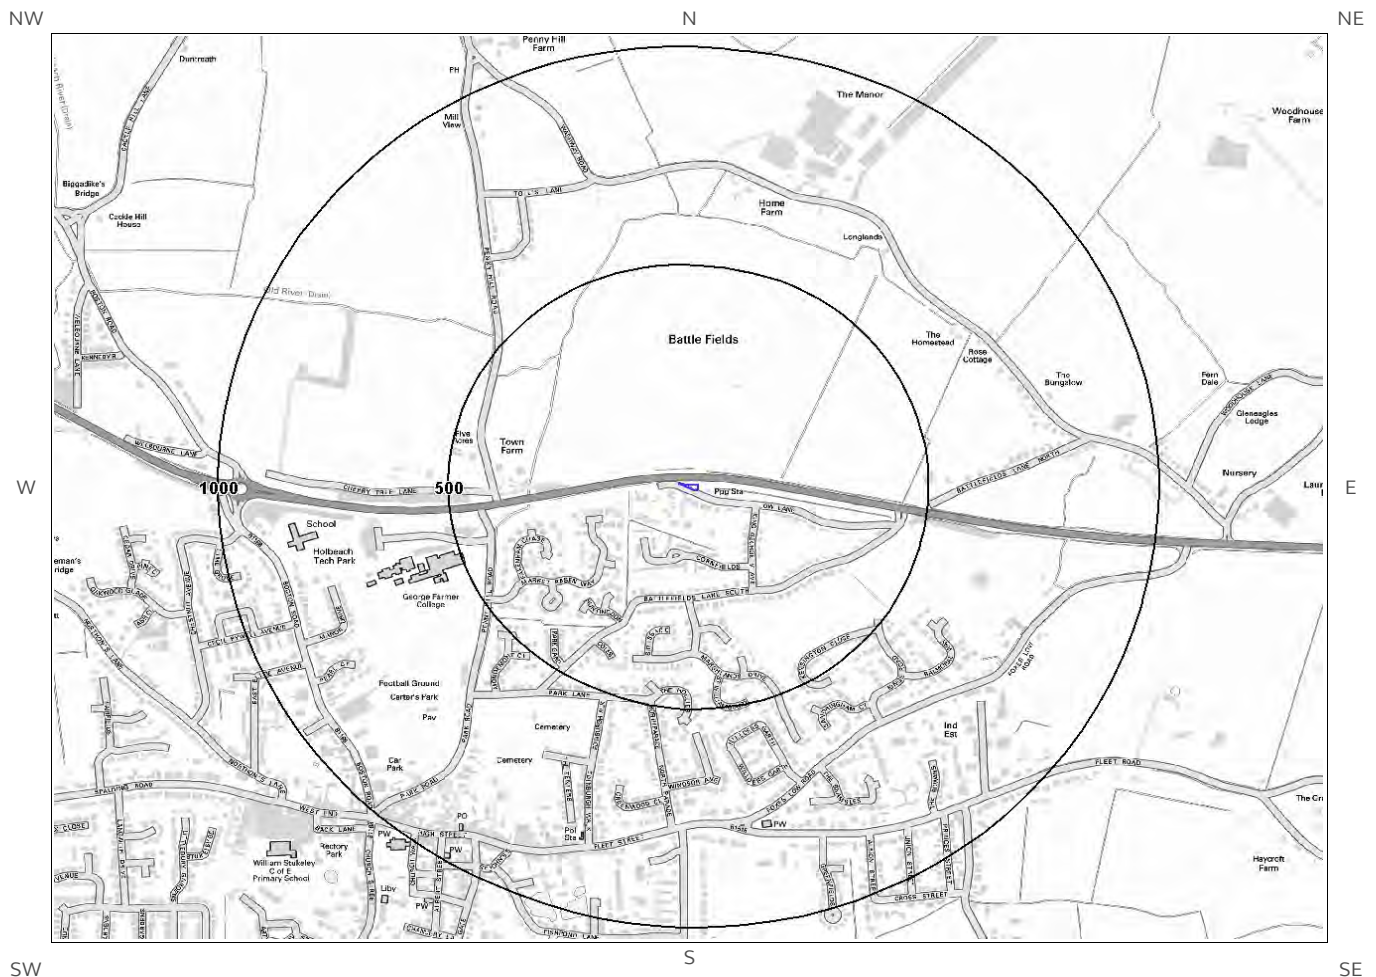

Artificial Ground Legend

© Crown copyright and database rights 2018.
Ordnance Survey licence 100035207.




1. Geology 1:10,000 scale

1.1 Artificial Ground

The following geological information represented on the mapping is derived from 1:10,000 scale BGS Geological mapping.

Are there any records of Artificial/ Made Ground within 500m of the study site boundary at 1:10,000 scale? No

Database searched and no data found.



Site Outline

Search Buffers (m)

500

1000

1.2 Superficial Deposits and Landslips

The following geological information represented on the mapping is derived from 1:10,000 scale BGS Geological mapping

1.2.1 Superficial Deposits/ Drift Geology

Are there any records of Superficial Deposits/ Drift Geology within 500m of the study site boundary at 1:10,000 scale? No

Database searched and no data found.

1.2.2 Landslip


Are there any records of Landslip within 500m of the study site boundary at 1:10,000 scale? No

Database searched and no data found.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of Great Britain at 1:10,000 scale


This Geology shows the main components as discrete layers, these are: Artificial / Made Ground, Superficial / Drift Geology and Landslips. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nationwide coverage.

1.3 Bedrock and linear features map (1:10,000 scale)

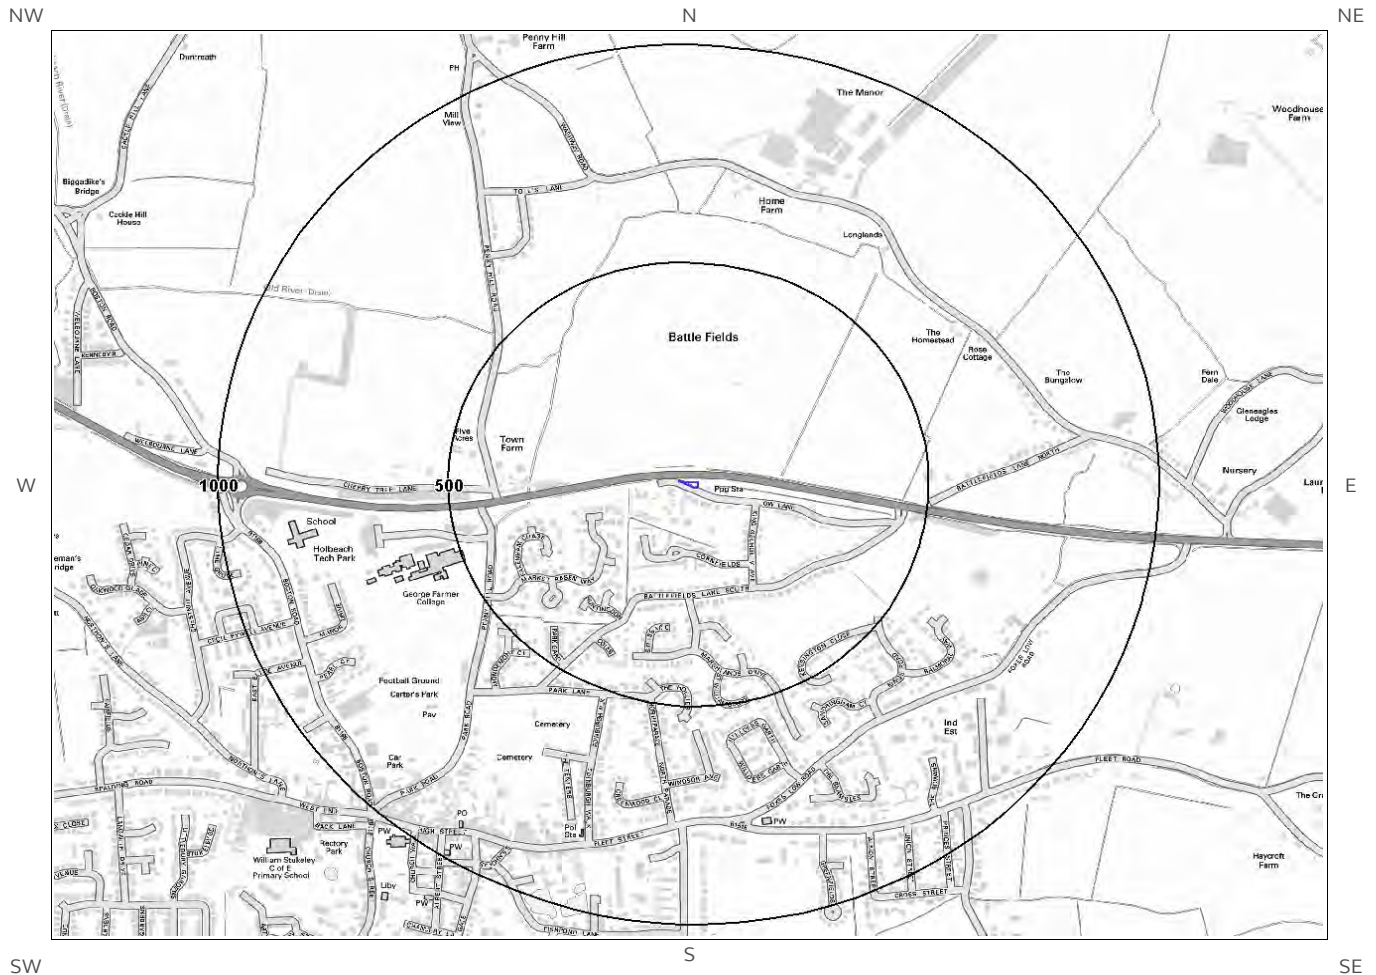

Bedrock and linear features Legend

© Crown copyright and database rights 2018.
Ordnance Survey licence 100035207.

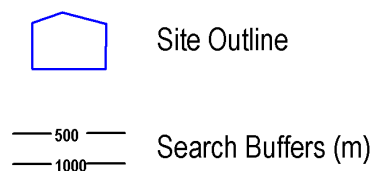

1.3 Bedrock and linear features

The following geological information represented on the mapping is derived from 1:10,000 scale BGS Geological mapping.

1.3.1 Bedrock/ Solid Geology

Records of Bedrock/Solid Geology within 500m of the study site boundary at 1:10,000 scale.

Database searched and no data found at this scale.

1.3.2 Linear features

Are there any records of linear features within 500m of the study site boundary at 1:10,000 scale? No


Database searched and no data found at this scale.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of great Britain at 1:10,000 scale.


This Geology shows the main components as discrete layers, these are: Bedrock/ Solid Geology and linear features such as faults. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nationwide coverage.

2 Geology 1:50,000 Scale

2.1 Artificial Ground map

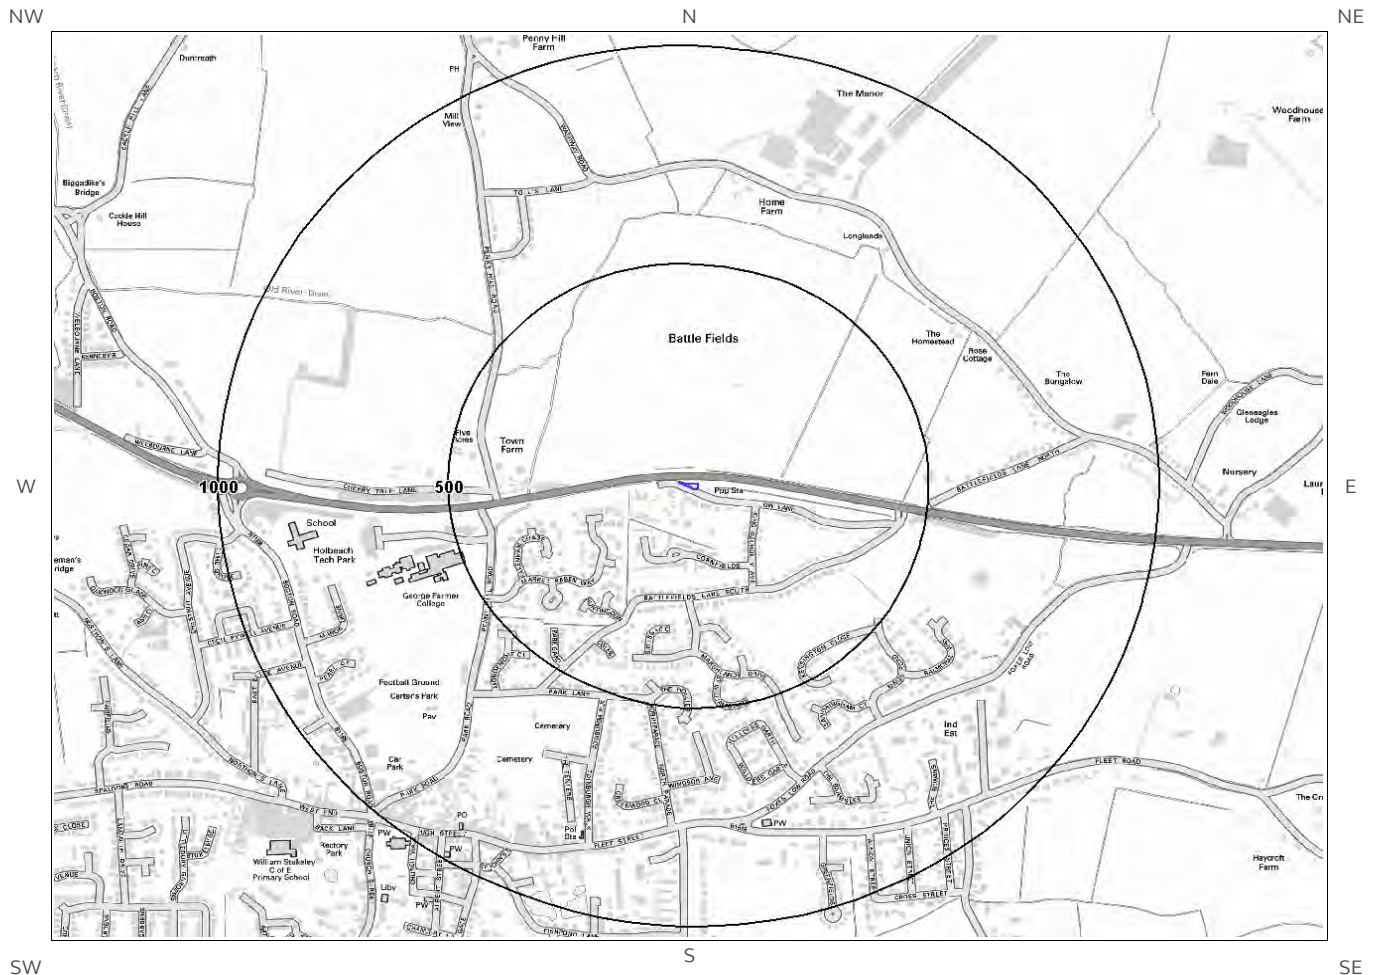

© Crown copyright and database rights 2018.
Ordnance Survey licence 100035207.

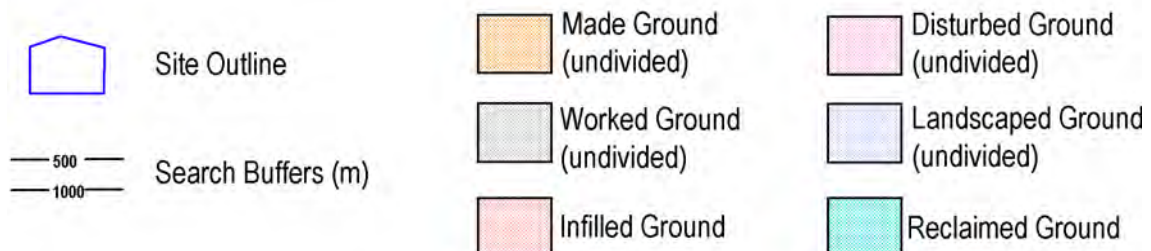

2. Geology 1:50,000 scale

2.1 Artificial Ground

The following geological information represented on the mapping is derived from 1:50,000 scale BGS Geological mapping, Sheet No: 144

2.1.1 Artificial/ Made Ground

Are there any records of Artificial/ Made Ground within 500m of the study site boundary? No


Database searched and no data found.

2.1.2 Permeability of Artificial Ground

Are there any records relating to permeability of artificial ground within the study site boundary? No

Database searched and no data found.


2.2 Superficial Deposits and Landslips map (1:50,000 scale)

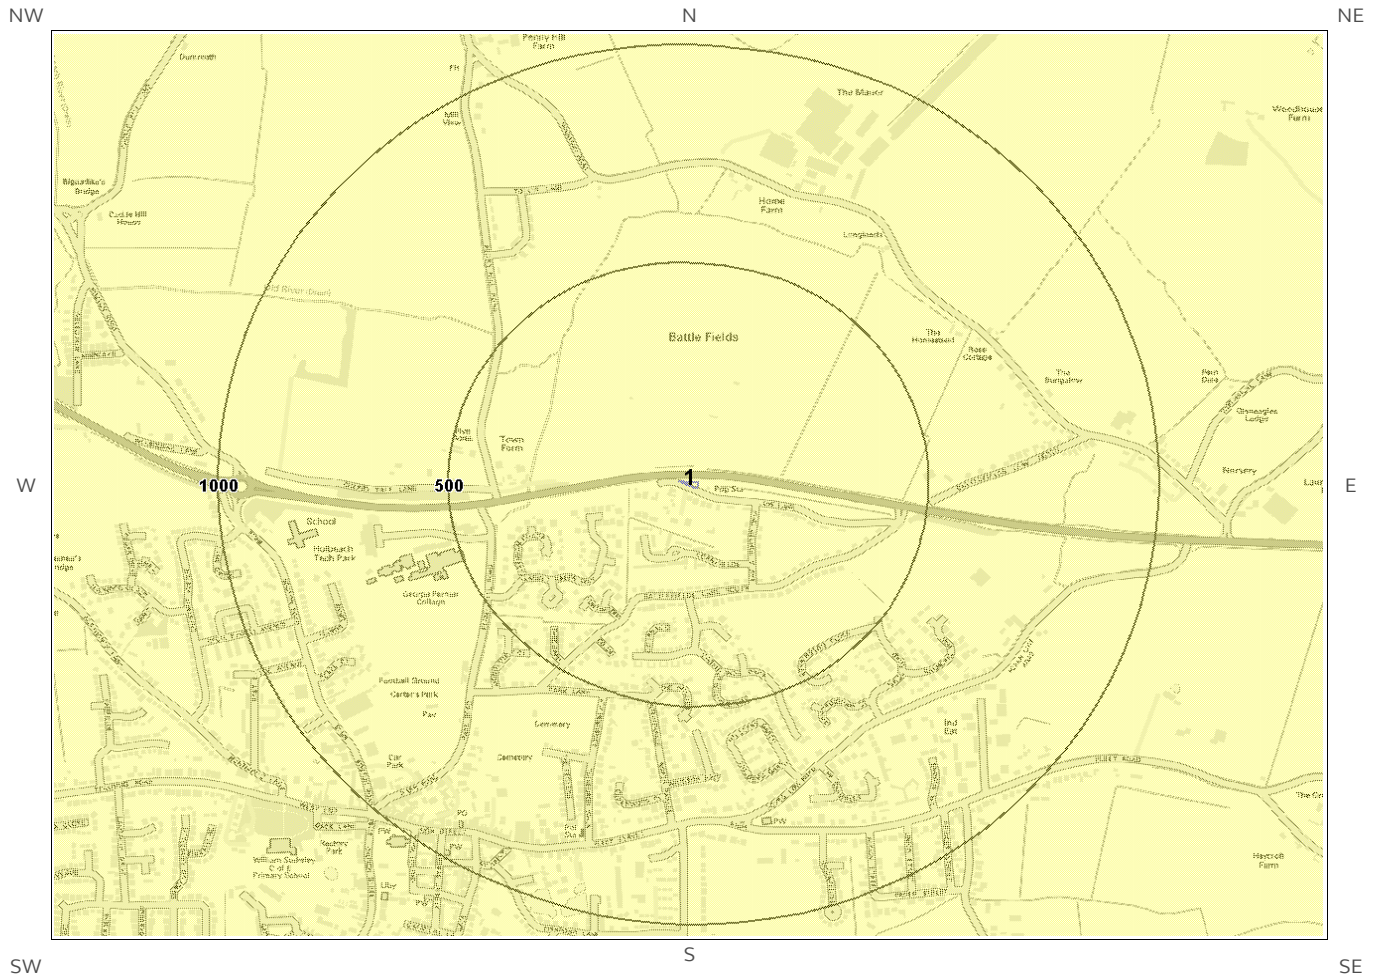

© Crown copyright and database rights 2018.
Ordnance Survey licence 100035207.



Site Outline



Search Buffers (m)

2.2 Superficial Deposits and Landslips

2.2.1 Superficial Deposits/ Drift Geology

Are there any records of Superficial Deposits/ Drift Geology within 500m of the study site boundary? Yes

ID	Distance	Direction	LEX Code	Description	Rock Description
1	0.0	On Site	TFD-XCZ	TIDAL FLAT DEPOSITS	CLAY AND SILT

2.2.2 Permeability of Superficial Ground

Are there any records relating to permeability of superficial ground within the study site boundary? Yes

Distance (m)	Direction	Flow Type	Maximum Permeability	Minimum Permeability
0.0	On Site	Intergranular	Low	Very Low

2.2.3 Landslip

Are there any records of Landslip within 500m of the study site boundary? No

Database searched and no data found.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of Great Britain at 1:50,000 scale.


This Geology shows the main components as discrete layers, there are: Artificial/ Made Ground, Superficial/ Drift Geology and Landslips. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nationwide coverage.

2.2.4 Landslip Permeability

Are there any records relating to permeability of landslips within the study site boundary? No

Database searched and no data found.


2.3 Bedrock and linear features map (1:50,000 scale)

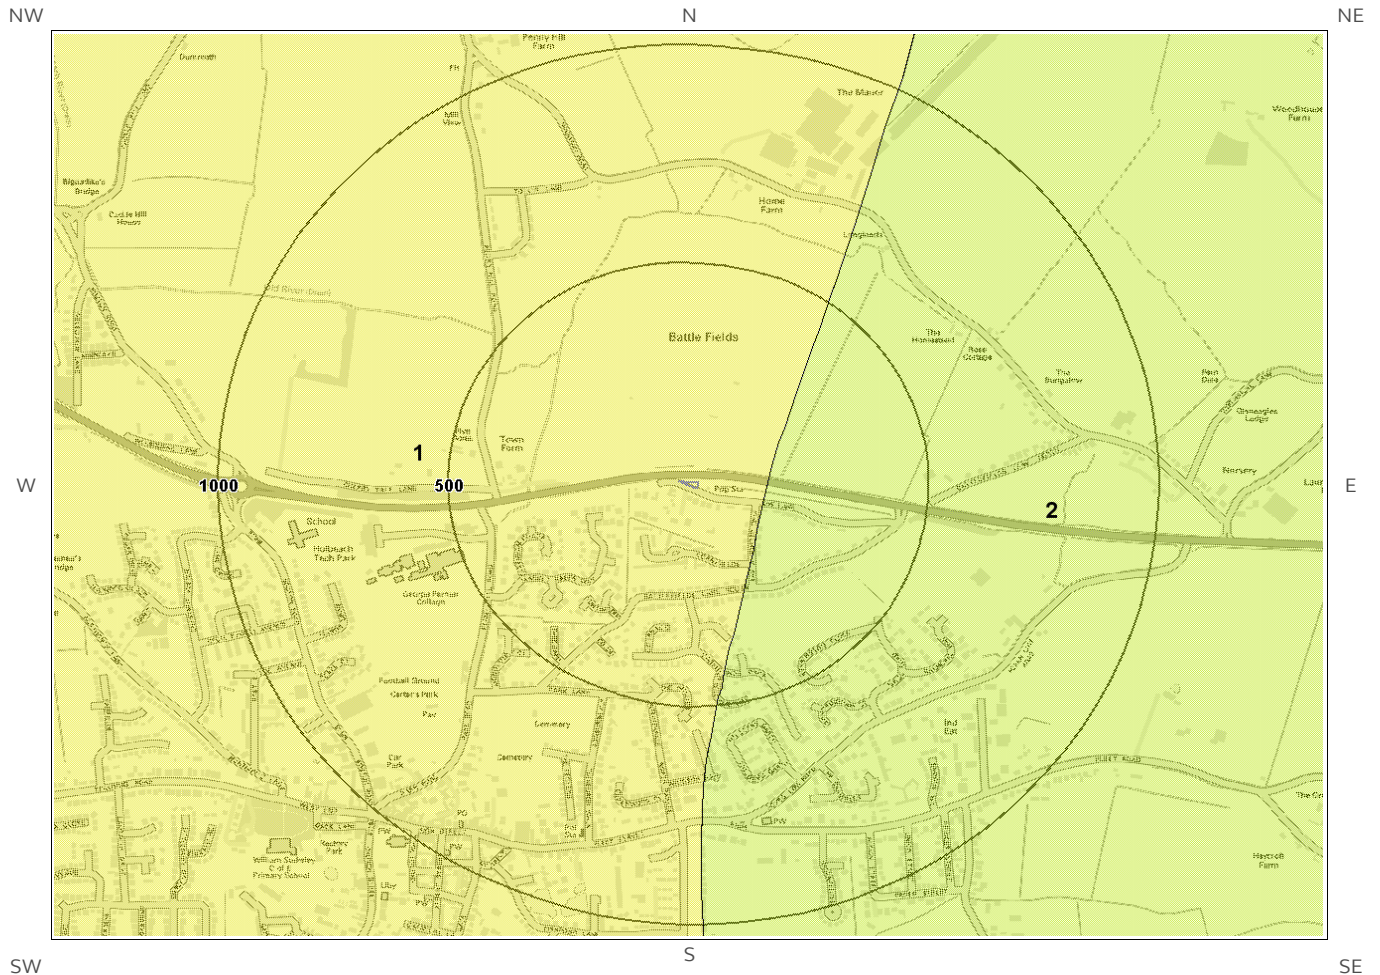

© Crown copyright and database rights 2018.
Ordnance Survey licence 100035207.



Site Outline



Search Buffers (m)

2.3 Bedrock, Solid Geology & linear features

The following geological information represented on the mapping is derived from 1:50,000 scale BGS Geological mapping, Sheet No: 144

2.3.1 Bedrock/Solid Geology

Records of Bedrock/Solid Geology within 500m of the study site boundary:

ID	Distance	Direction	LEX Code	Rock Description	Rock Age
1	0.0	On Site	WWB-MDSI	WEST WALTON FORMATION - MUDSTONE AND SILTSTONE	OXFORDIAN
2	146.0	E	AMC-MDST	AMPTHILL CLAY FORMATION - MUDSTONE	OXFORDIAN

2.3.2 Permeability of Bedrock Ground

Are there any records relating to permeability of bedrock ground within the study site boundary? Yes

Distance	Direction	Flow Type	Maximum Permeability	Minimum Permeability
0.0	On Site	Fracture	Low	Very Low

2.3.3 Linear features

Are there any records of linear features within 500m of the study site boundary? No

Database searched and no data found.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of Great Britain at 1:50,000 scale.

This Geology shows the main components as discrete layers, these are: Bedrock/Solid Geology and linear features such as faults. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nation wide coverage.

3 Radon Data

3.1 Radon Affected Areas


Is the property in a Radon Affected Area as defined by the Health Protection Agency (HPA) and if so what percentage of homes are above the Action Level? The property is not in a Radon Affected Area, as less than 1% of properties are above the Action Level.

The radon data in this report is supplied by the BGS/Public Health England and is the definitive map of Radon Affected Areas in Great Britain and Northern Ireland. The dataset was created using long-term radon measurements in over 479,000 homes across Great Britain and 23,000 homes across Northern Ireland, combined with geological data. The dataset is considered accurate to 50m to allow for the margin of error in geological lines, and the findings of this report supercede any answer given in the less accurate Indicative Atlas of Radon in Great Britain, which simplifies the data to give the highest risk within any given 1km grid square. As such, the radon atlas is considered indicative, whereas the data given in this report is considered definitive.

3.2 Radon Protection


Is the property in an area where Radon Protection are required for new properties or extensions to existing ones as described in publication BR211 by the Building Research Establishment? No radon protective measures are necessary.

4 Ground Workings map

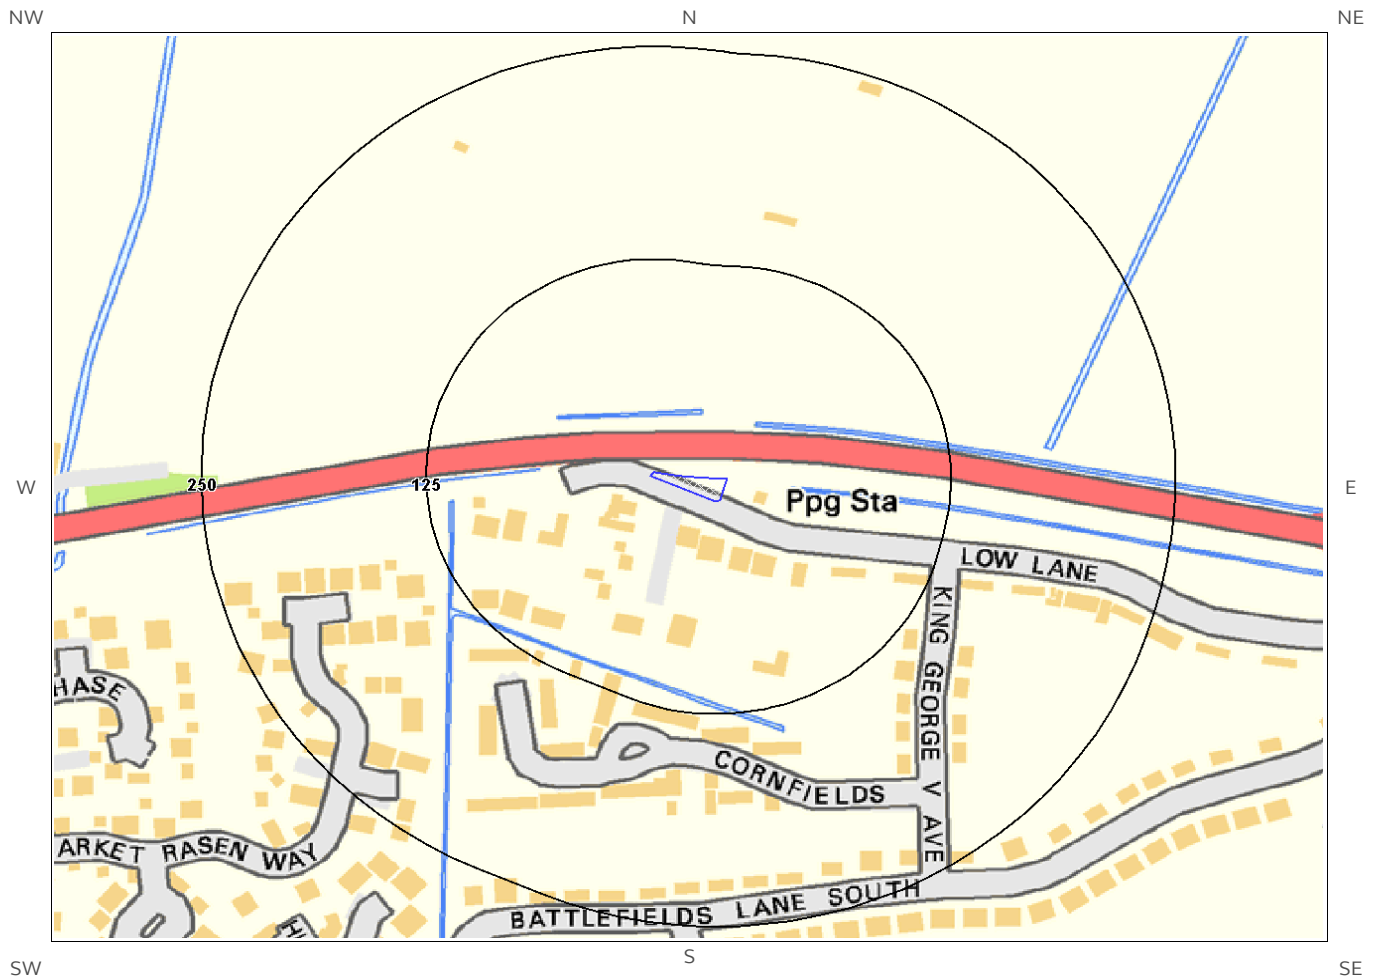

Ground Workings Legend

© Crown copyright and database rights 2018.
Ordnance Survey licence 100035207.

- | | | | |
|---|--------------------|---|----------------------------------|
|  | Site Outline |  | Historic Surface Ground Workings |
|  | Search Buffers (m) |  | Historic Underground Workings |
| | |  | Current Ground Workings |

4 Ground Workings

4.1 Historical Surface Ground Working Features derived from Historical Mapping

This dataset is based on Groundsure's unique Historical Land Use Database derived from 1:10,560 and 1:10,000 scale historical mapping

Are there any Historical Surface Ground Working Features within 250m of the study site boundary? No

Database searched and no data found.

4.2 Historical Underground Working Features derived from Historical Mapping

This data is derived from the Groundsure unique Historical Land Use Database. It contains data derived from 1:10,000 and 1:10,560 historical Ordnance Survey Mapping and includes some natural topographical features (Shake Holes for example) as well as manmade features that may have implications for ground stability. Underground and mining features have been identified from surface features such as shafts. The distance that these extend underground is not shown.

Are there any Historical Underground Working Features within 1000m of the study site boundary? No

Database searched and no data found.

4.3 Current Ground Workings


This dataset is derived from the BGS BRITPITS database covering active; inactive mines; quarries; oil wells; gas wells and mineral wharves; and rail deposits throughout the British Isles.

Are there any BGS Current Ground Workings within 1000m of the study site boundary? Yes

The following Current Ground Workings information is provided by British Geological Survey:

ID	Distance (m)	Direction	NGR	Commodity Produced	Pit Name	Type of working	Status
Not shown	985.0	S	536298 324645	Clay & Shale	Holbeach Brick Pits	A surface mineral working. It may be termed Quarry, Sand Pit, Clay Pit or Opencast Coal Site	Ceased

5 Mining, Extraction & Natural Cavities map

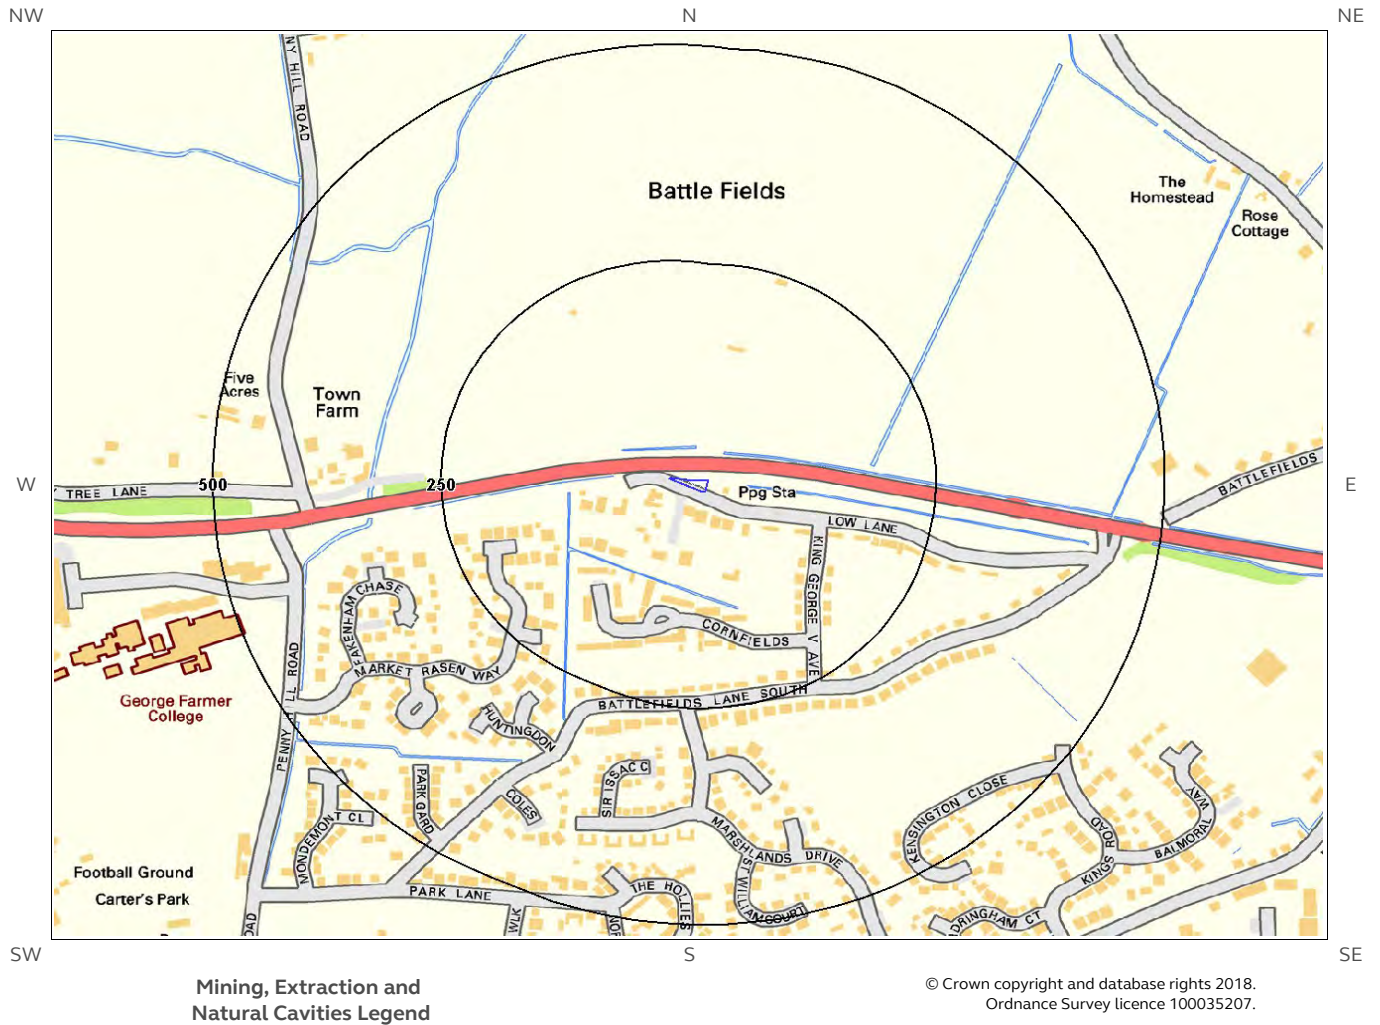

5 Mining, Extraction & Natural Cavities

5.1 Historical Mining

This dataset is derived from Groundsure unique Historical Land-use Database that are indicative of mining or extraction activities.

Are there any Historical Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.2 Coal Mining

This dataset provides information as to whether the study site lies within a known coal mining affected area as defined by the coal authority.

Are there any Coal Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.3 Johnson Poole and Bloomer

This dataset provides information as to whether the study site lies within an area where JPB hold information relating to mining.

Are there any JPB Mining areas within 1000m of the study site boundary? No

The following information provided by JPB is not represented on mapping: Database searched and no data found.

5.4 Non-Coal Mining

This dataset provides information as to whether the study site lies within an area which may have been subject to non-coal historic mining.

Are there any Non-Coal Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.5 Non-Coal Mining Cavities

This dataset provides information from the Peter Brett Associates (PBA) mining cavities database (compiled for the national study entitled “Review of mining instability in Great Britain, 1990” PBA has also continued adding to this database) on mineral extraction by mining.

Are there any Non-Coal Mining cavities within 1000m of the study site boundary? No

Database searched and no data found.

5.6 Natural Cavities

This dataset provides information based on the Peter Brett Associates natural cavities database. The dataset is made up of points and polygons. Where polygons are used these represent an area in which it is expected the cavities could be found. It does not indicate that cavities are present everywhere within the polygon, and caution should be used in the interpretation of this data.

Are there any Natural Cavities within 1000m of the study site boundary? No

Database searched and no data found.

5.7 Brine Extraction

This data provides information from the Coal Authority issued on behalf of the Cheshire Brine Subsidence Compensation Board.

Are there any Brine Extraction areas within 1000m of the study site boundary? No

Database searched and no data found.

5.8 Gypsum Extraction

This dataset provides information on Gypsum extraction from British Gypsum records.

Are there any Gypsum Extraction areas within 1000m of the study site boundary? No

Database searched and no data found.

5.9 Tin Mining

This dataset provides information on tin mining areas and is derived from tin mining records. This search is based upon postcode information to a sector level..

Are there any Tin Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.10 Clay Mining

This dataset provides information on Kaolin and Ball Clay mining from relevant mining records.


Are there any Clay Mining areas within 1000m of the study site boundary?

No

Database searched and no data found.

6 Natural Ground Subsidence

6.1 Shrink-Swell Clay map

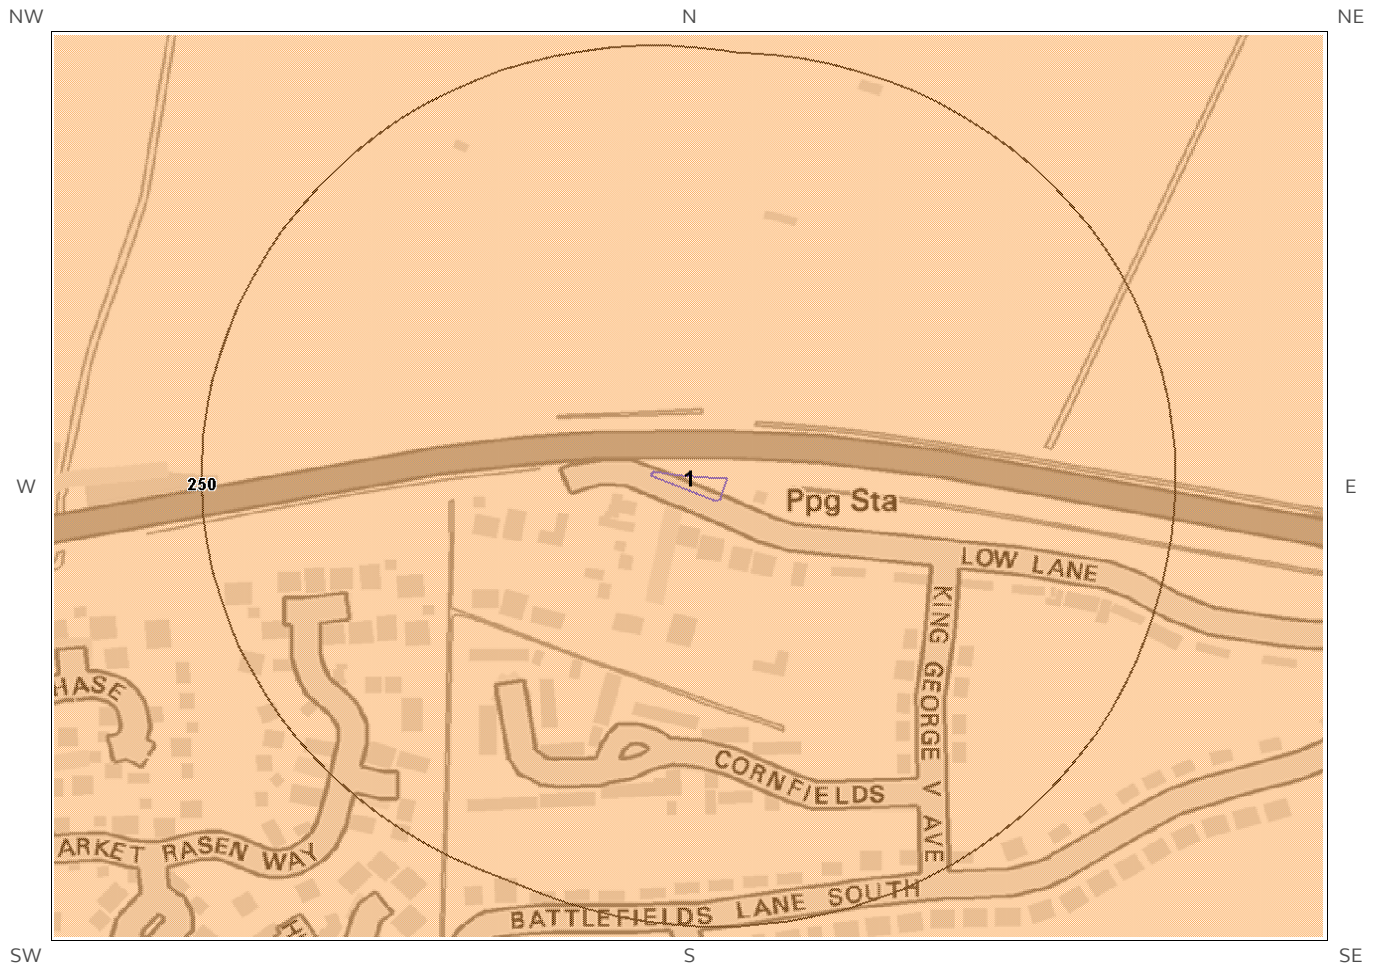


Shrink Swell Clay Legend

© Crown copyright and database rights 2018.
Ordnance Survey licence 100035207.



6.2 Landslides map

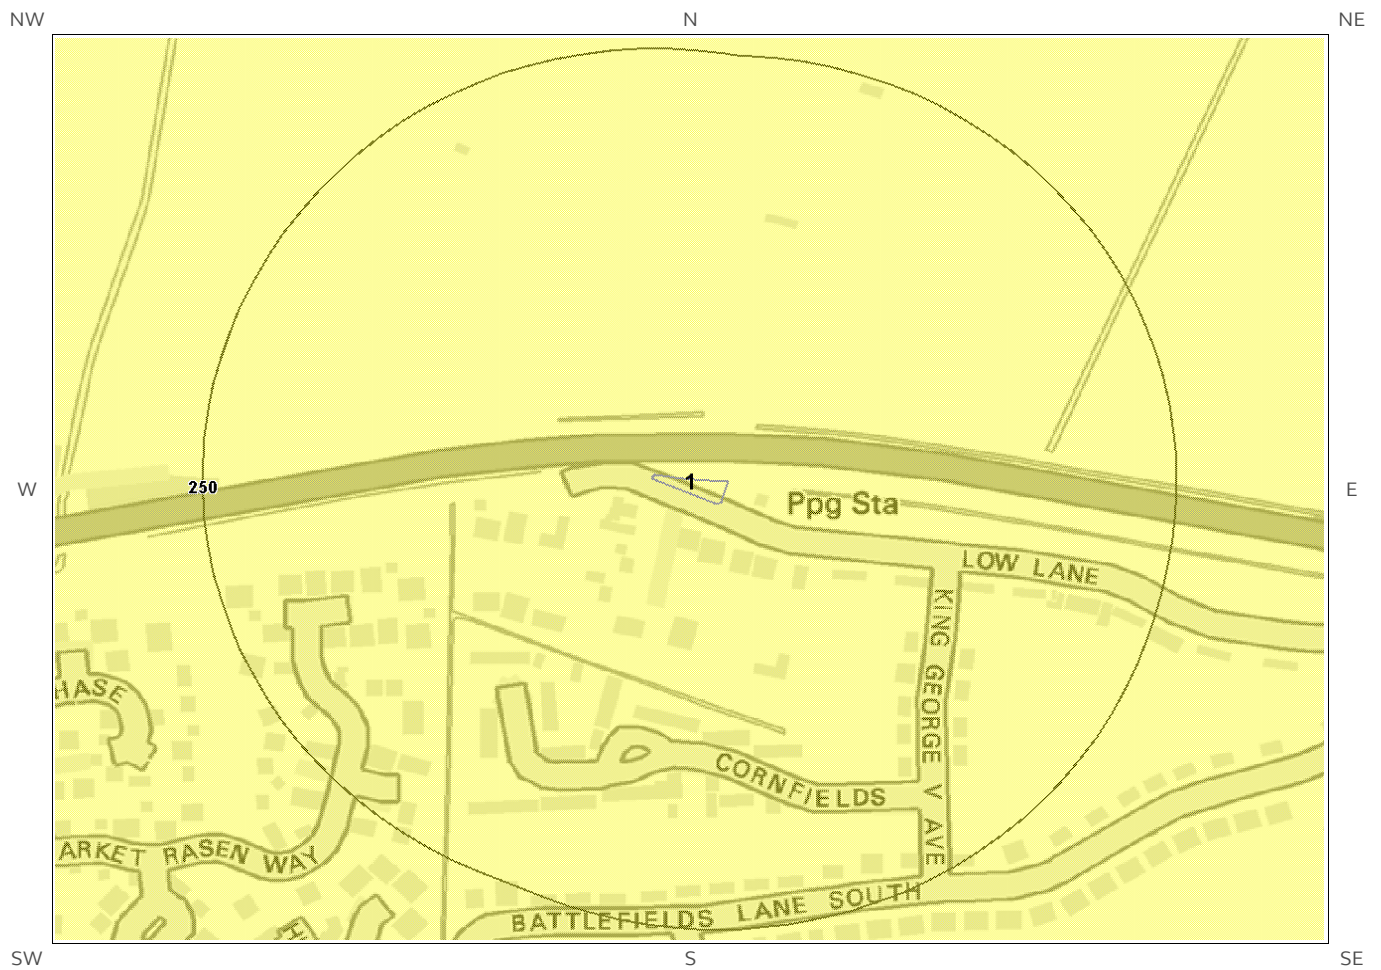


Landslides Legend


© Crown copyright and database rights 2018.
Ordnance Survey licence 100035207.



6.3 Ground Dissolution of Soluble Rocks map

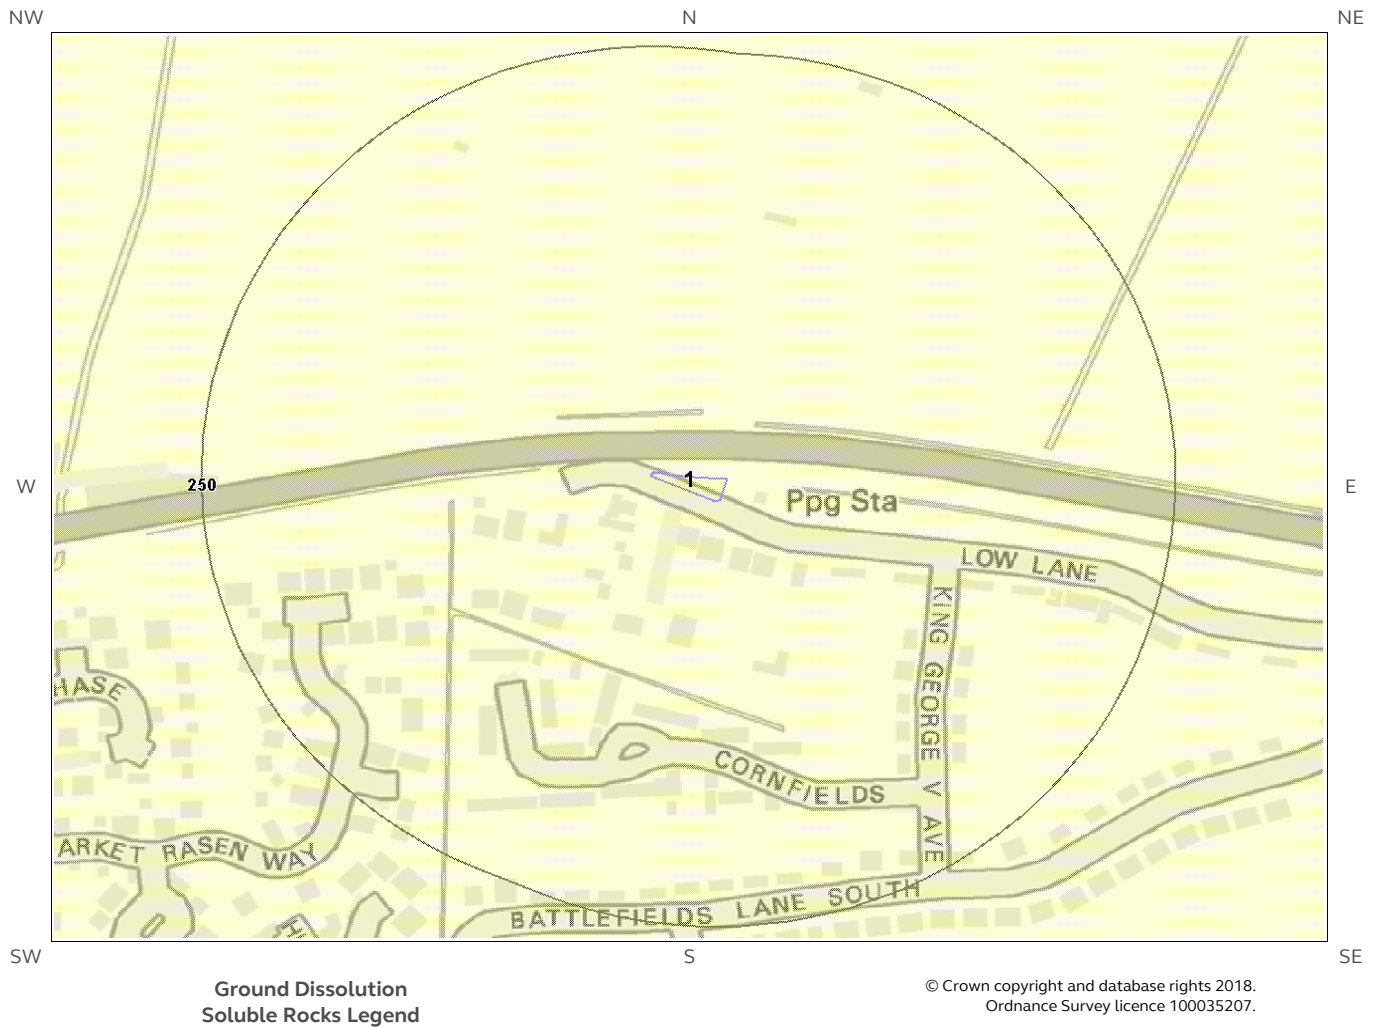

6.4 Compressible Deposits map

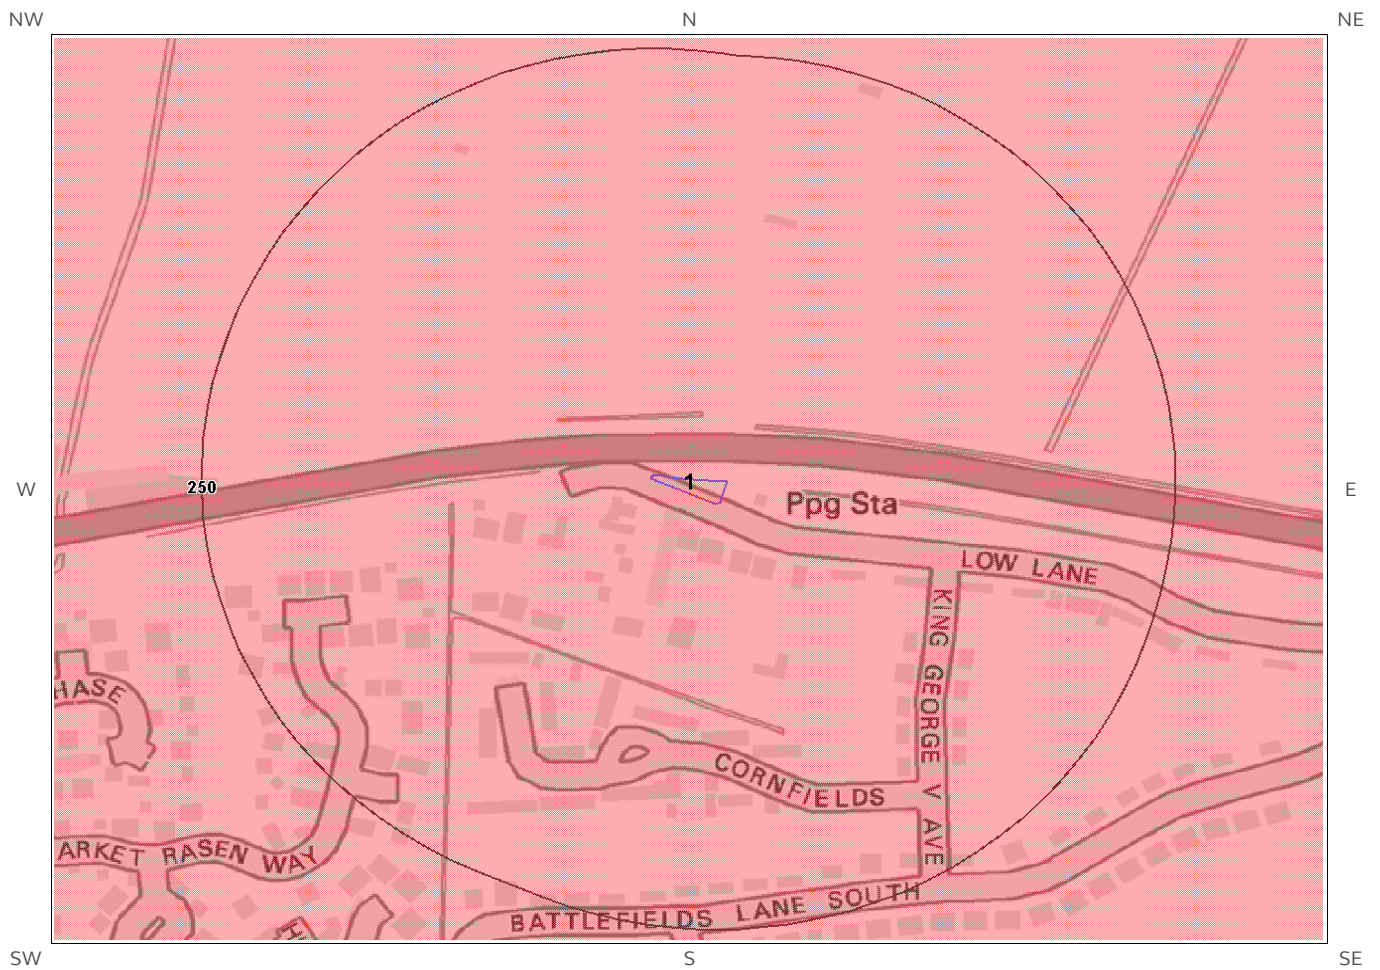


Compressible Deposits Legend

© Crown copyright and database rights 2018.
Ordnance Survey licence 100035207.



6.5 Collapsible Deposits map

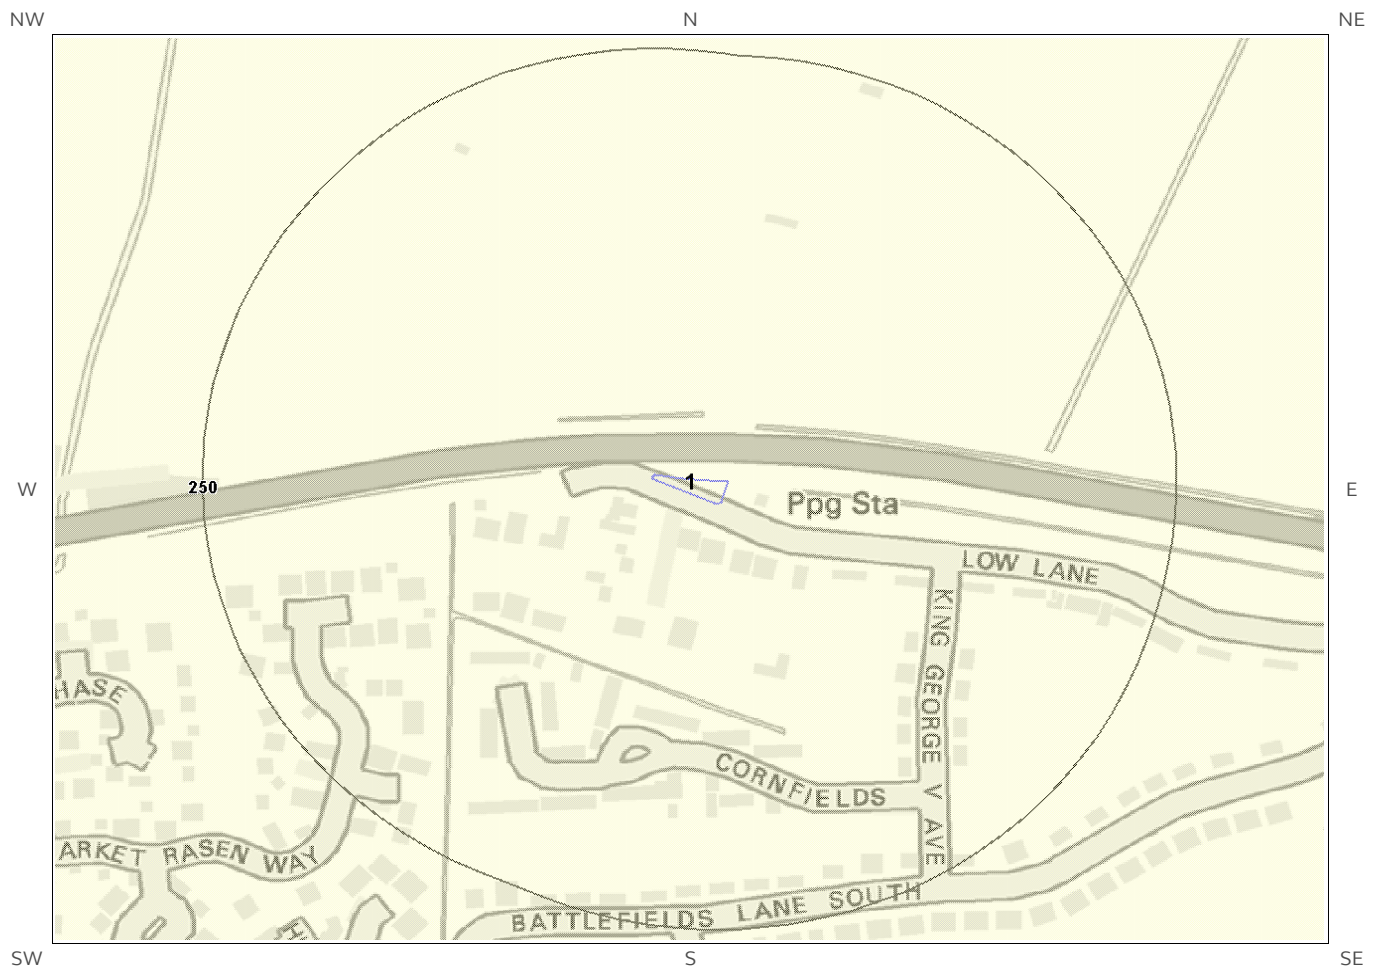


Collapsible Deposits Legend

© Crown copyright and database rights 2018.
 Ordnance Survey licence 100035207.



6.6 Running Sand map

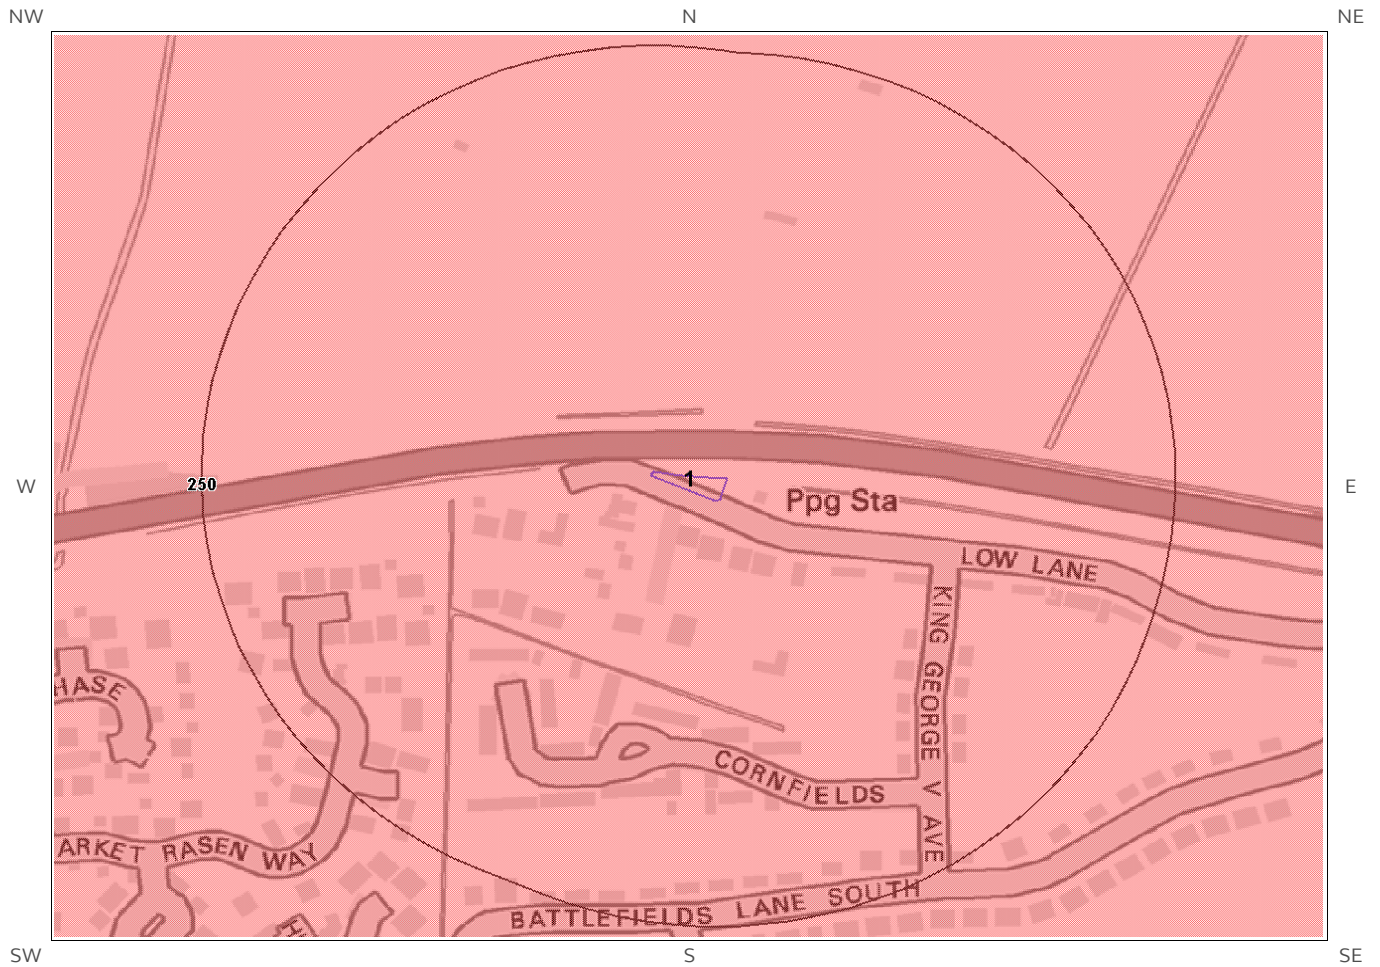

Running Sand Legend

© Crown copyright and database rights 2018.
Ordnance Survey licence 100035207.



6 Natural Ground Subsidence

The National Ground Subsidence rating is obtained through the 6 natural ground stability hazard datasets, which are supplied by the British Geological Survey (BGS).

The following GeoSure data represented on the mapping is derived from the BGS Digital Geological map of Great Britain at 1:50,000 scale.

What is the maximum hazard rating of natural subsidence within the study site* boundary? Moderate

6.1 Shrink-Swell Clays

The following Shrink Swell information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Low	Ground conditions predominantly medium plasticity. Do not plant trees with high soil moisture demands near to buildings. For new build, consideration should be given to advice published by the National House Building Council (NHBC) and the Building Research Establishment (BRE). There is a possible increase in construction cost to reduce potential shrink-swell problems. For existing property, there is a possible increase in insurance risk, especially during droughts or where vegetation with high moisture demands is present.

6.2 Landslides

The following Landslides information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Very Low	Slope instability problems are unlikely to be present. No special actions required to avoid problems due to landslides. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with landslides.

* This includes an automatically generated 50m buffer zone around the site

6.3 Ground Dissolution of Soluble Rocks

The following Ground Dissolution information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Negligible	Soluble rocks are present, but unlikely to cause problems except under exceptional conditions. No special actions required to avoid problems due to soluble rocks. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with soluble rocks.

6.4 Compressible Deposits

The following Compressible Deposits information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Moderate	Significant potential for compressibility problems. Avoid large differential loadings of ground. Do not drain or de-water ground near the property without technical advice. For new build - consider possibility of compressible ground in ground investigation, construction and building design. Consider effects of groundwater changes. Extra construction costs are likely. For existing property - possible increase in insurance risk from compressibility, especially if water conditions or loading of the ground change significantly.

6.5 Collapsible Deposits

The following Collapsible Rocks information provided by the British Geological Survey:


ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Negligible	No indicators for collapsible deposits identified. No actions required to avoid problems due to collapsible deposits. No special ground investigation required, or increased construction costs or increased financial risk due to potential problems with collapsible deposits.

6.6 Running Sands

The following Running Sands information provided by the British Geological Survey:


ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Moderate	Significant potential for running sand problems with relatively small changes in ground conditions. Avoid large amounts of water entering the ground (for example through pipe leakage or soak-aways). Do not dig (deep) holes into saturated ground near the property without technical advice. For new build - consider the consequences of soil and groundwater conditions during and after construction. For existing property - possible increase in insurance risk from running sand, for example, due to water leakage, high rainfall events or flooding.

7 Borehole Records map

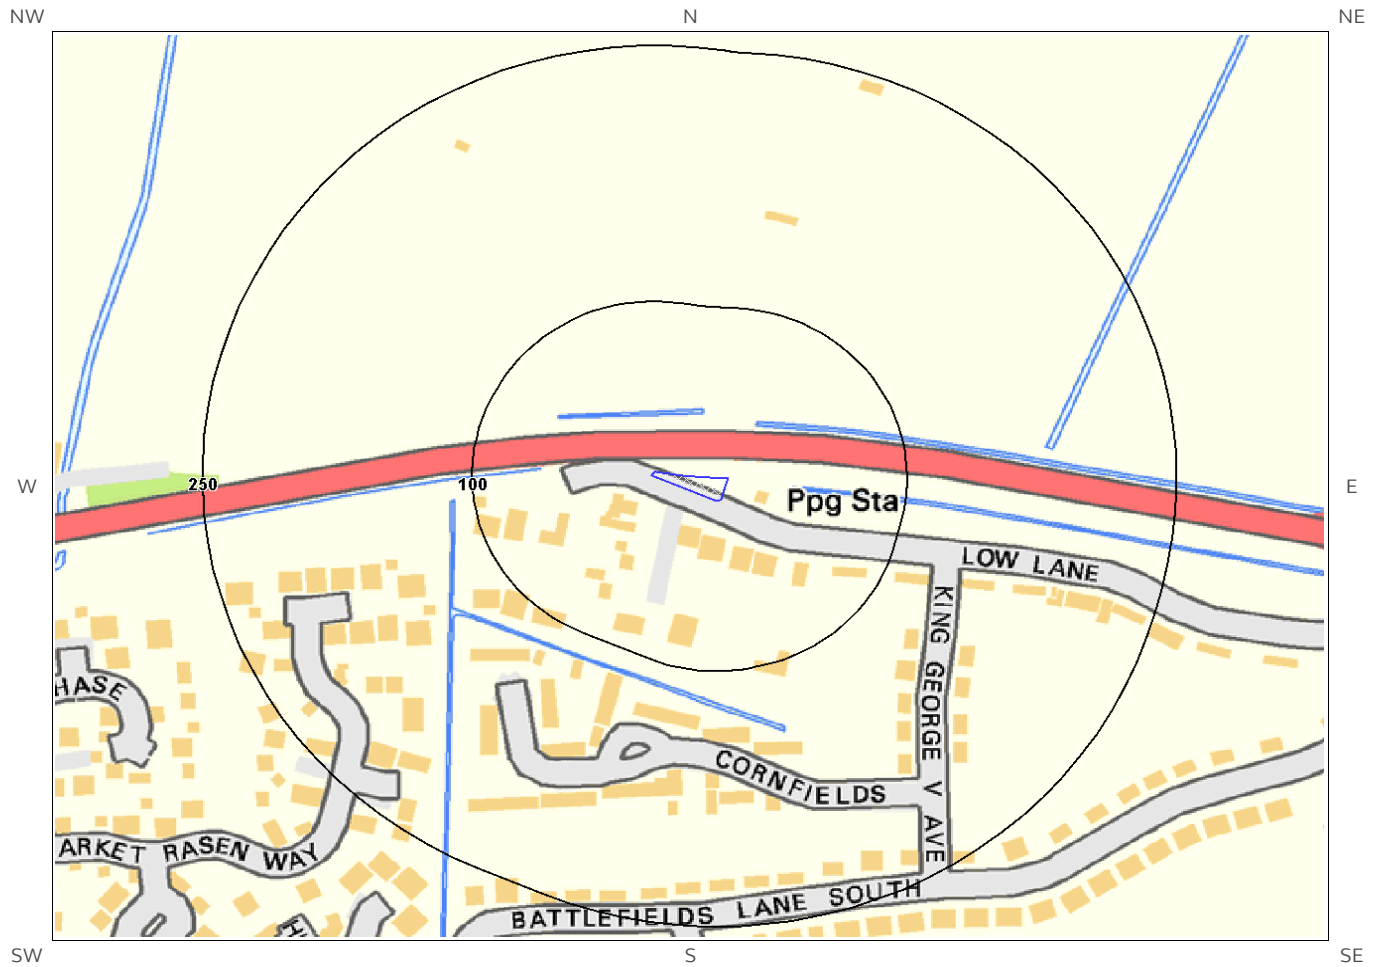

Borehole Records Legend

© Crown copyright and database rights 2018.
 Ordnance Survey licence 100035207.

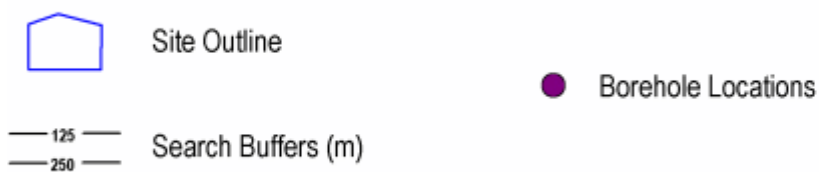

7 Borehole Records

The systematic analysis of data extracted from the BGS Borehole Records database provides the following information.

Records of boreholes within 250m of the study site boundary:

0

Database searched and no data found.

8 Estimated Background Soil Chemistry

Records of background estimated soil chemistry within 250m of the study site boundary:


2

For further information on how this data is calculated and limitations upon its use, please see the Groundsure Geo Insight User Guide, available on request.

Distance (m)	Direction	Sample Type	Arsenic (As)	Cadmium (Cd)	Chromium (Cr)	Nickel (Ni)	Lead (Pb)
0.0	On Site	RuralSoil	<15 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg
19.0	W	RuralSoil	<15 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg


*As this data is based upon underlying 1:50,000 scale geological information, a 50m buffer has been added to the search radius.

9 Railways and Tunnels map

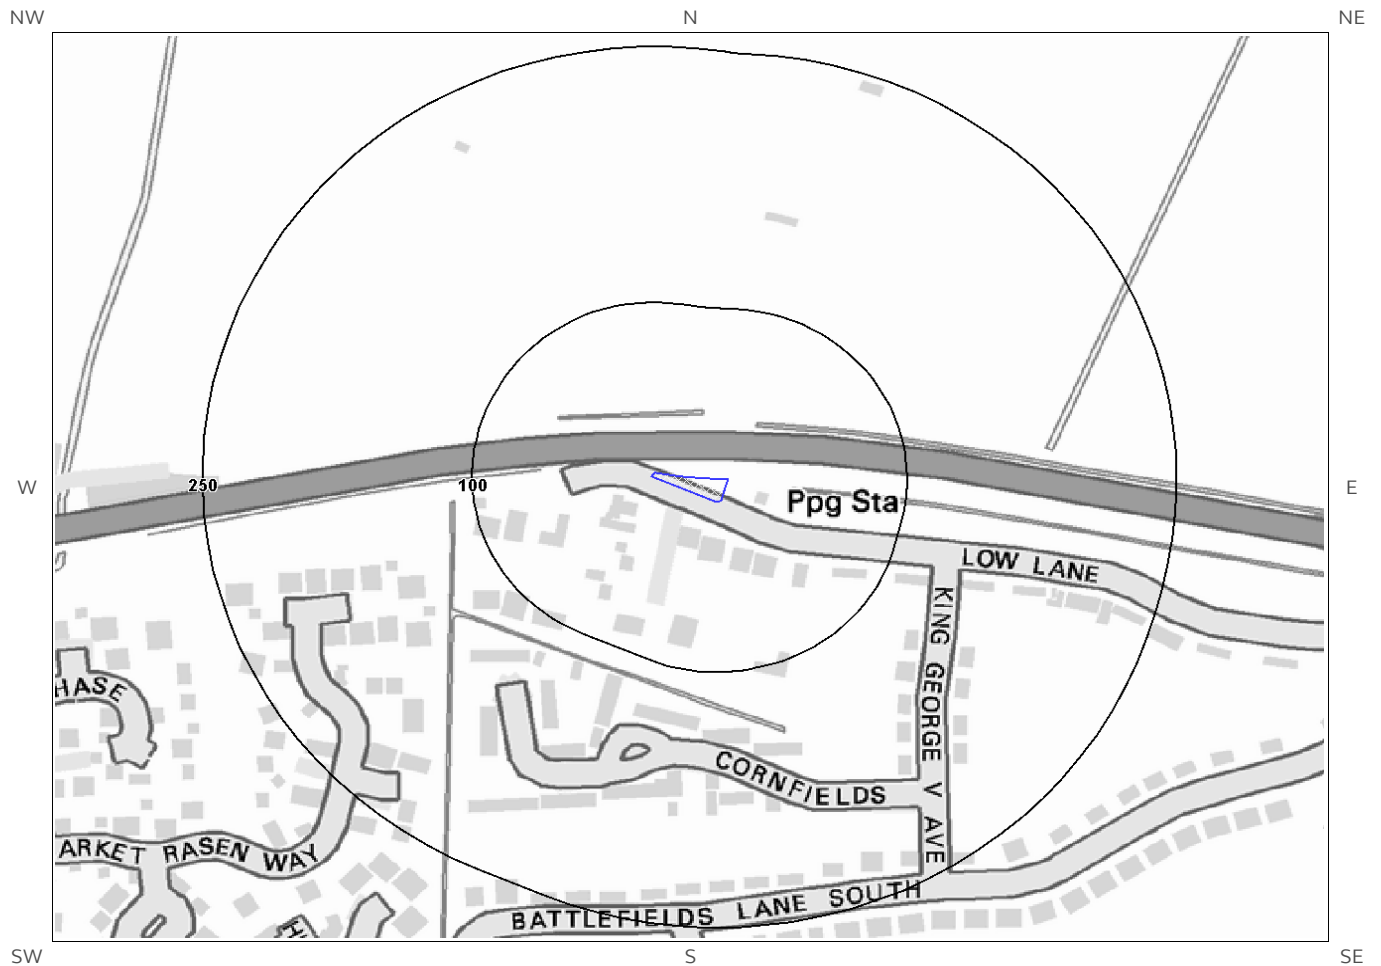

Railways and Tunnels Legend

© Crown copyright and database rights 2018.
Ordnance Survey licence 100035207.
© OpenStreetMapContributors

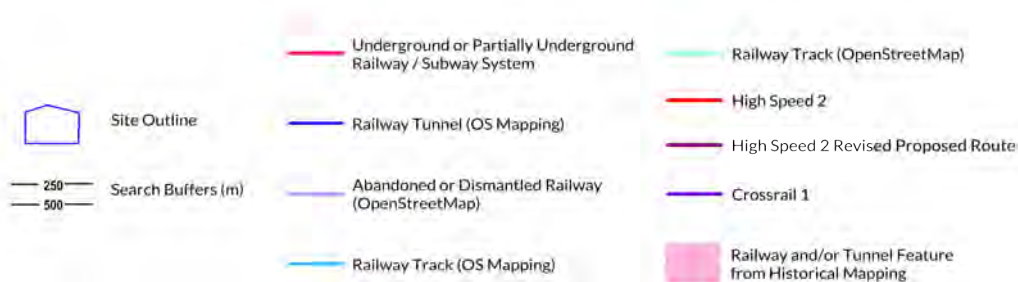

9 Railways and Tunnels

9.1 Tunnels

This data is derived from OpenStreetMap and provides information on the possible locations of underground railway systems in the UK - the London Underground, the Tyne & Wear Metro and the Glasgow Subway.

Have any underground railway lines been identified within the study site boundary? No

Have any underground railway lines been identified within 250m of the study site boundary? No

Database searched and no data found.

Any records that have been identified are represented on the Railways and Tunnels map.

This data is derived from Ordnance Survey mapping and provides information on the possible locations of railway tunnels forming part of the UK overground railway network.

Have any other railway tunnels been identified within the site boundary? No

Have any other railway tunnels been identified within 250m of the site boundary? No

Database searched and no data found.

Any records that have been identified are represented on the Railways and Tunnels map.

9.2 Historical Railway and Tunnel Features

This data is derived from Groundsure's unique Historical Land-use Database and contains features relating to tunnels, railway tracks or associated works that have been identified from historical Ordnance Survey mapping.

Have any historical railway or tunnel features been identified within the study site boundary? No

Have any historical railway or tunnel features been identified within 250m of the study site boundary? No

Database searched and no data found.

Any records that have been identified are represented on the Railways and Tunnels map.

9.3 Historical Railways

This data is derived from OpenStreetMap and provides information on the possible alignments of abandoned or dismantled railway lines in proximity to the study site.

Have any historical railway lines been identified within the study site boundary? No

Have any historical railway lines been identified within 250m of the study site boundary? No

Database searched and no data found.

Multiple sections of the same track may be listed in the detail above
Any records that have been identified are represented on the Railways and Tunnels map.

9.4 Active Railways

These datasets are derived from Ordnance Survey mapping and OpenStreetMap and provide information on the possible locations of active railway lines in proximity to the study site.

Have any active railway lines been identified within the study site boundary? No

Have any active railway lines been identified within 250m of the study site boundary? No

Database searched and no data found.

Multiple sections of the same track may be listed in the detail above
Any records that have been identified are represented on the Railways and Tunnels map.

9.5 Railway Projects

These datasets provide information on the location of large scale railway projects High Speed 2 and Crossrail 1 .

Is the study site within 5km of the route of the High Speed 2 rail project? No

Is the study site within 500m of the route of the Crossrail 1 rail project? No

Further information on proximity to these routes, the project construction status and associated works can be obtained through the purchase of a Groundsure HS2 and Crossrail 1 Report.

The route data has been digitised from publicly available maps by Groundsure. The route as provided relates to the Crossrail 1 project only, and does not include any details of the Crossrail 2 project, as final details of the route for Crossrail 2 are still under consultation.

Please note that this assessment takes account of both the original Phase 2b proposed route and the amended route proposed in 2016. As the Phase 2b route is still under consultation, Groundsure are providing information on both options until the final route is formally confirmed. Practitioners should take account of this uncertainty when advising clients.

Contact Details

Groundsure Helpline
Telephone: 08444 159 000
info@groundsure.com



British Geological Survey Enquiries

Kingsley Dunham Centre
Keyworth, Nottingham NG12 5GG
Tel: 0115 936 3143.
Fax: 0115 936 3276.
Email: enquiries@bgs.ac.uk
Web: www.bgs.ac.uk



BGS Geological Hazards Reports and general geological enquiries

British Gypsum

British Gypsum Ltd
East Leake
Loughborough
Leicestershire
LE12 6HX



The Coal Authority

200 Lichfield Lane
Mansfield
Notts NG18 4RG
Tel: 0345 7626 848
DX 716176 Mansfield 5
www.coal.gov.uk



Public Health England

Public information access office
Public Health England, Wellington House
133-155 Waterloo Road, London, SE1 8UG
<https://www.gov.uk/government/organisations/public-health-england>
Email: enquiries@phe.gov.uk
Main switchboard: 020 7654 8000



Johnson Poole & Bloomer Limited

Harris and Pearson Building, Brettell Lane
Brierley Hill, West Midlands
DY5 3LH
Tel: +44 (0) 1384 262 000
Email: enquiries.gs@jpb.co.uk
Website: www.jpb.co.uk



Ordnance Survey

Adanac Drive, Southampton
SO16 0AS
Tel: 08456 050505
Website: <http://www.ordnancesurvey.co.uk/>



Getmapping PLC

Virginia Villas, High Street, Hartley Witney,
Hampshire RG27 8NW
Tel: 01252 845444
Website: <http://www1.getmapping.com/>



Peter Brett Associates
Caversham Bridge House
Waterman Place
Reading
Berkshire RG1 8DN
Tel: +44 (0)118 950 0761 E-mail: reading@pba.co.uk
Website: <http://www.peterbrett.com/home>



Acknowledgements: Ordnance Survey © Crown Copyright and/or Database Right. All Rights Reserved. Licence Number [03421028]. This report has been prepared in accordance with the Groundsure Ltd standard Terms and Conditions of business for work of this nature.

Standard Terms and Conditions

Groundsure's Terms and Conditions can be viewed online at this link:
<https://www.groundsure.com/terms-and-conditions-may25-2018>