

Memorial Elevation as existing
Scale 1:20

SCALE 1 : 20
SCALE 1 : 1

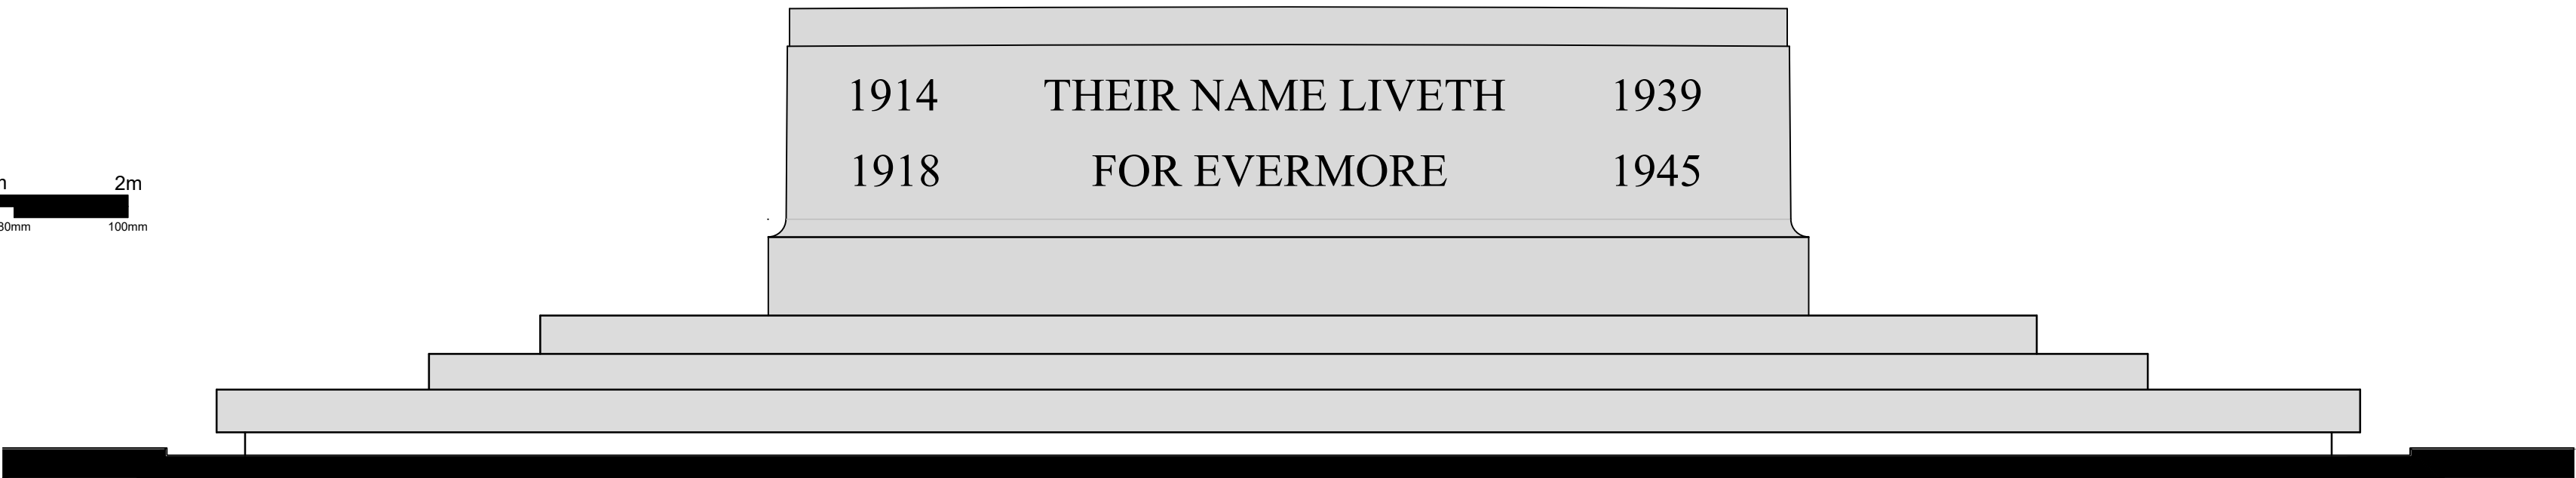


Photo 10 - Joint with pointing missing / eroded



Photo 9 - Stones misaligned at joint



Photo 8 - Depressions and damaged arris to stone



Photo 11 - Algae growth on stone surfaces, pointing missing.



Photo 12 - Surface algae and general grime

Memorial Plan as existing
Scale 1:20

SCALE 1 : 20
SCALE 1 : 1

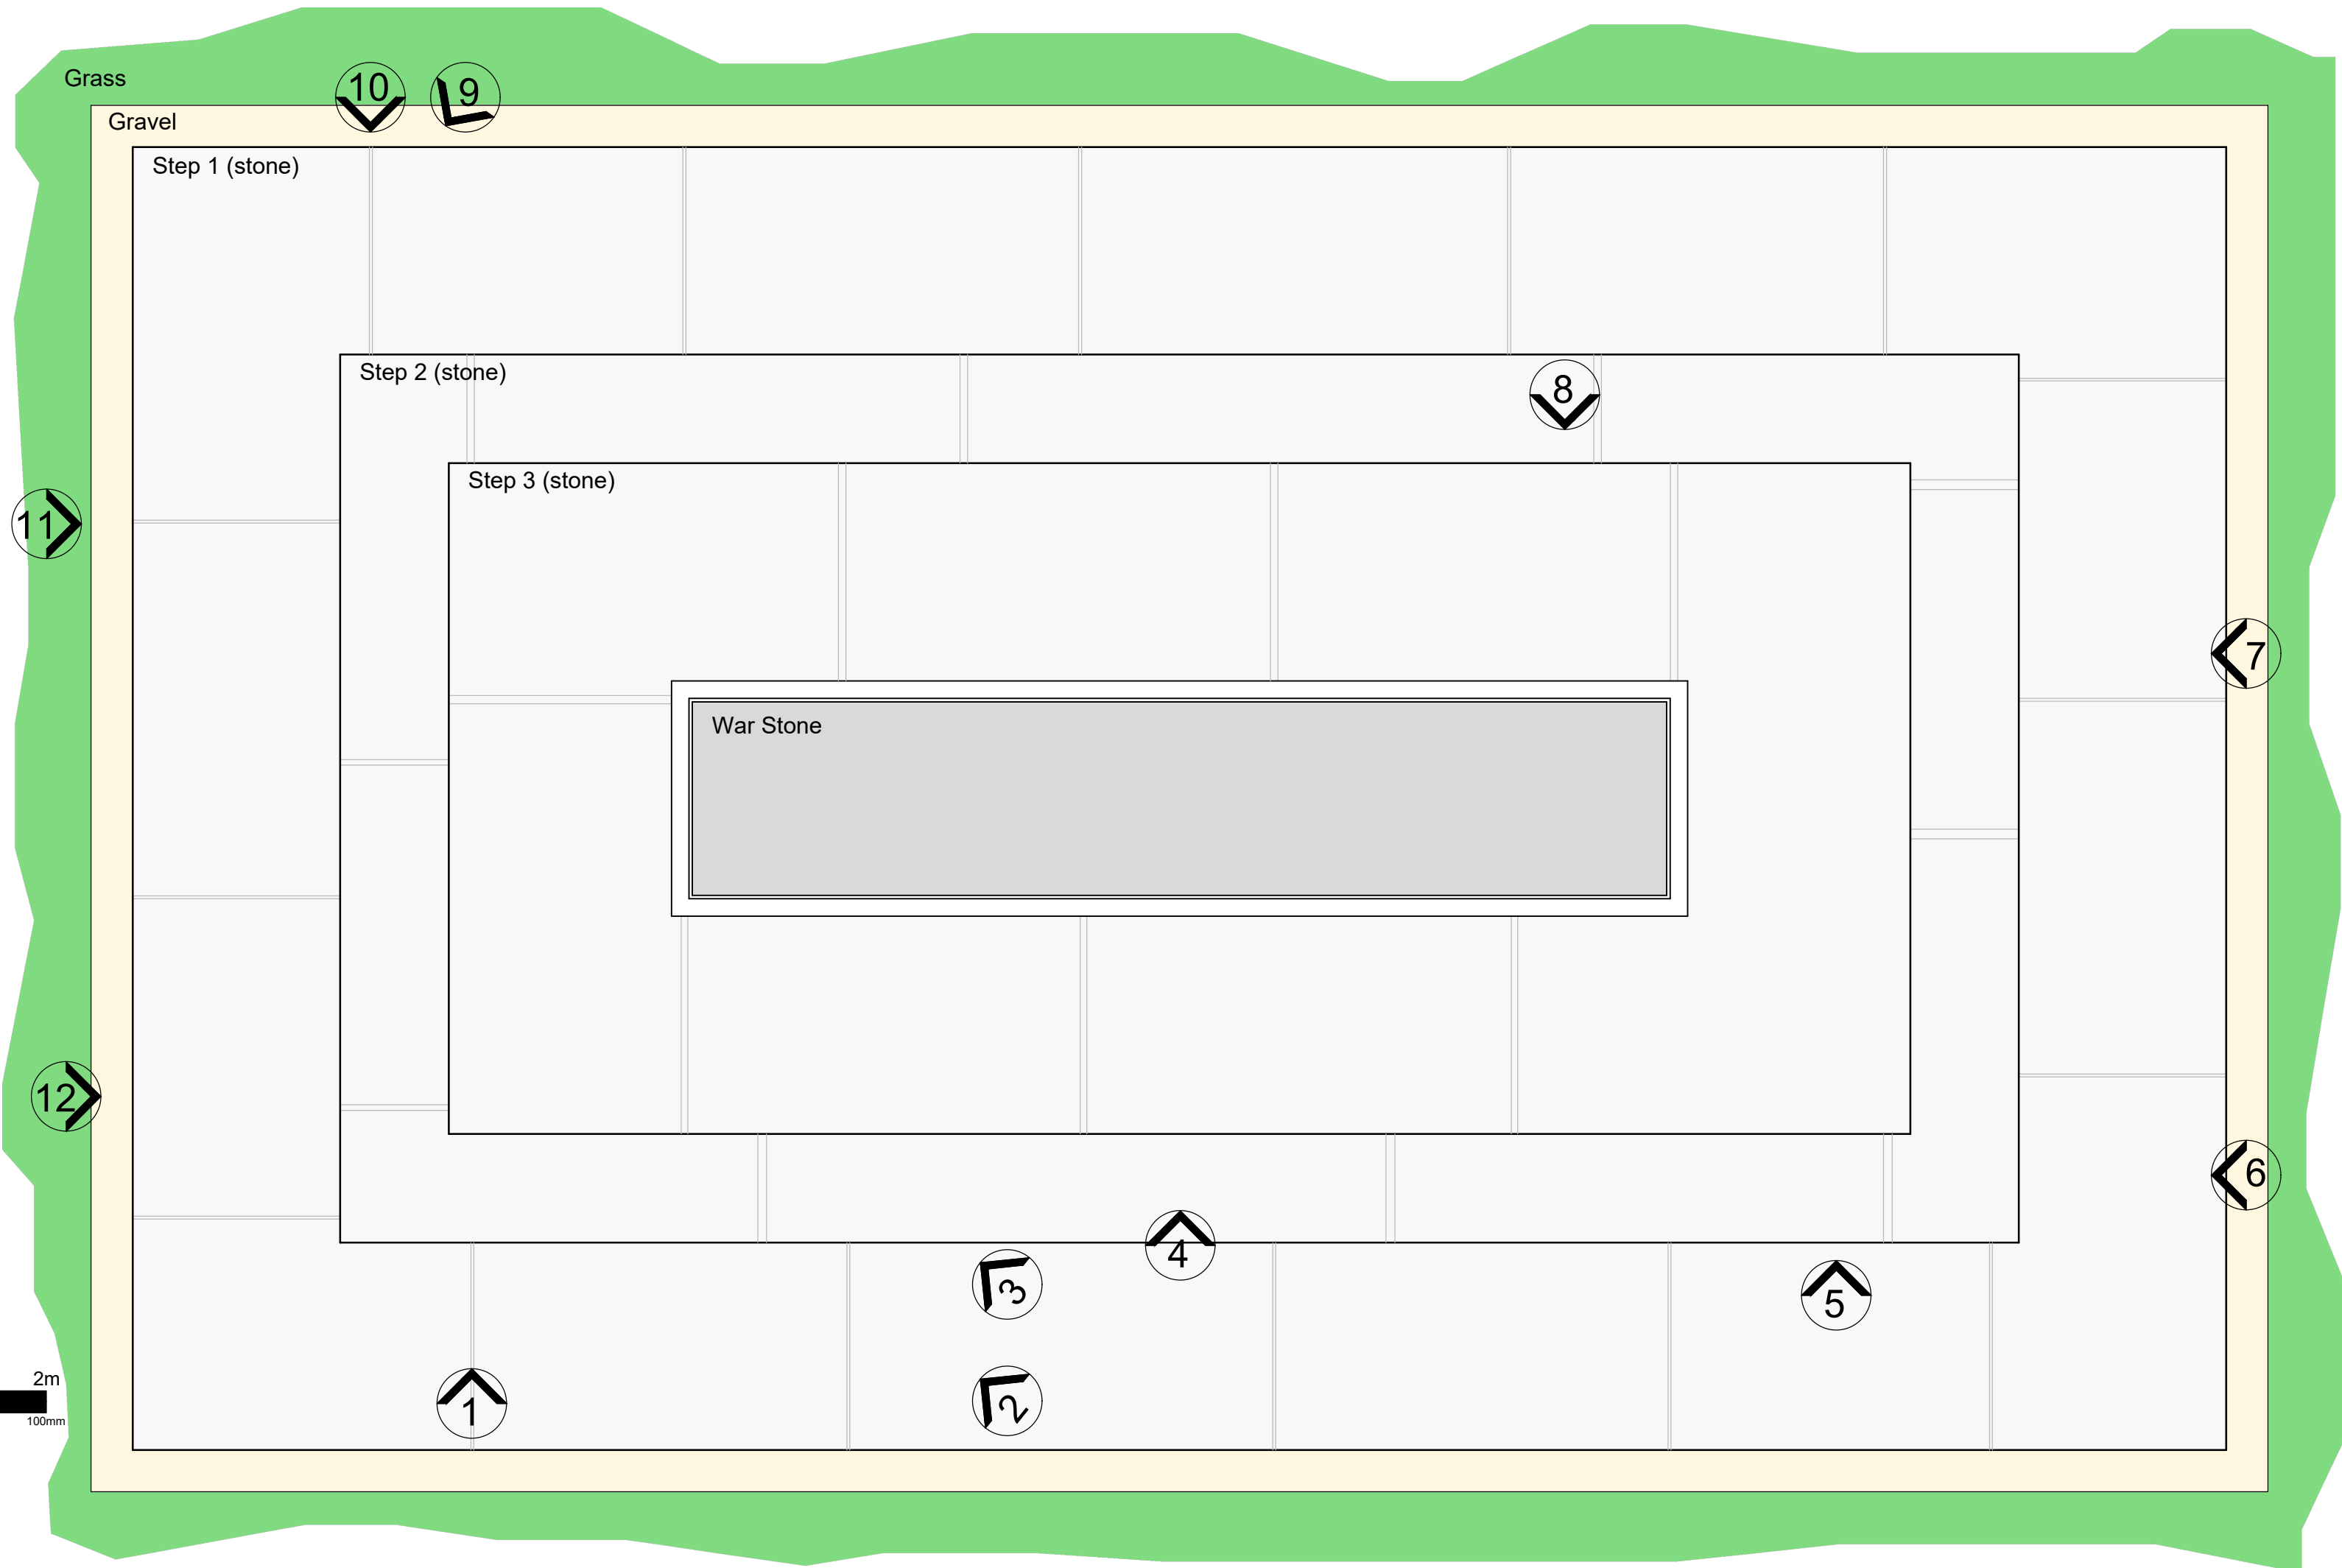
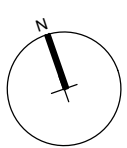


Photo 1 - Joint with pointing missing and vegetation



Photo 2 - Nominal 80mm depression in stone surface



Photo 3 - Nominal 110mm depression in stone surface



Photo 4 - Nominal 110mm depression in stone surface



Photo 5 - Nominal 400mm crack through stone

DO NOT SCALE THIS DRAWING. THE CONTRACTOR IS DEEMED TO HAVE CHECKED ALL DIMENSIONS ON SITE AND REPORT ANY DISCREPANCIES TO OGLESBY & LIMB LTD.
THE CONTENTS OF THIS DRAWING ARE COVERED BY COPYRIGHT AND REMAIN THE PROPERTY OF OGLESBY & LIMB LTD. WRITTEN APPROVAL MUST BE OBTAINED FROM OGLESBY & LIMB LTD PRIOR TO DUPLICATION OR REPRODUCTION OF THIS DRAWING OR ITS CONTENTS.
ANY DIMENSIONS NOT SHOWN ARE TO BE CHECKED AND AGREED WITH OGLESBY & LIMB LTD.

Ref.	Date	Description	Initial
X	XX.XX.XX	Xxxxx	xxx

Oglesby & Limb Ltd

Chartered Architect

Suite 1, Market Chambers
12 Market Place, Spalding, Lincs
PE11 1SL

Tel: 01775 761196

e-mail: design@o-l-ltd.co.uk

O&L

Client:
South Holland District Council

Project:
**Proposed Cleaning and repointing of
War Stone of Spalding War Memorial
Ayscoughfee Hall Gardens
Church Gate
Spalding
PE11 2RA**

Drawing Title:
**Proposed Details of cleaning and
repointing
Details of cracked pointing and
surface defects and grime
LBC APPLICATION ISSUE**

Date:	Mar 2024	Scale:	as shown @ A1
Drawn by:	cad	Checked by:	ajo

Drawing Number:	Rev.
A1606-06	P1