

LEVEL MONITORING

for Subsidence Management Services

The Yews, Jarvis 's Gate, Spalding, Lincolnshire, PE12 0EP

Client:	Subsidence Management Services
Client Contact:	Stephen Palmer
Claim Number:	17WCI000382
Client Reference:	IFS-AVI-SUB-17-0068560
Policy Holder:	Mr Mark Campling
Report Date:	14 November 2018
Our Ref:	M9847



Level Monitoring Readings

The following table shows the reading levels of the various Level Monitoring Station points.

Date	1	2	3	4	5	6	7	8	9	6a
16/08/2017	10.5765	10.4988	10.5496	10.4902	10.4703	10.4059	10.3770	10.5067	10.5028	
18/10/2017	10.5771	10.4981	10.5496	10.4904	10.4712	10.4069	10.3777	10.5073	10.5032	
16/01/2018	10.5773	10.4996	10.5502	10.4913	10.4722	10.4061	10.3779	10.5073	10.5033	
13/03/2018	10.5776	10.4998	10.5505	10.4914	10.4724		10.3783	10.5076	10.5032	10.4116
17/05/2018	10.5775	10.4998	10.5507	10.4915	10.4721		10.3789	10.5076	10.5036	10.4122
19/07/2018	10.5764	10.4972	10.5488	10.4899	10.4706		10.3765	10.5068	10.5026	10.4104
18/09/2018	10.5763	10.4962	10.5482	10.4887	10.4695		10.3758	10.5062	10.5023	10.4096
08/11/2018	10.5755	10.4971	10.5480	10.4886	10.4698		10.3759	10.5066	10.5024	10.4094



Level Monitoring Difference Graphs

The following graphs display the progressive movement that each Level Monitoring Station recorded at each separate site visit date to give an overall look at how much the property is moving.

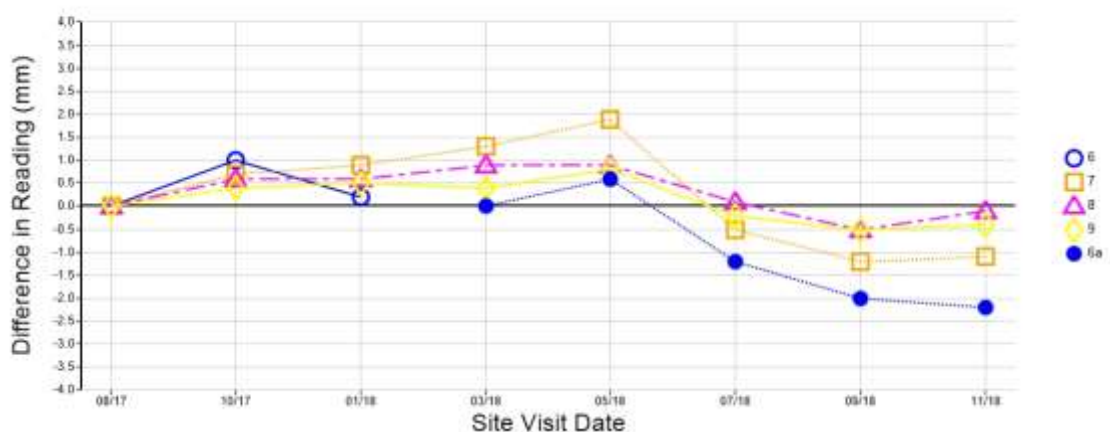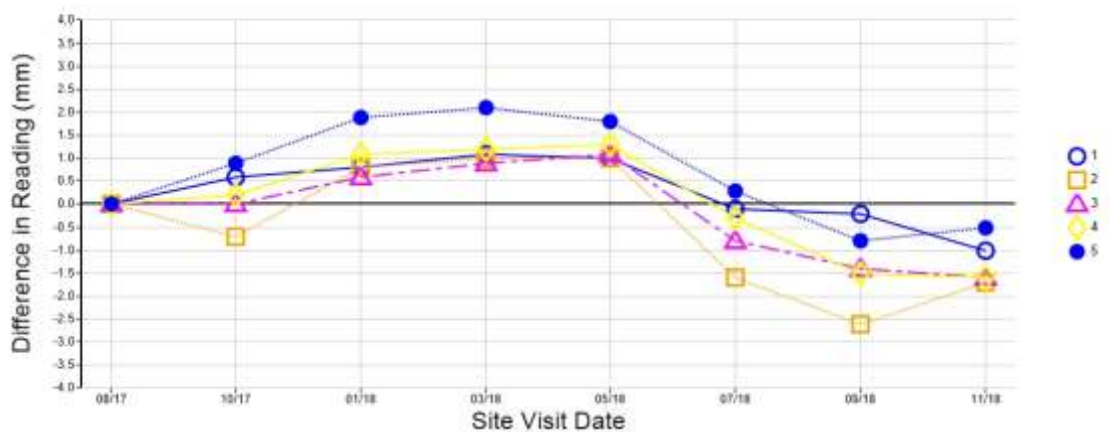

Level Monitoring Displacement Map

The following image shows an isometric representation of the movement of the property, based on the Level Monitoring Stations that were installed.

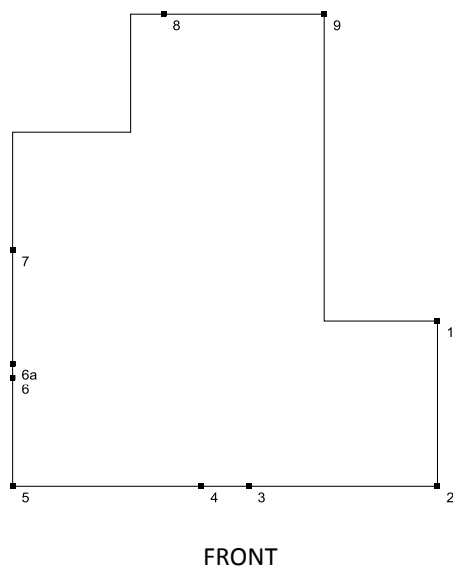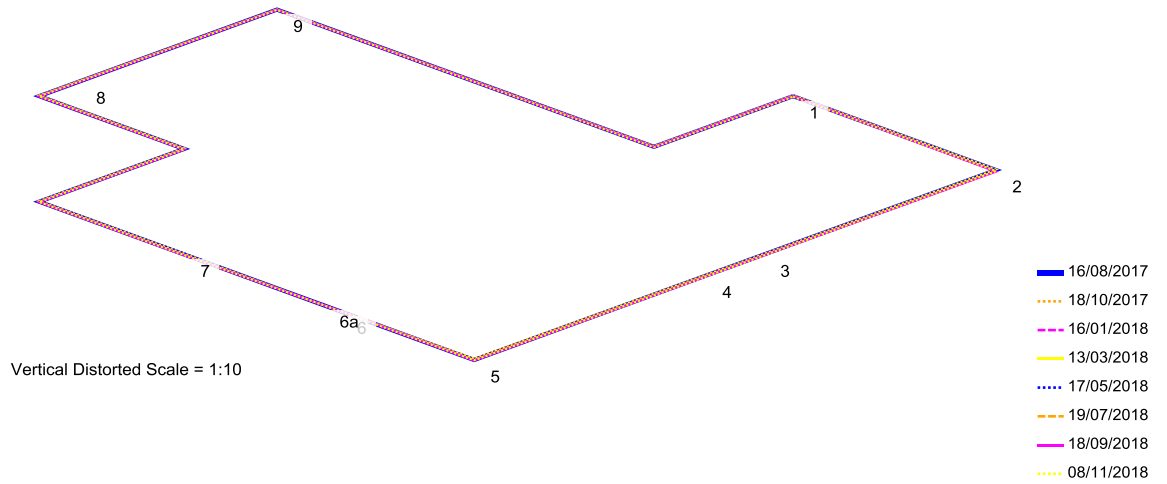

Site Visit Notes

Readings are relative to deep datum installed within the front garden. It has an assumed value of 10.0000m.

Site Visit: 16 August 2017

C3 - HC has been issued as VC.

Site Visit: 13 March 2018

L6 missing, this has been re-fixed and a new readings taken.